



Designjet T9x0, T15x0 ePrinter Series and T25x0, T3500 eMultifunction Series

Service Manual

Edition 3, February 17, 2017

© 2016 HP Development Company, L.P.

Legal notices

This document contains proprietary information that is protected by copyright. All rights are reserved. No part of this document may be photocopied, reproduced, or translated to another language without the prior written consent of HP Development Company.

Warranty

The information contained in this document is subject to change without notice.

HP makes no warranty of any kind with regard to this material, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose.

HP shall not be liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material.

Safety

The Warning symbol calls attention to a procedure, practice, or the like, which, if not correctly performed or adhered to, could result in personal injury. Do not proceed beyond a Warning symbol until the indicated conditions are fully understood and met.

The Caution symbol calls attention to an operating procedure, practice, or the like, which, if not correctly performed or adhered to, could result in damage to or destruction of part or all of the printer. Do not proceed beyond a Caution symbol until the indicated conditions are fully understood and met.

Table of contents

1 Printer fundamentals	1
Introduction	2
Theory of operation	6
2 Troubleshooting	34
The front panel	35
Service keys combination	37
Troubleshooting tree (T920 and T1500 only)	39
Product Troubleshooting trees (T2500 and T3500 only)	41
Scanner Troubleshooting Tree	42
Scanner CIS Troubleshooting	43
Troubleshooting using board LEDs	44
Paper handling problems	50
Ink supply problems	70
Print-quality problems	84
Connectivity problems	104
Scanning Problems	109
HP 727 Printhead Troubleshooting	111
Videos for replacing CSR parts and HP 727 printhead	113
Firmware upgrades	114
3 System error codes	115
Introduction	116
What to do if the front panel fails to initialize	118
System error codes in brief	121
System error codes in full	124
Appendix A: How to troubleshoot system error 79:04 and 79.2:04	164
Appendix B: Updating firmware in boot mode	176
Appendix C: Obtaining the diagnostics package	177

4 Diagnostics, Service Utilities and Calibrations	179
Introduction	180
Diagnostic Tests and Utilities	181
Service Utilities	203
Service Calibrations	232
5 Parts and diagrams	240
Introduction	240
Printer support	241
Center and Roll covers	242
Rear covers	243
Cover Front Panel Side	244
Cover SVS Side	245
Center Assemblies	246
Front Panel Side Assemblies	248
SVS Side Assemblies	249
Scan Axis Assemblies	250
Paper Path Assemblies (Front)	251
Paper Path Assemblies (Center)	253
Stacker Parts (Rear)	255
Stacker Parts (Front)	256
Carriage Assembly	260
Electrical Parts	261
Miscellaneous Parts	263
CIS Unit Construction	265
Scanner Control Unit	266
6 Removal and installation	269
Parts list; all models	270
Parts list; HP Designjet T2500 and T3500 eMultifunction Series only	272
Parts list; HP Designjet T2500 eMultifunction Series only	273
Parts list; HP Designjet T3500 eMultifunction Series only	274
Introduction	275
Customer Self Repair parts	277
Service Calibration Guide to Removal and Installation	278
Main cover (front panel side)	281
Main cover (service station side)	283
Center cover (T920 only)	285
Converger Assembly	287
Cleanout	288

Output platen	290
Fixed tray cover (Front Panel side)	291
Fixed tray cover (service station side)	292
Arch sidewall cover (front panel side)	293
Arch sidewall cover (service station side)	294
Rear cover	295
Window Sensor	296
HP 727 Printhead installation tips and tricks	298
Ink Service kit	303
Open the E-Box	304
E-Box fan	308
Jester PCA	310
Power supply unit	311
Hard disk drive	313
Engine PCA	314
Formatter PCA	315
Front panel	318
Carriage	322
Line Sensor	326
Carriage PCA	327
Rail Oiler Kit	329
PRS Actuator	330
Belt	332
Encoder Strip	333
Scan Axis Motor	335
Drop Detector	338
Service Station with Drop Detector	339
Primer Assembly	343
ISS (Ink Supply Station) Front Panel Side	346
ISS SVS Side	350
Ink Tubes and Trailing Cable	354
Media Sensor	357
Bottom Rewinder Support	359
Top Rewinder Support	361
Top Tip Support	363
Bottom Tip Support	364
Vertical Media Guide	366
Center Support	368
Full Bleed	369
Auto Pinch Lifter	370
Pinch Wheel Assembly	376

Motor Media Advance Transmission with Encoder	379
Starwheel Motor	387
Starwheel Support	392
Second Starwheel Rail	394
Overdrive	396
Cutter Platten	398
Sensor Valves	401
Valves Motor	404
Stacker	405
Stacker adaptor for MFP	407
Stacker Pinches	411
Stacker Hand Off	412
Stacker Hand Off Assy Service Kit (CR357-67041)	413
OPTO Sensor	417
REDI sensor	419
OVD Transmission with Motor	420
Ramps Motor	422
Stacker Arm Sensor	424
Bump Cutter Actuator	426
How to release Service Station Caps	427
How to manually move Valves	428
How to manually move Stacker Ramps	429
Scanner Controller Unit (SUP)	430
CIS Tiles	431
CIS Modules	432
CIS FFC Cables	433
CIS Glass	434
Stepper Motor Assembly (taco sensor, and belt)	435
Stepper Motor Assembly (cable)	437
Paper and Lid Sensors	438
Paper and Lid Sensor Cable	440
USB & Awake / Power Cable	441
CIS Bridge Damper	443
CIS Scanner Latch	445
Pressure Rollers	446
Front panel side scanner cover	447
Service station side scanner cover	448
Rear scanner cover	449
Bumper bracket	450
Deflector hinge	451
Lift assembly	452

Scanner front beam bumper assembly	453
Scanner latch hook assembly	454
Top scanner cover	455
Batch scanning piece	456
Card Reader Accessory	457
7 Maintenance	458
Preventive Maintenance	459
Preventive Maintenance Kits	472
8 Customer Self Repair Flyers	473
Starwheel	474
Cutter	476
Stacker arm	478
Ink covers	479
Leg, front-panel side	481
Leg, service-station side	484
Bottom roll cover	487
Top roll cover	489
Carriage latch	491
Basket	494
Pinch arm top roll	496
Pinch arm bottom roll	497
Scanner's glass plate	498

1 Printer fundamentals

- [Introduction](#)
- [Theory of operation](#)

Introduction

This service manual contains information necessary to test, maintain, and service the following:

- HP DesignJet T920 ePrinter
- HP DesignJet T920 PostScript ePrinter
- HP DesignJet T930 ePrinter
- HP DesignJet T930 PostScript ePrinter
- HP DesignJet T1500 ePrinter
- HP DesignJet T1500 PostScript ePrinter
- HP DesignJet T1530 ePrinter
- HP DesignJet T1530 PostScript ePrinter
- HP DesignJet T2500 eMultifunction
- HP DesignJet T2500 PostScript eMultifunction
- HP DesignJet T2530 eMultifunction
- HP DesignJet T2530 PostScript eMultifunction
- HP DesignJet T3500 Production eMultifunction
- HP DesignJet T3500 Production PostScript eMultifunction


For information about using these printers, see the user's guide.

Features overview

There are 13 versions of the HP DesignJet T9x0-T15x0-T25x0-T3500 series:

- CR354A HP DesignJet T920 36-in ePrinter
- CR355A/B HP DesignJet T920 36-in PostScript ePrinter
- L2Y21A HP DesignJet T930 36-in ePrinter
- L2Y22A/B HP DesignJet T930 36-in PostScript ePrinter
- CR356A HP DesignJet T1500 36-in ePrinter
- CR357A/B HP DesignJet T1500 36-in PostScript
- L2Y23A HP DesignJet T1530 36-in ePrinter
- L2Y24A/B HP DesignJet T1530 36-in PostScript
- CR358A HP DesignJet T2500 eMultifunction
- CR358A/B HP DesignJet T2500 PostScript eMultifunction
- L2Y25A HP DesignJet T2530 eMultifunction

- L2Y26A/B HP DesignJet T2530 PostScript eMultifunction
- B9E24A/B HP DesignJet T3500 Production eMFP

 **NOTE:** As of August 2013 there are no plans for an upgrade to enable PostScript features from non-PostScript capabilities.

The different sku features are:

Feature	CR354A HP DesignJet T920 36-in ePrinter and L2Y21A HP DesignJet T930 36-in ePrinter	CR355A/B HP DesignJet T920 36-in PostScript ePrinter and L2Y22A/B HP DesignJet T930 36-in PostScript ePrinter	CR356A HP DesignJet T1500 36-in ePrinter and L2Y23A HP DesignJet T1530 36-in ePrinter	CR357A/B HP DesignJet T1500 36-in PostScript and L2Y24A/B HP DesignJet T1530 36-in PostScript	CR358A HP DesignJet T2500 eMultifunction, CR358A/B HP DesignJet T2500 PostScript eMultifunction, L2Y25A DesignJet T2530 eMultifunction and L2Y26A/B T2530 PostScript eMultifunction	B9E24A/B HP DesignJet T3500 Production eMFP
Paper source	One 36-in roll, and single sheets		Two 36-in rolls, and single sheets			
Paper output	Stacker, accepting up to 50 A1 plain-paper sheets, and basket					
Connectivity	Gigabit Ethernet LAN (1000 base T) One USB HS host connector in the front panel, for USB flash drives IPv4, IPv6, IPSec, TCP9100, LPR, DHCP, AutoIP/Zeroconf, Bonjour, SNMP/v3, Airprint					
Web services	Automatic firmware upgrade, HP DesignJet ePrint & Share, printing by email					
Speed	Line-drawing, fast, plain paper: 21.6 s mono or color on A1&D Color image, normal, plain paper: 69 s on A1&D Color image, best, glossy paper: 246 s on A1&D					
Resolution	Up to 2400×1200 optimized dpi from 1200×1200 input ppi					
Memory	1.5GB RAM (2.5GB RAM T3500);1GB in Formatter and 512MB in Engine PCA), 320 GB hard disk (500 GB hard disk for T1530 and T2530), 32 GB Dedicated file-processing memory, 32GB (T920 series), 64 GB (T1500 series), and 128 GB (T2500 and T3500 series), Virtual Memory					
Supplies	Off-axis ink cartridges: <ul style="list-style-type: none"> • Introductory supplies: 69 ml (40 ml T3500) matte black, photo black, gray, cyan, magenta, yellow • Replacement supplies: 69 ml / 300 ml (130 ml T3500) matte black, for other colors 40 ml / 130 ml; photo black, gray, cyan, magenta, yellow • Can be replaced by the customer One printhead for all colors: <ul style="list-style-type: none"> • 9/8-in length • Drop size: 9 pl matte black / 6 pl other inks • Can be replaced by the customer 					
Hardware differentiation:			X	X	X	X

Feature	CR354A HP DesignJet T920 36-in ePrinter and L2Y21A HP DesignJet T930 36-in ePrinter	CR355A/B HP DesignJet T920 36-in PostScript ePrinter and L2Y22A/B HP DesignJet T930 36-in PostScript ePrinter	CR356A HP DesignJet T1500 36-in ePrinter and L2Y23A HP DesignJet T1530 36-in ePrinter	CR357A/B HP DesignJet T1500 36-in PostScript and L2Y24A/B HP DesignJet T1530 36-in PostScript	CR358A HP DesignJet T2500 eMultifunction, CR358A/B HP DesignJet T2500 PostScript eMultifunction, L2Y25A DesignJet T2530 eMultifunction and L2Y26A/B T2530 PostScript eMultifunction	B9E24A/B HP DesignJet T3500 Production eMFP
Second roll			X	X	X	X
Borderless printing on roll photo media			X	X	X	X
Other differentiations:			X	X	X	X
Languages supported	HP-GL/2, HP-RTL, TIFF, JPEG, CALS G4, HP PCL 3 GUI, URF	Adobe PostScript 3, Adobe PDF 1.7ext3 HP-GL/2, HP-RTL, TIFF, JPEG, CALS G4, HP PCL 3 GUI, URF	HP-GL/2, HP-RTL, TIFF, JPEG, CALS G4, HP PCL 3 GUI, URF	Adobe PostScript 3, Adobe PDF 1.7ext3 HP-GL/2, HP-RTL, TIFF, JPEG, CALS G4, HP PCL 3 GUI, URF		
Virtual Memory [GB]	32	32	64	64	128	128
1 job in queue (last job reprint)	X					
Job queues		X	X	X	X	X
Job preview from queue		X	X	X	X	X
Crop marks and nesting			X	X	X	X
EWS job submittal			X	X	X	X
Job on-hold for media (mummify)		X	X	X	X	X
Auto rotate, automatic blank area removal	X	X	X	X	X	X
Accounting in EWS			X	X	X	X

Readership

The procedures described in this service manual are to be performed by HP Certified service personnel only.

Part numbers

 
Part numbers for printer service parts are located in [Parts and diagrams on page 240](#).

Warning labels



Electric shock hazard

Hazardous voltage inside the printer (built-in power supply) could result in death or serious personal injury. See the installation instructions before connecting power. Ensure that the input voltage is within the printer's rated voltage range. Use only earthed mains outlets and the power cords supplied by HP with the printer. There are no operator-serviceable parts inside the printer. Refer servicing to qualified service personnel. Disconnect the power cord before servicing. Voltage is still present in the built-in power supply after the main switch is turned off.



Double pole/neutral fusing

Electric shock hazard. The built-in power supply incorporates a fuse on each conductor, therefore the printer could be energized even when one fuse has blown. There are no operator-replaceable fuses inside. Refer servicing to qualified service personnel. Disconnect the power cord before servicing.


Theory of operation

Schematics

Electronics are based on 3 main components:


- E-box - contains the power supply and all the PCAs (driving the printer), plus the Ethernet port.
- Carriage PCA - drives the printhead.
- Front Panel - user interface and USB port.

The following diagram describes the connections between components and electronic boards and the data line type for T920, T1500 and T2500.

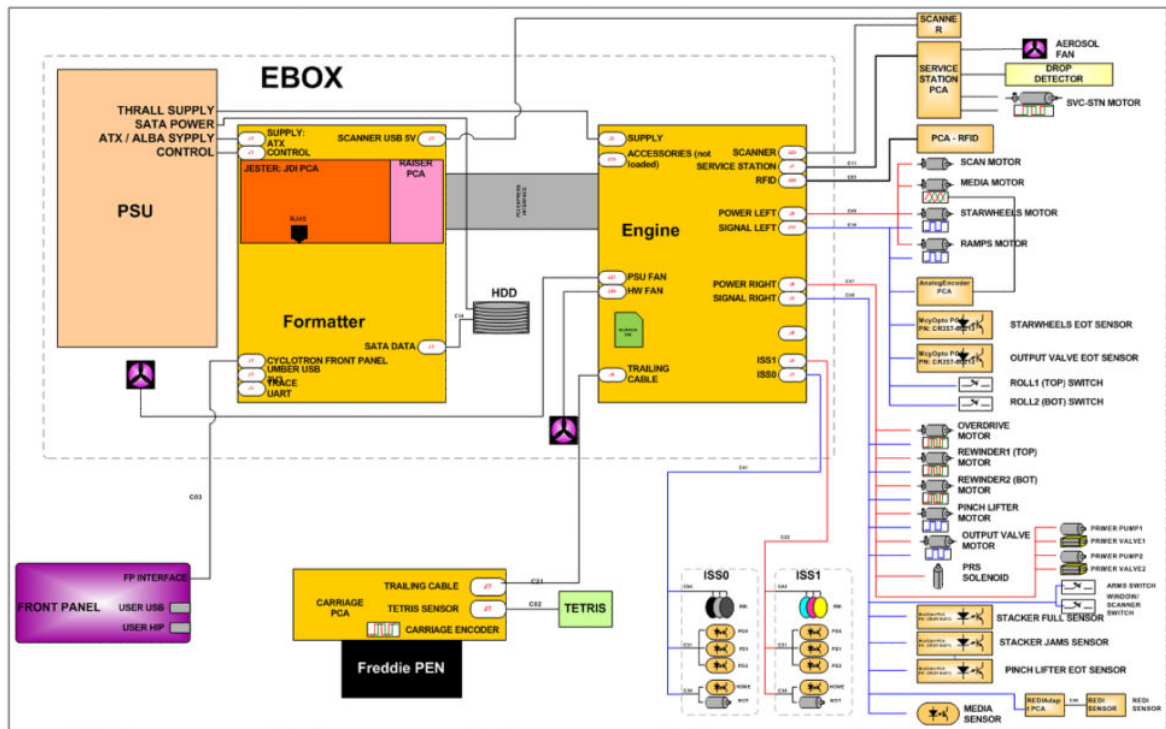


Block Diagram

(HP DesignJet T3500 eMultifunction Series only)

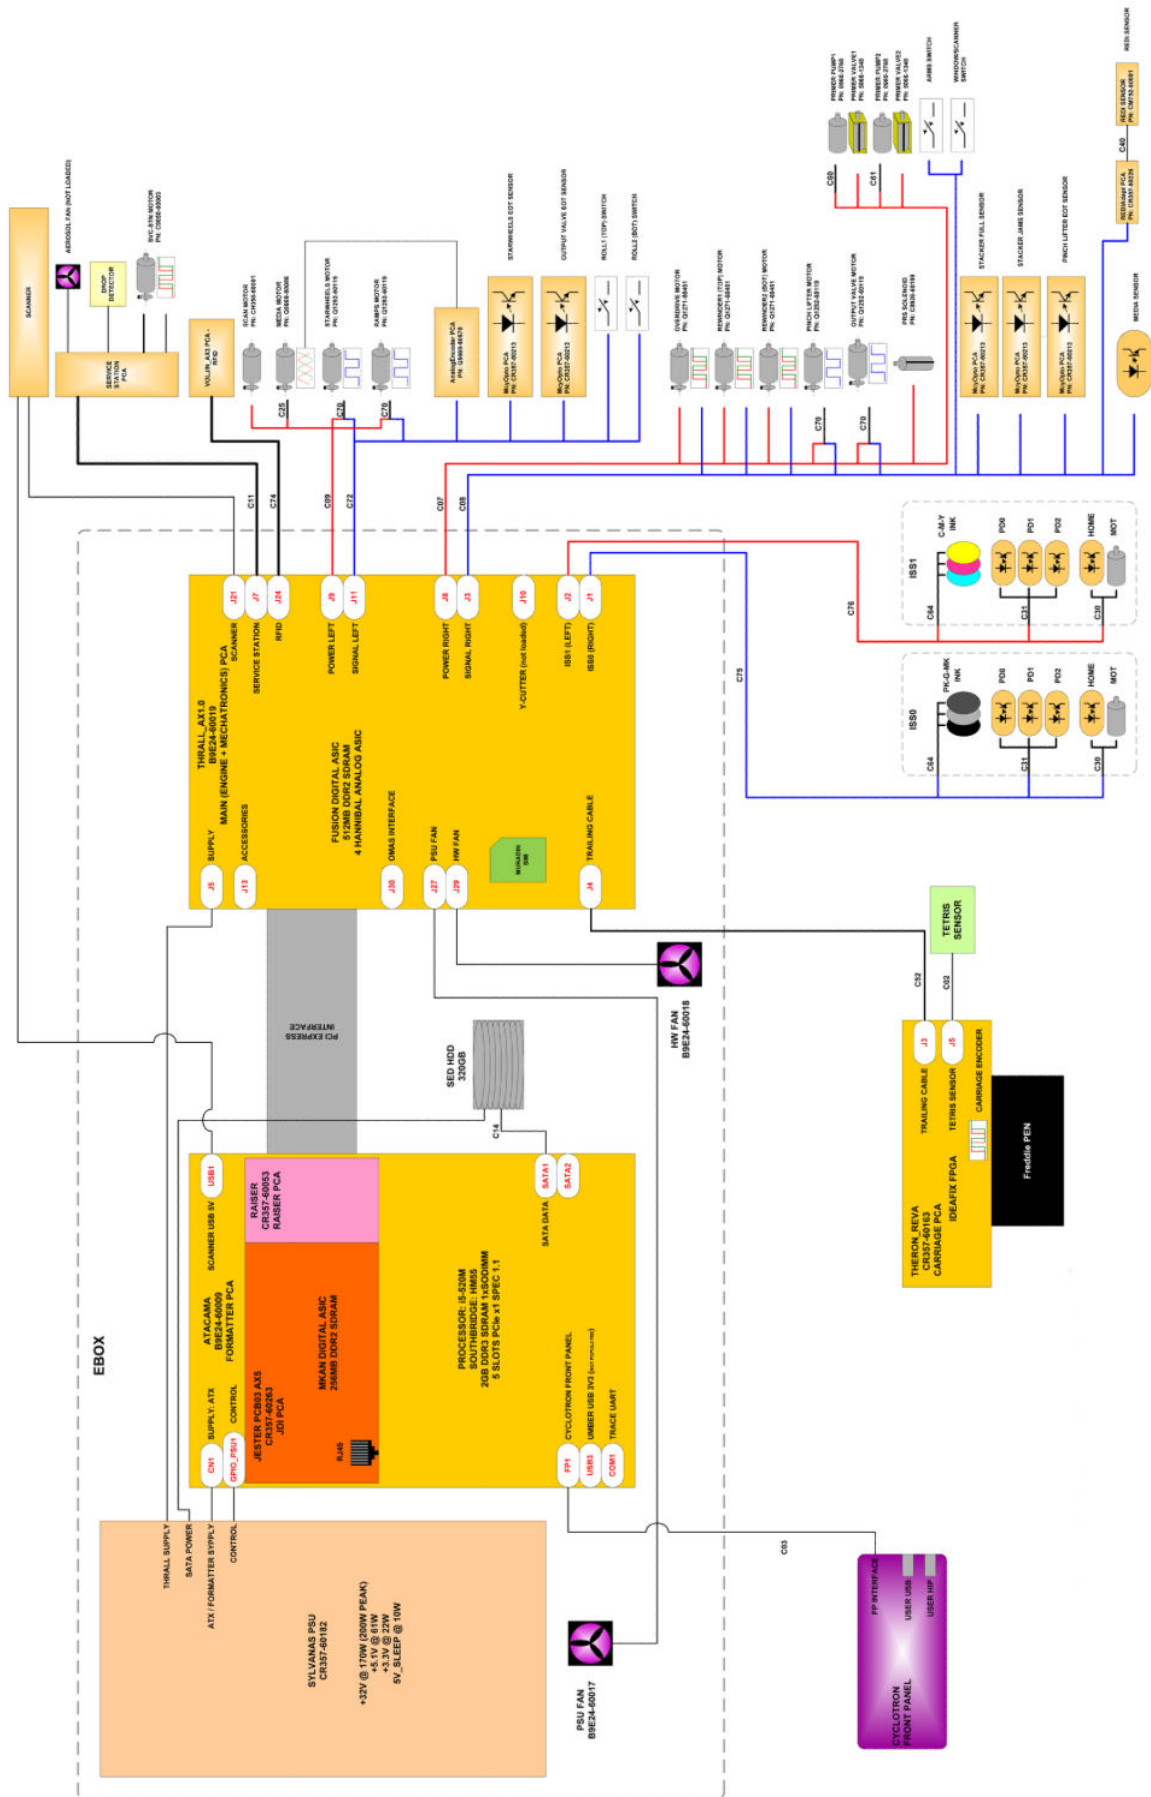


Block Diagram

(HP DesignJet T2500 and T3500 eMultifunction Series only)

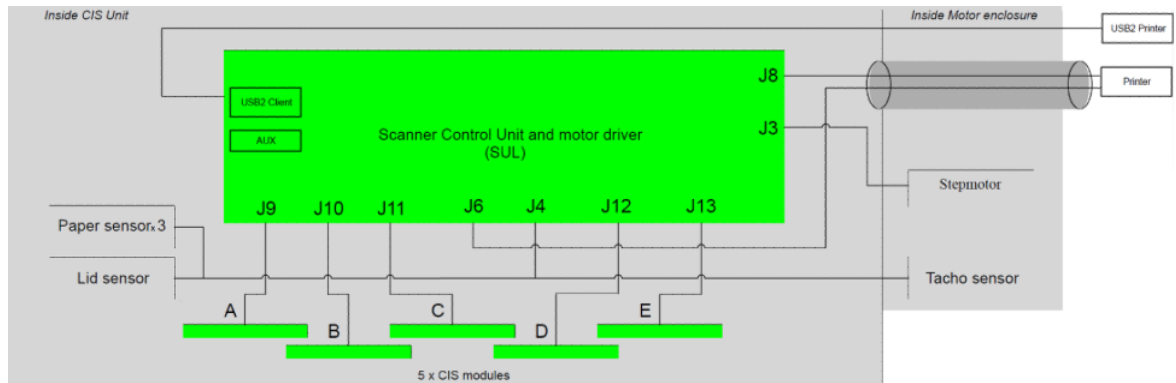

Wiring Diagram

(HP DesignJet T2500 and T3500 eMultifunction Series only)

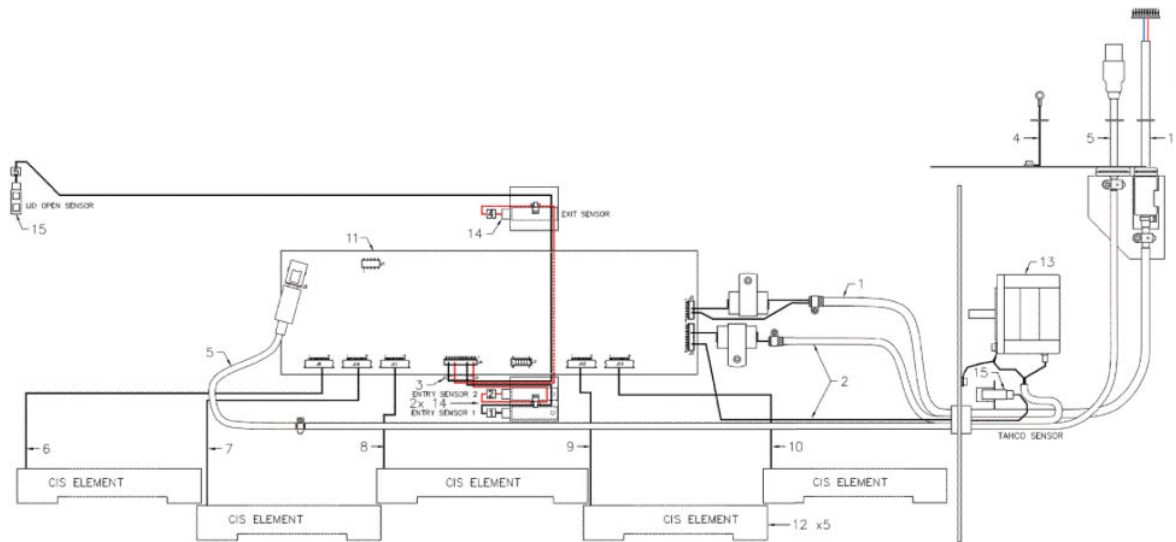



Scanner Controller Board Layout (SULG)

(HP DesignJet T2500 and T3500 eMultifunction Series only)



	Voltage	Min limit	Max limit
TP1	5V-Main (Always on when there is power to the board)	4.75	5.25
TP2	5V	4.75	5.25
TP3	1.2V	1.1	1.3
TP8	3.3V	3.2	3.4
TP6	2.5V	2.4	2.6
TP7	1.8V	1.7	1.9

	Voltage	Min limit	Max limit
TP15	0.9V	0.8	1.0
IC201	3.3VLDO	3.1	3.5
IC203	3.3VLDO	3.1	3.5
IC204	3.3VLDO	3.1	3.5



TP1
5V Main (4.75-5.25)

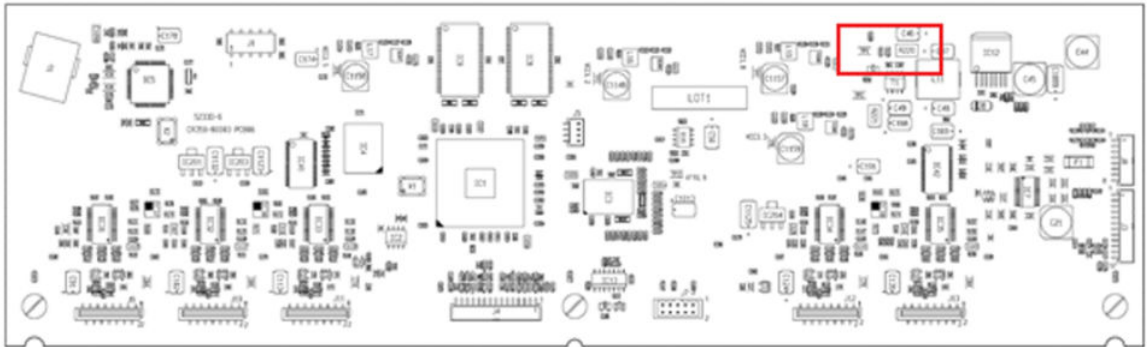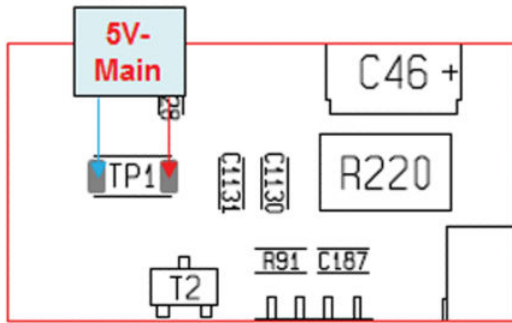



TP2
5V (4.75-5.25)

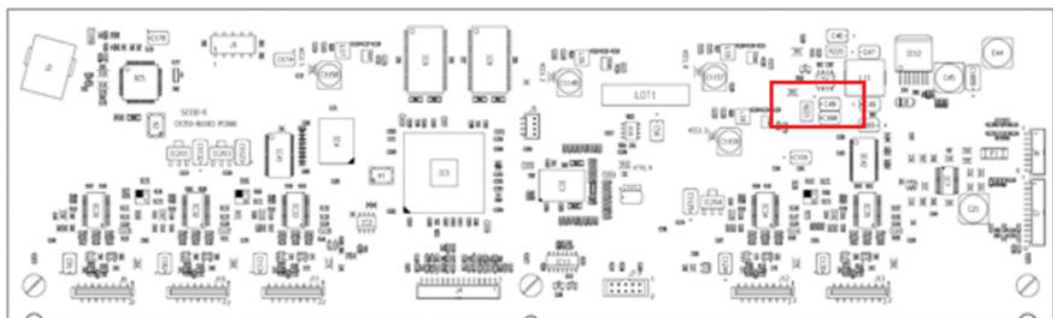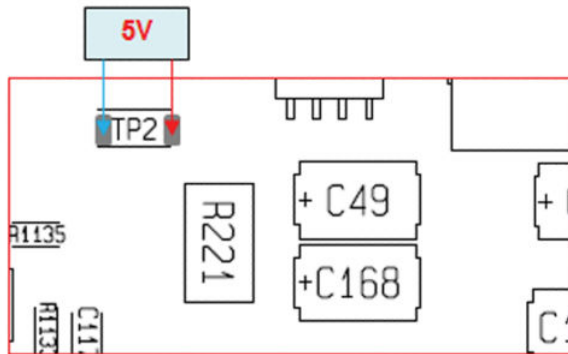

TP3
1.2V (1.1-1.3)

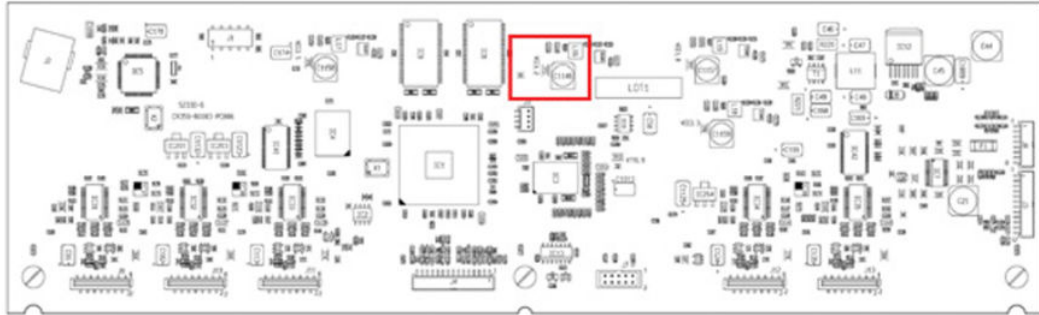
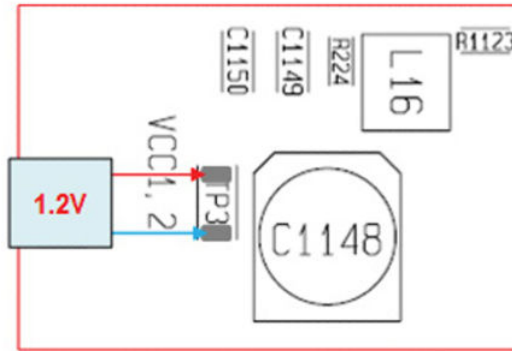


TP8
3.3V (3.2-3.4)

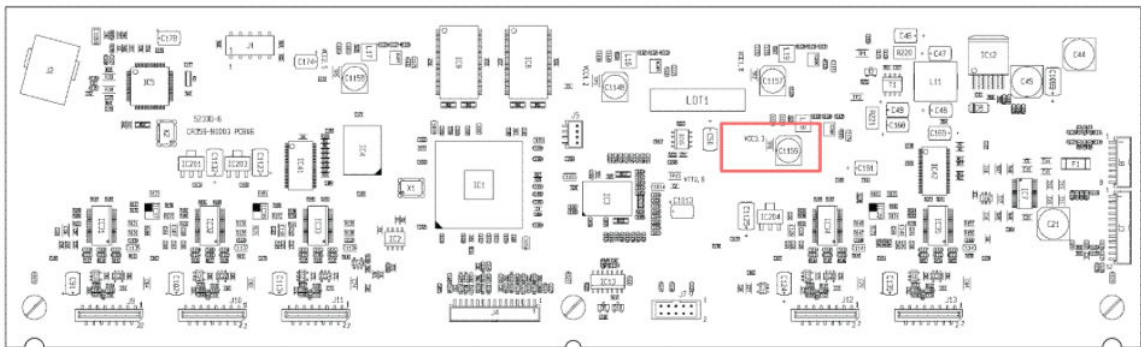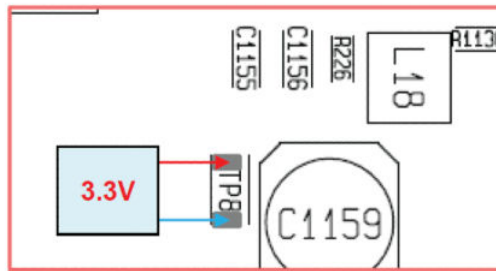



TP6

2.5V (2.4-2.6)

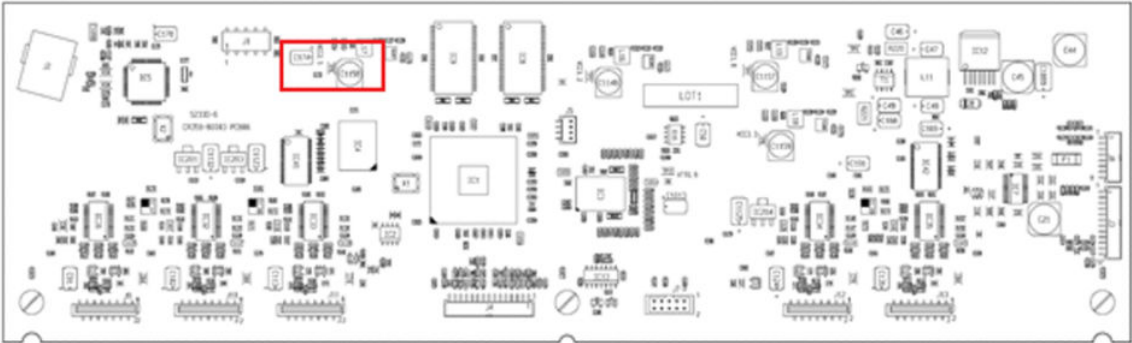
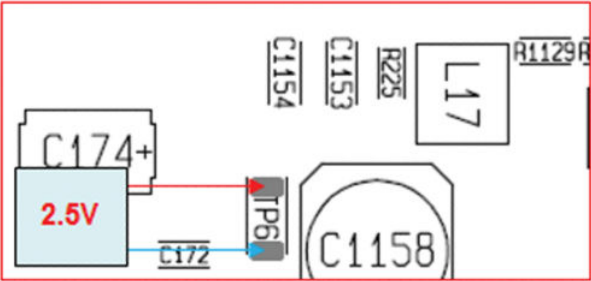


TP7



1.8V (1.7-1.9)

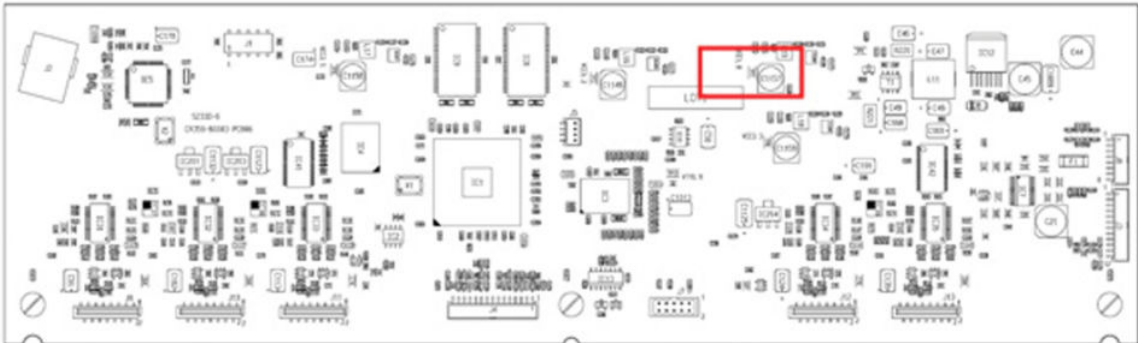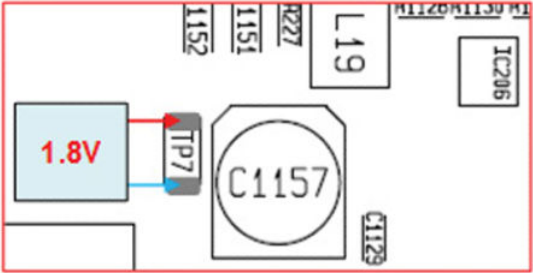

IC203 3.3V LDO(3.2-3.4)

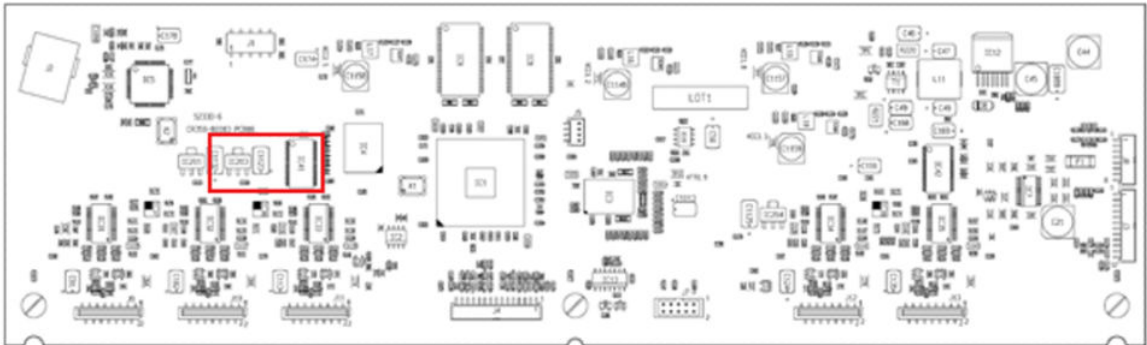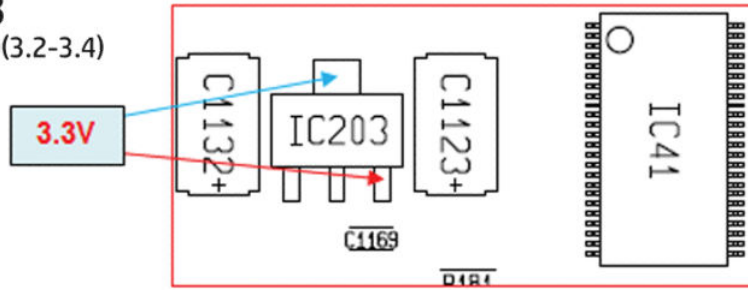

IC204 3.3V LDO(3.2-3.4)

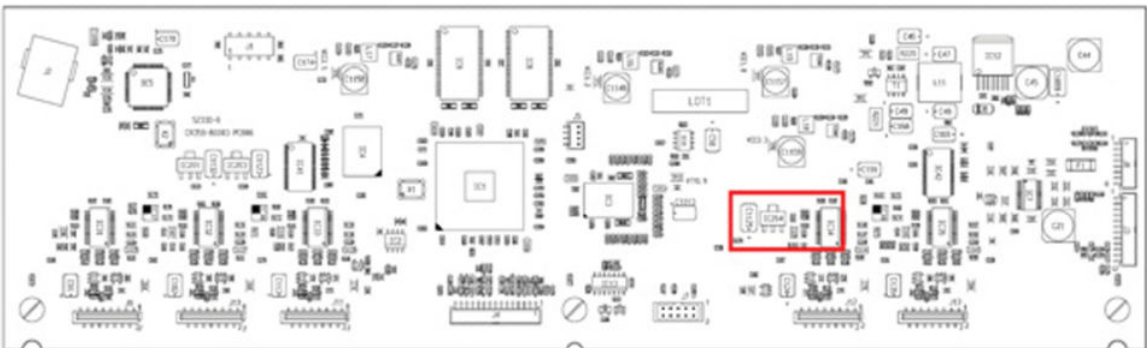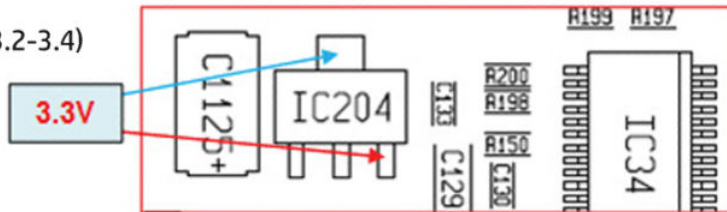

Printer Initialization

There are 3 main blocks to be initialized before the printer can be operated:




Electronic components init

1. The front panel shows a white background and blue HP logo.




2. The upper LED in the formatter is **ON**, indicating that the formatter has been initialized.
3. The middle LED in the formatter blinks, indicating that the HDD has been initialized.

 **NOTE:** Steps 2&3 are the same when waking from Sleep Mode except the 3 LEDs are not on but; **ON-Blinking-OFF**

OS & Firmware init

1. The OS is loaded into RAM. The Front Panel blinks for a second.
2. If boot up is after a bad power-off, the boot sequence automatically runs a file system check.
 - a. The Front Panel shows the **FSCK**, text.

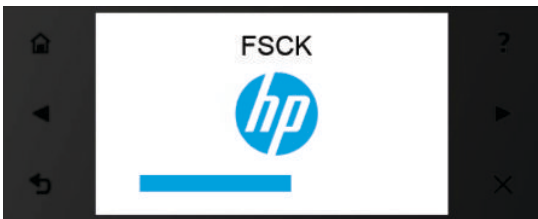

- b. First, **FSCK** runs on the root partition.
 - c. If **FSCK** is successful, the OS boots up from the root partition and runs **FSCK** on the data partition.
3. After **FSCK**, the OS finishes booting from the HDD.
 4. The home button lights up to allow stopping the boot sequence, and entry to the diagnostics menu, see [Diagnostics, Service Utilities and Calibrations on page 179](#).



Mechanical components init

1. The Front Panel shows a black background with a blue circle in the middle. The “Initializing” message appears. A progress bar shows the percentage of subsystems that have been initialized.
2. The printer moves the carriage from side to side to validate its position within the scan axis. The printer initializes the service station, moving the caps from bumper to bumper.

3. The pinches move down into position.
4. **T2500 and T3500 only:** The printer will initialize the Scanner and start checking it.
5. The carriage and service station move to the home position
6. The printer checks the status of supplies and the printhead, and then initializes the Ink Supply Stations.
7. Servicing routines are launched. The routines refresh the printhead depending on the time that the printer has been off. The Front Panel shows “Preparing Print System”.
8. The paper path subsystems are initialized by exercising the ramps and rewinder, checking if there is media present over the Media Sensor.
9. At the end of the process, the home screen appears in the Front Panel.

Front Panel Menu Map

The following tables show the front panel menu layout.

Print from USB preferences	Print from USB preferences menu
	➤ <i>Print Quality: Fast/Normal/Best</i>
	➤ <i>Color: Color/Grayscale/B&W</i>
	➤ <i>Collate: On/Off</i>
	➤ <i>Page Order: First page on top/Last page on top</i>
	➤ <i>Roll: Save paper/Roll 1/Roll 2</i>
	➤ <i>Printer margins: Clip from contents/Add to contents</i>
	➤ <i>Storage mode (print and store, print and delete)</i>
Print from Cloud preferences	Print from Cloud preferences menu
	➤ <i>Print quality: Fast/Normal/Best</i>
	➤ <i>Color: Color/Grayscale/B&W</i>
	➤ <i>Roll: Save paper/ Roll1 / Roll2</i>
	➤ <i>Printer margins: Clip from contents/Add to contents</i>
	➤ <i>HP ePrint Center Jobs: Directly print&On hold</i>

Scan to USB	Scan to USB menu		
	+ Network	+ ePrint&Share	ePrint&Share
			➤ <i>Format</i>
			➤ <i>Compression</i>
			➤ <i>Resolution</i>
			➤ <i>Color</i>
			➤ <i>Content type</i>
			➤ <i>Original paper type</i>
			➤ <i>Blueprint invert</i>
			➤ <i>Background removal</i>
			➤ <i>De-skew</i>
		➤ <i>Full width (36")</i>	

Connectivity > Network Connectivity	Network Connectivity	
	+Gigabit Ethernet	Gigabit Ethernet
		+ Modify configuration
		➤ + Information
		➤ + Print Sec Report: Yes/No
		+ TCP/IP
		➤ + Hostname
		➤ + IPV4 Settings
		➤ + Config Method: Bootp/DHCP/Auto IP/Manual
		➤ + Manual Settings
		➤ + Default IP: Auto IP/ Legacy
		➤ + DHCP Release: Yes/No
		➤ + DHCP Renew: Yes/No
		➤ + Primary DNS
		➤ + Secondary DNS
		➤ + IPV6 Settings
		➤ + Enable: On/Off
		➤ + Address
		➤ + Manual Settings
		➤ + Enable_Off
		➤ + Address
		➤ + DHCPV6 Policy
		➤ + Router Specified
		➤ + Router Unavailable
		➤ + Always
		➤ + Primary DNS
		➤ + Secondary DNS
		➤ + Proxy Server
		➤ + Proxy Port
		➤ + Idle Timeout
		+ Security
		➤ + Secure Web: https Required / https Optional
➤ + IPSEC: Keep / Disable		
➤ + 802.1X: Reset / Keep		
➤ + RESET Security: Yes /No		
+ Link Speed: Auto/10T Half / 10T Full/100TX Half / 100TX Full /100TX Auto/ 1000T Full		

Connectivity > Internet Connectivity	Internet Connectivity
	+ Internet connection: yes/no
	+ Proxy
	➤ Enable proxy: Direct access / Use proxy server
	➤ Proxy address
	➤ Proxy port
	➤ Proxy authentication
	➤ + Proxy authentication: enable/disabled
	➤ + User name
	➤ + Password
	➤ + Basic authentication protocol: enabled/disabled
	➤ + Digest authentication protocol: enabled/disabled
	➤ + NTLM authentication protocol: enabled/disabled
➤ Reset factory settings	
Connectivity > AirPrint Connectivity	AirPrint Connectivity
	➤ AirPrint: Enabled / Disabled
	➤ Help: brief description and directions
Connectivity > HP ePrint Center Connectivity	HP ePrint Center Connectivity
	➤ HP ePrint Center connectivity: enable/disable/remove
	➤ Printer code
	➤ Printer email address
	➤ HP ePrint Center Jobs: Directly print/on hold
	➤ HP ePrint Center information: summary of settings
➤ Restore factory settings	
Connectivity > Connectivity Wizard	Connectivity Wizard
Connectivity > Diagnostics & troubleshooting	Diagnostics & troubleshooting
	➤ All tests
	➤ Network connectivity tes
	➤ Internet connectivity test
	➤ HP Designjet ePrint & Share test
	➤ Firmware update test
	➤ Email server test
➤ Customer involvement program test	

Updates	Updates menu	
	+ Firmware update	Firmware update menu
		➤ Check: Automatic/manual
		➤ Download: Automatic/manual
		➤ Firmware update information: description and "Check now" shortcut
	➤ Firmware update history: firmware history and "Switch to previous" shortcut to roll back to previous firmware	

Security	Security menu	
	+ USB drive: enable/disable	
	+ Firmware upgrade from USB: enable/disable	
	+ Internet connection: yes/no	
	+ Enable HP ePrint Center connectivity: yes/no	
	+ User sessions	
	➤ + Session timeout	
	+ Printer Access Control	
	➤ Enable administrator account	
	➤ + Change administrator password	
	➤ + Disable administrator account	

Paper	Paper menu	
	+ Paper load	Paper load
		➤ Load roll 1
		➤ Load roll 2
	+ Paper unload	➤ Load sheet
		➤ Unload roll 1
		➤ Unload roll 2
		➤ Unload sheet
	+ Change ActivePaper Type	
	+ Paper types list .	
	+ Form feed and cut	
+ Move paper		
+ Pause printing		
+ Stacker open alert delay		
Ink	Ink menu	
	➤ Replace ink cartridges	
	➤ Replace printhead	

Setup menu			
+ Printing preferences	<ul style="list-style-type: none"> ➤ Graphics language: Automatic/HPGL2/CALS-G4/TIFF/JPG 		
	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="text-align: center; vertical-align: middle;">+ Print quality</td> <td> <p>Print quality</p> <ul style="list-style-type: none"> ➤ Quality level: Fast/Normal/best ➤ Maximum detail : on/off ➤ Economode: on/off </td> </tr> </table>	+ Print quality	<p>Print quality</p> <ul style="list-style-type: none"> ➤ Quality level: Fast/Normal/best ➤ Maximum detail : on/off ➤ Economode: on/off
	+ Print quality	<p>Print quality</p> <ul style="list-style-type: none"> ➤ Quality level: Fast/Normal/best ➤ Maximum detail : on/off ➤ Economode: on/off 	
	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="text-align: center; vertical-align: middle;">+ Color options</td> <td> <p>Color options</p> <ul style="list-style-type: none"> ➤ Color/grayscale: print in color/print in grayscale/print in pure B&W ➤ RGB source profile: sRGB (HP)/Adobe RGB (HP)/sRGB IEC61966-2.1/Adobe RGB (1998)/Apple RGB/ColorMatch RGB ➤ Printer emulation: off/HP Designjet 500/800 series/HP Designjet 1000 series/HP Designjet 4000/4500 series </td> </tr> </table>	+ Color options	<p>Color options</p> <ul style="list-style-type: none"> ➤ Color/grayscale: print in color/print in grayscale/print in pure B&W ➤ RGB source profile: sRGB (HP)/Adobe RGB (HP)/sRGB IEC61966-2.1/Adobe RGB (1998)/Apple RGB/ColorMatch RGB ➤ Printer emulation: off/HP Designjet 500/800 series/HP Designjet 1000 series/HP Designjet 4000/4500 series
	+ Color options	<p>Color options</p> <ul style="list-style-type: none"> ➤ Color/grayscale: print in color/print in grayscale/print in pure B&W ➤ RGB source profile: sRGB (HP)/Adobe RGB (HP)/sRGB IEC61966-2.1/Adobe RGB (1998)/Apple RGB/ColorMatch RGB ➤ Printer emulation: off/HP Designjet 500/800 series/HP Designjet 1000 series/HP Designjet 4000/4500 series 	
	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="text-align: center; vertical-align: middle;">+ Paper options</td> <td> <p>Paper options</p> <ul style="list-style-type: none"> ➤ Paper size: Automatic/list of std paper sizes ➤ Remove blank areas: on/off ➤ Resize 100%/129%/141%/200%/210%/258%/282%/352%/400%/419%/Fit to page ➤ Rotate: 0/90/180/270 ➤ Mirror image: on/off ➤ Enable crop lines: on/off ➤ Roll switching options: minimize paper waste/minimize roll changes/use roll with less paper ➤ Roll matching options: job fits into roll/match exact paper width ➤ Printing paper info: on/off ➤ Roll protection <ul style="list-style-type: none"> ➤ Protect roll 1: yes/no ➤ Protect roll 2: yes/no </td> </tr> </table>	+ Paper options	<p>Paper options</p> <ul style="list-style-type: none"> ➤ Paper size: Automatic/list of std paper sizes ➤ Remove blank areas: on/off ➤ Resize 100%/129%/141%/200%/210%/258%/282%/352%/400%/419%/Fit to page ➤ Rotate: 0/90/180/270 ➤ Mirror image: on/off ➤ Enable crop lines: on/off ➤ Roll switching options: minimize paper waste/minimize roll changes/use roll with less paper ➤ Roll matching options: job fits into roll/match exact paper width ➤ Printing paper info: on/off ➤ Roll protection <ul style="list-style-type: none"> ➤ Protect roll 1: yes/no ➤ Protect roll 2: yes/no
	+ Paper options	<p>Paper options</p> <ul style="list-style-type: none"> ➤ Paper size: Automatic/list of std paper sizes ➤ Remove blank areas: on/off ➤ Resize 100%/129%/141%/200%/210%/258%/282%/352%/400%/419%/Fit to page ➤ Rotate: 0/90/180/270 ➤ Mirror image: on/off ➤ Enable crop lines: on/off ➤ Roll switching options: minimize paper waste/minimize roll changes/use roll with less paper ➤ Roll matching options: job fits into roll/match exact paper width ➤ Printing paper info: on/off ➤ Roll protection <ul style="list-style-type: none"> ➤ Protect roll 1: yes/no ➤ Protect roll 2: yes/no 	

Setup	Setup menu		
	+ Printing preferences	➤ Graphics language: Automatic/HPGL2/CALS-G4/TIFF/JPG	
		+ Print quality	Print quality ➤ Quality level: Fast/Normal/best ➤ Maximum detail : on/off ➤ Economode: on/off
		+ Color options	Color options ➤ Color/grayscale: print in color/ print in grayscale/print in pure B&W ➤ RGB source profile: sRGB (HP)/ Adobe RGB (HP)/sRGB IEC6 966-2.1/Adobe RGB (1998)/ Apple RGB/ColorMatch RGB ➤ Printer emulation: off/HP Designjet 500/800 series /HP Designjet 1000 series/ HP Designjet 4000/4500 series
		+ Paper options	Paper options ➤ Paper size: Automatic/ list of std paper sizes ➤ Remove blank areas: on/off ➤ Resize 100%/129%/141%/200%/ 210%/258%/282%/352%/400\$/ 419%/Fit to page ➤ Rotate: 0/90/180/270 ➤ Mirror image: on/off ➤ Enable crop lines: on/off ➤ Roll switching options: minimize paper waste/minimize roll changes/use roll with less paper ➤ Roll matching options: job fits into roll/match exact paper width ➤ Printing paper info: on/off ➤ Roll protection ➤ Protect roll 1: yes/no ➤ Protect roll 2: yes/no
		+ Margins	Margins ➤ Margins: Print with margins/ Borderless ➤ Margin layout: standard/ oversize/Clip contents by margins ➤ Borderless method: autofit/ by application
		+ HPGL2 options	HPGL2 options ➤ Merge: on/off

Setup	Setup menu	
	+ Scan preferences	Scan preferences
		➤ <i>Format</i>
		➤ <i>Compression</i>
		➤ <i>Resolution</i>
		➤ <i>Color</i>
		➤ <i>Content type</i>
		➤ <i>Original paper type</i>
		➤ <i>Blueprint invert</i>
		➤ <i>De-skew</i>
		➤ <i>Full width (36")</i>
	+ Print retrieval	Print retrieval
		➤ <i>Dry time: extended/optimal/reduced/non</i>
		➤ <i>Retrieval time: off/30sec/1min/2min/5min/10min</i>
		➤ <i>Cutter: on/off</i>
	+ Job management options	Job management options
		➤ <i>Queue: on/off</i>
		➤ <i>When start printing: optimized/immediately/after processing</i>
		+ Nest options
➤ <i>Nesting: in order/optimized order/off</i>		
➤ <i>Wait time</i>		
➤ <i>Enable crop lines: on/off</i>		
		➤ <i>Oversized nested job margin: 0mm/2.5mm/5mm</i>
➤ <i>Max number of printed jobs</i>		
➤ <i>Job recovery mode: put on hold/cancel</i>		
➤ <i>Paper mismatch action: put on hold / print anyway</i>		

Setup	Setup menu		
	+ Front panel options	Front panel options	
		➤ <i>Language</i>	
		➤ <i>Display brightness</i>	
		➤ <i>Speaker volume: off/low/high</i>	
		➤ <i>Date and time options</i>	Date and time options
			➤ <i>Current device time</i>
			➤ <i>Set date</i>
			➤ <i>Set time</i>
			➤ <i>Set time zone</i>
			➤ <i>Unit selection: English/metric</i>
	➤ <i>Auto-off</i>	Auto-off	
		➤ <i>Enable(only when disconnected from LAN): on/off</i>	
		➤ <i>Auto-off timeout:</i>	
	+ Customer involvement program	➤ <i>Sleep mode wait time</i>	
		<i>Customer involvement program</i>	
		➤ <i>Customer involvement program configuration</i>	
		➤ <i>Customer involvement program Information</i>	
	+ Printer Logs	<i>Printer Logs</i>	
		➤ <i>System Errors</i>	
➤ <i>System Warnings</i>			
➤ <i>Printhead</i>			
➤ <i>Ink Cartridges</i>			
+ Resets	<i>Resets</i>		
	➤ <i>Restore factory settings</i>		

Image-quality maintenance	Image-quality maintenance		
	➤ <i>Optimize Print Quality</i>		
	➤ <i>Calibration status</i>		
	➤ <i>Calibrate color</i>		
	➤ <i>Align printhead</i>		
	➤ <i>Print diagnostic image</i>		
	+ <i>Paper advance calibration</i>	Paper advance calibration	
		➤ <i>Calibrate paper advance</i>	
		➤ <i>Adjust paper advance</i>	
		➤ <i>Reset paper advance</i>	
	+ <i>Clean printhead</i>	Clean Printhead	
		➤ <i>Clean all</i>	
		➤ <i>Clean MK - Y</i>	
		➤ <i>Clean C-M-PK-G</i>	
	➤ <i>Enable color calibration: on/off</i>		
➤ <i>Calibrate scanner</i>			
➤ <i>Scanner IQ plot</i>			

Internal prints	Internal prints menu	
	+ Demo prints	Demo prints
		➤ Print drawing demo
		➤ Print rendering demo
	+ Demo prints	➤ Print GIS demo
		User information prints
		➤ Print usage report
	+ User information prints	➤ Print HP-GL/2 palette
		Service information prints
	+ Service information prints	➤ Print current information
		➤ Print usage information
		➤ Print event logs
		➤ Print calibration status
➤ Print connectivity configuration		
➤ Print all pages		
Service Menu	➤ Scanner IQ plot	


Front Panel Menu Map (T3500 only)

+ Print, Scan & Copy Quicksets
➤ Scan quicksets
➤ Copy quicksets
➤ Print from usb quicksets
➤ Print from Cloud preferences
➤ + Print quality
➤ + Fast
+ Default Printing configuration
➤ Graphics language
➤ + Automatic
➤ Print quality
➤ + Quality level
➤ + Fast
➤ Color options
➤ + Color/Grayscale
➤ + Print in color
➤ Paper options
➤ + Paper size
➤ + Automatic
➤ Margins
➤ + Margins
➤ + Print with margins
➤ HP-GL/2 options
➤ + Merge
➤ + On
➤ PS options
➤ + Encoding
➤ + Automatic
➤ Print retrieval
➤ + Drying time
➤ + Extended
➤ Image-quality maintenance
+ Job management options
+ Paper
+ Ink & Printhead


+ Connectivity
➤ Newtork connectivity
➤ + Gigabit Ethernet
➤ + Modify configuration
➤ Internet connectivity
➤ + Internet connection
➤ + Yes
➤ AirPrint connectivity
➤ + AirPrint
➤ + Enabled
➤ HP ePrint Center connectivity
➤ + HP ePrintCenter connectivity
➤ + Enable
➤ Connectivity wizard
➤ Diagnostics & troubleshooting
➤ + All tests
+ System
+ Firmware update
+ Security
+ Internal prints
➤ Demo prints
➤ + Print drawing demo
➤ User information prints
➤ + Print usage report
➤ Service information prints
➤ + Print current information
➤ Scanner IQ plot
+ Product certifications
+ Service menu

HP 727 Printhead Start-up process

1. Insert cartridges: If the printhead is initialized during the installation of the printer, the printer will first check for new supplies.

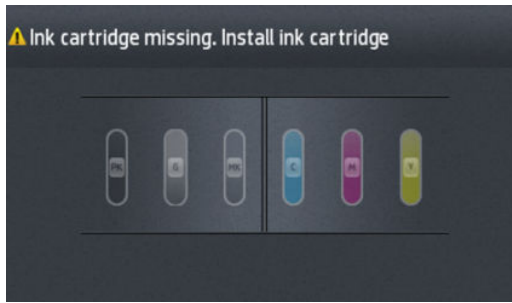


“Ink cartridge missing. Install ink cartridge.”

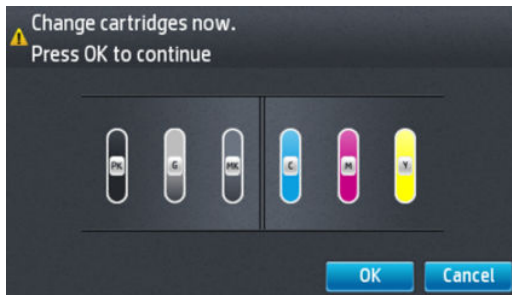

“Change cartridges now. Press OK to continue.”

If the printer still needs to purge the ink tubes and there are cartridges already installed in it, the printer will reject the supplies, reporting them as “Not Valid” and will request to “remove and reinsert” the supplies. Cartridges can be reseated in order to be accepted by the printer before the tubes are purged. This allows the printer to do a full validation of the supply before running a tube purge.


If the cartridges used for installation do not contain the required 60cc of ink for purging, the printer will report that “cartridge is not valid for setup”.

 **NOTE:** keep in mind that to initialize a printhead you need 40ml of Matte Black ink and 30ml of ink for the rest of the colors. To purge ink tubes, you need 60cc of all colors. If in doubt, use 130ml cartridges.

2. After inserting the cartridges, the printer requests the printhead.




"Preparing for printhead replacement"

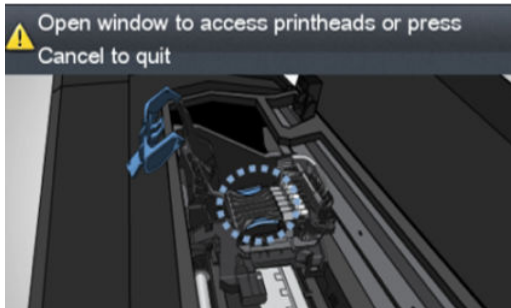


"Open window to access printheads or press Cancel to quit"

 **NOTE:** If printhead insertion is completed during printer installation, remember to remove the orange caps.

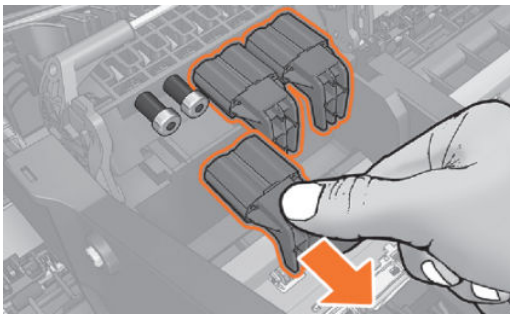


3. After inserting the printhead, the printer will check electronic connections. If the check fails, the printer will ask to reseal the printhead.

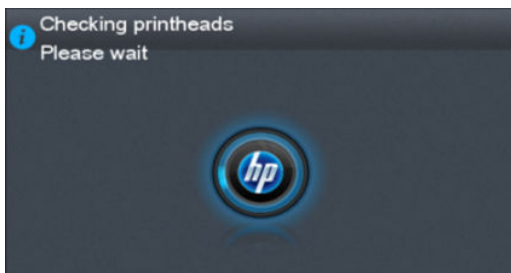

"Checking printheads. Please wait"

4. Once it is certain that the printhead is recognized, the printer will purge the ink tubes if they are empty. It will also fill the printhead.

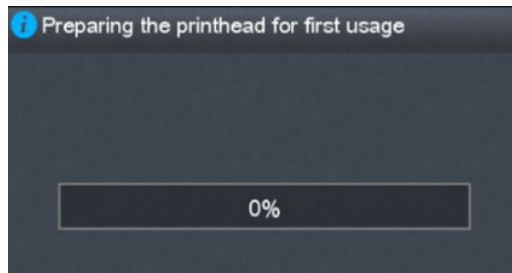

"Preparing the printhead for first usage"

If the process finishes OK, the printer will flag the printer tubes and printhead as filled with ink.

If during the process the printer detects that a cartridge has been removed it will show the message "A supply has been removed" and it will go back to step 1.

After this step, all ink tubes should be completely filled. The circles on top of the printhead should also look filled.


5. At this point, the printer will run 2 checks to validate the start-up: first will check for ink pressure and second for printhead temperature while spitting. If the pressure fails, it will be logged as a SE 93.0.n:10 in the service plot (where n is the failing color). If the temperature check fails, it will be logged as a SE 93.2.n:10 in the service plot (where n is the failing color). The SE are not shown in the front panel. In both cases, the printer will request to Reseat the printhead. After the reseat the printer will try to fill again the tubes and printhead by going to step 3.

n indicates the missing color:

- n=0 stands for photo black
- n=1 stands for gray
- n=2 stands for matte black
- n=3 stands for cyan
- n=4 stands for magenta
- n=5 stands for yellow

6. After this second trial, the pressure and temperature tests will be repeated. If the pressure fails, it will be logged as a SE 93.1.n:10 in the service plot (where n is the failing color). If the temperature check fails, it will be logged as a SE 93.3.n:10 in the service plot (where n is the failing color). The SE are not shown in the front panel. In any case, the printer will move to step 3 and try to execute it.

7. After the printhead and tubes are filled, the printer completes some printhead servicing to finalize the initialization.

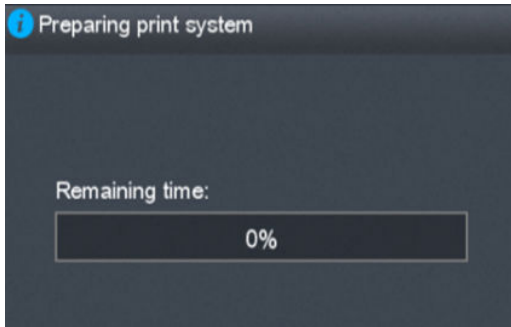

"Preparing print system"

If successful. If the printhead is properly initialized, the printer shows the following message:




"Printhead replacement. Printhead successfully replaced. Press OK to continue."

If unsuccessful. If there is a problem the printer, depending on the problem, one of the two following messages appears:



"Replace printhead. The printhead failed to complete the replacement process. Replace printhead. Press OK to continue with printhead replacement."

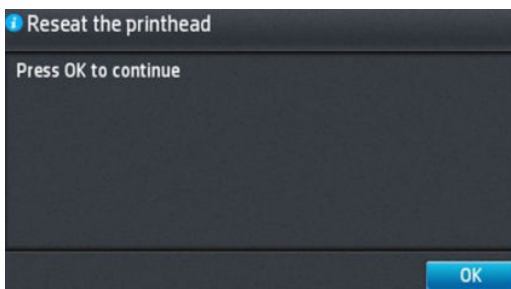

"Reseat the printhead. Press OK to continue."

CIS Technology


Example of a CIS Element, Contact Image Sensor:




The CIS Element consist of 3 major parts:

- Sensor
- Lens
- Light source

The Light source is 3 RGB LEDs that are lit one at a time. The sensor consists of 10368 individual monochrome sensors.

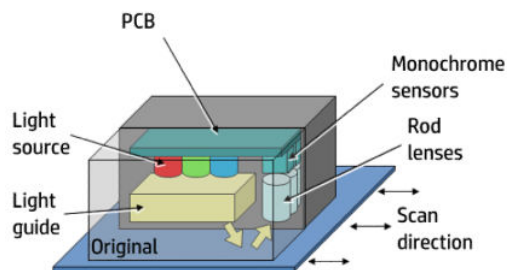


The purpose of the lens is to channel the light from the “pixels” on the image to the sensors. There is no magnification in the lens (1x1).

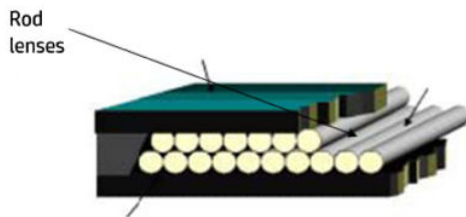

Due to the very short focal length, the focus depth is limited. The original has to be in contact with the surface of the glass plate in order to be in focus.

The LED's flash one at a time, capturing one color at a time.

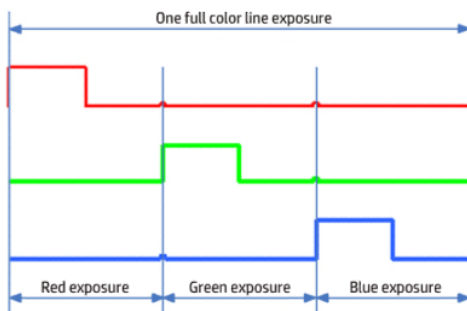

2 Troubleshooting

- [The front panel](#)
- [Service keys combination](#)
- [Troubleshooting tree \(T920 and T1500 only\)](#)
- [Product Troubleshooting trees \(T2500 and T3500 only\)](#)
- [Scanner Troubleshooting Tree](#)
- [Scanner CIS Troubleshooting](#)
- [Troubleshooting using board LEDs](#)
- [Paper handling problems](#)
- [Ink supply problems](#)
- [Print-quality problems](#)
- [Connectivity problems](#)
- [Scanning Problems](#)
- [HP 727 Printhead Troubleshooting](#)
- [Videos for replacing CSR parts and HP 727 printhead](#)
- [Firmware upgrades](#)

The front panel





The front panel is located on the front right of the printer. It gives you complete control of your printer: from the front panel, you can print, view information about the printer, change printer settings, perform calibrations and tests, and so on. The front panel also displays alerts (warning and error messages) when necessary.

For more information about front panel, refer to the users guide.

Sleep mode

Sleep mode puts the printer into a reduced power state after a period of inactivity, turning off the front panel display to save energy. Printer features can be enabled from this mode, and the printer maintains network connectivity, waking up only as necessary. The printer can be woken from sleep mode by the **Power** button, by sending a print job, or by opening the window, the roll cover, or the stacker cover. The printer wakes up in several seconds, more quickly than if it is completely turned off. While in sleep mode, the **Power** button blinks.

To change the time that elapses before sleep mode, press , then , then **Setup > Front panel options > Sleep mode wait time**. You can set a time between 5 and 240 minutes; the default time is 30 minutes.

Printer Monitoring (with the Print Spooler) and Remote Printer Management with the HP Utility and Web JetAdmin continue to be available during sleep mode. Some remote management tasks offer the option of remotely waking up the printer if needed to perform the task.

Other Power States

Besides sleep mode, the printer has 5 different power states (including ready and sleep). Depending on the power state, the printer has different subsystems wake up and ready for use.

State	Ready	Sleep	Stand-by/soft -off	Off
What is working?	Everything	Networking	Nothing	Nothing
Visual cues	Front panel and power button LED is on	Front panel is off, power button LED is pulsing	Everything off	Everything off
How to enter	Going out from any other power state	After "Sleep mode" timeout	<ol style="list-style-type: none"> 1. Press power button 2. Press power button more than 5 sec 3. After "Auto-off" timeout 	<ol style="list-style-type: none"> 1. Turn off rear power switch 2. Unplug power cord
How to leave	Enter into any of the other states	<ol style="list-style-type: none"> 1. Press power button 2. Any network activity 3. Open window, open supplies, open roll covers, open stacker arms 4. Going to Stand-By/Soft-off 5. Auto-reboot¹ 	Press Power button	<ol style="list-style-type: none"> 1. Plug in power cord 2. Turn on rear power switch
What has power?	Everything	Front panel and power button; JDI, Formatter, and PSU	<ul style="list-style-type: none"> • Real Time Clock (battery supplied) • Part of the PSU 	Real Time Clock (battery supplied)
Max power	75W	8 W	0.5 W	0.1W

(1) After 50 cycles of sleep-mode, the printer performs an auto-reboot, done between 22h00 and 06h00.

Background information

Summary			
	Energy cost	Ink cost	CO2 eq. **
	(\$/year)	(\$/year)	(Tons)
T2300	25.3	624.0	48023
T920/T1500/T2500, 30' sleep timeout*	8.5	624.0	18551
T920/T1500/T2500, 10' sleep timeout*	6.8	624.0	14550
T920/T1500/T2500, 30' sleep + auto on/off	5.1	624.0	17518

* Assumes printer is never switched off.

** Total DECC equiv. CO2 footprint of all IB during 5 years May-2013 / May-2018 assuming 20% switches-off printer or office power and 33% programs schedule on/off.

Auto-off

Auto-off sets the printer to "soft-off" mode after the period of time set by the user can in the Front Panel. This feature is disabled when the printer is connected to the LAN, and in this case, the printer can't go to soft-off automatically. The default value from factory for the Auto-off time out is 120min.



NOTE: In some situations this can be confusing since printers without LAN will be set to off automatically during the night. Furthermore, once the printer has been switched off automatically it needs to be turned on with the Blue Power Button on the printer. Switching on from the rear button will not wake up the printer.

Service keys combination

Entering the User Diagnostics Menu

1. Go to Printer Main Menu.
2. Go to Diagnostics Menu.
3. Type code “1714”.
4. Go to Diagnostic Tests.
5. Allow the printer to reboot.

Printer will remain in “User Diagnostics Menu” until it’s setup to go back to Printer mode.

To go back to Printer mode:




1. From “User Diagnostics Menu” go to “Reboot in printer mode”.
2. Allow the printer to reboot.


The “User Diagnostics Menu” has a limited set of Diagnostics and allows only to perform the following actions:

- [Scan Axis Motor on page 335](#)
- [Paper Drive Test on page 186](#)
- [Electronics Module Test on page 187](#)
- [Sensors Test on page 191](#)
- [Stacker Jam Sensor Test on page 196](#)
- [Stacker Capacity Sensor Test on page 196](#)
- [Stacker Empty Sensor Test on page 191](#)
- [Output Valve Test on page 192](#)
- [Pinches Lifter Test on page 194](#)
- [Stacker Ramps Test on page 194](#)
- [Stacker Overdrive Test on page 195](#)
- [Ink Delivery System \(IDS\) Test on page 196](#)
- [Service Station with Drop Detector on page 339](#)
- [Enable I/O Interfaces Utility on page 200](#)
- [Unit Information Utility on page 200](#)


Entering the Diagnostics Menu when booting the printer


1. Make sure the product is switched off with the **Power** button on the side of the Front Panel, and **not** with the power switch on the back of the product.
2. Press and release the **Power** key to switch on the product.

3. Wait for the Home button light to come on.
4. Press the Home button; the button will acknowledge by blinking.
5. All LEDs will come on; press and release them one after another:
 - The Cancel icon 
 - The Home icon 
 - The Help icon 

 **NOTE:** Do not push the icons all at the same time, push each one in the order shown above and release each icon before pressing on the next icon

6. The 6 buttons on the Front Panel then blink 4 times; wait until the product completes the initialization sequence and shows the **Diagnostics menu**.
7. In the **Diagnostics menu**, scroll up and down sliding a finger vertically on the Front Panel, and press on the desired option.

 **NOTE:** The Diagnostic Tests and Utilities work in a special mode that does not require the full initialization of the product. Therefore, whenever a test is finished a test, switch off the product and switch it on again before printing, or executing another test.

 **NOTE:** A quick press of a button on the Front Panel frame may not be recognized by the product. When pressing a button, be sure to press it for about 1 second.


 **NOTE:** If the product hangs up during a test; switch the product off and restart from step 1.

Entering the service utilities menu

1. From the home screen, select the Information icon in the top left corner. For information about the Front Panel keys, see using [The front panel on page 35](#) or:
2. From the product information area, press the main menu / tool icon on the bottom right corner of the screen.
3. Scroll down to the lowest menu option and select the **Service menu** option.
4. Enter the 4-digit 1st level access code “3174” and press **OK**.
5. Select the **Service utilities** menu option.
6. From the **service utilities** menu you can scroll up and down to see all the available utilities. Press on the selected menu option.

Troubleshooting tree (T920 and T1500 only)


As a general approach, the following tree should be followed to troubleshoot any issue. This helps understand at which point the problem was caused. The tree is sequential; before checking a subsystem, the previous steps need to be working. Once a sub system is identified as causing the problem, the service and utilities related to that component can be used to troubleshoot further. See [Diagnostics, Service Utilities and Calibrations on page 179](#).

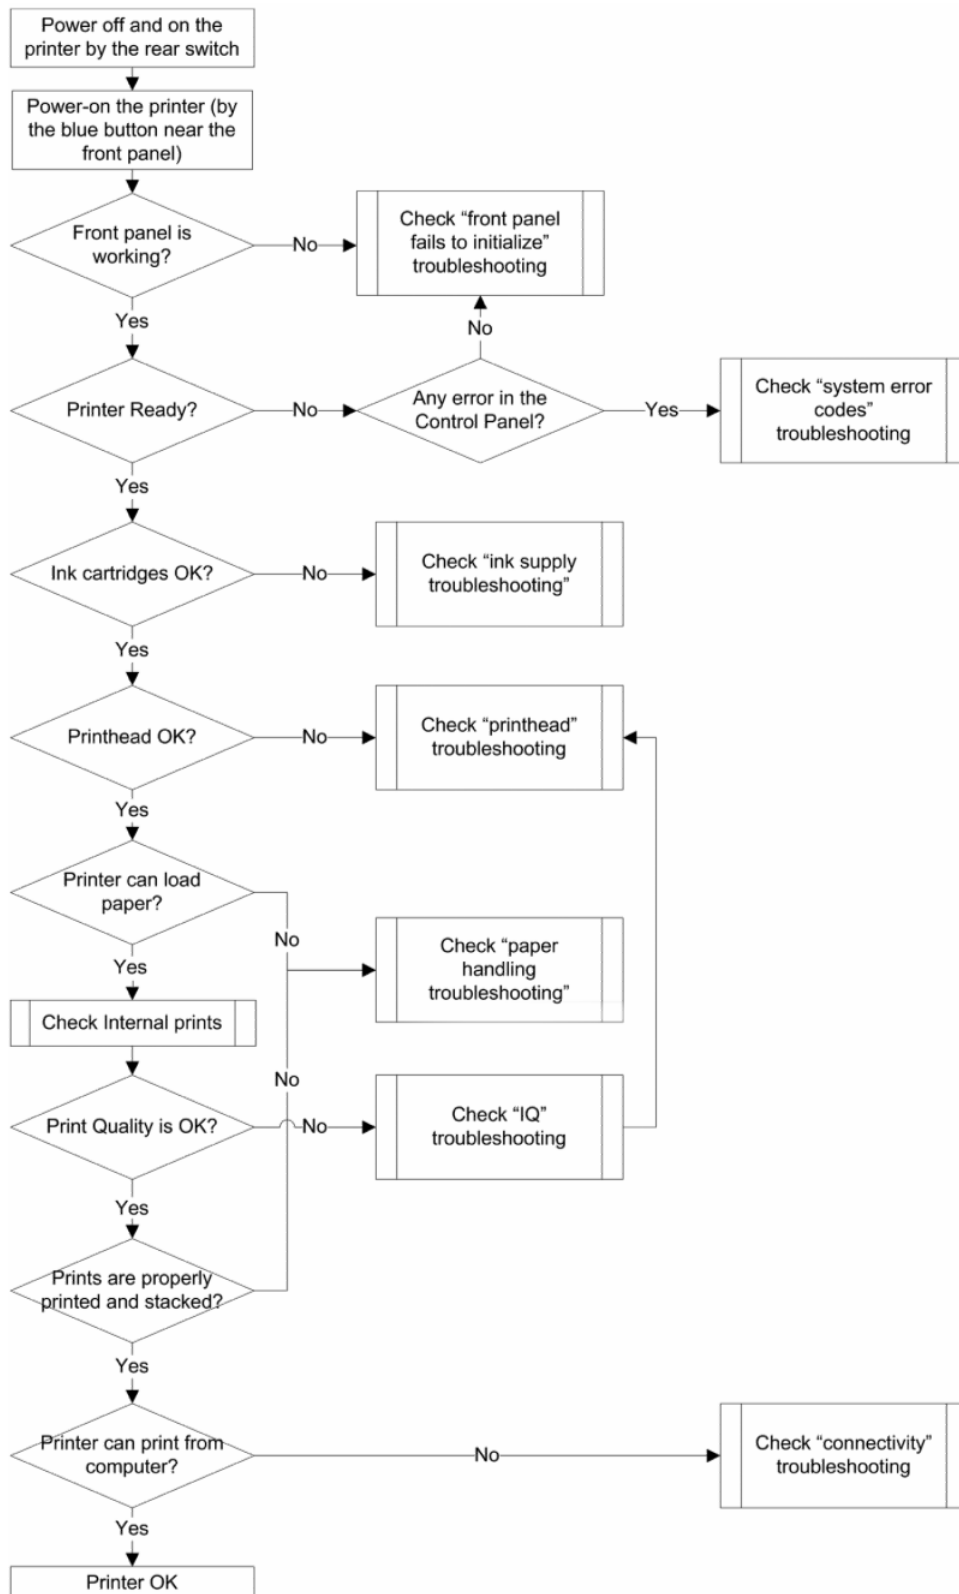

 **NOTE:** Once an issue is confirmed, check that printer has latest firmware installed.


Product Troubleshooting trees (T2500 and T3500 only)

Figure 1-1 Troubleshooting

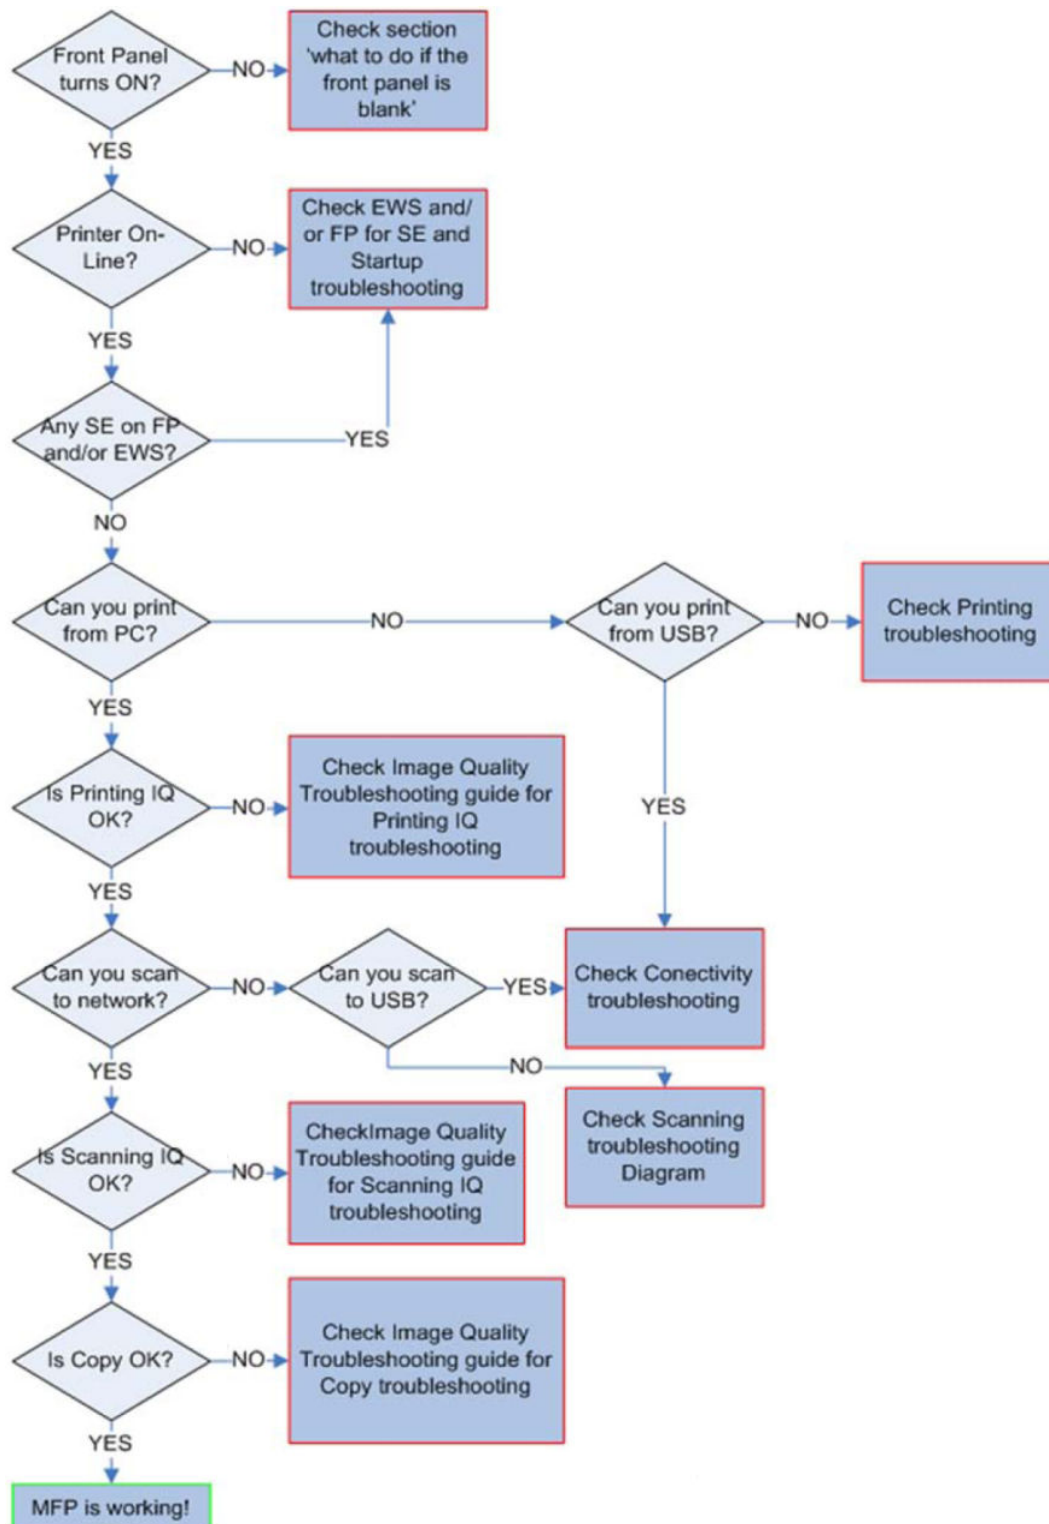


Scanner Troubleshooting Tree

Figure 1-2 Scanner Troubleshooting

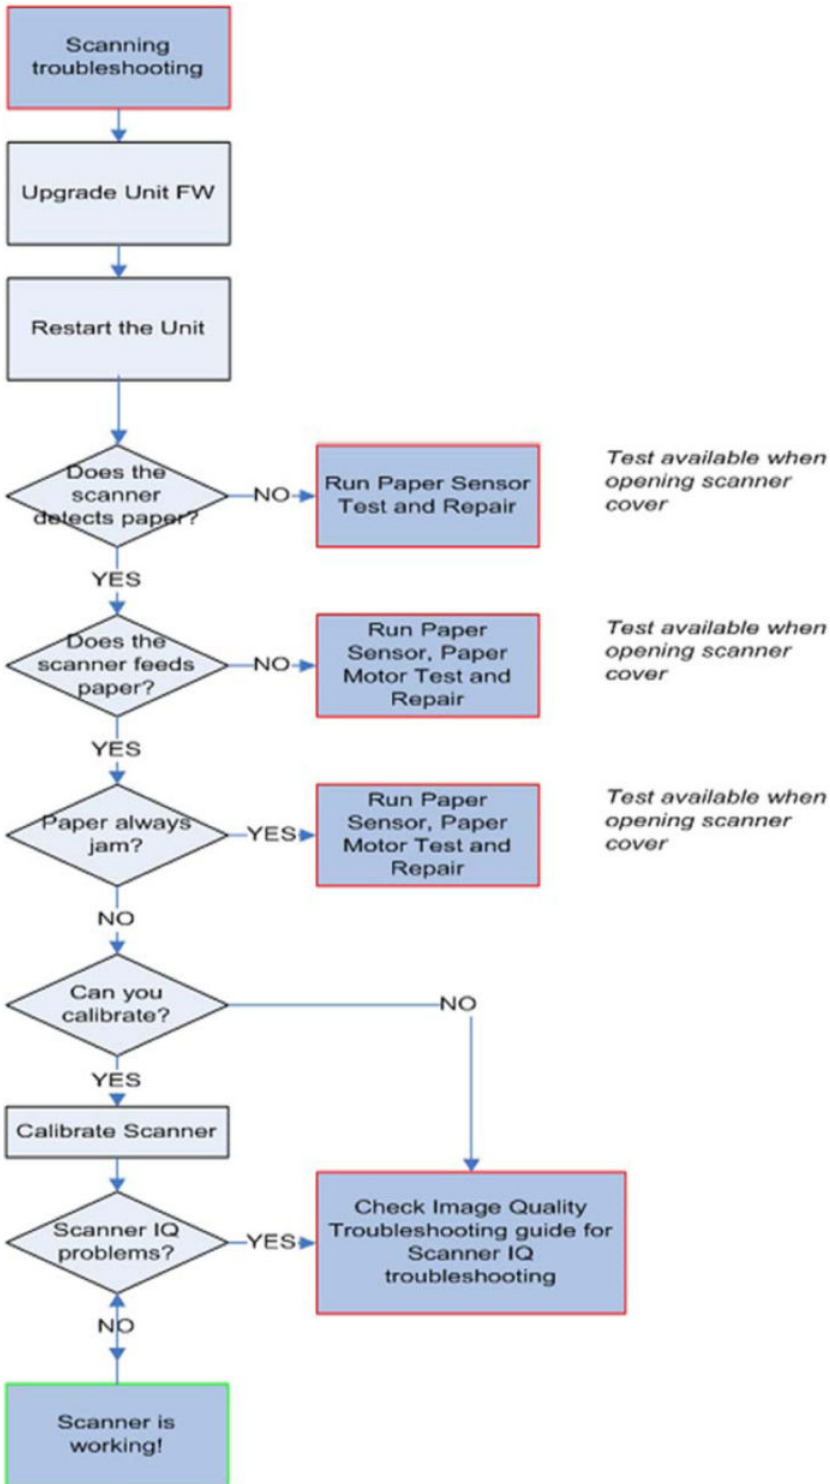

Scanner CIS Troubleshooting

Figure 1-3 Scanner Troubleshooting

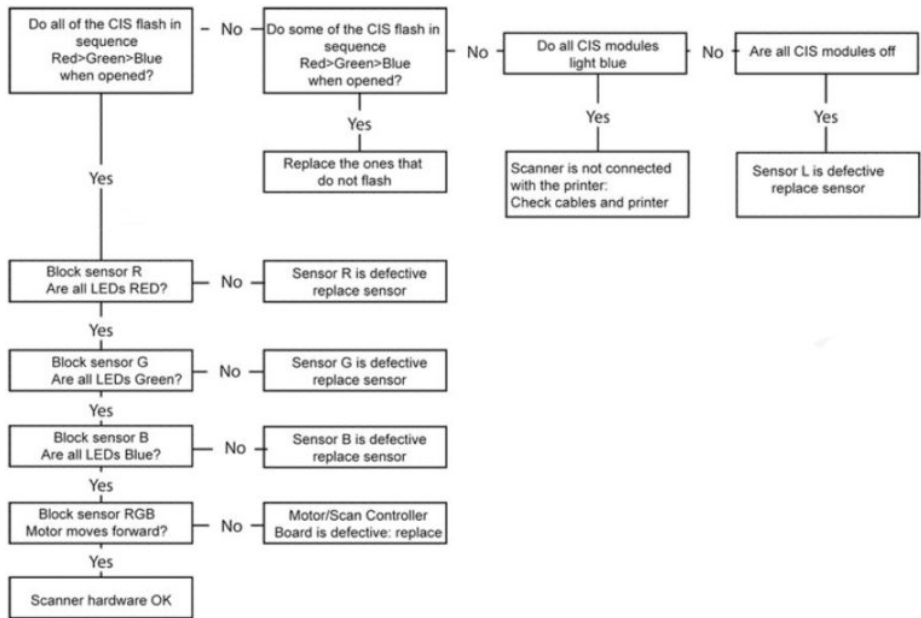


Troubleshooting using board LEDs


All the printer boards have diagnostic LEDs to help in the troubleshooting. Although some LED information is redundant and also known by the printer firmware, using the board LEDs can be very useful when trying to diagnose power or communication problems. The following sections provide information on the physical location and meaning of each board's diagnostic LEDs.

For further information regarding electric and electronic interactions, see the subsystems' block diagrams in section [Theory of operation on page 6](#).

Board name: Formatter PCA

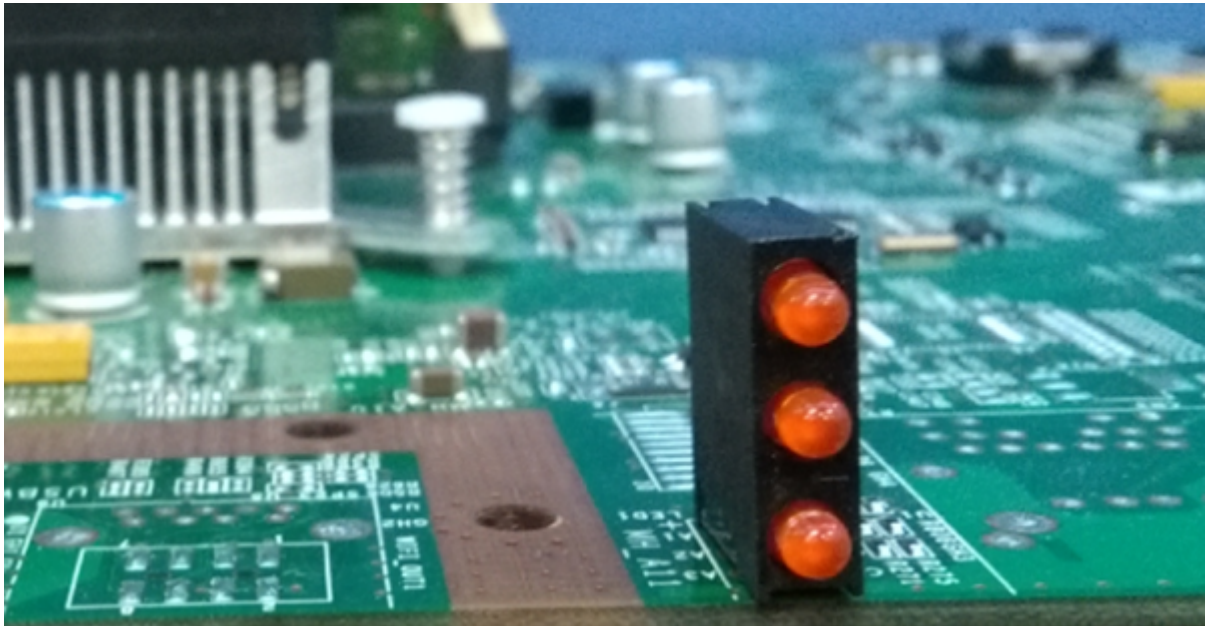

Meaning of LEDs:

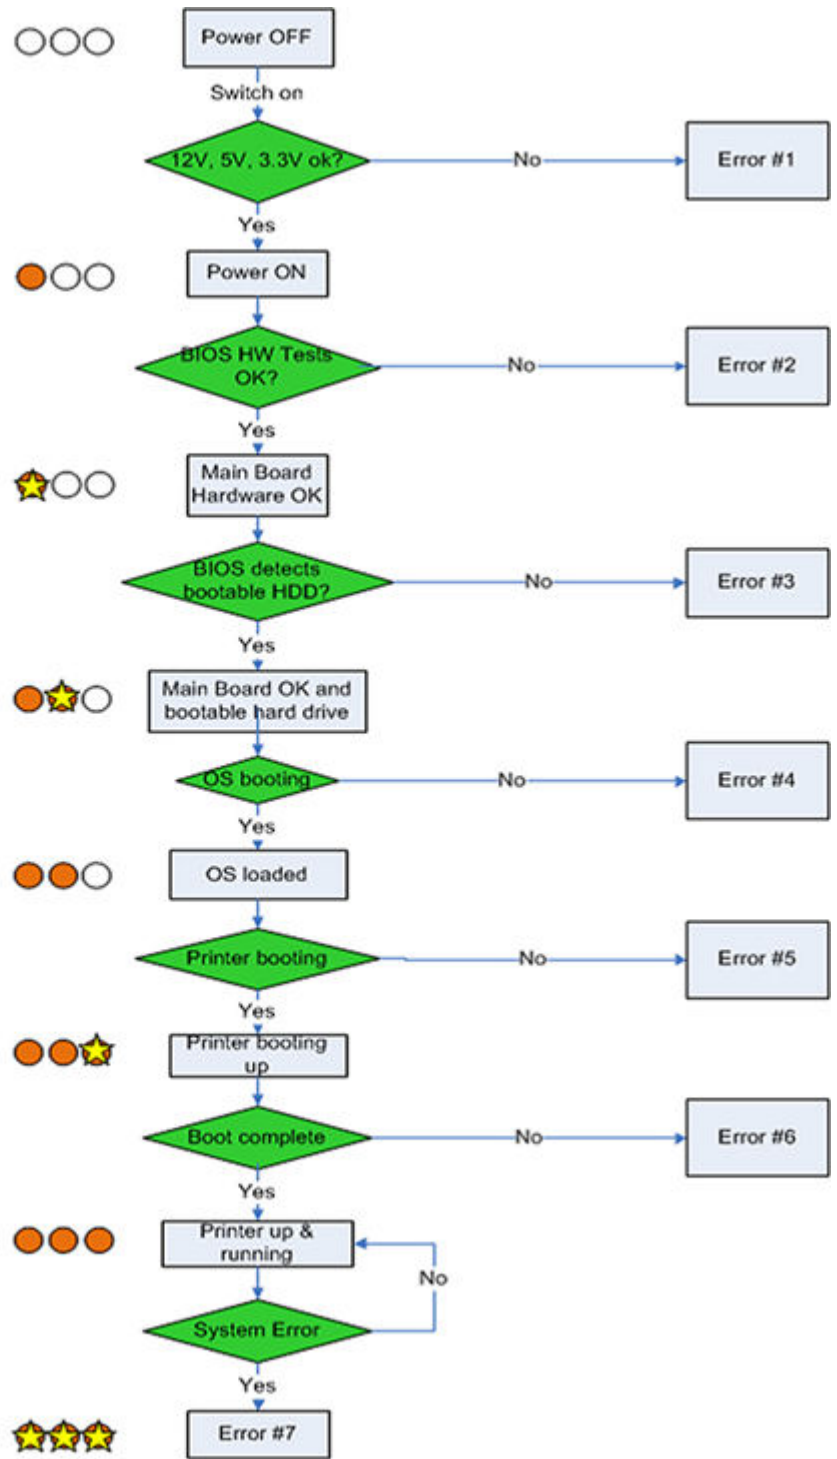

Error 1: No Power ○○○

Root cause: Board, power signal or eBox PSU are malfunctioning.

Actions:

Check power button cable

Check eBox power supply and replace if necessary

Replace main board

Error 2: Main board hardware failure ●○○

Root cause: Main board is malfunctioning

Actions:

Change main board

Error 3: Hard drive error ★○○

Root cause: Hard drive not connected or malfunctioning

Actions:

Check hard drive is properly connected (data and power cables)

Change hard drive

Error 4: Operating system not booting ●★○

Root cause: Hard drive data problem

Action: change hard drive.

Error 5: Printer firmware not booting ●●○

Root cause: Hard drive data corruption

Action: change hard drive.

Error 6: Printer booting not complete ●●★

Root cause: printer is booting

Action: check for system errors in IPS

Error 7: System Error ★★

Root cause: a system error has occurred

Action: check for system error code in IPS

Board name: Carriage PCA



Meaning of LEDs:

State	Orange LED DS3	Orange LED DS4	Red LED DS1	Orange LED DS2
32V Power input OFF	OFF	??	??	??
Vcc Power OFF	??	OFF	OFF	OFF
32V Power input ON	ON	??	??	??
Vcc Power ON	??	ON	??	??
FPGA not programmed	??	ON	ON	ON
FPGA programmed in Reset State	??	ON	OFF	OFF
FPGA out of reset but no clock	??	ON	Regular blinking	Not blinking
FPGA out of reset, HCI clock OK, HCI not initialized	??	ON	??	Slow blinking
FPGA out of reset, HCI clock OK, HCI Id initialized	??	ON	??	Fast blinking
FPGA out of reset, PLL unlocked	??	ON	Two-pulse blinking	??

Board name: Jester PCA




Meaning of LEDs:

There is only one LED left on Jester. It is a Green/Red LED able to code the following states:

Board status	LED status	Period
Some Voltage/Temperature out of range	Fix Red	-
Monokhan does not respond (possibly in reset)	Slow Red	0.4 Hz
Mismatching Hardware/Software version	Quick Red	5 Hz
Monokhan unexpected reset	Fix Green	-
Normal operation	Quick Green	5 Hz

Board name: Engine PCA

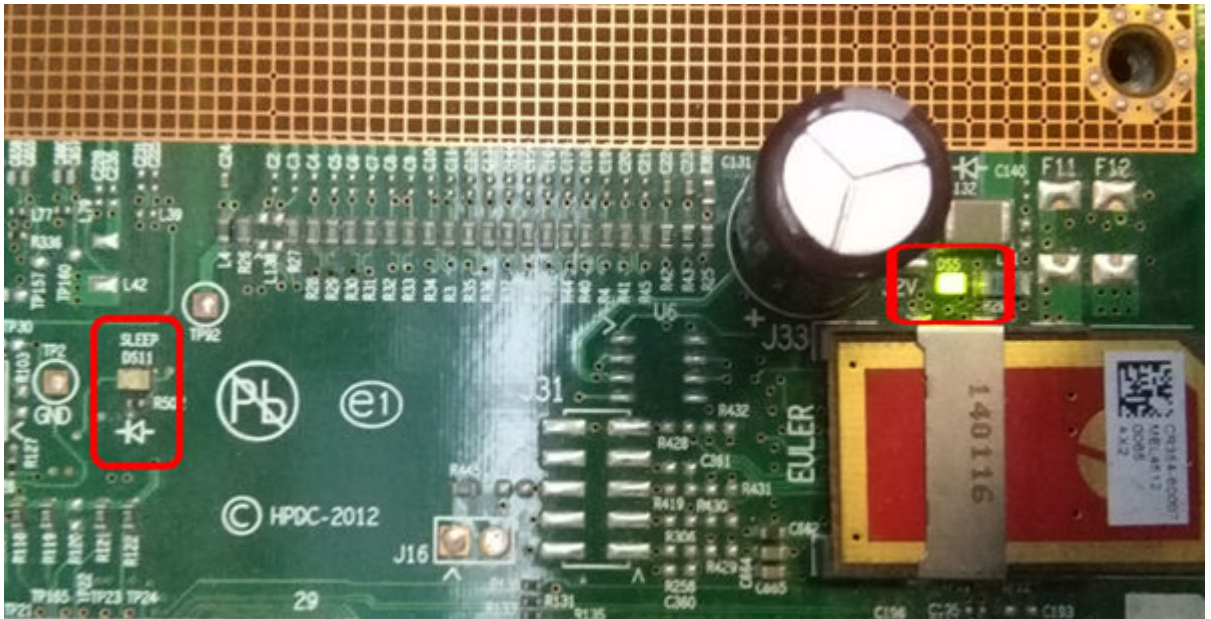

Meaning of LEDs:

State	Green LED DS5	Green LED DS11
32V Power input OFF	Off	Off
32V Power input ON	On	Off
Sleep mode activated	Off	On


Paper handling problems

- [The paper has jammed in the print platen](#)
- [The paper has jammed in the stacker](#)
- [Thin paper is jamming in the stacker](#)
- [High density plots jamming in the stacker](#)
- [Several stacker paper jams](#)
- [Stacker capacity lower than expected](#)
- [The stacker detects "Stacker is full" permanently](#)
- [The stacker detects "Stacker jam" permanently](#)
- [The printer rejects the paper during paper load](#)
- [Prints do not fall neatly into the basket](#)
- [Using the stacker](#)
- [The paper type is not in the list](#)
- [The printer printed on the wrong paper type](#)
- [An "on hold for paper" message](#)
- [The printer displays out of paper when paper is available](#)
- [The print remains in the printer after printing has completed](#)
- [The cutter does not cut well](#)
- [The roll is loose on the spindle](#)
- [The roll is unloaded unexpectedly](#)


The paper has jammed in the print platen

When a paper jam occurs, you normally see the **Possible paper jam** message in the front panel display, and a system error 81:01 or 86:01.


1. Open the window.

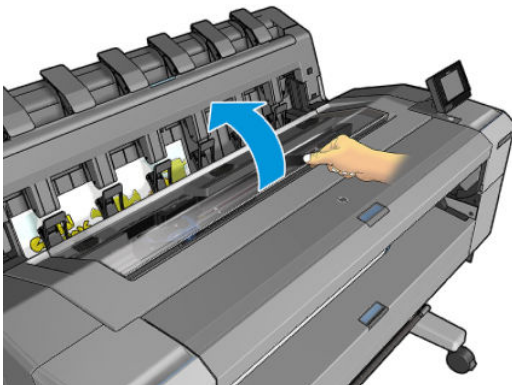


2. Move the carriage manually to the left side of the printer, if feasible.

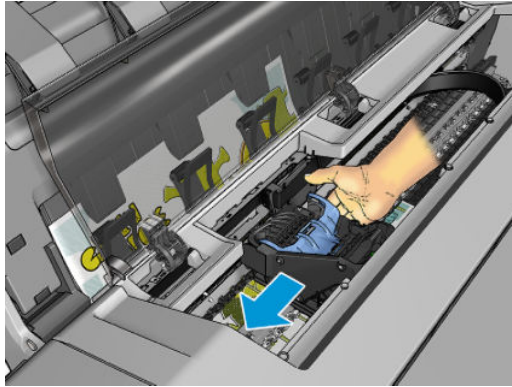


3. Go to the paper path.

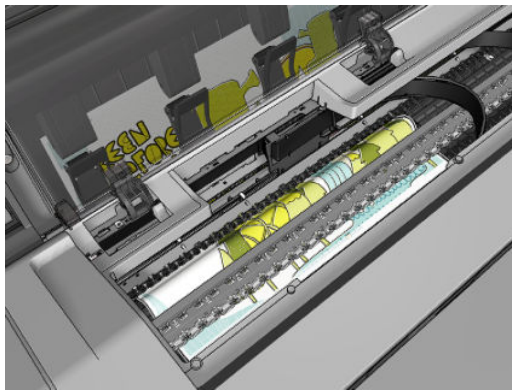




4. Cut the paper with a pair of scissors.

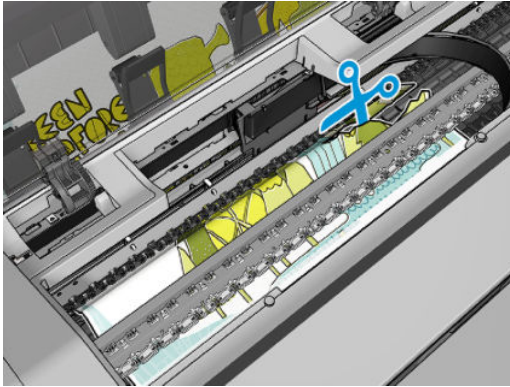


5. Open the roll cover.

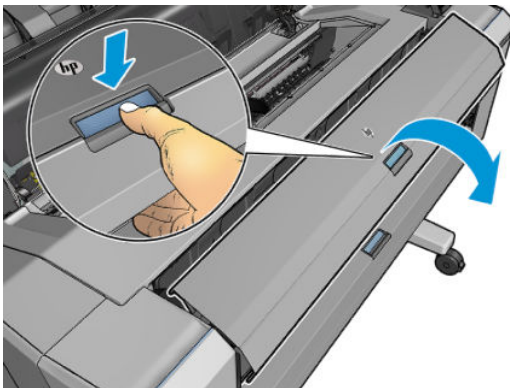


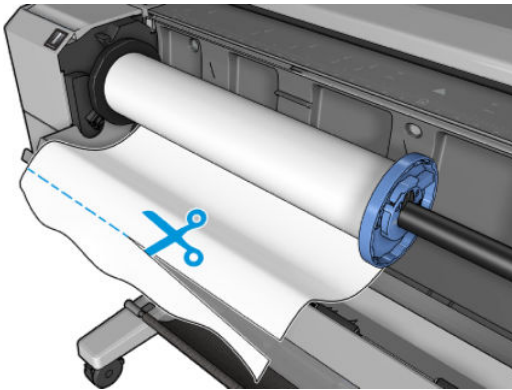
6. Manually rewind paper onto the roll.

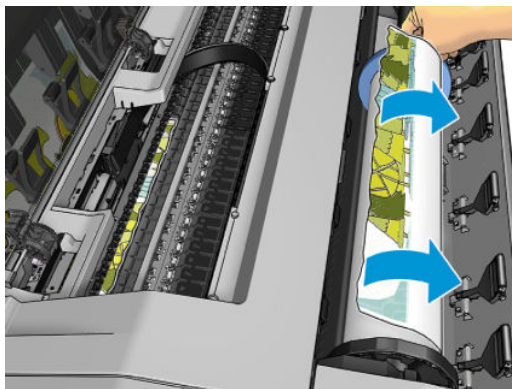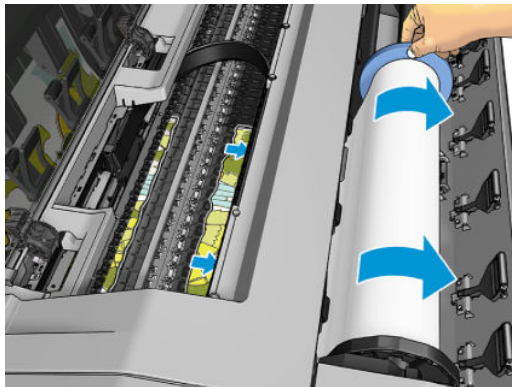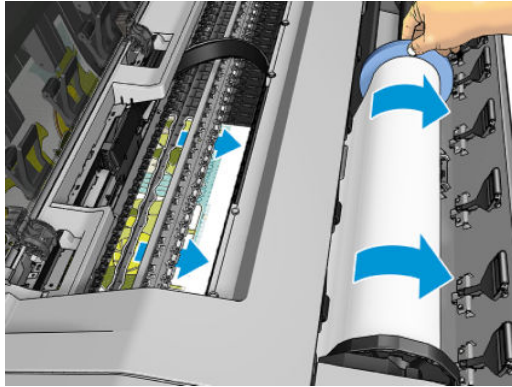



7. If the leading edge of the paper is ragged, trim it carefully with scissors.

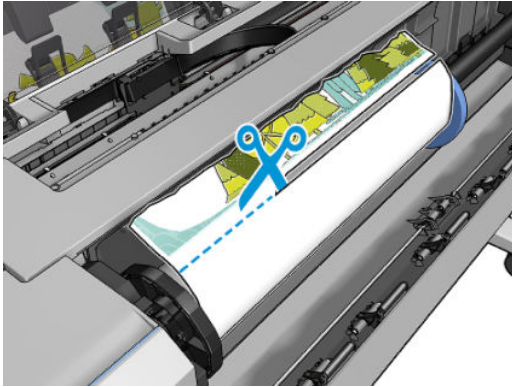


 **NOTE:** In the T3500 the guide can be used for cutting.



8. Remove the paper left in the printer.

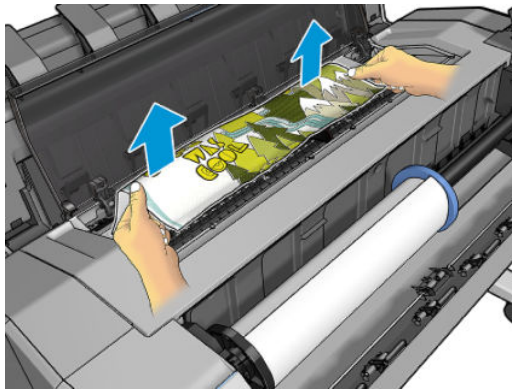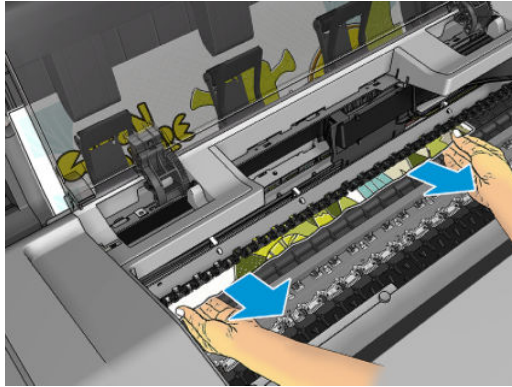


9. Make sure you have removed every fragment of paper.

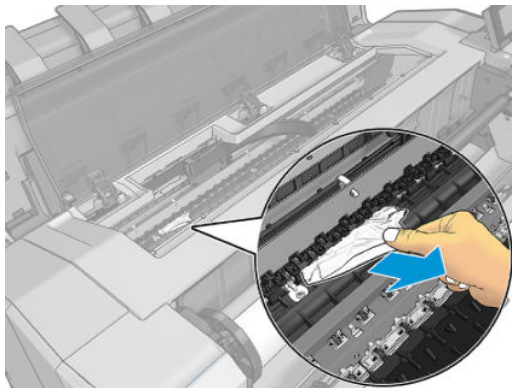

 **IMPORTANT:** Remove remaining paper by carefully pulling it out in the direction of the paper axis.

10. Close the window and the roll cover.

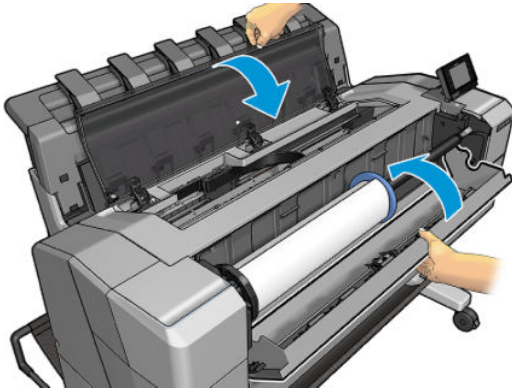

11. Restart the printer by holding down the power button for a few seconds, or by turning the power switch at the rear off and then on.
12. Reload the roll, or load a new sheet.

 **NOTE:** If you find that there is still some paper causing an obstruction within the printer, restart the procedure and carefully remove all pieces of paper.

The paper has jammed in the stacker

When a stacker jam is detected, printing is paused, and the front panel asks you to open the stacker cover and clear the jam by pulling out the paper.

 **IMPORTANT:** Remove remaining paper by carefully pulling it out in the direction of the paper axis.

When the stacker arms cover is closed and the printer detects no jammed paper, the front panel requests confirmation to continue printing.

Thin paper is jamming in the stacker

When using a media thinner than 75gsm, the blue lever needs to be pulled forwards so that there is a larger gap between the arms and stacker tray when the arms are closed.





After printing with thin media, remember to return the blue lever so that there is a small gap between the arms and stacker tray.




High density plots jamming in the stacker

If you are printing high-density plots (over 15ngrs ink density) with media below 80grs/m², and you encounter that plots have problems curving at the end of the stacker, or do not stack properly, and cause jams:


- Use Manual mode.
- Print to the basket.
- Use thicker media; over 80grs/m².

- Use the CR357-67089 “Stacker tray filler” (CSR)

To improve the performance of the stacker when printing high density graphic content customers can use the “Stacker tray filler” that guides stacker paper exit.

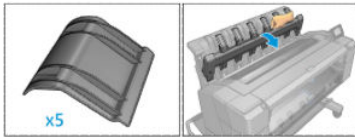

Place the parts of the Stacker tray filler as illustrated below:

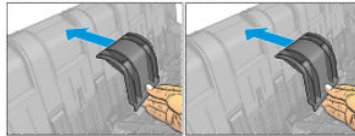

Several stacker paper jams

Call agent:

1. Ask customer for Media type used and plot content.
2. Ask customer to check there is free space between top of the stacker and the wall.
3. Ask customer to check if one or several wheels of the arms cover is stuck in the paper path.
4. Exclude the cause to be any of the previously described issues. See [Thin paper is jamming in the stacker on page 56](#) and [High density plots jamming in the stacker on page 57](#).

A root cause can be one or several wheels of the arm cover stuck in the paper path.

Ask the customer to perform the following actions:

5. Check that no cable routing is blocking the paper path.
6. Remove all paper from the stacker.
7. Detach the stacker arms cover from the printer.
8. Visually check that there are no missing wheel supports in the stacker cover (there are 25 wheel supports).
9. Shake the stacker cover a couple of times so all the wheel supports can move freely.
10. Ensure that all wheel supports in the cover can rotate freely (by pushing them, and checking that they return to their position). If any of them are stuck, try to move slightly to free them.
11. If any of the wheel supports are stuck or are missing, send a new stacker arms cover to the customer.
12. If all the wheel supports are free and there are none missing, then arrange an on-site visit with a new stacker and stacker cover arms.


Service engineer:

Items required:


Take a stacker

Take stacker cover arms

1. Remove all paper from the stacker.
2. Detach the stacker cover from the printer.
3. Visually check that there are no missing wheel supports in the stacker cover (there are 25 wheel supports).
4. Shake the stacker cover a couple of times so all the wheel supports can move freely.
5. Ensure that all wheel supports in the cover can rotate freely (by pushing them, and checking that they return to their position). If any of them are stuck, try to move slightly to free them.
6. If any of the wheel supports are stuck or are missing, send a new stacker arms cover to the customer.
7. If all the wheel supports are free and there are none missing, check that there are no free or misplaced pieces at the bottom of the stacker (pinches, first wheel holder, wheels, etc.).

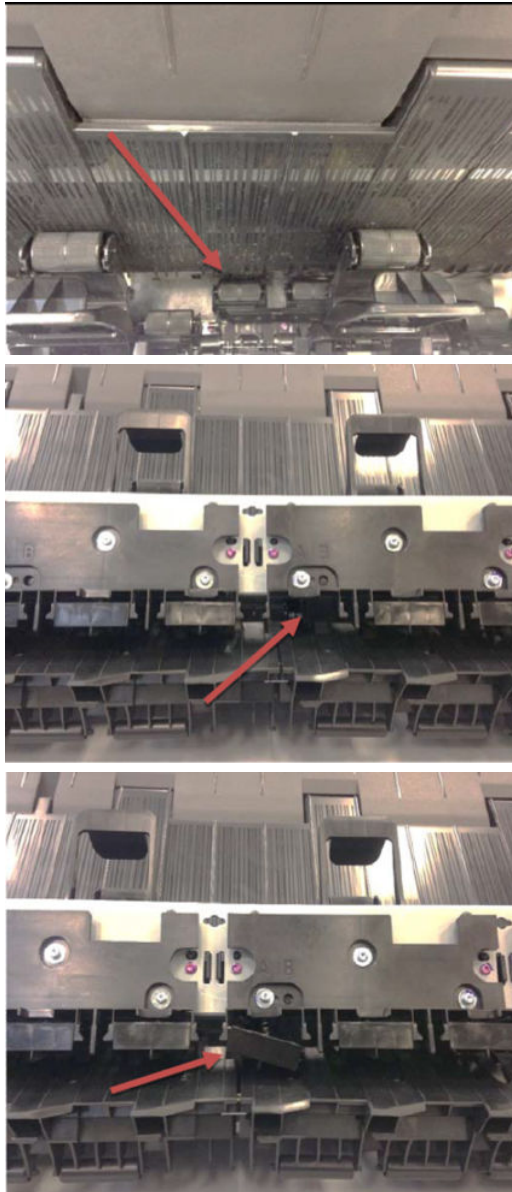


8. Check that Ramps are broken are not broken and are aligned.

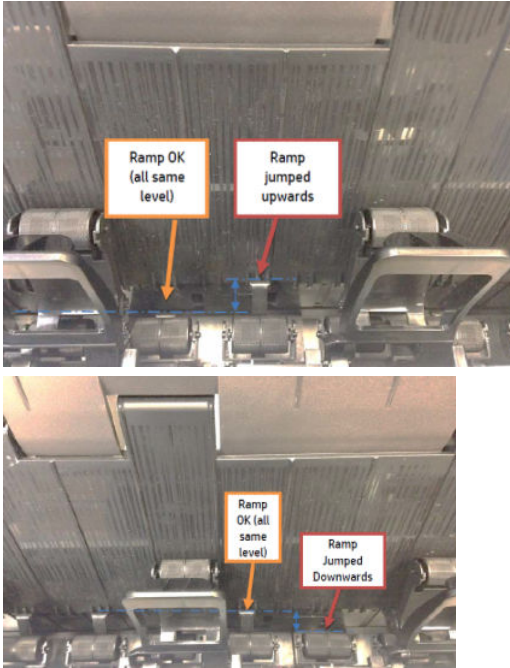

9. Report root cause in cso and change Stacker.

Stacker capacity lower than expected

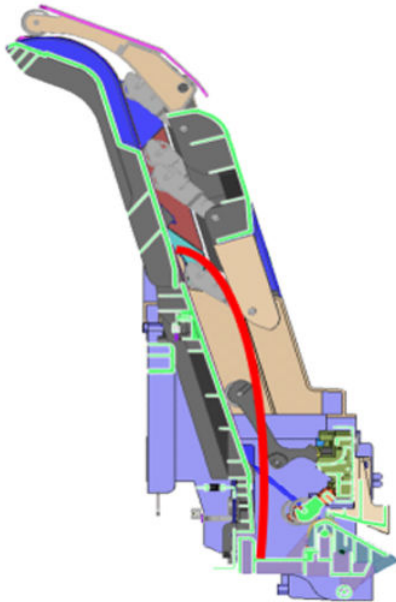

Stacker capacity is defined as up to 50 pages (T920/T1500/T2500), and 100 pages (T3500), A1/D size line drawing plots in landscape on bond media, but stacker capacity depends on media thickness and page size. If you are printing plots shorter than A1 and you experience a reduction in the stacker capacity because they collapse and the curling fills the available stacking space:


- Try to increase the length of the plots when printing A2 and A3 sizes:

- Print A2 sizes in portrait position, using low-width rolls or nesting to minimize waste of paper.
- For A3 size, group different jobs in the same plot.

The stacker detects "Stacker is full" permanently

Even when there are no pages in the stacker, it detects that it is full.

- Remove the stacker arm and check the stacker wheels. If you find a stacker wheel in the upper position, get it down with the hand.
- Run the capacity sensor diagnostic.
- Run the ramps motor diagnostic.
- Check that when the ramps are up all are at the same height.

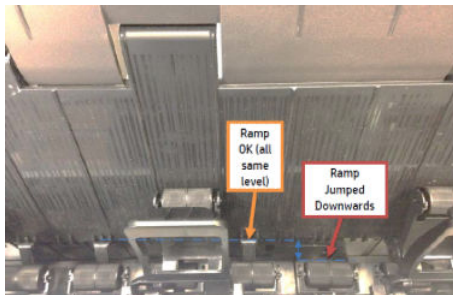

If ramps are not aligned, replace the stacker.

- Run the capacity sensor diagnostic. If it fails, replace Hand off Assy sensor.

The stacker detects "Stacker jam" permanently

Even when there are no pages in the stacker, it detects a jam.

- Run the capacity sensor diagnostic. If it fails, replace Hand off Assy sensor.

The printer rejects the paper during paper load

If the roll load process is too long and unsuccessful, check the following items:

- Roll paper is properly inserted in the spindle and pressed uniformly by the hubs.
- The core of the roll paper is not misplaced. If this is the case, try to correct its position.
- Check if the black hub of the spindle is damaged. If any part of the spindle is damaged, it could cause roll load problems.

If the roll affected is from a polyester or film type, it is possible that the edges of the paper are not properly detected during the paper load process:

- Upgrade to the latest FW release to solve the problem, as the paper load algorithm has been improved.

Prints do not fall neatly into the basket

- Ensure that the network and power cables are not getting in the way.
- Ensure that the basket is correctly installed.

- Ensure that the basket is open.
- Ensure that the basket is not full.
- Ensure that the paper is not jammed.
- Paper often tends to curl near the end of a roll, which can cause output problems. Load a new roll, or remove prints manually as they are completed.


If you see the message **Please remove the print from the basket and press OK to continue**, empty the basket, check that there is no paper in the path to the basket, then press **OK**. The printer checks that the problem has been fixed.

Using the stacker

Installation

Prevent interruptions:

1. Open the basket; this indicates the clear space required at the back of the printer.

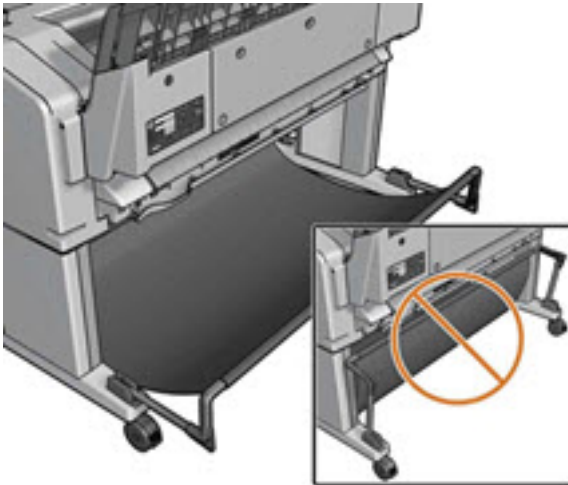

2. Route the cables to the side desired to attach the power cable; the left side is shown here.




Removing prints from the stacker tray

Sheets can be removed from the stacker while printing. It is recommended to remove all prints when not printing.

 **NOTE:** Once removed, do not put prints back into the tray as this can collapse output.

If prints are replaced in the stacker tray; make sure that they reach the bottom of the stacker and don't overlap the page that is being printed, or the small black plastic piece.

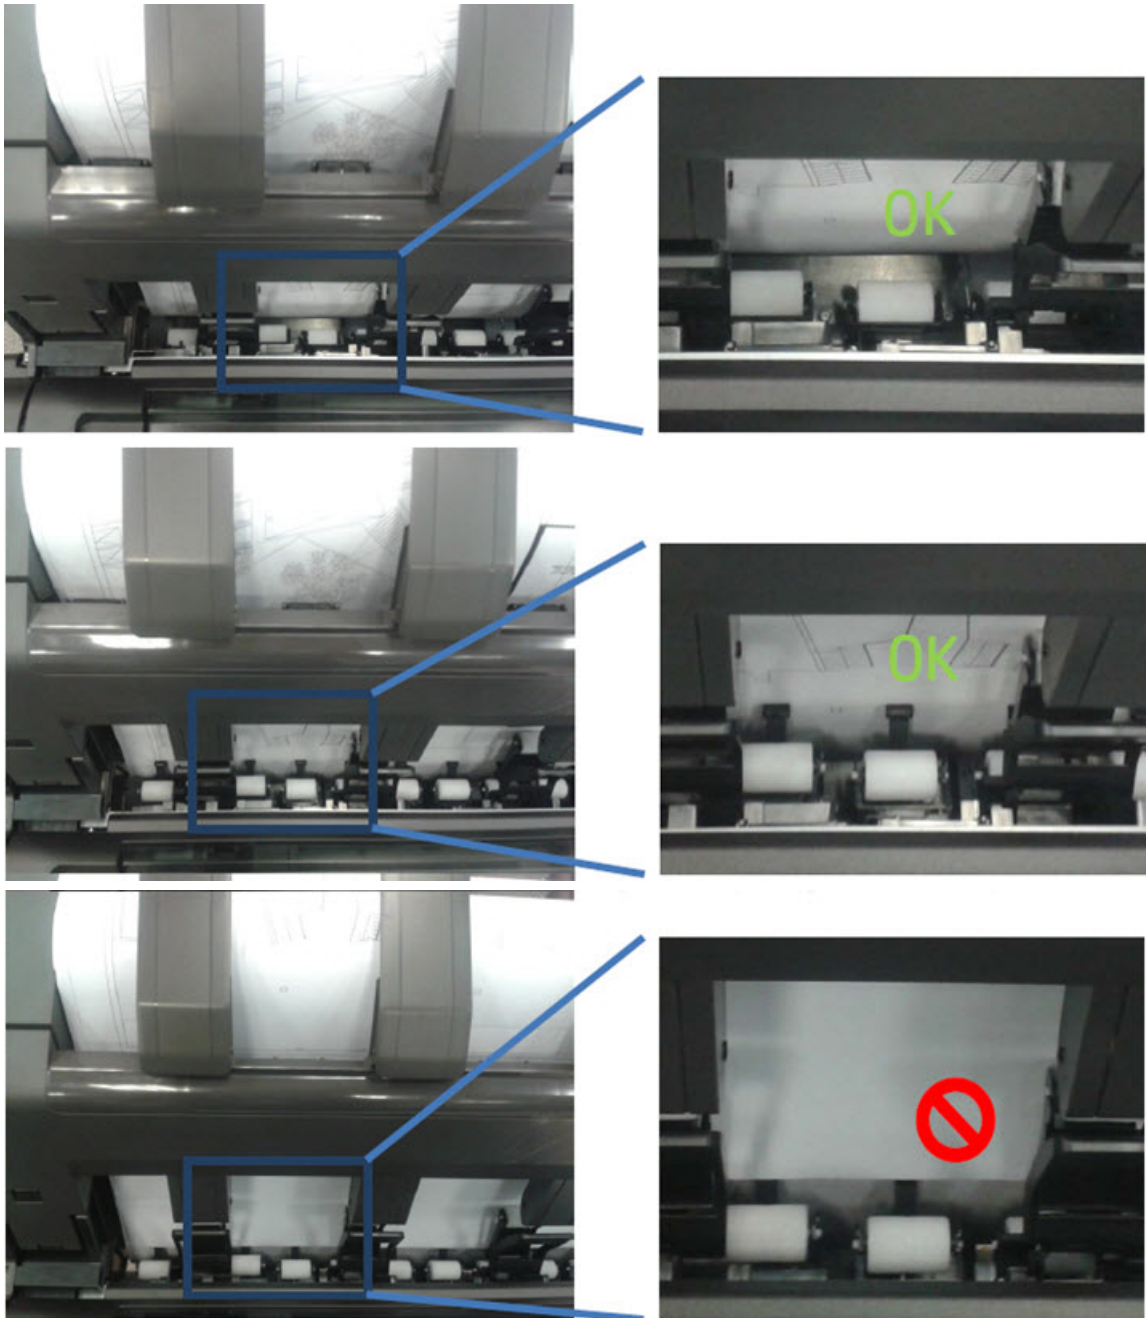

Printing high quality prints

To obtain the best possible quality, consider:

High quality photo media graphics

Use instant dry photo media such as HP Instant Dry Photo or Satin paper to get ready-to-use and robust prints.

Optimize quality when printing solid black areas; use Manual mode (print with the stacker open), and carefully remove the output immediately after printing.

High quality matte media graphics

HP Heavy Coated Paper and Super Heavy Coated Paper reproduce deeper blacks and more saturated colors than bond paper due to heavier coating.

When printing solid black areas, carefully remove output immediately after printing to prevent the next print covering it.


Utilize full stacker capacity

The stacker is optimized for plain paper use (the most common size ISO A1/D). Capacity is up to 50 pages. When the printer detects that the stacker is full, an alert appears to empty the stacker. The actual capacity may differ depending on the combination of paper size printed and media type; for example, heavyweight coated is a media with a higher grammage than plain paper, therefore the number of pages that the stacker can handle is less.

How to switch from stacker to basket and vice versa

The default output is the Stacker, however, switching to the basket is very easy:

In driver properties, select the **Layout/Output** tab, then in **Output options** select **Basket** for **Delivery**:

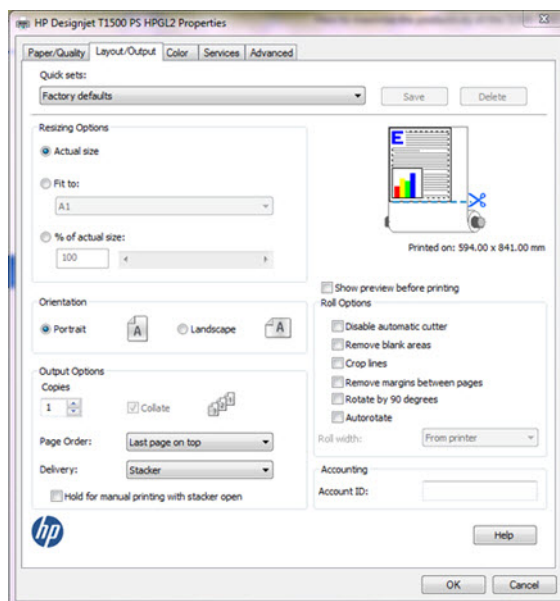


TIP: Also use this setting together with the **Quick sets** in the driver or as a driver default by going to Windows **Start**, then **Device and printers** and editing the **Printing properties**.

TIP: At any time, the jobs appearing in the queue can be redirected and sent to either the stacker or the basket by modifying the job setting in the Front Panel.


Manual mode

Manual mode is designed to help maximum print quality with photo media. The driver automatically enables Manual mode when photo media is selected in the driver; the job now waits in queue for the stacker to open, and to be activated. This ensures the stacker doesn't touch the print while drying. If jobs are not required to be "Hold for manual mode" there are 2 options:

1. Manual mode can be enabled/disabled in the **Layout/options** tab in the driver by clicking in the checkbox **Hold for manual printing with stacker open**.
2. Disable the driver check for photo media so Manual mode is not enabled automatically. Press the **Start** button, select **Devices and Settings**, and right-click the printer's icon. Select **Printer Properties**. Select **Device Settings**.

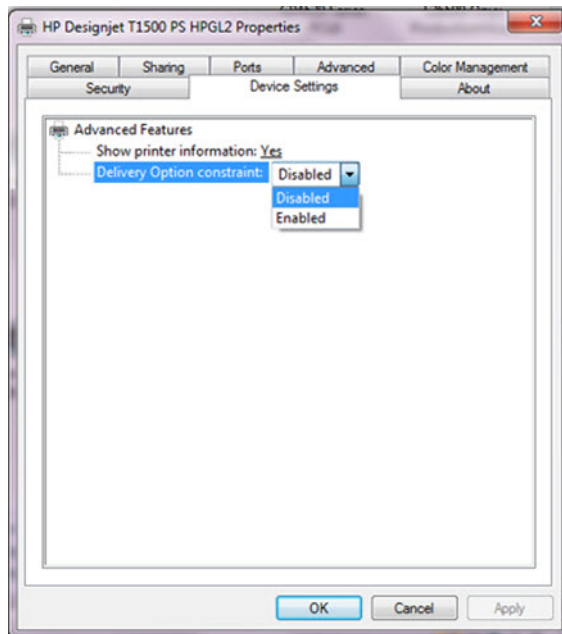

 **NOTE:** When a job is put "On hold for manual mode" the printer doesn't stop; while this job is waiting, and if the stacker is closed, other jobs can still be sent and printed.

 **NOTE:** After printing the job sent in Manual mode with the stacker open, the printer stops until the stacker is closed, or another job is sent from the queue.

Resuming print interruptions

The stacker has a sensor to prevent unexpected behavior of the media in the tray, and ensure that the jams never reach the printhead. Eventually, when prompted by the printer, it's required to go to the stacker and correct it by flattening the paper. Once fixed, printing will resume.

Media jam frequency may increase under certain conditions; when printing images with very high ink density on light media like Bond or Coated under specific environmental conditions such as 30°C-86°F/70%. In such cases, switching to a media with higher grammage such as HP Heavy Weight Coated can help to increase productivity.

The paper type is not in the list

To work with a paper that does not appear in the list in the driver or front panel, you can choose one of the other papers in the list. However, you should at least choose a paper of the same type: transparent or translucent, photo or bond, coated or technical.



NOTE: For photo paper, it is important to select a photo paper type, as the printer adjusts its use of ink for photo paper.

Transparent or translucent film

If your paper is a transparent film (for example, a transparency), select paper type **Film > Transparent/Clear film**.

If your paper is a translucent paper or film (for example, technical paper), select paper type **Film > Matte film**.

Photo paper

If your paper is a photo paper, use the **Photo Paper** category. For gloss or high-gloss paper, select paper type **Photo Gloss Paper**. For semi-gloss, satin, pearl, or luster finishes, select paper type **Photo Semi-gloss/Satin Paper**.

To increase gamut on photo paper, select paper type **HP Universal Gloss Photo Paper** or **HP Universal Satin Photo Paper**, depending on the finish.

Bond and coated or technical paper

Your paper type selection for generic paper depends on the paper's ink absorption capacity.

- For thin papers (< 90 g/m²) or uncoated papers (for example plain paper or bright white paper), select paper type **Bond and Coated Paper > Plain Paper**. You can also select **Recycled Bond Paper**.
- For light coated papers (< 110 g/m²), select paper type **Bond and Coated Paper > HP Coated Paper**.
- For heavyweight coated papers (< 200 g/m²), select paper type **Bond and Coated Paper > Heavyweight Coated Paper**.

Black ink is easily removed when touched

This happens when your paper is incompatible with matte black ink. To use an optimized ink combination, select paper type **Photo Paper > Photo Gloss Paper**.

After printing, the paper has wrinkles or there is too much ink

Reduce the quantity of ink, or use thicker paper. Matte paper categories from thinnest to thickest are:

- Plain Paper
- Coated Paper
- Heavyweight Coated Paper
- Super Heavyweight Plus Matte Paper




TIP: If you load paper that is slightly thicker than the paper type you selected, the printer will use less ink than usual for the loaded paper.

The printer printed on the wrong paper type

If the printer prints your job before you were able to load your desired paper, you may have **Any** or **Use printer settings** selected for the Paper Type in the printer driver. In this case, the printer will print immediately on whichever paper is loaded. Load your desired paper, and select your paper type specifically in the driver.

- **In the Windows driver dialog:** select the **Paper/Quality** tab, then select your paper type from the Paper Type list.
- **In the Mac OS X Print dialog:** select the **Paper/Quality** panel, then select your paper type from the Paper Type list.

 **NOTE:** The driver default is **Any** for Mac OS and **Use printer settings** for Windows; they have the same effect.

An “on hold for paper” message

Based on a set of conditions that you can set when sending a job to a two-roll printer, the printer will decide which of the loaded rolls of paper is more suitable to print the job. If there is no roll of paper available that meets all the conditions, the printer will put the job on hold for paper. You can manually resume the job, forcing it to print on a paper other than the one originally specified, otherwise it will stay on hold.

Which criteria are used to decide on which roll a job will be printed?

When a user sends a job, the desired paper type can be set (in the driver or in the Embedded Web Server). The printer will print the job on a roll of paper of the chosen paper type that is large enough to print the drawing without clipping. If there is more than one roll on which the job could be printed meeting all the criteria, the roll will be chosen according to your preferences. These can be set from the front panel.

When is a job put on hold for paper?

If the paper mismatch action is set to **Put job on hold**, a job is put on hold for paper in the following cases:

- The paper type that has been selected by the user is not currently loaded on the specified roll—or on either of the rolls, if no roll has been specified.
- The paper type that has been selected by the user is loaded on the specified roll, but the drawing is too large to fit on the roll—or on either of the rolls, if no roll has been specified.

If I load a new roll of paper, will jobs that were on hold for paper be automatically printed?

Yes. Every time a new roll of paper is loaded, the printer will check if there are any jobs on hold for paper that could be printed on the loaded roll.

I don't like jobs being put on hold for paper. Can I prevent it?

Yes, this can be done from the front panel.

I set the option “Paper mismatch action” to “Print anyway”, but some jobs are still put on hold (Windows driver only)

If the **Show print preview** option is selected in the driver or the Embedded Web Server, jobs are put on hold until you have checked the preview and resumed the job. Check that the **Show print preview** option is not checked in the driver, and that there are no pending preview windows waiting for confirmation to continue printing.

My job is exactly as wide as the roll of paper that is loaded on the printer, but is put on hold for paper

Margins are managed in different ways depending on the file type:

- For HP-GL/2 and HP RTL files, by default, margins are included inside the drawing, so a 914 mm (36 in) HP-GL/2 and HP RTL file can be printed on a 914 mm (36 in) roll of paper and will not be put on hold for paper.
- For other file formats, such as PostScript, PDF, TIFF or JPEG, the printer assumes that margins need to be added outside the drawing (as, in many cases, these formats are used for photographs and other images that do not include margins). This means that, to print a 914 mm (36 in) TIFF, the printer needs to add margins, and the drawing needs 925 mm (36.4 in) of paper to be printed; this would cause the job to be put on hold if the paper that is loaded on the printer is only 914 mm (36 in) wide.

If you wish to print these file formats without adding extra margins outside of the drawing, the **Clip contents by margins** option can be used. This option will force the margins to be set inside of the drawing, so a 914 mm (36 in) TIFF can be printed on a 914 mm (36 in) roll of paper without being put on hold. However, if there is no white space already included in the drawing's borders, some contents could be clipped because of the margins.



NOTE: If you choose the option **Match exact size**, your job will be printed only on paper whose width exactly matches the width of the job.

The printer displays out of paper when paper is available

If the roll has become loose from its core, it will not feed correctly and the printer will not load the paper. If possible, tighten the paper to its core or load a new roll.

The print remains in the printer after printing has completed

The printer holds the paper to allow the print to dry after printing. If a sheet of paper is only partially ejected after the drying time, gently pull it out of the printer.

The cutter does not cut well

By default, the printer is set to cut the paper automatically after each job.

If the cutter is turned on but not cutting correctly, check that the cutter rail is clean and clear of any obstacles.

Even if the cutter is set to Off, the printer will still cut while:

- Switching from Roll 1 to Roll 2 or viceversa
- Switching the output from Stacker to Basket, and viceversa

If the cutter is not cutting, check that the carriage engages properly with the cutter actuator in order to activate it.

- Launch printhead replacement.
- Power of the printer with the rear power switch when the carriage is in the middle of the printer.
- At this point, the cutter should be activated.
- Move the carriage manually to the service station side end to disengage the cutter.
- Move the carriage manually to the Front panel side end to engage it again.
- Notice the noise made by the engagement/disengagement, and also that the carriage friction is higher when the cutter is engaged.

- Finally, move the carriage manually to the service station side end to disengage the cutter.
- Power on the printer.

Finally, if code SE86:01 appears while cutting, it may be required to manually readjust the Encoder Strip and move it up slightly.

The roll is loose on the spindle

The roll may need to be replaced or reloaded.

The roll is unloaded unexpectedly

In the cases below an excess of friction is causing a malfunction in the media input which causes the media roll to unload unexpectedly.

One of the main causes of friction is that the sides of the paper are brushing against the hubs for different possible reasons, such as:

- Media has expanded due to climatic conditions (for example, switching off Air Conditioning).
- Poor quality media with telescoping, core is narrower than media.

Call agent:

1. Ask customer if the issue has happened while printing. If so, refer to [39.11:01 Media unloaded \(Advisory\) on page 138](#) troubleshooting.
2. Upgrade the printer to the latest firmware.
3. Ask customer to open roll cover and feed media into the media path.
 - a. Check if the sides of the media roll are brushing against the hubs. If they are, tell customer to reposition the media roll on the spindle ensuring some margin ($\approx 3\text{mm}$) between the sides of the media and the black and blue hubs and check that it does not brush against the hubs anymore. If this is not the case, continue troubleshooting as below.
 - b. Visually check that the hubs (black and blue pieces) are not broken. If they are damaged, send a new spindle to the customer.

Ink supply problems

- [Cannot insert an ink cartridge](#)
- [Ink cartridge status messages](#)
- [Problems during insertion](#)
- [Clean the printhead](#)
- [Align the printhead](#)
- [Printhead status messages](#)
- [Printhead 727 Error codes](#)

Cannot insert an ink cartridge

1. Check that you have the correct type of cartridge (model number).
2. Check that the colored label on the cartridge is the same color as the label on the slot.
3. Check that the cartridge is correctly oriented, with the letter or letters marking the cartridge label right-side up and readable.

 **CAUTION:** Never clean inside the ink cartridge slots.

Ink cartridge status messages

These are the possible ink cartridge status messages:

- **OK:** The cartridge is working normally, with no known problems.
- **Missing:** There is no cartridge present, or it is not correctly connected to the printer.
- **Low:** The ink level is low.
- **Very low:** The ink level is very low.
- **Empty:** The cartridge is empty.
- **Reseat:** You are recommended to remove the cartridge and then reinsert it.
- **Replace:** You are recommended to replace the cartridge with a new cartridge.
- **Expired:** It is past the cartridge's expiration date.
- **Incorrect:** The cartridge is not compatible with this printer. The message includes a list of compatible cartridges.
- **Non-HP:** The cartridge is used, refilled, or counterfeit.
- **Not Valid:** If the printer doesn't have enough ink to perform an operation, it will display the front panel message "Not Valid For Operation". In order to remove the message, a cartridge containing more ink is needed.

Problems during insertion

At installation

 **NOTE:** To better understand the start up process, see [HP 727 Printhead Start-up process on page 28](#).

Prerequisites: Before starting any troubleshooting, do the following:


1. Ensure the latest firmware is installed in the printer. If you need to update the firmware, download the latest version from www.hp.com/go/T1500/software.
2. Download the Service plot (this helps to check for error codes and ink levels).
3. Make sure there is enough ink to start up the printhead (40cc for matte black (mK) and 30cc for other inks; for a tubes purge - 60cc for each color). Ink levels can be checked in the service plot. If in doubt, use 130ml cartridges.
4. Ensure that septum is gently moisturized (see below)

The tube connectors can be lubricated by moistening with water to help with the insertion of the printhead. This can be done as follows:


- a. Moisten a soft cotton bud with Water or PEG.




- b. Open the carriage latch completely.

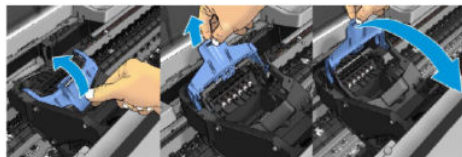

- c. Use the wet cotton bud to moisten the septum.

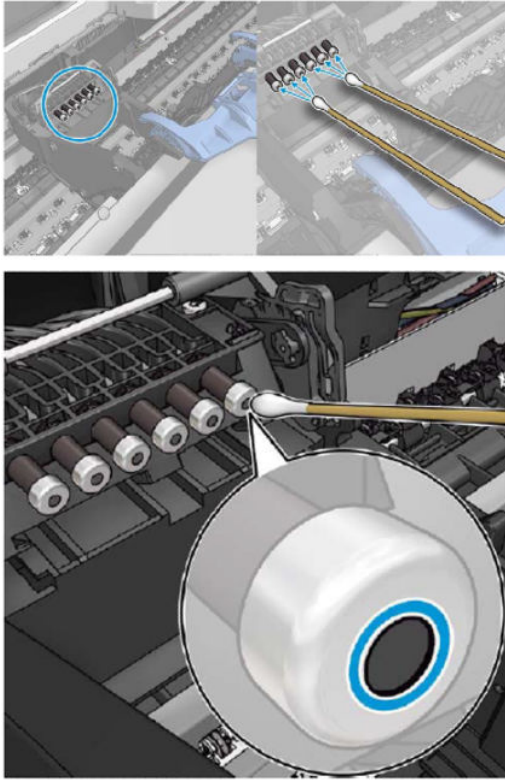

- d. Close latch. If necessary, push against the rear side of the carriage to ensure it is properly closed.

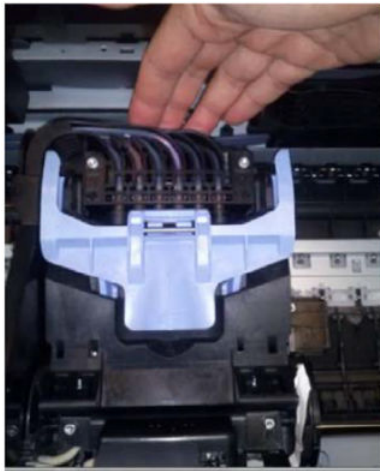


The carriage latch is not closed properly


The carriage appears to be closed, but the blue latch sticks up a little and does not stay flat.

How to check:


- ▲ Ensure that:
 - a. The carriage latch is properly engaged.

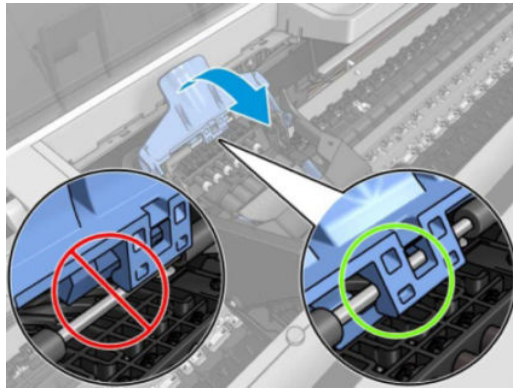

- b. The latch is completely down.

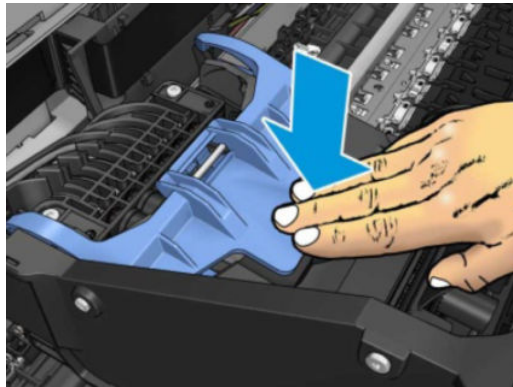

If these two conditions are not met, printhead installation may fail and/or some tubes may not be filled with ink.

 **NOTE:** If the carriage is open, it will be detected by the printer and the customer will be asked to try to close it again. However, if the carriage is not closed and the printer is powered off, there is a risk that, after booting up, the printer will raise service system error 86:01. In this case, turn the printer off again, close the carriage (removing the printhead, if necessary), and then move the printhead to the Service Station. Finally boot up the printer again.

Root Cause

Incorrect printhead insertion can cause errors because of insufficient lubrication or the latch not engaging properly.

Corrective actions:

1. Perform Prerequisites (Firmware upgrade, moisturize septums).
2. Check that you have the correct type of printhead (model number).
3. Check that the printhead is correctly oriented.
4. Check that you have correctly closed and latched the printhead cover.

The front panel display recommends reseating the printhead after insertion and no tubes start to fill (tubes are empty)

The printer brings the printhead to the Service Station and rejects it immediately.

1. Perform Prerequisites (Firmware upgrade, moisturize septums).
2. Send/Bring a set of ink supplies plus PHA.
3. Check Printhead errors:

How to check:


When a reseal message appears, the printer will show a printhead error on the Front Panel.

The printer has not yet started to pump ink into the tubes.

Check the Printhead error code

- On the Front Panel check the Printhead “status”:

Go to Main Menu — Printhead — Printhead information.

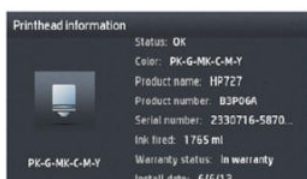

- From EWS:

Generate the Service plot. Go to the Embedded Web Server: Support tab -> Service support -> Printer information. This will open a new page. Select the All pages tab. Download this page or print it to a PDF file.



Printhead error related to RESEAT:

Status code (dec)	Status code (hex)	Status name	User reported status	Description on printer HW	Test	Troubleshooting
0	0x0	WORKING	OK	The pen is working properly	All	-
2	0x2	FAILS_CONTINUITY	RESEAT		Pen ID programming and pen continuity	Trailing cable/ PSU/ E-box
4	0x4	SHUTDOWN	-	Not used	NA	Trailing cable/ PSU/ E-box
32	0x20	TEMP_EXTREMELY_LO W	RESEAT	The temperature of the pen is below the normal margins	Thermal runtime tests	PHA Replace

Status code (dec)	Status code (hex)	Status name	User reported status	Description on printer HW	Test	Troubleshooting
128	0x80	TEMP_TOO_LOW	RESEAT	The temperature of the pen is below the normal margins	Thermal runtime tests	PHA Replace
8192	0x2000	CSDATA_NOT_RESPONDING	RESEAT	The CSDATA communication fails	Pen ID programming	Trailing/PHA
16384	0x4000	CSDATA_TRANSMITTER_ERROR	RESEAT	The CSDATA communication is erroneous	Every pen communication	Trailing/PHA

4. If the printhead shows Reseat error code (0x00002, 0x02000, 0x04000...)

Root Cause

- If the printer rejects the printhead before even trying to initiate tube purging, it can indicate that the printer does not recognize the printhead. This may also cause a 0x00002 printhead Error Code to be shown on the Front Panel.
- The printer is not able to communicate with the printhead.
- Other issues.

Corrective action

- Reseat the same printhead and try again. Follow Front Panel instructions. Do not stop the servicing routines, allow the printhead to be initialized.
- If it fails replace it with a new PHA and follow Front Panel instructions.
- Try 2 times more with the new PHA.
- If the reseat message continues to appear, check the carriage PCA using the Carriage test in the diagnostic menu. Replace carriage PCA if needed.

5. If there is no Printhead error shown on the Front Panel or EWS

Root Cause

- Unknown.

Corrective action

- Reseat the same printhead and try again. Follow Front Panel instructions.

After this process it may end on a PH reseat with a PHA error (see step 4 in [Check the Printhead error code on page 74](#)) or in a Printhead replacement (see [The front panel display shows “PH replacement not complete” on page 75](#)).

The front panel display shows “PH replacement not complete”

The printhead is rejected and some ink tubes are not filled: Yellow and Matte Black are missing, or Cyan, Magenta, Gray, and Photo Black are missing.

1. Perform Prerequisites (Firmware upgrade, moisturize septums).

2. For Printers prior to May 2014 (for T3500 go to 3.3).


Visually check if there are empty tubes:

- a. Open the carriage.
- b. Check the end of the tubes. They should appear as shown in the picture below. The rest of the ink circuit can be checked for bubbles and ink. When the tubes are empty, they will have a bluish color. When filled, the tubes will look darker and the yellow channel will have a slight magenta color (due to the combination of ink color and tube color).

Filled tubes:



Empty tubes:

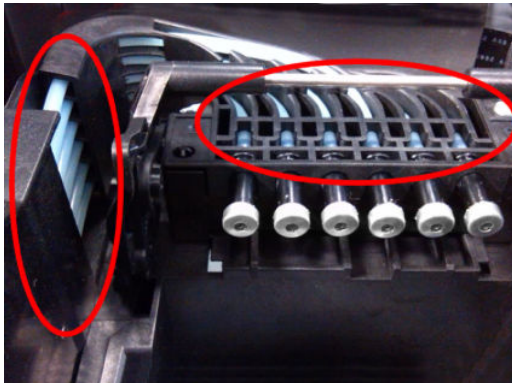


Root Cause

- There are two primer channels. Yellow and Matte Black share one primer channel. Cyan, Magenta, Gray, and Photo Black share the other primer channel. If one primer fails, one of the groups might not get filled.
- There are 2 Ink Supply Stations, If the missing colors are grouped as they are in the Ink Supply Station, this issue can be related to that part of the printer.

Corrective action

- Run the primer test to check if the primer is working. If it fails, replace the primer.
- Run the “Ink Delivery System diagnostic” to check the status of the Ink Supply Station . If it fails, replace the corresponding ISS.
- Also, ensure that the ink tube connectors are properly lubricated.

- Run a tube purge to fill all the tubes, including the missing color.
- To purge the tubes, first remove all supplies (ink and printhead). Then run “Purge tubes” from the service utilities. Re-insert the inks and printhead, as requested.

 **NOTE:** If a cartridge is inserted and the ink tube is not filled, the printer can potentially mark the cartridge as “Out Of Ink”. To prevent this from happening, do not install cartridges when some tubes are empty.

3. For Printers after May 2014 (firmware MRY_02_00_05.6 and later)

In then firmware of those printers, new error codes have been included to simplify diagnosticability of PHA replacement root cause: Filling SE codes (looking at those SE in the service plot avoids the need to visually check the ink tubes).

- a. Generate the Service plot since the SE93.x.n:10 are not show in the front panel. Go to the Embedded Web Server: Support tab -> Service support -> Printer information. This will open a new page. Select the All pages tab. Download this page or print it to a PDF file.

SE 93.0.n:10 During the tube filling, the first check of ink pressure for color n failed. If no SE 93.2.n:10 appears, it means that the issue was fixed after the customer reseated the printhead.

SE 93.2.n:10 After reseating the printhead, the second check of ink pressure for color n failed. This means that color n in the printhead may not be filled with ink or that the ink tube is leaking.

SE 93.1.n:10 During the tube filling, the first check of temperature for color n during the printhead spit test failed. If no SE 93.3.n:10 appears, it means that the issue was fixed after the customer reseated the printhead.

SE 93.3.n:10 During the tube filling and after reseating the printhead, the second check of temperature for color n during the printhead spit test failed. This means that color n in the printhead is not filled with ink.

n indicates the color at fault:

- n=0 stands for photo black
- n=1 stands for gray
- n=2 stands for matte black
- n=3 stands for cyan
- n=4 stands for magenta
- n=5 stands for yellow.

- b. Service plot shows the following SE:

- SE 93.1.0:10
- SE 93.1.1:10
- SE 93.1.3:10
- SE 93.1.4:10
- SE 93.3.0:10
- SE 93.3.1:10

- SE 93.3.3:10
- SE 93.3.4:10

Root Cause

- Upper primer than manages 4 ink tubes(Cyan/Magenta/Gray/Photo black)is failing, therefore, those tubes are not completely filled.

Corrective action

- Replace upper primer.
- Run the “Ink Delivery System diagnostic” to check the status of the Ink Supply Station . If it fails, replace the corresponding ISS.
- Also, ensure that the ink tube connectors are properly lubricated.
- Run a tube purge to fill all the tubes, including the missing color.
- To purge the tubes, first remove all supplies (ink and printhead). Then run “Purge tubes” from the service utilities. Re-insert the inks and printhead, as requested.

c. Service plot shows the following SE:

- SE 93.1.2:10
- SE 93.1.5:10
- SE 93.3.2:10
- SE 93.3.5:10

Root Cause

- Lower primer than manages 2 ink tubes (Yellow and Matte Black) is failing, therefore, those tubes are not completely filled.

Corrective action

- Replace lower primer.
- Run the “Ink Delivery System diagnostic” to check the status of the Ink Supply Station . If it fails, replace the corresponding ISS.
- Also, ensure that the ink tube connectors are properly lubricated.
- Run a tube purge to fill all the tubes.
- To purge the tubes, first remove all supplies (ink and printhead). Then run “Purge tubes” from the service utilities. Re-insert the inks and printhead, as requested.

d. Service plot shows the following SE:

- SE 93.1.0:10
- SE 93.1.1:10
- SE 93.1.2:10
- SE 93.3.0:10

- SE 93.3.1:10
- SE 93.3.2:10

Root Cause

- Service Station Side Ink Supply Station than manages 3 ink tubes (Gray/Photo black /Matte black) is failing, therefore, those tubes are not completely filled.

Corrective action

- Replace Service Station Side Ink supply Station
- Also, ensure that the ink tube connectors are properly lubricated.
- Run a tube purge to fill all the tubes.

To purge the tubes, first remove all supplies (ink and printhead). Then run “Purge tubes” from the service utilities. Re-insert the inks and printhead, as requested.

e. Service plot shows the following SE:

- SE 93.1.3:10
- SE 93.1.4:10
- SE 93.1.5:10
- SE 93.3.3:10
- SE 93.3.4:10
- SE 93.3.5:10

Root Cause

- Front Panel Side Ink Supply Station than manages 3 ink tubes(Cyan/Magenta/Yellow)is failing, therefore, those tubes are not completely filled.

Corrective action

- Replace Front Panel Side Ink supply Station
- Also, ensure that the ink tube connectors are properly lubricated.
- Run a tube purge to fill all the tubes.

To purge the tubes, first remove all supplies (ink and printhead). Then run “Purge tubes” from the service utilities. Re-insert the inks and printhead, as requested.

f. Service plot shows one or several 93.x.n:10 SE:

- If multiple colors are missing, there will be both a SE 93.1.n:10 and SE 93.3.n:10 for each missing color.
- If only a SE 93.1.n:10 appears, it means that the color failed to be filled during the first attempt, but the printer auto recovery was able to fully fill the printhead.

Root Cause

- Any of the aforementioned root causes may apply.

Corrective action

- Test the primer and Ink Supply Station. Ensure the ink tube connectors are properly lubricated.
- Run a tube purge to fill all the tubes.

To purge the tubes, first remove all supplies (ink and printhead). Then run “Purge tubes” from the service utilities. Re-insert the inks and printhead, as requested.



NOTE: If a cartridge is inserted and the ink tube is not filled, the printer can potentially mark the cartridge as “Out Of Ink”. To prevent this from happening, do not install cartridges when some tubes are empty.

The printer rebooted during the start-up; printhead initialization took a long time and was then canceled

Root cause

- Printhead issue.
- Incorrect error message from drop detection that causes the printer to carry out additional servicing routines.
- Other issues.

Corrective action

- Do not stop the servicing routines, allow the printhead to be initialized.
- If, after the start-up, the image quality is poor, carry out the usual image quality troubleshooting.
- If at the moment of interruption (System Error or user intervention) the tubes were already filled, try to re-install the printhead.
- If at the moment of interruption (System Error or user intervention) the tubes weren't fully loaded yet, try to launch a Tube Purge from the Service Menu.

During Usage

During normal usage, any Printhead reseal or replacement should imply sending a new PHA.

The printhead shows an Error Code 0x00010 or 0x00040

The printhead shows an Error Code 0x00010 or 0x00040.

Root Cause

The nozzle area is overheating. This can be due to air present in the nozzle area of the printhead.

Corrective action

Check that the ink tubes are filled and have no air bubbles. Run manual printhead cleaning to try to restore the printhead. Ultimately, replace the printhead if needed.

All ink tubes are filled, but the printer requests a random printhead reseal

Root Cause

To analyze the root cause, check the printhead Error Code in the table at the end of this document.

Corrective action

The printhead reset issue can be solved by simply removing and reinstalling the printhead. If, after the reset, the error message continues, try a new printhead. If the reset message continues to appear, check the carriage PCA using the Carriage test in the diagnostic menu.

During printer installation troubleshooting, the printer asks if the printhead to be used is “New” or “Reused”

Root Cause



Depending on the situation, when trying to replace the printhead with a new one, the printer can ask if the printhead that is going to be used is “New” or “Reused”. For instance, this can happen when the ink tubes are filled, but the printhead installation fails during the servicing routines.

Corrective action

If doing a reset of the old printhead, the “Reused” option should be selected. The “New” option should only be selected if the printhead that is going to be used needs to be filled with ink. When “New” is selected, the printer will check if there is enough ink to run the new printhead installation. If there is not enough ink, the printer will only carry out the servicing routines to prepare the printhead.

Clean the printhead

As long as the printer is kept turned on, automatic cleaning is performed periodically. This ensures there is fresh ink in the nozzles and prevents nozzle clogs, thus preserving print quality. If you have print quality problems, please see [Print-quality problems on page 84](#) before proceeding.

To clean the printhead, go to the front panel and press , then , then **Image Quality Maintenance > Clean printhead**, and select the color group including the color that needs cleaning (**Clean all, Clean MK-Y, Clean C-M-PK-G**).


Align the printhead


Precise printhead alignment is essential for accurate colors, smooth color transitions, and sharp edges in graphical elements. Your printer has an automatic printhead alignment process which runs whenever the printhead has been accessed or replaced.

You may need to align the printhead after a paper jam or if you are experiencing print-quality problems.

1. Load the paper you wish to use. You can use a roll or a cut sheet; plain white paper is recommended.

 **CAUTION:** Do not use transparent or semi-transparent paper to align the printhead.

2. Ensure that the window is closed, as a strong light source near the printer during printhead realignment can affect alignment.
3. From the front panel, press , then **Image Quality Maintenance > Align printhead**.

 **NOTE:** Printhead alignment can also be started from the Embedded Web Server (**Support > Print Quality Troubleshooting**), or from the HP Utility (Windows: **Support > Print Quality Troubleshooting**; Mac OS X: **Information and Print Quality > Align**).

4. If the loaded paper is satisfactory, the printer runs the realignment and prints a realignment pattern.
5. The process takes about five minutes. Wait until the front panel display shows the process complete before using the printer.

If the printer cannot complete the printhead alignment successfully, you may be asked to clean the printhead and try again.

Printhead status messages

These are the possible printhead status messages:

- **OK:** The printhead is working normally, with no known problems
- **Missing:** There is no printhead present, or it is not correctly installed in the printer.
- **Reseat:** You are recommended to remove the printhead and then reinsert it. If that fails, clean the electrical connections. If that fails, replace the printhead with a new one.
- **Replace:** The printhead is failing. Replace the printhead with a working one.
- **Replacement incomplete:** The printhead replacement process has not completed successfully; re-launch the replacement process and let it finish completely.
- **Remove:** The printhead is not a suitable type for use in printing.
- **Non-HP ink:** Ink from a used, refilled, or counterfeit ink cartridge has passed through the printhead. See the limited warranty document provided with your printer for details of the warranty implications.

Printhead 727 Error codes


How to check the printhead error code:

- Generate the Service plot. Go to the Embedded Web Server: **Support tab > Service support > Printer information**. This will open a new page. Select the All pages tab. Download this page or print it to a PDF file.

Current Printhead Kit Info (I)				
	Warranty status	Status	Error ID Code	Product Number
1 - Photo black-Gray-Matte black-Cyan-Magenta-Yellow	In warranty	OK	0	B3P06A

Current Printhead Kit Info (II)				
	Product Name	Serial Number	Install Date	Warranty Date
1 - Photo black-Gray-Matte black-Cyan-Magenta-Yellow	HP 727	2330716-5870420W	2013-06-06	20140322

- Alternatively, check the printhead “Status” in the Front Panel.

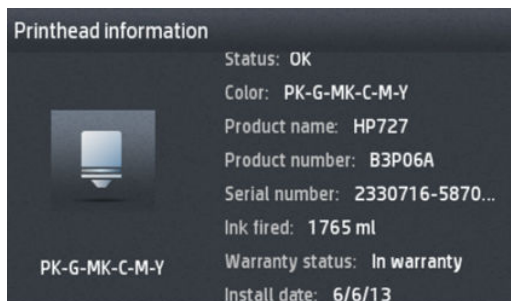

Printhead 727 error codes:

The following table lists the potential error codes reported by the printer:

Status / Failure mode	Action reported to user	Service Support / Printer Information Code by EWS	Printhead Information by Control Panel	Description
WORKING	OK	0	0x00000	The pen is working properly
FAILS_LOGICAL_V	RESEAT	1	0x00001	Under-voltage, over-voltage or ink shortage detected in Vcc (5V)
FAILS_CONTINUITY	RESEAT	2	0x00002	Failed pen ID programming or pen continuity tests
SHUTDOWN	REPLACE	4	0x00004	CsData fault, printhead clock or temperature error
FAILS_VPP	RESEAT	8	0x00008	Under-voltage, over-voltage, leakage or ink shortage detected in Vpp or VppLogic
TEMP_EXTREMELY_HIGH	REPLACE	16	0x00010	The temperature of the pen is beyond maximum margin
TEMP_EXTREMELY_LOW	REPLACE	32	0x00020	The temperature of the pen is under minimum margin
TEMP_TOO_HIGH	RESEAT	64	0x00040	The temperature of the pen has been above the normal margins for too long
TEMP_TOO_LOW	RESEAT	128	0x00080	The temperature of the pen has been below the normal margins for too long
BAD_ACUMEN_INFO	REPLACE	256	0x00100	Parity error on printhead bits
NO_PEN	MISSING	512	0x00200	There is no pen detected
BAD_ACUMEN_ACCESS	RESEAT	1024	0x00400	Error while reading or writing printhead bits
WRONG_MODEL	REMOVE	2048	0x00800	The model inserted is not the model required by the printer
MISMATCH	REMOVE	4096	0x01000	The color or the printhead version is not in the required slot
CSDATA_NOT_RESPONDING	RESEAT	8192	0x02000	The CSDATA communication failed
CSDATA_TRANSMIT_ERROR	RESEAT	16384	0x04000	The CSDATA communication failed
EXPIRED_WARRANTY	—	524288	0x80000	The printhead is ok but failed the warranty validation

Print-quality problems

- [General advice](#)
- [Print-quality troubleshooting wizard](#)
- [Recalibrate the paper advance](#)
- [Horizontal lines across the image \(banding\)](#)
- [Lines are too thick, too thin or missing](#)
- [Lines appear stepped or jagged](#)
- [Lines print double or in the wrong colors](#)
- [Lines are discontinuous](#)
- [Lines are blurred](#)
- [Line lengths are inaccurate](#)
- [The whole image is blurry or grainy](#)
- [The paper is not flat](#)
- [The print is scuffed or scratched](#)
- [Ink marks on the paper](#)
- [Black ink comes off when you touch the print](#)
- [Edges of objects are stepped or not sharp](#)
- [Edges of objects are darker than expected](#)
- [Horizontal lines at the end of a cut sheet print](#)
- [Vertical bands of different colors](#)
- [White spots on the print](#)
- [Colors are inaccurate](#)
- [Colors are fading](#)
- [The image is incomplete \(clipped at the bottom\)](#)
- [The image is clipped](#)
- [Some objects are missing from the printed image](#)
- [A PDF file is clipped or objects are missing](#)
- [Avoiding the stretching of printouts in Solidworks and HPGL2 drivers](#)
- [The Image Diagnostics Print](#)
- [Product Limitations](#)
- [If you still have a problem](#)

General advice

When you have any print-quality problem:

- To achieve the best performance from your printer, use only genuine manufacturer's supplies and accessories, whose reliability and performance have been thoroughly tested to give trouble-free performance and best-quality prints. For details of recommended papers, see users guide.
- Make sure that the paper type selected in the front panel is the same as the paper type loaded into the printer (see users guide). At the same time, check that the paper type has been calibrated. Also make sure that the paper type selected in your software is the same as the paper type loaded into the printer.

⚠ CAUTION: If you have the wrong paper type selected, you could experience poor print quality and incorrect colors, and perhaps even damage to the printhead.

- Check that you are using the most appropriate print-quality settings for your purposes (see users guide). You are likely to see lower print quality if you have moved the print-quality slider to the 'Speed' end of the scale, or set the custom quality level to **Fast**.
- Check that your environmental conditions (temperature, humidity) are in the recommended range. See users guide.
- Check that your ink cartridges and printhead have not passed their expiration dates: see users guide.



For the latest information, please visit <http://www.hp.com/go/T920/support> or <http://www.hp.com/go/T1500/support>.

Print-quality troubleshooting wizard

The print-quality troubleshooting wizard can help with the following problems:

- Horizontal lines across the image (banding)
- The whole image is blurry or grainy
- Lines are too thick, too thin or missing
- Colors are inaccurate

To start the wizard:



- **From the HP Designjet Utility for Windows:** Go to the **Support** tab, and select **Print Quality Toolbox**.
- **From the HP Utility for Mac OS X:** Select **Print quality troubleshooting** in the Support group.
- **From the Embedded Web Server:** Go to the **Support** tab, then select **Print quality troubleshooting**.
- **From the front panel:** Press , then , then **Image quality maintenance**.

Alternatively, or if you have other print-quality problems, you can continue reading this chapter.


Recalibrate the paper advance




Accurate paper advance is important to image quality because it is part of controlling the proper placement of dots on the paper. If the paper is not advanced the proper distance between printhead passes, light or dark bands appear in the print and image grain may increase.

The printer is calibrated to advance correctly with all the papers appearing in the front panel. When you select the type of loaded paper, the printer adjusts the rate at which to advance the paper while printing. However, if you are not satisfied with the default calibration of your paper, you may need to recalibrate the rate at which the paper advances. See users guide for steps to determine if paper advance calibration will solve your issue.



You can check the paper advance calibration status of the currently loaded paper at any time from the front panel. Press , then , then **Image quality maintenance > Calibration status**. The status may be one of the following.


- **DEFAULT:** This status appears when loading any paper that has not been calibrated. HP papers in the Front Panel have been optimized by default and unless you experience image quality problems in your printed image such as banding or graininess it is not recommended to recalibrate the paper advance.
- **OK:** This status indicates that the loaded paper has been calibrated before. However you may need to repeat the calibration if you experience image quality problems such as banding or graininess in your printed image.

 **NOTE:** Whenever you update the printer's firmware, the paper advance calibration values are reset to factory default, see users guide.



 **CAUTION:** Transparent papers and films must be calibrated by pressing , then , then **Image quality maintenance > Paper advance calibration > Adjust paper advance**, from step four in Recalibrating the paper advance procedure.

Recalibrating the paper advance procedure


1. From the front panel, press , then , then **Image quality maintenance > Paper advance calibration > Calibrate paper advance**. The printer automatically recalibrates the paper advance and prints a paper advance calibration image, which you can send to stacker or basket.
2. Wait until the front panel displays the status screen, then reprint your print.

 **NOTE:** The recalibration procedure takes a few minutes. Do not worry about the paper advance calibration image. The front-panel display shows any errors in the process.


If you are satisfied with your print continue using this calibration for your paper type. If you see improvement in your print, continue with step three. If you are dissatisfied with the recalibration, return to the default calibration, see [Return to default calibration on page 87](#).

3. If you would like to fine-tune the calibration or are using a transparent paper, press , then , then **Image quality maintenance > Paper advance calibration > Adjust paper advance**.

4. Select the percentage of change from -100% to +100%. To correct light banding, decrease the percentage.

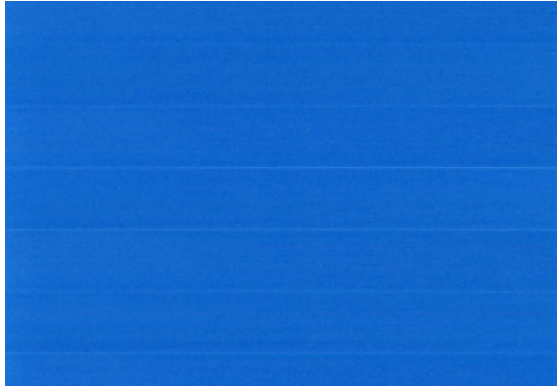

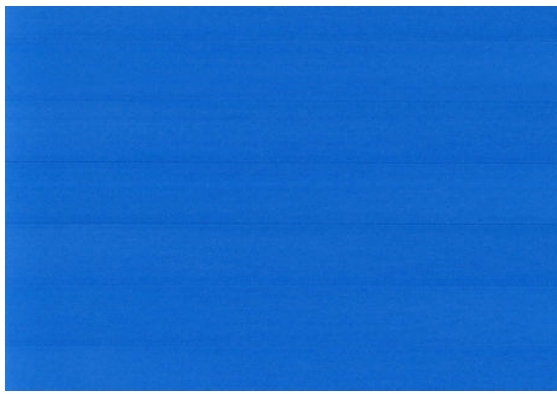

To correct dark banding, increase the percentage.



5. Press **OK** on the front panel, to save the value.
6. Wait until the front panel displays the status screen and reprint your print.

Return to default calibration



Returning to the default calibration sets all the corrections made by the paper advance calibration to zero. To return to the default paper advance calibration value, you must reset the calibration.

1. From the front panel, press , then , then **Image quality maintenance > Paper advance calibration > Reset paper advance**.
2. Wait until the front panel displays the operation has completed successfully.

Horizontal lines across the image (banding)

If your printed image suffers from added horizontal lines as shown (the color may vary):



1. Check that the paper type you have loaded corresponds to the paper type selected in the front panel and in your software. See users guide.
2. Check that you are using appropriate print-quality settings for your purposes (see users guide). In some cases, you can overcome a print-quality problem merely by selecting a higher print-quality level. For instance, if you have set the Print Quality slider to **Speed**, try setting it to **Quality**. If you change the print-quality settings, you may wish to reprint your job at this point in case the problem has been solved.
3. Print the Image Diagnostics Print. See [The Image Diagnostics Print on page 98](#).
4. If the printhead is working correctly, go to the front panel and press , then , then **Image quality maintenance** > **Calibration status** to see the paper advance calibration status. If the status is DEFAULT, try performing paper advance calibration: see [Recalibrate the paper advance on page 85](#).


In case you are using rolls with 3-in core adaptors:





1. Check that the roll core is not damaged.
2. Make sure that the 3-in adaptor is correctly attached to the spindle.
3. Print using Roll 1 for better performance.
4. Print in a higher quality/slower mode.
5. If horizontal banding is only showing in the laterals of the media, check that the 3-in. adaptors are positioned so that the spring of the black hub and the blue hub are aligned:

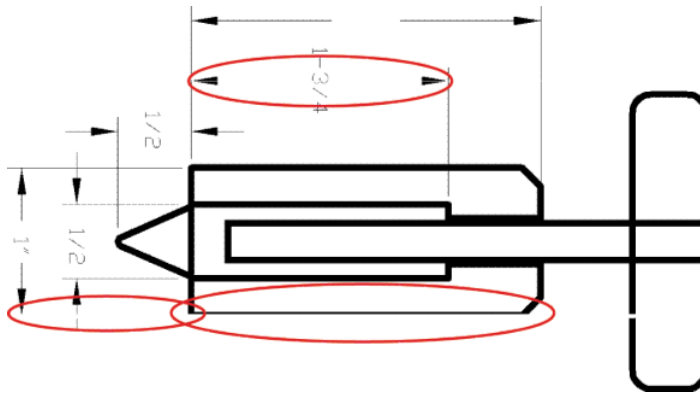

If the problem persists despite all the above actions, contact your customer service representative for further support.

Lines are too thick, too thin or missing




1. Check that the paper type you have loaded corresponds to the paper type selected in the front panel and in your software. See users guide.
2. Check that you are using appropriate print-quality settings for your purposes (see users guide). If printing on photo paper, select the custom print-quality options in the driver dialog, and try turning on the **Maximum detail** option (if available). You may wish to reprint your job at this point in case the problem has been solved.
3. If the resolution of your image is greater than the printing resolution, you may notice a loss of line quality. If you are using the PCL3GUI or the HP-GL/2 driver for Windows, you can find the **Max. Application Resolution** option in the driver dialog's **Advanced** tab, under **Document Options > Printer Features**. If you change this option, you may wish to reprint your job at this point in case the problem has been solved.
4. When printing on uncoated paper in Fast mode, try loading the paper as Bright Bond.
5. If the problem remains, go to the front panel and press , then , then **Image quality maintenance > Align printhead** to see the printhead alignment status. If the status is PENDING, you should align the printhead. See [Align the printhead on page 81](#). After alignment, you may wish to reprint your job in case the problem has been solved.
6. Go to the front panel and press , then , then **Image quality maintenance > Calibration status** to see the paper advance calibration status. If the status is DEFAULT, you should perform paper advance calibration: see [Recalibrate the paper advance on page 85](#).
7. If lines are too thin or missing, print the Image Diagnostics Print. See [The Image Diagnostics Print on page 98](#).

If the problem persists despite all the above actions, contact your customer service representative for further support.

Lines appear stepped or jagged

If lines in your image appear stepped or jagged when printed:

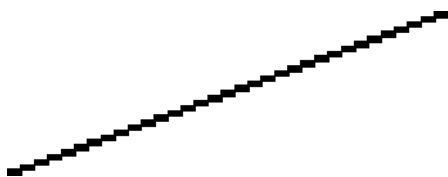


1. The problem may be inherent in the image. Try to improve the image with the application you are using to edit it.
2. Check that you are using appropriate print-quality settings. See users guide.
3. Select the custom print-quality options in the driver dialog, and turn on the **Maximum detail** option (if available).


Lines print double or in the wrong colors

This problem can have various visible symptoms:

- Colored lines are printed double, in different colors.

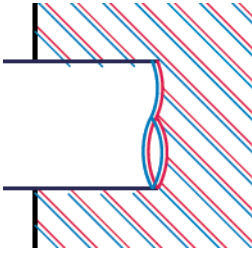

- The borders of colored blocks are wrongly colored.

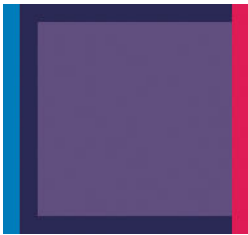

To correct this kind of problem:

1. Align the printhead. See [Align the printhead on page 81](#).
2. Reseat the printhead by removing and then reinserting it. See users guide.

Lines are discontinuous

If your lines are broken in the following way:



1. Check that you are using appropriate print-quality settings. See users guide.
2. When printing on uncoated paper in Fast mode, try loading the paper as Bright Bond.

3. Align the printhead. See [Align the printhead on page 81](#).
4. Reseat the printhead by removing and then reinserting it. See users guide.

Lines are blurred



Humidity can cause ink to soak into the paper, making the lines blurred and fuzzy. Try the following:

1. Check that your environmental conditions (temperature, humidity) are suitable for high-quality printing. See users guide.
2. Check that the paper type selected in the front panel is the same as the paper type you are using. See users guide.
3. Try changing to a heavier paper type, such as HP Heavyweight Coated Paper or HP Super Heavyweight Plus Matte Paper.
4. Select a paper type that is slightly thinner than the paper you have loaded; this will persuade the printer to use less ink. Here are some example paper types in ascending order of thickness: Plain Paper, Coated Paper, Heavyweight Coated Paper, Super Heavyweight Plus Matte Paper.
5. If you are using photo paper, try changing to a different type of photo paper.
6. Align the printhead. See [Align the printhead on page 81](#).





Line lengths are inaccurate

If you have measured your printed lines and find that the lengths are not sufficiently accurate for your purposes, you can try to improve line length accuracy in the following ways.

1. Print on HP Matte Film, for which your printer's line length accuracy is specified. See users guide.
Polyester film is about ten times more dimensionally stable than paper. However, using film that is thinner or thicker than HP Matte Film will reduce line length accuracy.
2. Set the Print Quality slider to **Quality**.
3. Maintain the room at a steady temperature between 10 and 30°C (50 and 86°F).
4. Load the roll of film and let it rest for five minutes before printing.
5. If you are still not satisfied, try recalibrating the paper advance. See [Recalibrate the paper advance on page 85](#).

The whole image is blurry or grainy



1. Check that the paper type you have loaded corresponds to the paper type selected in the front panel and in your software. See users guide.
2. Check that you are printing on the correct side of the paper.
3. Check that you are using appropriate print-quality settings (see users guide). In some cases, you can overcome a print-quality problem merely by selecting a higher print-quality level. For instance, if you have set the Print Quality slider to **Speed**, try setting it to **Quality**. If you change the print-quality settings, you may wish to reprint your job at this point in case the problem has been solved.
4. Go to the front panel and press , then , then **Image quality maintenance** > **Calibration status** to see the printhead alignment status. If the status is PENDING, you should align the printhead. See [Align the printhead on page 81](#). After alignment, you may wish to reprint your job in case the problem has been solved.
5. Go to the front panel and press , then , then **Image quality maintenance** > **Calibration status** to see the paper advance calibration status. If the status is DEFAULT, you should perform paper advance calibration: see [Recalibrate the paper advance on page 85](#).

If the problem persists despite all the above actions, contact your customer service representative for further support.

The paper is not flat

If the paper does not lie flat when it comes out of the printer, but has shallow waves in it, you are likely to see defects in the printed image, such as vertical stripes. This can happen when you use thin paper that becomes saturated with ink.



1. Check that the paper type you have loaded corresponds to the paper type selected in the front panel and in your software. See users guide.
2. Try changing to a thicker paper type, such as HP Heavyweight Coated Paper or HP Super Heavyweight Plus Matte Paper.
3. Select a paper type that is slightly thinner than the paper you have loaded; this will persuade the printer to use less ink. Here are some example paper types in ascending order of thickness: Plain Paper, Coated Paper, Heavyweight Coated Paper, Super Heavyweight Plus Matte Paper.
4. If you see horizontal stripes, try printing the same job rotated; this sometimes reduces the visibility of the stripes.

The print is scuffed or scratched

The black ink pigment can be scuffed or scratched when touched by a finger, a pen or some other object. This is particularly noticeable on coated paper.

Photo paper may be extremely sensitive to the basket or to anything else that it contacts soon after printing, depending on the amount of ink used and the environmental conditions at the time of printing.

To reduce the risk of scuffs and scratches:


- Handle prints carefully.
- Catch your prints as they are cut from the roll and do not let them fall into the basket. Alternatively, leave a sheet of paper in the basket so that freshly printed sheets do not make direct contact with the basket.


Ink marks on the paper

This problem can occur for several different reasons.

Horizontal smears on the front of the paper

When a lot of ink is used on a paper-based material, the paper absorbs the ink quickly and expands. If the paper is stiff and curled, near the end of the roll the leading edge of the paper may rise slightly in the print area. As the printhead moves over the paper, it may come into contact with the paper and smear the printed image.

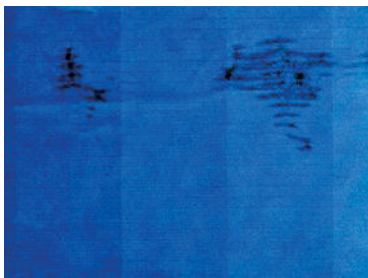

Whenever you notice this problem, cancel the printing job immediately. Press  on the front panel and also cancel the job from your computer application. Soaked paper can damage the printhead.

Try the following suggestions to avoid this problem:

1. Increase the margins by relocating the image to the center of the page, either with your software or with the front panel's **Move Paper** option (see users guide). To prevent such smears most effectively, the distance from the image to the leading edge of the paper should be at least 20 mm (0.8 in).
2. Select a faster print mode: change from Best to Normal, or from Normal to Fast mode.

Other smears on the paper


The following suggestions may be used for all kinds of smears, including those on the front of the paper:

1. Check that the paper type you have loaded corresponds to the paper type selected in the front panel and in your software. See users guide.
2. Use a recommended paper type (see users guide) and the correct print settings.
3. If using sheet paper, try rotating the sheet 90 degrees. The orientation of the paper fibers may affect performance.
4. Try changing to a thicker paper type, such as HP Heavyweight Coated Paper or HP Super Heavyweight Plus Matte Paper.
5. Select a paper type that is slightly thinner than the paper you have loaded; this will persuade the printer to use less ink. Here are some example paper types in ascending order of thickness: Plain Paper, Coated Paper, Heavyweight Coated Paper, Super Heavyweight Plus Matte Paper.

Black ink comes off when you touch the print

This problem may be caused by printing with matte black ink on photo paper. The printer will not use matte black ink if it knows that the paper will not retain it. To be sure of avoiding matte black ink, you can select Photo Gloss Paper as the paper type (in the Photo Paper category).

Edges of objects are stepped or not sharp

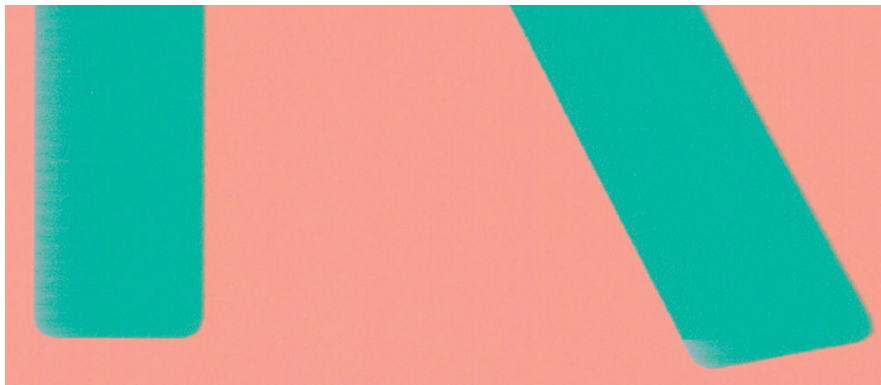

If edges of objects or lines appear to be poorly defined or lighter in density, and you have already set the print-quality slider to **Quality** in the driver dialog, select the custom print-quality options, and try setting the quality level to **Normal**. See users guide.

Edges of objects are darker than expected



If edges of objects seem darker than expected, and you have already set the print-quality slider to **Quality** in the driver dialog, select the custom print-quality options, and try setting the quality level to **Normal**. See users guide.

Horizontal lines at the end of a cut sheet print

This type of defect affects only the end of a print, within approximately 30 mm of the trailing edge of the paper. You may see some very thin horizontal lines across the print.

To avoid this problem:

1. Print the Image Diagnostics Print. See [The Image Diagnostics Print on page 98](#).
2. Consider printing with roll paper.
3. Consider using larger margins around your image.

Vertical bands of different colors

If your print has vertical bands of different colors along it:

1. Try using higher print-quality settings (see users guide). For instance, if you have set the Print Quality slider to **Speed**, try setting it to **Quality**.
2. Try using thicker paper, choosing from the recommended paper types such as HP Heavyweight Coated Paper and HP Super Heavyweight Paper. See users guide.

White spots on the print



You may notice white spots on the print. This is probably due to paper fibers, dust or loose coating material. To avoid this problem:

1. Try cleaning the paper manually with a brush before printing, to remove any loose fibers or particles.
2. Always keep the cover of your printer closed.
3. Protect your paper rolls and sheets by storing them in bags or boxes.

Colors are inaccurate



If the colors of your print do not match your expectations, try the following:

1. Check that the paper type you have loaded corresponds to the paper type selected in the front panel and in your software. See users guide. Also, press , then , then **Image quality maintenance > Calibration status** to check the color calibration status. If the status is PENDING or OBSOLETE, you should

perform color calibration: see users guide. If you have made any changes, you may wish to reprint your job in case the problem has been solved.

2. Check that you are printing on the correct side of the paper.
3. Check that you are using appropriate print-quality settings (see users guide). If you have selected the **Speed** or **Fast** options, you may not get the most accurate colors. If you change the print-quality settings, you may wish to reprint your job at this point in case the problem has been solved.
4. If you are using Application Color Management, check that the color profile you are using corresponds to the selected paper type and print-quality settings. If you have doubts about which color settings to use, see users guide.
5. If the problem consists of color differences between your print and your monitor, please follow the instructions in the “How to calibrate your monitor” section of the HP Color Center. At this point, you may wish to reprint your job in case the problem has been solved.
6. Print the Image Diagnostics Print. See [The Image Diagnostics Print on page 98](#).
7. Try using the color adjustment options to produce the colors you want. See users guide.

If the problem persists despite all the above actions, contact your customer service representative for further support.

Color accuracy using EPS or PDF images in page layout applications

Page layout applications such as Adobe InDesign and QuarkXPress do not support color management of EPS, PDF or grayscale files.


If you have to use such files, try to ensure that the EPS, PDF or grayscale images are already in the same color space that you intend to use later on in Adobe InDesign or QuarkXPress. For instance, if your final goal is to print the job in a press that follows the SWOP standard, convert the image into SWOP when you create it.

Colors are fading

If you print on instant-dry photo paper, your prints will fade rapidly. If you plan to display the prints for more than two weeks, you should laminate them to achieve longer life.

Prints on swellable coated papers will fade much less rapidly. However, lamination will increase the life of prints (depending on the type of lamination) with all paper types. For more information, consult your laminate provider.

The image is incomplete (clipped at the bottom)

- Did you press  before all the data were received by the printer? If so, you have ended the data transmission and will have to print the page again.
- There may be a communications problem between your computer and the printer. Check your network cable.
- Check to make sure that your software settings are correct for your current page size (for example, long-axis prints).
- If you are using network software, make sure it has not timed out.

The image is clipped

Clipping normally indicates a discrepancy between the actual printable area on the loaded paper and the printable area as understood by your software. You can often identify this kind of problem before printing by previewing your print (see users guide).

- Check the actual printable area for the paper size you have loaded.

printable area = paper size – margins
- Check what your software understands to be the printable area (which it may call "printing area" or "imageable area"). For example, some software applications assume standard printable areas that are larger than those used in this printer.
- If you have defined a custom page size with very narrow margins, the printer may impose its own minimal margins, clipping your image slightly. You may want to consider using a larger paper size, or borderless printing (see users guide).
- If your image contains its own margins, you may be able to print it successfully by using the **Clip Contents by Margins** option (see users guide).
- If you are trying to print a very long image on a roll, check that your software is capable of printing an image of that size.
- You may have asked to rotate the page from portrait to landscape on a paper size that is not wide enough.
- If necessary, reduce the size of the image or document in your software application, so it fits between the margins.

There is another possible explanation for a clipped image. Some applications, such as Adobe Photoshop, Adobe Illustrator and CorelDRAW, use an internal 16-bit coordinate system which means that they cannot handle an image of more than 32,768 pixels.



NOTE: An image 32,768 pixels long would print at a length of 1.39 m (54.61 in) if you select Best or Quality in the driver, 2.78 m (109.23 in) if you select Fast, Normal or Speed in the driver.

If you try to print an image larger than this from these applications, the bottom of the image may be clipped. To print the whole image, try these suggestions:

- Try using the PostScript printer driver to print your job, if you have not already tried it.
- The Windows HP-GL/2 driver dialog includes an option called **Max. application resolution**, which enables you to print successfully in this situation. You will not normally need to change the default setting, which is **Auto**. However, you can find the option in the **Advanced** tab, under **Document Options > Printer Features**.
- Save the file in another format, such as TIFF or EPS, and open it with another application.
- Use a RIP to print the file.

Some objects are missing from the printed image

Large quantities of data may be necessary to print a high-quality large-format print job, and in some specific workflows there may be issues that can lead to some objects missing from the output. Here are some suggestions to help you to avoid this problem.

- Try using the PostScript printer driver to print your job, if you have not already tried it.
- Select a smaller page size and scale to the desired final page size in the driver or in the front panel.

- Save the file in another format, such as TIFF or EPS, and open it with another application.
- Use a RIP to print the file.
- Reduce the resolution of bitmap images in your application software.
- Select a lower print quality in order to reduce the resolution of the printed image.



NOTE: If you are working under Mac OS X, not all of these options are available.

These options are suggested for troubleshooting purposes and may adversely affect the final output quality or the time necessary to generate the print job. Therefore, they should be cancelled if they do not help to solve the problem.

A PDF file is clipped or objects are missing

In older versions of Adobe Acrobat or Adobe Reader, large PDF files could be clipped or lose some objects when printing with the HP-GL/2 driver at high resolution. In order to avoid such problems, update your Adobe Acrobat or Adobe Reader software to the latest version. From version 7 onwards, these problems should be solved.

Avoiding the stretching of printouts in Solidworks and HPGL2 drivers

Printing with the High Quality feature enabled can cause printouts to appear stretched; this issue will be solved in future driver releases.

In the meantime, you can avoid the issue by following these steps.



IMPORTANT: It is critical to follow all steps in order.

1. Enter **Driver Properties**.
 - a. Adjust all settings you need to modify from the **Driver's Properties** dialog.
 - b. Click **OK** and do not re-enter to the Driver's Properties again.
2. Enter **Page Setup**.
 - a. Adjust all settings you need to modify from the **Page Setup** dialog. If needed, select the **High Quality** option.
 - b. Click **OK** to close the dialog.
3. Click the **Print** button in order to print the job with the selected settings.



NOTE: After closing the **Page Setup** dialog, do not enter the **Driver's Properties** again; it will cause the printout to stretch.

The Image Diagnostics Print

See [Diagnostics Print on page 207](#).

Product Limitations

This Product limitations review document is designed to highlight and communicate the major product limitations of the HP Designjet T2500/T2530/T3500 Printers. Included are appropriate workarounds (where possible). It is intended for HP internal use only and is subject to change as and when new information is available. It should be treated with the utmost confidentiality, and should not be reproduced and distributed

openly. Its purpose is to serve as an informational document for those who come into direct contact with customers (Sales Force, Marketing Centers, and Technical Support) in order that they can VERBALLY acknowledge the limitations, explain them, and provide the best possible workaround. The limitations described here will only affect some users some of the time.

 **NOTE:** For a complete up to date list of printing related Product limitations; please check the T920/T1500 Product Limitations document.

Scanner

Part of the image is lost when scanning thin or semi-transparent paper

Limitation type


Permanent

Symptoms affecting the customer

Clipping on an image when scanning thin or transparent media; the following two reasons explain why:

- The scanner reads content located inside the E-size marks, any image part outside will not be read. If the paper edge is located outside those marks, it will not be detected either.
- If the paper is too thin, the scanner may not locate the paper edge easily.

In both situations, the scanner can confuse a black line inside the image with the paper edge. If the image profile is not regular, parts of the image can be lost. Example:

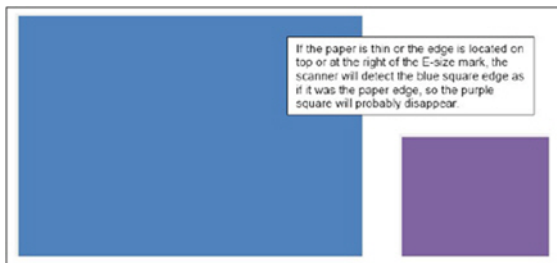

Communication to the customer

There are some workarounds available to minimize this issue:

1. Make sure that the paper edge is located at the left of the E-size mark.
2. Change the job orientation; it could work better for the image type you want to scan.
3. If the paper is too thin, place a piece of white paper below the original when scanning.
4. Use the Scan full width option.

Context

The algorithm to detect the paper edge has improved compared to the T2300, but it still might fail depending on the image and paper type.

Scan to LAN cannot be configured successfully in IPv6 or IPSec networks

Limitation type

Permanent

Symptoms affecting the customer

The issue happens when trying to setup a folder for scanning, and the customer network uses pure IPv6 protocol, or has IPSec protocol configured.

The Embedded Web Server shows an error message when trying to setup the folder saying that the computer specified as a server cannot be found. It is not possible to set up, and use scan to folder in this environment.

Communication to the customer

In order to use scan to folder at least a mixed IPv4/IPv6 network is required. In case of IPSec, the scan to folder will never work if the network is using IPSec policies. We recommend in this case using the Scan to USB option.

Context

Same problem happens in the T2300.

Firmware

Sending multiple images using PCL3GUI driver in Mac with Nesting ON might lead to printer system error 79:04

Limitation Type

Temporary

Symptoms affecting the customer

When sending two or more images to the printer using the PCL3GUI driver from Mac, if the printer has nesting activated and the images contain white areas, the printer is not able to process correctly, and shows system error 79:04. Details of the system error are:

- SE: 79:04
- File: vpmBe.c
- Line 2024

Communication to the customer

As a temporary workaround, in case of system error, switch nesting off to print these files. A new driver is being developed that solves this problem.

Context

This problem is specific to this driver version, other printers or drivers do not show it.

Driver

When printing a multi-page file, time to start printing might be long

Limitation type

Temporary


Symptoms affecting the customer

After installing the Windows driver, the **Page Order** setting is set by default to **First page on top**. By doing this, the printer has to process all the pages before starting to print, in order to start printing with the last page, and leave the first page on top of the stacker, so taking longer to process and begin.

This will be changed in future driver releases, but customers that already installed the driver with the first version of the DVD need to change the setting manually to improve performance.

Communication to the customer

To improve the processing time, change the setting to **Last page on top**.

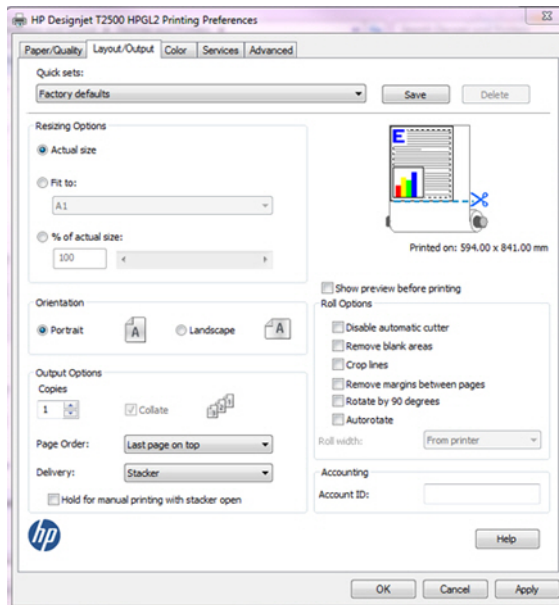

Context

This problem does not occur in the T920/T1500 because the driver default is already set to **Last page on top**.

Connectivity

Printer cannot access the Internet after changing the proxy settings

Limitation type

Permanent

Symptoms affecting the customer

After changing the proxy settings in the printer, trying to connect to the Internet may give an error message.

Communication to the customer

In some cases it is required to restart the printer to refresh the Internet settings.

Image Quality

Printouts show different colors compared to the T790/T1300/T2300

Limitation type

Temporary

Symptoms affecting the customer

If a customer replaces a T2300 MFP with a T2500 MFP, they will notice a color change when printing certain images with certain paper types, and using some setting combinations.

Communication to the customer

Colors are different in the T2500 due to differences in the method for creating internal paper presets. If issues are related to red colors being more orange in coated paper, a workaround is to disable the Color Calibration by going to the **Main Menu ► Image-Quality Maintenance ► Enable color calibration**, and set to **Off**.

Context

Same problem happens in the T920/T1500.


Inaccurate lines in the first or last 10 cm of a job

Limitation type

Permanent

Symptoms affecting the customer

When scanning an original with horizontal lines, the first or last 10 cm of the image might show some steps or discontinuances in the horizontal lines.

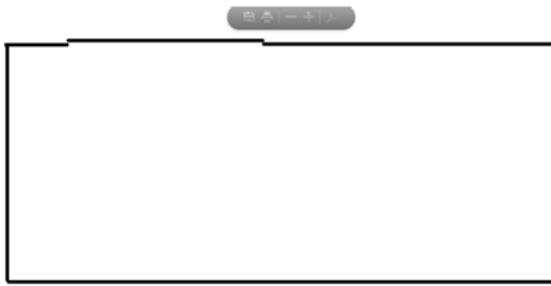

Communication to the customer

A misalignment of up to 4 pixels is considered normal with this type scanner technology. The amount of misalignment depends on the scan resolution and paper type used.

This issue is related to the distance between the original paper and the CIS sensors. When the paper enters the scanner, it is only held by one set of rollers, so the paper is not completely flat, and the focal distance between the CIS sensors and the paper might change. Once the paper has gone completely through the rollers of the scanner, the media becomes held by the second roller, and the issue is solved. The same instance occurs when the media is leaving the scanner. This is the reason why you can see the issue only during the first and last 10cm of the image.

The issue is usually improved after calibrating, but sometimes the defect cannot be completely removed.

Context

This issue also happens in the Designjet T2300 eMFP.

If you still have a problem

If you still experience print-quality problems after applying the advice in this chapter, here are some further things that you can do:

- Try using a higher print-quality option. See users guide.
- Check the driver you are using to print with. If it is a non-HP driver, consult the driver vendor about the problem. You could also try using the correct HP driver, if feasible. The latest HP drivers can be downloaded from <http://www.hp.com/go/T920/drivers>, <http://www.hp.com/go/T1500/drivers>, <http://www.hp.com/go/T2500/drivers>, or <http://www.hp.com/go/T3500/drivers>.
- If you are using a non-HP RIP, its settings may be incorrect. See the documentation that came with the RIP.
- Check that your printer's firmware is up to date. See users guide.
- Check that you have the right settings in your software application.

Connectivity problems

- [General network troubleshooting](#)
- [Printer discovery](#)
- [Connectivity Configuration page](#)
- [LEDs](#)
- [Link troubleshooting](#)
- [Link configuration methods](#)
- [Reset network parameters](#)
- [Internet connection troubleshooting](#)
- [Problems with proxy](#)
- [Security](#)

General network troubleshooting

Some symptoms are:

- The front panel display does not show the **Receiving** message when an image is sent to the printer.
- Computer displays an error message when trying to print.
- Computer or printer hangs (stays idle), while communication is taking place.
- Printed output shows random or inexplicable errors (misplaced lines, partial graphics etc.).
- Printer cannot wake up when sending a job using EWS or drivers.

To solve a communication problem:



- Ensure that the correct printer is selected in the application.
- Ensure that the printer works correctly when printing from other applications.
- Remember that very large prints may take some time to receive, process and print.
- If the printer is connected to a network, check the printer connectivity status: the printer should have an IP address and it should match the IP address specified in the printing computer. If the addresses do not match, then configure correctly; if the issue persists, check the network configuration.
- Try another interface cable.
- When a network device automatically configures itself on an IP address from the DHCP service, the IP address may differ from the time the device was last switched off to the time it is next switched on. This can lead to the device being shown as "offline" when driver port settings are configured with the original IP address. There are at least three possible ways to avoid this:

- Increase the lease time of the DHCP server device.
- Set a fixed IP address for the printer that will not be changed by DHCP.
- Configure the printer and driver to refer to the hostname instead of the numeric IP address. To set a fixed IP address for the printer:





Finally, the T790, T1500, T2500, and T3500 embed a Jet Direct (JDI) connectivity card. For detailed information see:

- HP Jetdirect Print Servers Administrator's Guide.
- <http://www.hp.com/go/jetdirect>

To use the hostname instead of the numeric IP address:

1. Go to the front panel and press  or .
2. Take a note of the IP address and the hostname (HP XXXXXX format).
3. If the computer is running Windows, go to **Control Panel > Printers >**, right-click the printer and select **Properties > Ports > Configure Port**, and in the Printer name or IP address field enter the hostname.

Finally, if unexpected printer behavior is experienced, one can restore most of the printer's settings:

- Basic networking settings can be reset by pressing , then , then **Connectivity > Network connectivity > Advanced > Restore factory settings**.
- Network security settings can be reset by pressing , then , then **Connectivity > Network connectivity > Gigabit Ethernet > Modify configuration > Reset Security**.

Printer discovery

If unable to install the HP software provided with the printer, check that:

- All cable connections to the computer and the printer are secure.
- The network is operational and the network hub is turned on.
- All applications, including virus protection programs, spyware protection programs, and firewalls, are closed or disabled for computers running Windows.
- The printer is installed on the same subnet as the computers that use the printer. If the installation program cannot discover the printer, print the network configuration page, and enter the IP address manually in the installation program.

Though it is not recommended that a static IP address is assigned to the printer, it might resolve some installation problems (such as a conflict with a personal firewall) by doing so.

Connectivity Configuration page

The Connectivity Configuration page provides comprehensive print server status. It is an important diagnostic tool, especially if network communications are not available. For a description of messages that may appear on the Connectivity Configuration page, see the HP Jetdirect Print Servers Administrator's Guide for the print server model.

The connectivity configuration page can be printed by pressing the setting icon in the **Front Panel > Internal Prints > Printer Usage Information > Service Information Prints > Print Connectivity configuration**.

LEDs

The printer has status lights (LEDs) that indicate the link status and network activity.

- When the green light is on, the printer has successfully linked to the network.
- When the yellow light is blinking, there is network transmission activity.

Link troubleshooting

If the printer does not successfully connect to the network:

- Both LEDs will be off.
- **LAN Error- Loss of Carrier** will be indicated on the Connectivity Configuration page.

If a link failure is indicated, try the following:

- Check the cable connections, or try another cable.
- Manually configure the link setting to match the port configuration of the network hub or switch. Turn the printer off, then on again, to re-initialize the setting.
- Print an Connectivity Configuration page and check link settings.

Item Description

Port Config If the printer is properly linked, this item has one of the following values:

- **10BASE-T HALF:** 10 Mbps, half-duplex
- **10BASE-T FULL:** 10 Mbps, full-duplex
- **100TX-HALF:** 100 Mbps, half-duplex
- **100TX-FULL:** 100 Mbps, full-duplex
- **1000TX FULL**

If the printer is not properly linked, one of the following messages will appear:

- **UNKNOWN:** The printer is in an initialization state.
- **DISCONNECTED:** A network connection has not been detected. Check network cables. Reconfigure the link settings, or restart the printer.

Auto Negotiation Indicates whether auto-negotiation for link configuration is on or off:

- **ON (default):** The printer will attempt to automatically configure itself onto the network at the proper speed and communication mode.
- **OFF:** Manually configure the link speed and communication mode using the front panel. The settings must match those of the network for proper operation.

Link configuration methods

The printer supports 10, 100, or 1000 Mbps network link speeds using full-duplex or half-duplex communication modes (a 1000T half-duplex selection is not supported). By default, it will attempt to autonegotiate its link operation with the network. When connecting to network hubs and switches that do not support auto-negotiation, the printer will configure itself for 10 Mbps or 100 Mbps half-duplex operation. For example, when connected to a nonnegotiating 10 Mbps hub, the print server will automatically set itself to operate at 10 Mbps half-duplex.

If the printer is not able to connect to the network through auto-negotiation, set the link setting by one of the following methods:

- The front panel.
- The Embedded Web Server.
- Telnet interface, through a system command prompt.
- A TFTP (Trivial File Transfer Protocol) configuration file that is downloaded, for example, from a BootP or DHCP server.
- Network management tools such as HP Web Jetadmin.





Reset network parameters


Network parameters (for example, the IP address) can be reset to factory default values: **Front Panel > settings > connectivity > network connectivity > advanced > restore factory settings** and then turning the printer off and on again. After restoring, print an Connectivity Configuration page to confirm that factory reset values have been assigned.



CAUTION: A factory-installed HP Jetdirect X.509 certificate will be saved over a cold reset to factory default values. However, a Certificate Authority (CA) certificate that has been installed by the user to validate a network authentication server will not be saved.

Internet connection troubleshooting

If your printer has difficulty in connecting to the Internet, it may start the Connectivity Wizard automatically. You can also start the wizard manually at any time.

- From the front panel: Press , then , then **Connectivity > Connectivity wizard**.
- From the front panel: Press , then , then **Internal prints > Service information prints > Print connectivity config**. In this case, the results are printed out.

 **NOTE:** The results printed out are from the last run of the Connectivity wizard, so you must already have run the Connectivity wizard in order to get any results.

The Connectivity Wizard performs a series of tests automatically. You can also choose to perform individual tests. From the front panel, press , then , then **Connectivity > Diagnostics & troubleshooting**. The following options are available.

- **All tests**
- **Network connectivity test:** Check the printer's connection to the local area network.
- **Internet connectivity test:** Check the printer's connection to the Internet.

- **HP Designjet ePrint & Share test:** Check the printer's connection to HP Designjet ePrint & Share (not T3500).
- **HP ePrint Center connectivity test:** Check the printer's connection to the HP ePrint Center.
- **Firmware update test:** Check the printer's connection to HP's firmware update servers.
- **Email server test:** Check the printer's connection to the configured email server.
- **Customer Involvement Program test:** Check the printer's connection to the CIP.

Alternatively, these tests can be launched from the Embedded Web Server: select **Support > Connectivity troubleshooting**.

If any test fails, the printer describes the problem and recommends how to solve it.

Problems with proxy

If during the connectivity wizard process the test internet connectivity settings of step 2 fails; you need enter the proxy address manually. For that, press **Details > Modify > Enable proxy > Use proxy server**, and then enter your proxy address and port.

A proxy is a server that acts as an intermediary between computers on your local network and servers on the internet. Before setting up the printer, please check if your network requires a web proxy.

To check this open Internet Explorer or Safari on any computer within your network, and browse to the <http://hp.com> site. If you cannot connect to hp.com, your network does not have internet access and you need to consult with your IT provider on how to configure internet access. If you can connect to hp.com, you can check the browser settings for proxy configuration as follows:

- For Internet Explorer, go to **Tools > Internet Options > Connections > Local Area Network (LAN) Settings**. In the "Proxy server" part of the window, if the "Use a proxy server" box is unchecked, you do not need a web proxy. If it is checked, make a note of the Address and Port settings in the main window, or in the HTTP part of the Advanced settings window.
- For Safari, go to **Preferences > Advanced > Proxies > Change Settings**. If the "Web Proxy (HTTP)" box is unchecked, you do not need a web proxy. If it is checked, make a note of the Web Proxy Server name (before the ":") and port (after the ":").
- Proxy server names are typically like "proxy.mycompany.com" and proxy port is typically 80, but details are network dependent. If you are unable to determine whether you need a web proxy or how to configure it, please consult with your network administrator or Internet Service Provider. When in doubt, you probably do not need a web proxy.

If you are unable to determine whether you need a web proxy or how to configure it, please consult with your network administrator or Internet Service Provider. When in doubt, you probably do not need a web proxy.

Security

For security troubleshooting, please refer to the "HP Designjet Security white paper": <http://www.hp.com/go/designjet/security>

Scanning Problems

- [Banding Problems](#)
- [Image quality problems](#)
- [Dust problems](#)
- [Stitching problems](#)

Banding Problems

Bad/no gray balance calibration (CIS module to module match).



Image quality problems

Scanning originals that have folds or are crumpled on a CIS scanner is often taken to be a scanner defect, where in reality it is a limitation of the technology being used. Due to the very short distance from sensor to surface of the original, also called “Focal Length”, there is also a very short “Focus Depth”, meaning that if the original is NOT in contact with the glass plate, it is very likely to be out of focus.



Dust problems

There are image quality problems not related to hardware errors, these can be due to either insufficient cleaning, bad calibration or limitations in the CIS technology.




Streaks running in the scan direction which seem to appear and disappear during the scan are most likely caused by dust. Clean the scanner and the original. The streaks are often a darker shade of color.

Streaks that run in the scan direction, that are color dependent, or a lighter shade of the color are often related to calibration. Dust that was present in the scanner during calibration, but has been cleaned away since.

Stitching problems

Other issues can be that the scanner simply needs to be calibrated, either because the parameter block has been erased, never been calibrated, or that the scanner has been moved around.

Stitching problem between 2 CIS modules:

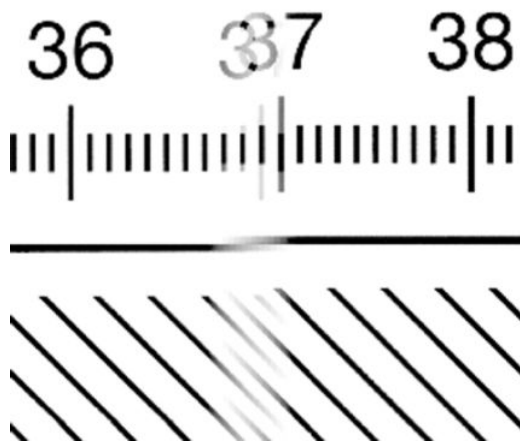

HP 727 Printhead Troubleshooting

General troubleshooting

If customers have problems installing a printhead (PH):

- Make sure that the printer has the latest firmware installed, available from: www.hp.com/go/T1500/software.
- Download the Service plot (this helps to check for error codes and ink levels).
- Make sure the carriage properly closes.
- Make sure there is enough ink to start up the printhead (40cc for matte black (mK) and 30cc for other inks; for a tubes purge - 60cc for each color). Ink levels can be checked in the service plot. If in doubt, use 130ml cartridges.
- Make sure that the ink tubes are filled. Refer to [How to check the printhead filling codes on page 111](#).

Symptoms	Printer message	Troubleshooting
Incomplete latch closure	None	<ol style="list-style-type: none">1. Upgrade last FW version.2. Moisten tube connections with Water or PEG (Polyethylene glycol).
PH rejected before filling the tubes	Reseat printhead	<ol style="list-style-type: none">1. Upgrade last FW version.2. Replace with new printhead.
PH rejected after filling the tubes	Reseat or replace printhead after initialization or Long initialization time	<ol style="list-style-type: none">1. Check which colors are still empty (if any) run printer diagnostics to validate Primer & ISS.2. Upgrade last FW version.3. Moisten tube connections with Water or PEG (Polyethylene glycol).4. Purge the tubes again. This requires new printhead and cartridges (130ml for colors and 69ml for Matte Black).

How to check the printhead error code

- ▲ See [Printhead 727 Error codes on page 82](#).

How to check the printhead filling codes

These SE are available in firmware MRY_02_00_05.6 and later.

1. Generate the Service plot, the SE 93.x.n:10 are not show in the Front Panel. Go to the Embedded Web Server: **Support tab ► Service support ► Printer information**. This will open a new page. Select the **All pages** tab. Download this page or print it to a PDF file.
2. Select the All pages tab. Download this page or print it to a PDF file.

How to read the filling codes


- **SE 93.0.n:10** During the tube filling, the first check of ink pressure for color n failed. If no SE 93.2.n:10 appears, it means that the issue was fixed after the customer reseated the printhead.
- **SE 93.2.n:10** After reseating the printhead, the second check of ink pressure for color n failed. This means that color n in the printhead may not be filled with ink or that the ink tube is leaking.
- **SE 93.1.n:10** During the tube filling, the first check of temperature for color n during the printhead spit test failed. If no SE 93.3.n:10 appears, it means that the issue was fixed after the customer reseated the printhead.
- **SE 93.3.n:10** During the tube filling and after reseating the printhead, the second check of temperature for color n during the printhead spit test failed. This means that color n in the printhead is not filled with ink.
- n indicates the color at fault:
 - n=0 stands for photo black
 - n=1 stands for gray
 - n=2 stands for matte black
 - n=3 stands for cyan
 - n=4 stands for magenta
 - n=5 stands for yellow.

Troubleshooting specific cases

- Check section [Problems during insertion on page 71](#) for prerequisites and specific cases:
 - [The carriage latch is not closed properly on page 72.](#)
 - [The front panel display recommends reseating the printhead after insertion and no tubes start to fill \(tubes are empty\) on page 74.](#)
 - The printhead shows error code 0x00002, 0x02000, or 0x04000, see [Step 4. If the printhead shows Reseat error code \(0x00002, 0x02000, 0x04000...\).](#)
 - [The front panel display shows “PH replacement not complete” on page 75.](#)
 - [The printer rebooted during the start-up; printhead initialization took a long time and was then canceled on page 80.](#)
 - [The printhead shows an Error Code 0x00010 or 0x00040 on page 80.](#)
 - [All ink tubes are filled, but the printer requests a random printhead reseat on page 80.](#)
 - [During printer installation troubleshooting, the printer asks if the printhead to be used is “New” or “Reused” on page 81.](#)

Videos for replacing CSR parts and HP 727 printhead

Videos for removing and installing CSR parts and HP 727 printhead are now available from the HP Support Advance Channel on YouTube: <http://www.youtube.com/user/hpsupportadvanced>.

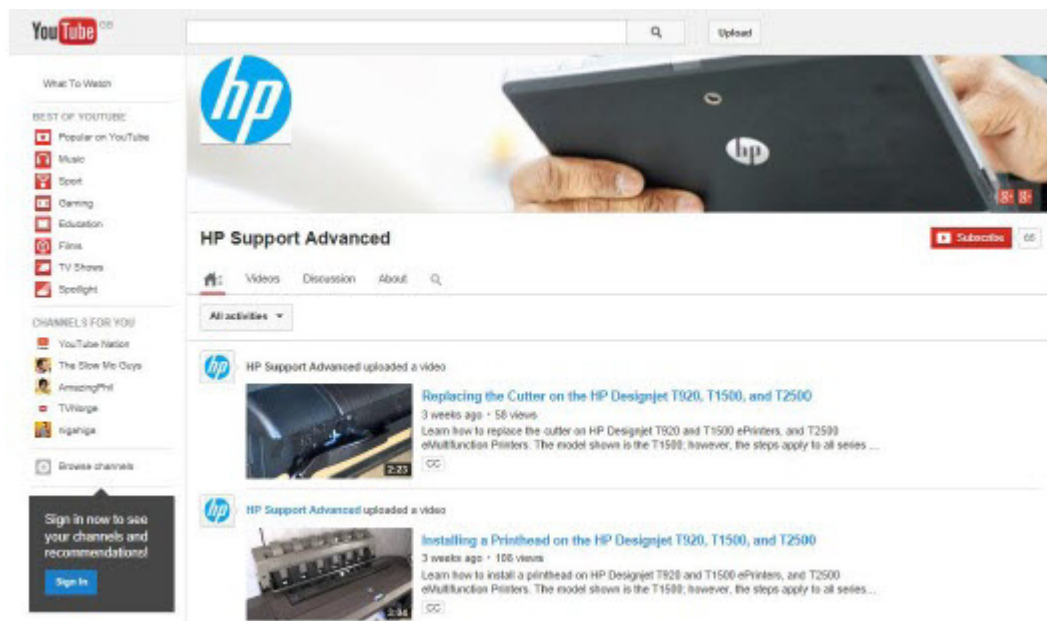

Videos are available for the following part removal and installation via these links:

- [HP 727 Printhead](#)
- [Cutter](#)
- [Front panel side Ink Cover](#) and [Service Station side Ink cover](#)
- [Starwheel rail](#)
- [Top roll cover](#) and [Bottom roll cover](#)
- [Stacker pads](#)
- [Carriage latch.](#)

Firmware upgrades

- [How to upgrade](#)
- [Embedded web server](#)
- [USB upgrade](#)
- [Firmware version deletes accounting data](#)

How to upgrade

To obtain the latest firmware, please check <http://www.hp.com/go/T790/firmware>, or <http://www.hp.com/go/T1500/firmware>, or <http://www.hp.com/go/T2500/firmware>, or www.hp.com/go/T3500/firmware

There are 3 ways of updating the firmware in the printer:

- Automatic firmware upgrade if web services are enabled
- Embedded web server. See users guide
- Using a USB key

Embedded web server

Once the file is downloaded open the EWS with any web browser and go to “Maintenance” – Upgrade Firmware”

USB upgrade

1. Upload the fmw file onto an empty USB stick.
2. Turn off the printer.
3. Plug in the USB stick.
4. Turn on the printer and follow instructions.

Firmware version deletes accounting data

Accounting data lost when upgrading firmware in HP Designjet T3500 Production Printer Series.

All accounting data in the Hard Disk is erased whenever a firmware upgrade from FW **AENEAS_01_XX_XX.X** to **AENEAS_02_XX_XX.X** is performed.

In this situation, you are strongly advised to save a copy of this data before performing the update.



IMPORTANT: The accounting information is retained if the upgrade is performed from FW **AENEAS_02_14_00.5** to **AENEAS_02_52_01.4**.

3 System error codes

- [Introduction](#)
- [What to do if the front panel fails to initialize](#)
- [System error codes in brief](#)
- [System error codes in full](#)
- [Appendix A: How to troubleshoot system error 79:04 and 79.2:04](#)
- [Appendix B: Updating firmware in boot mode](#)
- [Appendix C: Obtaining the diagnostics package](#)

Introduction

System error codes are generally used to report internal system errors. The following pages contain a list of system error codes with their descriptions and recommended corrective actions. Try only one recommended action at a time, in the order in which they appear in this manual, and restart the printer after each action. If the error code no longer appears, there is no need for any more corrective actions.

Errors of two kinds

Some system errors are continuable or advisory, which means that you can press **OK** on the front panel and continue using the printer.






Other system errors are non-continuable, which means that you cannot continue using the printer. In this case, turn the printer off and on again. If the error code reappears, then the printer requires an on-site visit in order to resolve the problem.

Reporting a system error to HP Support

If you have an error code that you cannot resolve, then report the error to HP Support. When reporting the error, have the following information ready.




NOTE: If you fail to provide any of this information, HP Support cannot help you properly. Make sure you take time to gather all of the information.

- The model and serial number of the printer, which can be seen in **Unit Information**, in the **Diagnostics** menu.
- Which firmware version the printer is using, which can be seen in **Unit Information**, in the **Diagnostics** menu.
- The complete error number, which can be seen in the Printer Information Area.
- The printer information or service plot of all pages. There are several ways of obtaining it:
 - Go to the Control Panel, press , then , then **Internal prints > printer usage information > Service information prints**.
 - Through the EWS. To access the EWS you have 2 options. Open a web browser and type the IP address of the printer. From the HP printer utility by clicking on the ADMIN tab and the launch the EWS. Once you have access to the Embedded Web Server. Go to , then , then **Service Support > Printer information**. Specific pages can be requested but it is recommended to request “all pages” which contain all the printer information. Note that it can take a significant amount of time to generate. Once generated you may be asked to email the file to the support center helping you, therefore you can save it from your Web browser, and later send the file, from Internet Explorer, for example, you can send the page directly: select **File > Send > Page by email**.
- Which software application the customer is using.
- The internal error code, file, and line fields found on the internal error screens, available by pressing  when the system error is shown on the front panel. To get the file and line fields, you need to scroll down to the next screen.



NOTE: The file and line fields are important to identify the source of the problem because the same internal error code can be reported in different files and lines. In the File field, supply only the filename: the part after the last slash (/). For example, for a file `/ae/.../elektra/hal/motors/ControlledMotor/Elektra/ControlledMotorElektra.cpp`, you need to provide only the **ControlledMotorElektra.cpp** part to HP Support.


 **TIP:** When investigating a system error, you are recommended to use the diagnostic package to further understand the problem. To obtain the diagnostic package (which takes a few minutes), see [Appendix C: Obtaining the diagnostics package on page 177](#).

Diagnostic package

It is possible to view all the actions the printer performs collected in a log file. To further understand a system error code, it is useful to have a log showing what the printer was doing at the time when the system error occurred. To get the diagnostic package, see [Appendix C: Obtaining the diagnostics package on page 177](#).

What to do if the front panel fails to initialize

The LEDs of the formatter (visible at the rear of the printer, see figure number 2 below), the power supply, and the network interface card can help you troubleshoot a problem if the front panel is not working. All these LEDs are located in the E-Box placed below the printer.

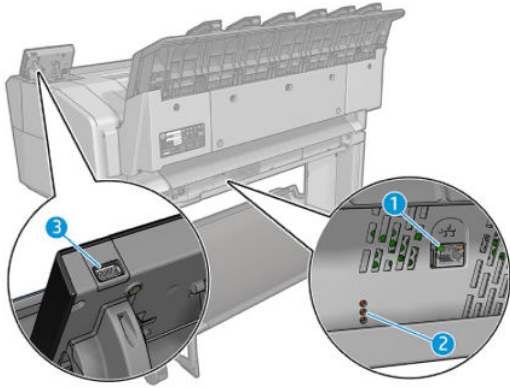


The call agent should ask the customer to follow these steps to troubleshoot the problem:

1. Switch the power off at the rear of the printer and disconnect the power cord. Reconnect the power cord and switch on the printer.
2. Check that the front panel interface cable is undamaged and correctly connected to the engine PCA.



3. Use the following table to interpret the LEDs and find the source of the problem. Remember that you should read these LEDs when you press the power button. Some combinations may require the replacement of more than one component. In this case, always replace one component at a time. Check the LEDs again to see whether the problem has disappeared. If the same LED sequence appears, replace the next component indicated in the table.

 **NOTE:** Once the printer has gone through the "Ready" state, the LEDs are no longer representative; in particular you will notice that on waking from "Sleep mode" the LEDs turn to PSU-On, Upper-On, Mid-blinking and Lower-Off.

PSU LED	Upper	Mid	Lower	Problem and recommendations
Off	Off	Off	Off	The printer is not receiving electrical power. <ol style="list-style-type: none"> 1. Ensure that the printer is connected to the power outlet. 2. Ensure that the outlet delivers the expected power. 3. Replace the power supply unit.
On	Off	Off	Off	There is a possible power failure in the formatter. <ol style="list-style-type: none"> 1. Reseat the power connector in the formatter. 2. Replace the formatter. 3. Replace the power supply unit.
On	On	Off	Off	The formatter BIOS is unable to start. <ol style="list-style-type: none"> 1. Update the BIOS. 2. Replace the formatter.
On	Blinking	Off	Off	The formatter BIOS cannot detect the hard disk drive. <ol style="list-style-type: none"> 1. Reseat the hard disk drive connectors. 2. Replace the hard disk drive. 3. Replace the formatter.
On	On	Blinking	Off	The operating system has experienced a fatal error. <ol style="list-style-type: none"> 1. Proceed with a File system check. 2. Replace the hard disk drive.
On	On	On	Off	There is a communication failure with the engine PCA. <ol style="list-style-type: none"> 1. Reseat the engine PCA. 2. Replace the engine PCA.
On	On	On	Blinking	There is a possible failure in the engine PCA. <ul style="list-style-type: none"> ▲ Replace the engine PCA.
On	On	On	On	There is a communication failure in the front panel. <ol style="list-style-type: none"> 1. Ensure that the front panel cable is properly connected to the formatter. 2. Replace the front panel.

Finally, there's another case where the printer seems to be in sleep mode but is not able to boot. All the formatter LEDs are off, but the PSU LED is On.

Front Power (Blue) Button	PSU LED	Upper	Mid	Lower	Problem and recommendations
Flashing (like in sleep mode)	On	Off	Off	Off	<p>There's a short-circuit in the 32v power line. The printer seems to be in sleep mode, but is not able to boot. All the formatter LEDs are Off.</p> <ol style="list-style-type: none"> 1. Replace the engine PCA. 2. If the problem persists, replace the power supply unit.

System error codes in brief

Reading a system error code

System error codes explain which component or system is failing, and what action should be taken to resolve the problem.

System error codes are displayed directly on the front panel's home page (they can also be seen on the Information page) and have been defined in the format XX.YZ. or XX.n:YZ.m.

- **XX:** Subsystem or process (2 digits)
- **n or m:** Subsystem or process index (optional), for example to identify the color of the ink cartridge
- **Y:** Who should perform the action (1 digit): 0 for user or 1 for service engineer
- **Z:** Action to perform (1 digit)

Subsystems

The following table explains the **XX** part of the system error code.

Code	Component or system
01	Engine PCA
02	Carriage PCA
03	Power supply unit and E-Box fans
05	Formatter and BIOS
06	Hard disk drive
08	Front panel
11	Trailing cable
21	Service station
22	Ink supply station
24	Tube assembly (IDS)
26.n	Ink cartridge (n=color)
27	Drop detector/Printhead
39	Roll switches
41	Paper-axis motor
42	Scan-axis motor
45	Rewinder
46	Pumps
47	Starwheel motor
48	PRS mechanism
52	Drop detector
54	Pinchwheel motor

Code	Component or system
55	Line sensor
56	Drive roller analog encoder sensor
59	Component authentication
60	Printer setup
61	Printing language
63	Input/output through LAN card
71	Memory management
72	Calibration
74	Firmware update
76	Hard disk full
78	Paper settings
79	Firmware
80	Stacker overdrive motor
81	Paper advance
86	Scan axis
87	Scan-axis encoder
89	Stacker ramp motor
90	Valve motor
93	Ink Delivery System

Actions for customers

The following table explains the **YZ** part of the system error code.

Code	Action
00	Replace
01	Reseat/Reconnect/Clean/Adjust (manually)
02	Calibrate/Adjust (using automatic process)
03	Restart the printer
04	Update firmware
05	Update software
06	Add accessory
07	Escalate
08	Send print again
09	Wrong part installed


Actions for qualified HP personnel

The following table explains the **YZ** part of the system error code.

Code	Action
10	Replace
11	Reseat/Reconnect/Clean/Adjust (manually)
12	Calibrate/Adjust (using automatic process)
13	Turn off the printer
14	Update firmware
15	Update software
16	Add accessory
17	Escalate
18	Send print again
19	Wrong part installed
20	Replacement recommended but not essential

System error codes in full

This section describes each of the system error codes that may be encountered while using the printer and suggests actions to solve the problem in each case.

 **IMPORTANT:** Try only one recommended action at a time, in the order in which they appear in this manual, and restart the printer after each action (unless the action was to restart the printer). If the error code no longer appears, there is no need for any more corrective actions.

01.7:10 Communication errors between engine PCA and formatter

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord. Reconnect the power cord, and then turn on the printer.

Service engineer:

1. Clean the gold contacts from the engine PCA connector
2. Replace the formatter.
3. If the problem persists, replace the Engine PCA. See [Engine PCA on page 314](#).


01.0:10 Problem with the engine PCA

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

- ▲ Replace the engine PCA. See [Engine PCA on page 314](#).

 **NOTE:** If the 01.0:10 is not solved after replacing the engine PCA, or after replacing it a SE 02.1:10 code appears (carriage PCA), check the trailing cable to engine PCA connection; It's low probability, but possible, that a wrong connection could cause the damage to the carriage PCA and / or engine PCA.


01.1:10 Error in the engine PCA

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

- ▲ Replace the engine PCA. See [Engine PCA on page 314](#)

 **NOTE:** If the 01.1:10 is not solved after replacing the engine PCA, or after replacing it a SE 02.1:10 code appears (carriage PCA), check the trailing cable to engine PCA connection; It's low probability, but possible, that a wrong connection could cause the damage to the carriage PCA and / or engine PCA.

01.2:10 Problem with the backup NVM

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check that the Encoder PCA Cable is correctly connected.
2. If the cable is correctly connected, replace the encoder PCA. See [Motor Media Advance Transmission with Encoder on page 379](#).



NOTE: The backup NVM is located in the Paper Path Encoder PCA. In order to replace this part, you need to order the service kit CR357-67009 "Motor Media Advance Transmission with Encoder", then only use the Encoder PCA part from this kit.

01.7:10 Communication errors between engine PCA and formatter

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Replace the formatter.
2. If the problem persists, replace the engine PCA. See [Engine PCA on page 314](#).

02.1:10 Problem with the carriage PCA

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check that the Trailing Cable is correctly connected between the Engine PCA and Carriage PCA.
2. Replace the carriage PCA. See [Carriage PCA on page 327](#).



NOTE: If the 02.1:10 is not solved after replacing the carriage PCA or after replacing it a SE 1.0:10 or SE 01.1:10 code appears (engine PCA), check the trailing cable connection to the engine PCA.; It's low probability, but possible, that a wrong connection could cause the damage to the carriage PCA and / or engine PCA.

03.2:10 Problem with the E-Box cooling fans

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check the fans to see which is not rotating by checking for airflow coming from the ebox; place a hand over the fan holes in the ebox underneath the printer to check for air coming from both fans.
2. Remove the E-Box (see [Open the E-Box on page 304](#)) open it, and check that the cable of the non-functional cooling fan is correctly connected. Reconnect the power cord and power on the E-Box. Check whether the fan is now rotating.
3. Replace the fan. See [E-Box fan on page 308](#).
4. Check the Power connection from PSU to Formatter and engine PCA.
5. Replace the PSU. See [Power supply unit on page 311](#).

03:10 Problem with the power supply unit

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord. Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check the cabling coming from the power supply to the Engine PCA.
2. Replace the PSU. See [Power supply unit on page 311](#).

05.1:10 Problems with the formatter FAN

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

- ▲ Replace the formatter. See [Formatter PCA on page 315](#).

05.4:10 BIOS data corrupted in formatter

Call agent:

- ▲ Replace the formatter. See [Formatter PCA on page 315](#).

05.5:10 BIOS should be updated (advisory)

Call agent:

- ▲ Update the formatter BIOS.

05.7:10 Synchronization problems between control panel and formatter

Call agent:

1. Disconnect any device connected to the USB host in the front panel.
2. Use the power switch at the rear to turn off the printer, then disconnect the power cord.

Reconnect the power cord, then turn on the printer.

Service engineer:

1. Replace the front panel. See [Front panel on page 318](#).
2. If after replacing the front panel, the SE continues to appear; replace the formatter PCA. See [Formatter PCA on page 315](#).

06:03 and 06:10 Problems with NVM in hard disk

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.

Reconnect the power cord, then turn on the printer.

Service engineer:

- ▲ Replace the hard disk drive. See [Hard disk drive on page 313](#).

06.1:10 Hard disk not detected

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.

Reconnect the power cord, then turn on the printer.

Service engineer:

1. Remove the E-Box (see [Open the E-Box on page 304](#)) open it, and check that the hard disk's power and data cables are correctly connected.
2. Replace the hard disk drive. See [Hard disk drive on page 313](#).
3. If after replacing the hard disk in the front panel the SE continues to appear; replace the formatter PCA. See [Formatter PCA on page 315](#).

06.2:10 Hard disk cannot be unlocked

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.

Reconnect the power cord, then turn on the printer.

Service engineer:

1. Remove the E-Box (see [Open the E-Box on page 304](#)) open it, and check that the hard disk's power and data cables are correctly connected.
2. Replace the hard disk drive. See [Hard disk drive on page 313](#).

06.3:10 Hard disk is corrupted

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Remove the E-Box (see [Open the E-Box on page 304](#)) open it, and check that the hard disk's power and data cables are correctly connected.
2. Replace the hard disk drive. See [Hard disk drive on page 313](#).

08:04 Communication lost between front panel and formatter

Call agent:

1. Restart the printer.
2. Update the firmware.

Service engineer:

1. Check that the front panel is correctly connected.
2. Replace the front panel. See [Front panel on page 318](#).
3. If after replacing the front panel the SE continues to appear; replace the formatter PCA and the network interface PCA. See [Formatter PCA on page 315](#).

08:08 A front panel icon does not work (advisory)

Call agent:

1. Restart the printer.
2. Update the firmware.

08:10 Problems detected in the front panel Hardware

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord. Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check that the front panel is correctly connected.
2. Replace the front panel. See [Front panel on page 318](#).

08:11 Communication lost between front panel and printer

Call agent:

1. Restart the printer.
2. Update the firmware.

Service engineer:

1. Check that the front panel is correctly connected.
2. Replace the front panel. See [Front panel on page 318](#).
3. If after replacing the front panel the SE continues to appear; replace the formatter PCA. See [Formatter PCA on page 315](#).

09:01 Media jam in Scanner

Call agent:

1. Turn off the product using the power key at the front, then also turn off the power switch at the rear and disconnect the power cable.
2. There is a small lever at the rear left of the scanner. Slide the lever to the right and open the scanner cover.
3. Solve the media jam.
4. Check and clean the pressure rollers.
5. Close the scanner cover and gently push it down to lock it into place.
6. Reconnect the product's power cable; turn on the power switch at the rear, and turn on the product using the power key. If no paper is seen:
 - a. Open the scanner cover. Underneath you should see red, then green, then blue flashing lights.
 - b. In the center of the scanner cover, between the flashing lights, you will find 4 small sensors labeled as R, G, B and L. Put your fingers over the R, G and B sensors simultaneously and the scanner motor should advance.

Service engineer:


- ▲ If there is no response from the scanner motor, replace the Engine PCA. See [Engine PCA on page 314](#).

Additional information

Currently, the batch scanning operation mode works as follows:

When the first page is scanned, it is not released until the next page is fed in. If customers insert the next page but want to correct skew removing and placing it back, the scanner firmware understands that both pages are the same, therefore, the first one is not released and is also rewound.

In this situation, input and output sensors are covered, and trigger System Error 09:01 or 09:03.

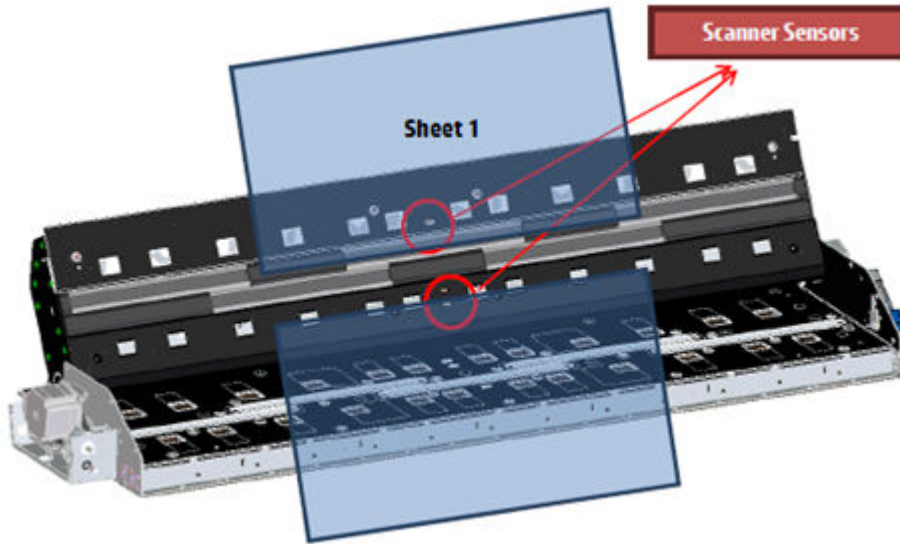


To prevent the situation, scanned pages should be released once they have been scanned, in this way the output sensor is left free and no System Error will appear.

The firmware fix to this issue will be included in the next release, scheduled December 2014.

Workaround

To avoid Scanner errors on Multi-page or multi-job scanning, explain to the user how to use the multipage or batch scanning workflow:

- The recommendation is NOT to stack scanned originals. Stacked originals may cause jams as they can hide the stacker printing area, increasing the chance of possible conflicts in workgroup environments.
- Users **should press eject paper from the FP** (eject symbol at top-right corner of the touch screen) each time **before scanning next page**.

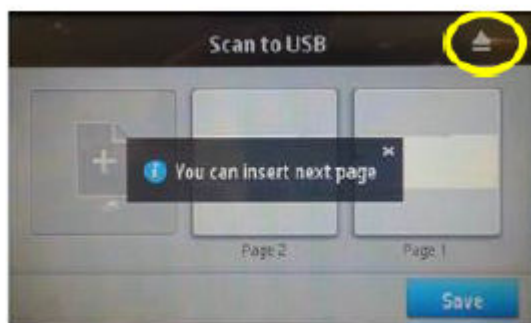

09:01:10 Scanner Motor is failing

Call agent:

1. Reboot the printer.
2. If system error persists, upgrade to the latest firmware.


3. Open the scanner cover. Underneath you will see red, then green, then blue flashing lights.
4. In the center of the scanner cover, between the flashing lights, you will find 4 small sensors labeled as R, G, B and L. Put your fingers over the R, G and B sensors simultaneously and the scanner motor should advance.

Service engineer:

1. If there is no response from the scanner motor, replace the Engine PCA, See [Engine PCA on page 314](#). See [Open the E-Box on page 304](#) or See [Stepper Motor Assembly \(taco sensor, and belt\) on page 435](#), see Scanner Motor Assembly (MFP only).
2. Replace the Scanner Controller Board. See [Scanner Controller Unit \(SUP\) on page 430](#).
3. Check the scanner controller board cable connections and replace the cables if required.
4. Replace the media sensors, See [Media Sensor on page 357](#) (MFP only).

Additional troubleshooting

Ensure that the Scanner routing cable is correct.

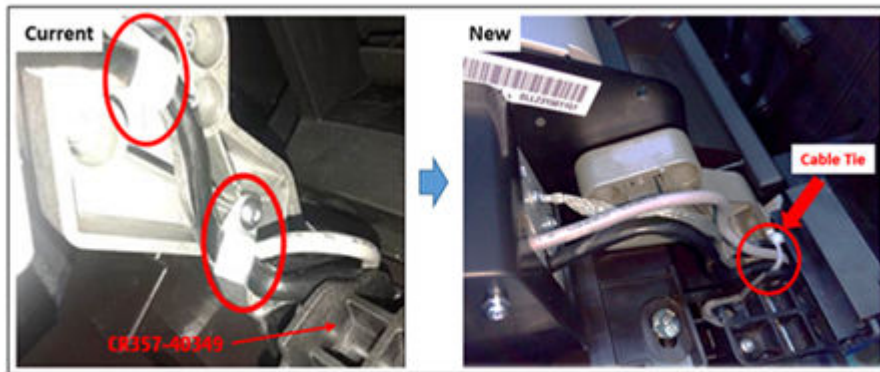


Two clamps to hold cables

One cable tie to hold cables


The process of routing the new cable:

1. Unfasten the two nuts and remove the clamps.

2. Replace PN CR357-40349, assembling it as shown below in rev.B.

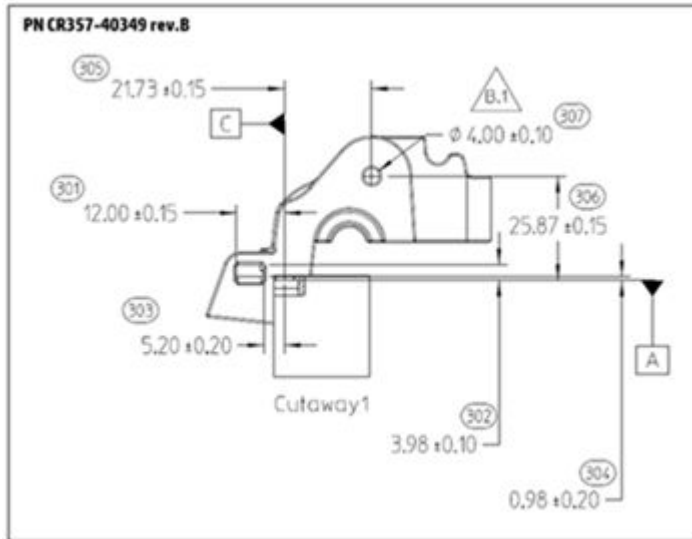

3. Mark the grey cable at 132 ± 5 mm. This mark is the reference to use with the Cable Tie. The minimum distance has to be the one gotten with the scanner closed.

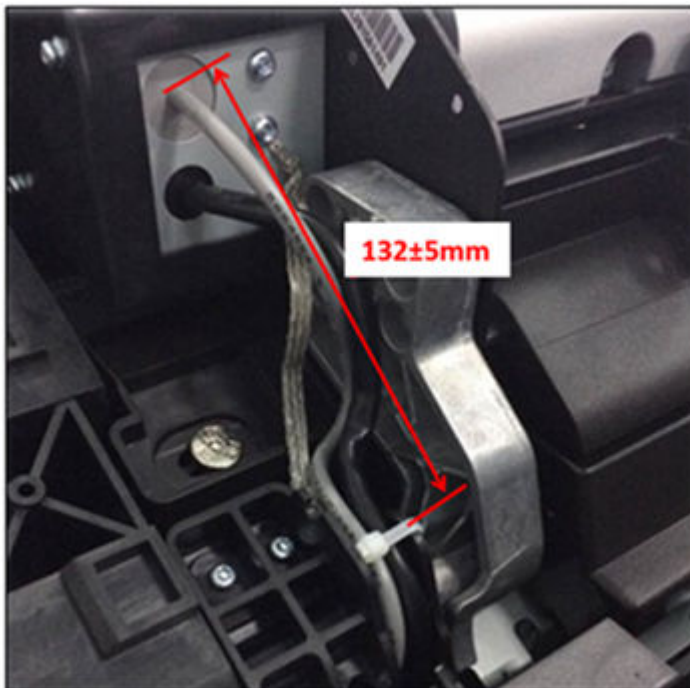

4. Pass the Cable Tie (1400-3401) through the hole to hold the cables exactly as shown above.

If SE09:01:10 and SE09:10:10 are still occurring, check the steps above and refer to [09:10:10 Scanner Controller Board \(SCU\) is failing on page 135](#) troubleshooting.

 **NOTE:** Please note that from SN CN7PF04M00 onwards this rework is already done on the manufacturing side.

09:02 Scanner not calibrated

- ▲ Calibrate the Scanner.

09:02:10 CIS A Element is failing

Call agent:

1. Clean the scanner of dust and dirt and perform the Scanner Calibration.
2. If the system error persists, upgrade with latest firmware version.

Service engineer:

1. Replace CIS A Element.
2. Replace Scanner Controller Board (SCU). See [Scanner Controller Unit \(SUP\) on page 430](#).

09:03 File I/O Error

Call agent:

1. Reboot the product.
2. Upgrade to the latest firmware.
3. Go to Jobs > Options > Delete all queue scan jobs.
4. Make sure the hard disk that is installed in the printer is the correct one for the product you are repairing.
5. Check and clean scanner elements.
6. Calibrate the scanner.

Service engineer:

- ▲ In some corner cases, the issue could be related to media movement. Replace the media sensors. See [Media Sensor on page 357](#).

Additional information

See Additional Information in SE [09:01 Media jam in Scanner on page 129](#)

09:03:10 CIS B Element is failing

Call agent:

1. Clean the scanner of dust and dirt and perform the Scanner Calibration.
2. If the system error persists, upgrade with latest firmware version.

Service engineer:

1. Replace CIS B Element.
2. Replace Scanner Controller Board (SCU). See [Scanner Controller Unit \(SUP\) on page 430](#).

09:04 Library failed to load.

Call agent:

1. Reboot the product.
2. Upgrade to the latest firmware.

09:04:10 CIS C Element is failing

Call agent:

1. Clean the scanner of dust and dirt and perform the Scanner Calibration.
2. If the system error persists, upgrade with latest firmware version.

Service engineer:

1. Replace CIS C Element.
2. Replace Scanner Controller Board (SCU). See [Scanner Controller Unit \(SUP\) on page 430](#).

09:05:10 CIS D Element is failing

Call agent:

1. Clean the scanner of dust and dirt and perform the Scanner Calibration.
2. If the system error persists, upgrade with latest firmware version.

Service engineer:

1. Replace CIS D Element.
2. Replace Scanner Controller Board (SCU). See [Scanner Controller Unit \(SUP\) on page 430](#).

09:06:10 CIS E Element is failing

Call agent:

1. Clean the scanner of dust and dirt and perform the Scanner Calibration.
2. If the system error persists, upgrade with latest firmware version.

Service engineer:

1. Replace CIS E Element.
2. Replace Scanner Controller Board (SCU). See [Scanner Controller Unit \(SUP\) on page 430](#).

09:08:11 Power cable of the Scanner is failing

Service engineer:

- ▲ Check the condition and connections of the Scanner Power cable, if necessary replace the cable.

09:09:11 USB cable of the Scanner is failing

Service engineer:

- ▲ Check the condition of the Scanner USB cable and its connections, if necessary replace the cable.

09:10:04 Scanner is in SAFE MODE

Service engineer:

- ▲ Restart the product, if the problem persists replace the SCU. See [Scanner Controller Unit \(SUP\) on page 430](#).

09:10:10 Scanner Controller Board (SCU) is failing

Call agent:

1. Turn off the product (20 sec.) using the Power key at the front, then also turn off the power switch at the rear and disconnect the power cable.
2. Perform the Scanner Calibration.
3. If the system error persists, upgrade with latest firmware version.
4. Perform File System Check.
5. Perform the Scanner Validation.

Service engineer:

1. Check the USB cable connection.
2. Replace the Scanner SCU. See [Scanner Controller Unit \(SUP\) on page 430](#).
3. Check the Scanner USB cable connection and the Power/Reset/Awake cable from the Scanner Controller Board to the Interconnect PCA; replace if broken.
4. Replace the Interconnect PCA.

Additional troubleshooting

Please check SE [09:01:10 Scanner Motor is failing on page 130](#) for additional troubleshooting information.

11:10 Trailing cable does not seem to be detected

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check that the trailing cable is correctly connected between the engine PCA and carriage PCA.
2. Check that the trailing cable connectors are not damaged, especially on the E-Box side; replace the trailing cable if necessary.
3. Check that the power cable from the power supply unit is connected to the formatter.
4. Replace the carriage PCA. See [Carriage PCA on page 327](#).
5. Replace the engine PCA. See [Engine PCA on page 314](#).

21.2:13 Failure moving service station

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord. Check the Primer Tubes.
Reconnect the power cord, then turn on the printer.
2. Ensure that the service station path is clear. Remove any visible obstacles (screws, plastic parts, etc.) restricting the movement of the service station.
3. If the carriage has stopped over the service station, on the left of the printer, check that the cutter is not activated. The cutter may be blocking the carriage over the service station, preventing the service station from moving correctly. The cutter is on the right side of the carriage.
4. Perform the service station diagnostic test to troubleshoot the problem further.

Service engineer:

- ▲ Replace the service station. See [Service Station with Drop Detector on page 339](#).

21:13 Problem with the Service Station motor

Call agent:

1. Ensure that the service station path is clear. Remove any visible obstacles (screws, plastic parts, etc.) restricting the movement of the service station.
2. If the carriage has stopped over the service station, on the left of the printer, check that the cutter is not activated. The cutter may be blocking the carriage over the service station, preventing the service station from moving correctly. The cutter is on the right side of the carriage.
3. Perform the service station diagnostic test to troubleshoot the problem further.

Service engineer:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Replace the service station. See [Service Station with Drop Detector on page 339](#).

22.0:00 Service-station-side ink supply station error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Perform the ink delivery system diagnostic test to troubleshoot the problem further.

Service engineer:

1. Check that the cables between the ink supply station and the engine PCA are not damaged and are properly connected. In case of any damage, replace the cable.
2. Replace the ink supply station on the service station side.
3. Replace the engine PCA. See [Engine PCA on page 314](#).

22.1:00 Front-panel-side ink supply station error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Perform the ink delivery system diagnostic test to troubleshoot the problem further.

Service engineer:

1. Check that the cables between the ink supply station and the engine PCA are not damaged and are properly connected. In case of any damage, replace the cable.
2. Replace the ink supply station on the front panel side.
3. Replace the engine PCA. See [Engine PCA on page 314](#).

24:10 Error detected in ink tube system

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Perform the Ink Delivery System diagnostic test in order to check that the bongos (pushers) go up and down to pressurize ink in the tube, and the Out of Ink sensors work properly.
2. If the diagnostic test does not find any problem, install new cartridges, and the printhead, and try purging the Ink Supply Tubes again.
3. If the problem persists, replace the Ink Supply Tubes. See [Ink Tubes and Trailing Cable on page 354](#).

26:01 Ink supply error found during IDS diagnostic test (advisory)

In the front panel message you can see letters representing the names of the colors of the faulty supplies.

Call agent:

1. Reseat the faulty ink supply and repeat the ink delivery system diagnostic test.
2. Replace the faulty ink supply and repeat the ink delivery system diagnostic test.

Service engineer:

- ▲ Replace the left ink supply station.

27:01 Too many nozzles out detected (Advisory)

Call agent:

1. Print the “Nozzle health” diagnostic print from the service menu. If printhead shows many nozzles out, replace the printhead.
2. If printhead doesn’t show too many nozzles out, run “drop detector calibration”.

Service engineer:

- ▲ If printhead doesn’t have too many nozzles out and “drop detection calibration” doesn’t help, replace the drop detector.

39.11:01 Media unloaded (Advisory)

Symptom

Plot cut partially and part of the image is kept in the unloaded roll.

This warning may happen in the following situations:

- When an end of roll 1 is detected because end of media is glued to the core.
- Paper has been unloaded before its end due to several reasons. In the cases below an excess of friction is causing malfunction in the media input which ends in unexpected media unloads:
 - Blue hub not completely introduced in the Media Roll core
 - Black Hub is broken and shifted to the left
 - Media sides are brushing the hubs for different conditions such as:
 - Media has expanded due to climate conditions (for example, switching off Air Conditioning)
 - Poor quality media: Media telescoping, core is narrower than media


Call agent:

1. Upgrade the printer to the latest firmware.
2. Ask customer if the advisory has appeared when reaching the end of the roll. In that case it is expected behavior. Tell customer to load new media roll and continue printing.
3. Ask customer to open roll cover and feed media into the media path.
 - a. Check if media sides are brushing the hubs. In that case tell customer to re-position the media roll on the spindle ensuring a margin ($\approx 3\text{mm}$) between the sides of the media and the black and blue hubs and observe there is no brushing. If this is not the case continue troubleshooting as described below
 - b. Visually check that the hubs (black and blue pieces) are not broken. If they are, send a new spindle to the customer.
4. If problem persists, send a Service Engineer with a new spindle a new rewinder motor.


Service engineer:

1. Follow all the steps from call agent section.



2. Measure distance of the Black hub on the left (as shown in picture below). This distance should be **greater than 4 cm**. Otherwise the black hub may be broken. Send a new spindle. Meanwhile recommend the customer to use roll 2 spindle if available.

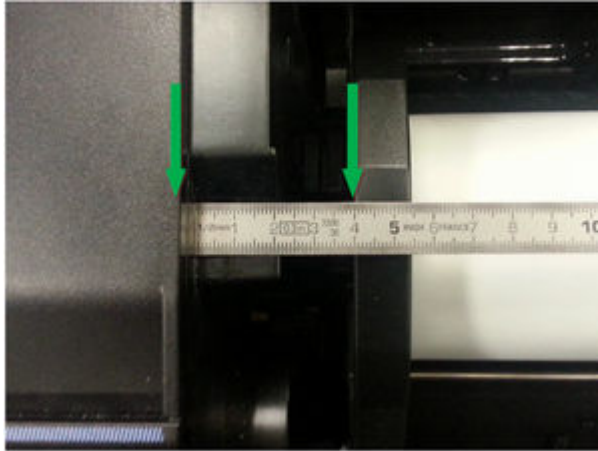


3. If customer is using 36 inch paper roll width, measure distance on the blue hub on the right (as shown in picture below). This distance should be **greater than 4.5 cm** otherwise, the blue hub is probably not completely inserted into the roll core.

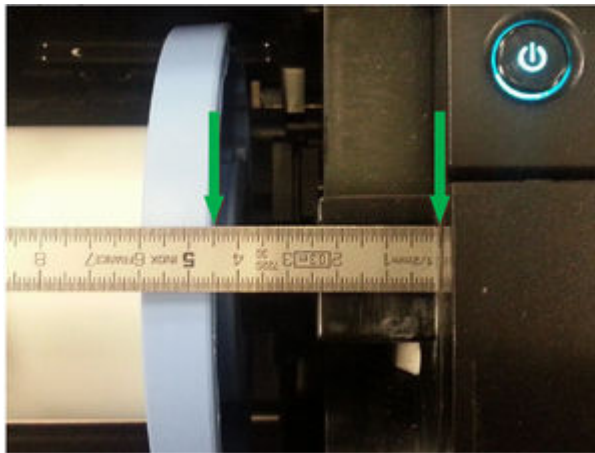

4. Clean the media path for visual inspection:
 - a. Disconnect and unroute the sensor from under the printer.

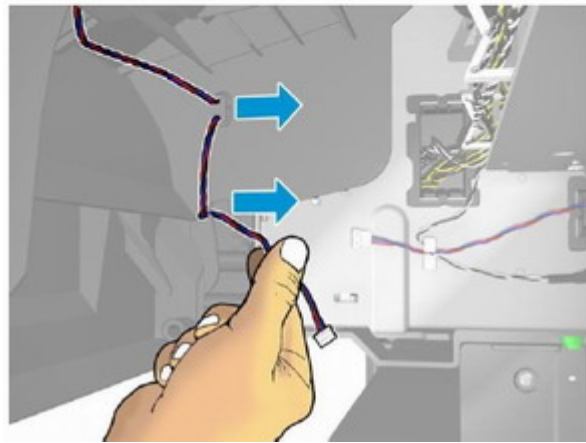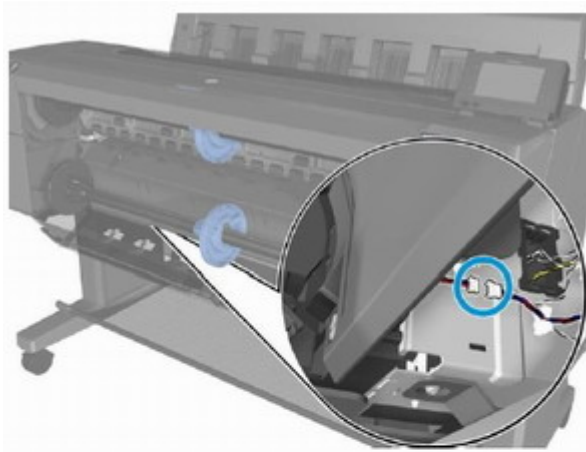

- b. Remove the T-15 cosmetic screw.

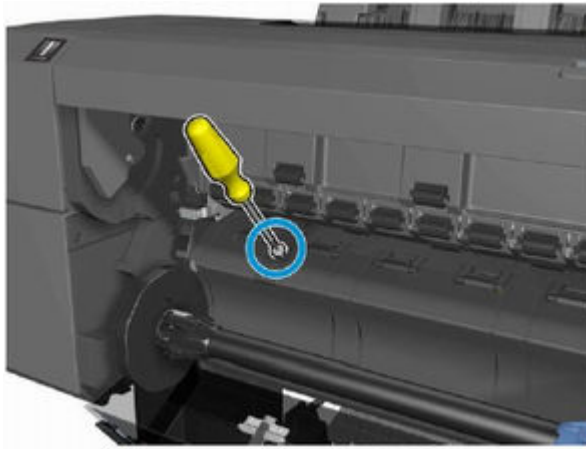

- 5. Remove the Cleanout Assy and visually check there are no obstructions in media path such as loose parts, plastics/foams/paper pieces.
- 6. If problem persists, replace spindle.
- 7. If problem persists, replace "rewinder motor"

39.12:01 Media unloaded (Advisory)

Symptom

Plot cut partially and part of the image is kept in the unloaded roll.

This warning may happen in the following situations:

- When an end of roll 2 is detected because end of media is glued to the core.
- Paper has been unloaded before its end due to several reasons. In the cases below an excess of friction is causing malfunction in the media input which ends in unexpected media unloads:
 - Blue hub not completely introduced in the Media Roll core
 - Black Hub is broken and shifted to the left
 - Media sides are brushing the hubs for different conditions such as:
 - Media has expanded due to climate conditions (for example, switching off Air Conditioning)
 - Poor quality media: Media telescoping, core is narrower than media


Call agent:

1. Upgrade the printer to the latest firmware.
2. Ask customer if the advisory has appeared when reaching the end of the roll. In that case it is expected behavior. Tell customer to load new media roll and continue printing.
3. Ask customer to open roll cover and feed media into the media path.
 - a. Check if media sides are brushing the hubs. In that case tell customer to re-position the media roll on the spindle ensuring a margin ($\approx 3\text{mm}$) between the sides of the media and the black and blue hubs and observe there is no brushing. If this is not the case continue troubleshooting as described below
 - b. Visually check that the hubs (black and blue pieces) are not broken. If they are, send a new spindle to the customer.
4. If problem persists, send a Service Engineer with a new spindle a new rewinder motor.


Service engineer:

1. Follow all the steps from call agent section.
2. Mount roll 2 in roll 1 position.



3. Measure distance of the Black hub on the left (as shown in picture below). This distance should be **greater than 4 cm**. Otherwise the black hub may be broken. Send a new spindle. Meanwhile recommend the customer to use roll 1 spindle if available.

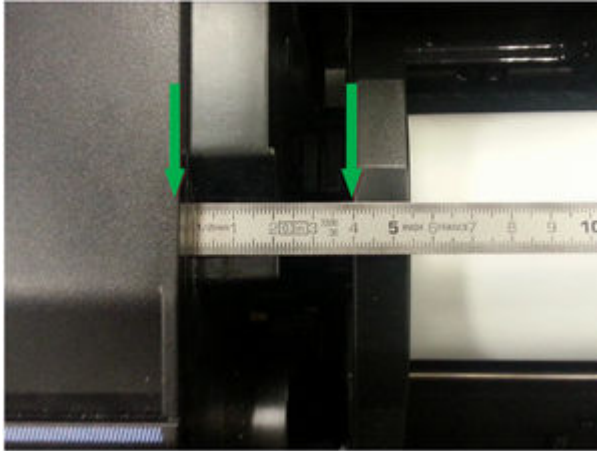


4. If customer is using 36 inch paper roll width, measure distance on the blue hub on the right (as shown in picture below). This distance should be **greater than 4.5 cm** otherwise, the blue hub is probably not completely inserted into the roll core.

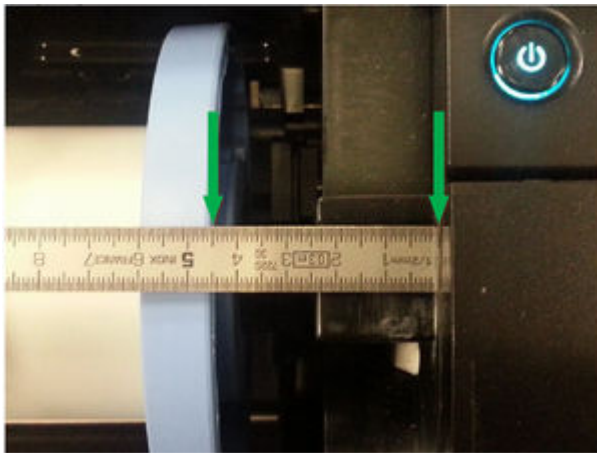

5. Clean the media path for visual inspection:
 - a. Disconnect and unroute the sensor from under the printer.

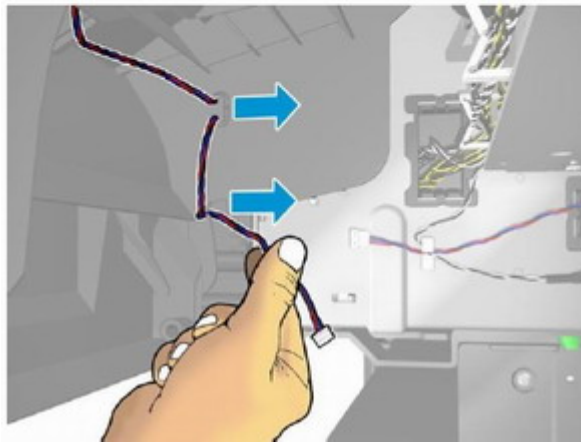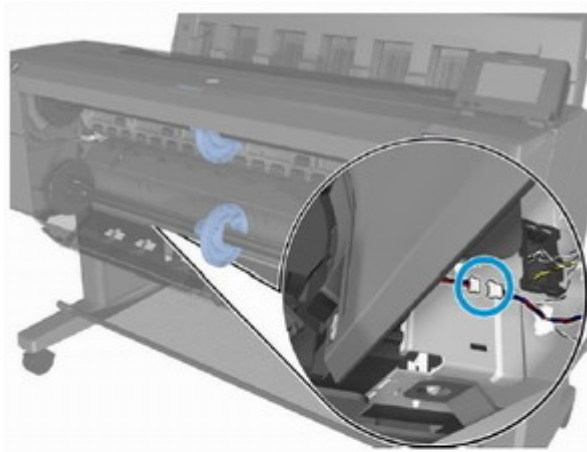

- b. Remove the T-15 cosmetic screw.

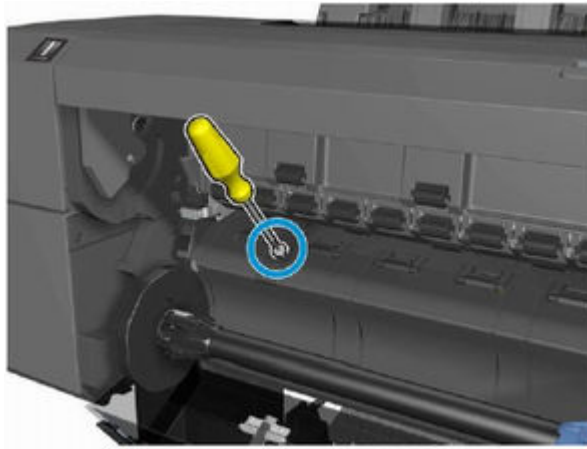

- 6. Remove the Cleanout Assy and visually check there are no obstructions in media path such as loose parts, plastics/foams/paper pieces.
- 7. If problem persists, replace spindle.
- 8. If problem persists, replace "rewinder motor"

41:03 Electrical problem (fault, current limit, overheating) in paper-axis motor

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Check for any visible obstacles restricting the movement of the paper advance roller. If there is a wrinkled mass of paper inside the paper path, lift the pinchwheels (using the pinchwheels diagnostic test), and clear the obstruction.
3. Perform the paper drive diagnostic test to troubleshoot the problem further.

Service engineer:

1. Check for any visible obstacles restricting the movement of the paper advance roller. If there is a wrinkled mass of paper inside the paper path, lift the pinchwheels (using the screw that moves the pinchwheels, or the pinchwheels diagnostic test) and clear the obstruction.
2. Check that the paper advance drive cable is undamaged and correctly corrected to the engine PCA.
3. Replace the paper advance drive.
4. Replace the engine PCA. See [Engine PCA on page 314](#).

42:03 Electrical problem (fault, current limit, overheating) in scan-axis motor

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
2. Reconnect the power cord, then turn on the printer.
3. Check for any visible obstacles restricting the movement of the carriage assembly. Remove any obstacle to let the carriage move freely along the whole scan axis.

Service engineer:

1. Check that the scan-axis motor cable is undamaged and correctly corrected to the engine PCA.
2. Replace the scan-axis motor. See [Scan Axis Motor on page 335](#).
3. Replace the engine PCA. See [Engine PCA on page 314](#).

45.1:03 and 45.1:10 Error in the rewinder 1 system (upper rewinder)

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Remove the paper from roll 1.
Reconnect the power cord, then turn on the printer.
2. The rewinder will be tested automatically during boot up.

Service engineer:

1. Check that the rewinder 1 cable is undamaged and correctly connected to the engine PCA.
2. Replace the upper roll rewinder.
3. If the issue is not solved, replace the Engine PCA. See [Engine PCA on page 314](#).

45.2:03 and 45.2:10 Error in the rewinder 2 system (lower rewinder)

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Remove the paper from roll 2.
Reconnect the power cord, then turn on the printer.
2. The rewinder will be tested automatically during boot up.

Service engineer:

1. Check that the rewinder 2 cable is undamaged and correctly connected to the engine PCA
2. Replace the lower roll rewinder.
3. If the issue is not solved, replace the Engine PCA. See [Engine PCA on page 314](#).

46.1:10 Error in the upper pump of the PHA blowing system

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check that the pump cable is undamaged and correctly corrected to the engine PCA.
2. Replace the upper pump.

46.2:10 Error in the lower pump of the PHA blowing system

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check that the pump cable is undamaged and correctly corrected to the engine PCA.
2. Replace the lower pump.

47:03 and 47:10 Starwheel motor error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Check for any visible obstacles restricting the movement of the starwheel assembly, then clear the obstruction.
3. Perform the scan-axis starwheel diagnostic test to troubleshoot the problem further.

Service engineer:

1. Check that the starwheel assembly cable is undamaged and correctly connected to the engine PCA.
2. Replace the starwheel motor. See [Starwheel Motor on page 387](#).
3. Replace the engine PCA. See [Engine PCA on page 314](#).

47.5:10 Problem at the starwheel lifter motor end of the travel sensor

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Check for any visible obstacles restricting the movement of the starwheel assembly, then clear the obstruction.
3. Perform the scan-axis starwheel diagnostic test to troubleshoot the problem further.

Service engineer:

1. Check that the starwheel lifter sensor cable is undamaged and correctly connected to the engine PCA.
2. Replace the starwheel lifter sensor. See [Starwheel Motor on page 387](#).
3. Replace the engine PCA. See [Engine PCA on page 314](#).

48:00 PRS Actuator system failure

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Perform the scan-axis PRS diagnostic test to troubleshoot the problem further.

Service engineer:

1. Check that the PRS Actuator cable is undamaged and correctly connected to the engine PCA.
2. Replace the printhead-to-paper space solenoid.
3. Replace the engine PCA. See [Engine PCA on page 314](#).

52:10 Drop detector failure

Call agent:

- ▲ Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.

Service engineer:

1. Check that the drop detector cable is undamaged and correctly connected to the service station board.
2. Replace the drop detector. See [Service Station with Drop Detector on page 339](#).
3. Replace the service station. See [Service Station with Drop Detector on page 339](#).

54.4:03 Pinchwheel lifter motor error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Check for any visible obstacles restricting the movement of the pinchwheel assembly, then clear the obstruction.

Service engineer:

1. Check that the pinchwheel motor assembly cable is undamaged and correctly connected to the engine PCA.
2. Replace the pinchwheel lifter motor. See [Pinch Wheel Assembly on page 376](#).
3. Replace the engine PCA. See [Engine PCA on page 314](#).

55:10 Cannot access the line sensor EEPROM

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Perform the carriage test to troubleshoot the problem further.

Service engineer:

1. Replace the line sensor. See [Line Sensor on page 326](#).
2. Replace the carriage PCA. See [Engine PCA on page 314](#).

56:01 Drive roller analog encoder homing failed

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Perform the paper path test to troubleshoot the problem further.

Service engineer:

1. Replace the encoder disk and encoder sensor.
2. Replace the engine PCA. See [Engine PCA on page 314](#).

59.1:09 Two electrical parts have been replaced at the same time

Service engineer:

- ▲ Replace one part at a time, and restart the printer before replacing another.

59.2:00 An unsupported or reused part has been installed

Service engineer:

- ▲ Install only new parts recommended by HP for this printer.

59.3:10 Wrong information stored on CryptoAsic

Call agent:

- ▲ Switch the power off at the rear of the printer, wait two minutes, then switch it back on again.

Service engineer:

- ▲ Escalate the case to Level 3, requesting new CryptoAsic SIM licenses. Update the CryptoAsic SIM with the delivered licenses.

59.4:10 CryptoAsic failure

Call agent:

- ▲ Switch the power off at the rear of the printer, wait two minutes, then switch it back on again.

Service engineer:

1. Reseat the CryptoAsic SIM PCA.
2. Order an CryptoAsic SIM PCA Service Kit. Escalate to Level 3 providing printer Serial Number, Product Number, and the serial number of the CryptoAsic SIM Service Kit. Replace the CryptoAsic SIM PCA. Write in an empty USB the file provided by Level 3. Plug the USB in the printer and reboot. If booting fails, enable diagnostic package with the USB and provide logs to Level 3.
3. Replace the engine PCA. See [Engine PCA on page 314](#).

59.5:19 CryptoAsic type mismatch

Call agent:

- ▲ Switch the power off at the rear of the printer, wait two minutes, then switch it back on again.

Service engineer:

1. Order an CryptoAsic SIM PCA Service Kit. Escalate to Level 3 providing printer Serial Number, Product Number, and the serial number of the CryptoAsic SIM Service Kit. Replace the CryptoAsic SIM PCA. Write in an empty USB the file provided by Level 3. Plug the USB in the printer and reboot. If booting fails, enable diagnostic package with the USB and provide logs to Level 3.
2. Replace the engine PCA. See [Engine PCA on page 314](#).

59.6:19 Printer serial number mismatch

Call agent:

- ▲ Switch the power off at the rear of the printer, wait two minutes, then switch it back on again.

Service engineer:

1. Order an CryptoAsic SIM PCA Service Kit. Escalate to Level 3 providing printer Serial Number, Product Number, and the serial number of the CryptoAsic SIM Service Kit. Replace the CryptoAsic SIM PCA. Write in an empty USB the file provided by Level 3. Plug the USB in the printer and reboot. If booting fails, enable diagnostic package with the USB and provide logs to Level 3.
2. Replace the engine PCA. See [Engine PCA on page 314](#).

59.7:14 CryptoAsic generic error

Call agent:

- ▲ Switch the power off at the rear of the printer, wait two minutes, then switch it back on again.

Service engineer:

- ▲ Order an CryptoAsic SIM PCA Service Kit. Escalate to Level 3 providing printer Serial Number, Product Number, and the serial number of the CryptoAsic SIM Service Kit. Replace the CryptoAsic SIM PCA. Write in an empty USB the file provided by Level 3. Plug the USB in the printer and reboot. If booting fails, enable diagnostic package with the USB and provide logs to Level 3.

60.1:11 Initialization error (cannot read RFID tag)

Call agent:

1. Switch the power off at the rear of the printer, wait two minutes, then switch it back on again.
2. Check the power cord; try connecting it to another power socket.

Service engineer:

1. Check that the RFID device is correctly connected.
2. If the error persists, get the diagnostic package (see [Appendix C: Obtaining the diagnostics package on page 177](#)) and contact Level 3 providing print Serial Number and Product Number.

60.2:17 Initialization error (RFID has incorrect data)

Call agent:

1. Switch the power off at the rear of the printer, wait two minutes, then switch it back on again.
2. Check the power cord; try connecting it to another power socket.

Service engineer:

1. Check that the RFID device is correctly connected.
2. If the error persists, get the diagnostic package (see [Appendix C: Obtaining the diagnostics package on page 177](#)) and contact Level 3 providing print Serial Number and Product Number.

61:01 Incorrect or unsupported file format (advisory)

Call agent:

1. Check whether the printer supports the file format. Formats such as PS, PDF, TIFF, and JPEG are supported by PostScript printers only.
2. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
3. Check the printer's graphic language setting (see the user's guide).
4. Resend the file to the printer.
5. Update the firmware.

61:04.1 PostScript fonts seem to be missing (advisory)

Call agent:

- ▲ Update the firmware to re-install the fonts.

61:04.2 Unknown PostScript ID sent to printer (advisory)

Call agent:

- ▲ Update the firmware.

61:08 Incorrect paper type specified in job (advisory)

Call agent:

- ▲ Change the paper type and resend the job.

61:08.1 Job cannot be printed because it is password-protected (advisory)

Call agent:

- ▲ Resend the job without password protection.

61:08.2 Job contains format errors or incorrect settings (advisory)

Call agent:

1. Ensure that the file format sent is supported by the printer.
2. Resend the job using the Embedded Web Server.

61:09 Unexpected end of job (advisory)

Call agent:

1. Resend the job.
2. Resend the job using the Embedded Web Server.

61:10 Job timed out (advisory)

A slow computer processing complex files can pause for longer than the default printer timeout, in which case some elements of the job may be lost.

Call agent:

1. Increase the I/O timeout using the printer's front panel (see 'Configure network settings' in the user's guide).
2. Resend the job from a faster computer.
3. Resend the job using the Embedded Web Server.
4. Use the "print to file" option in the driver and copy the resulting file to a USB flash drive. Print from the USB flash drive.

63:04 Network interface error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Check that the network cable is correctly connected to the network interface.
3. Update the firmware.

Service engineer:

1. If the printer is blocked showing the system error persistently; check that the network interface card (including the riser) are correctly connected.
2. If the printer is blocked showing the system error persistently; replace the network interface card.



Additional information

After waking up from sleep mode, the printer shows SE 63:04 and sometimes SE 79:04.

First of all, download the latest firmware release from hp.com. In the latest FW, there were improvements for ePrint and Share connectivity.

Follow the steps above to troubleshoot it. If the issue remains, follow this **workaround**:

▲ Disabled ePrint Center:

From the front panel, press , then , then **Connectivity ► HP ePrint Center Connectivity ► Disable**.

The FW team are investigating this issue.

63:10 Network interface error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Check that the network cable is correctly connected to the network interface.
3. Update the firmware.

Service engineer:

1. Check that the network interface card (including the riser) are correctly connected.
2. Replace the network interface card.

63:20 Potential problem in the network interface (advisory)

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Check that the network cable is correctly connected to the network interface.
3. Update the firmware.

Service engineer:

1. Check that the network interface card (including the riser) are correctly connected.
2. Replace the network interface card.

71:03 Out of memory

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Resend the job with one or more of the following changes:
 - Decrease resolution to 300 dpi.
 - Select Economode print mode.
 - Select the **Send job as bitmap** option.



71:08 Insufficient display list

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Resend the job with one or more of the following changes:
 - Decrease resolution to 300 dpi.
 - Select Economode print mode.
 - Select the **Send job as bitmap** option.

72.02 A service calibration should be performed (advisory)

Call agent:

- ▲ To find out which service calibration to perform, print the calibration status. At the front panel, press , then , then **Internal prints > Service information prints > Print calibration status**. Perform whichever calibration is needed.

74:01 Error uploading firmware update file (advisory)

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Ensure that the connection between the computer and the printer is functioning properly.
3. Try again to upload the firmware update file.

74.1:04 Error uploading paper preset (advisory)

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Ensure that the connection between the computer and the printer is functioning properly.
3. Try again to upload the paper preset.
4. Ensure that the version of the paper preset is compatible with the firmware version in the printer. You can check this on the same Web page from which you downloaded the paper preset.

74.08:04 Firmware update problem

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Try again to update the firmware. If necessary, see [Appendix B: Updating firmware in boot mode on page 176](#).
3. Download the firmware file again, as the file that you have may be corrupted.

Service engineer:

- ▲ Replace the front panel. See [Front panel on page 318](#).

76:03 The hard disk is full

Call agent:

1. Remove any unnecessary files from the hard disk using the Embedded Web Server.
2. Run the Hard Disk Recovery Utility.

78:08 Paper does not support borderless printing (advisory)

Call agent:

- ▲ Use a paper type that supports borderless printing.



NOTE: This should be resolved by the customer without assistance.


78.1:04 Paper settings area missing in paper settings file (advisory)

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Update the firmware.


79:03 Generic firmware error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Update the firmware.
3. Information available by pressing  while viewing the system error screen; or, preferably, provide the diagnostic package. See [Appendix C: Obtaining the diagnostics package on page 177](#).


79:04 Generic firmware error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Update the firmware.
3. See [Appendix A: How to troubleshoot system error 79:04 and 79.2:04 on page 164](#).
4. Information available by pressing  while viewing the system error screen; or, preferably, provide the diagnostic package. See [Appendix C: Obtaining the diagnostics package on page 177](#).

79.2:04 Generic Operating System error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Update the firmware.
3. See [Appendix A: How to troubleshoot system error 79:04 and 79.2:04 on page 164](#).
4. Information available by pressing  while viewing the system error screen; or, preferably, provide the diagnostic package. See [Appendix C: Obtaining the diagnostics package on page 177](#).

80:03 Stacker overdrive motor error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Test the cutter. Perform a 'Form Feed & Cut', and verify the paper can be cut. See [The cutter does not cut well on page 68](#).
3. Perform the stacker overdrive motor diagnostic test to troubleshoot the problem further.

Service engineer:

1. Check that the stacker overdrive motor cable is undamaged and correctly connected to the engine PCA.
2. Replace the stacker overdrive motor. See [Overdrive on page 396](#).
3. Perform the stacker overdrive Service Calibration.
4. Check the system initializing the printer and performing a "form feed and cut" action, or printing a small job.

81:01 Paper servo shutdown, possible paper jam

If this error is reported during printer setup, it may indicate that the printer has been dropped during transportation, causing structural damage. Before continuing with the 81:01 troubleshooting, first look for structural damage. To identify the structural damage, look for the following three things:

- Persistent 81:01 error codes
- Platen fingers rubbing on the roller surface, leaving black marks on the roller
- A gap in the platen beam. If there is any gap in the vertical direction between the plastic of the platen and the metal side plate, then the chassis is damaged and the printer cannot be repaired.

If no structural damage, continue with these steps:

Call agent:

1. Check for any visible obstacles restricting the movement of the drive roller. If there is a wrinkled mass of paper inside the paper path, lift the pinchwheels and clear the obstruction.
2. Perform the paper drive diagnostic test to troubleshoot the problem further.


Service engineer:

1. Check the connections on the engine PCA; the paper advance drive is connected to the connector labeled Paper Motor.
2. Adjust the encoder disc and motor mount configuration using the paper advance drive installation instructions.
3. Replace the paper advance drive.


Additional rework (Service engineer)

We have detected that some printers have bad encoder sensor PCA positioning and due to this manufacturing issue, report SE 81:01 on the front panel.

If after reviewing the possible paper obstacles and performing the paper drive diagnostic (troubleshooting for the call agent), the printer still shows SE 81:01, a service engineer should check the position of the encoder sensor PCA.

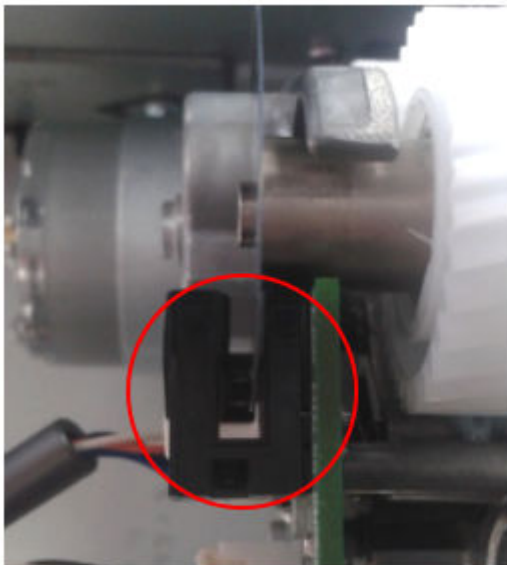

*** INCORRECT POSITION**

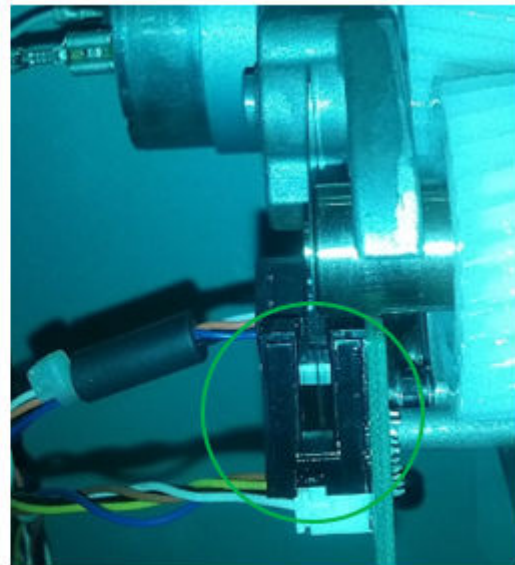

*** CORRECT POSITION**

As can be seen in the images above, the encoder must be positioned in the middle of the detection zone without contacting the sensor. Wrong encoder positioning will lead the printer to SE 81:01.

Once the issue has been detected, the service engineer should adjust the encoder correctly and the issue will be solved.

If the encoder is correctly positioned and 81:01 is still appearing, the root cause could be another one, unrelated to this manufacturing issue. In that case, escalate a case to GBU so that it can be thoroughly investigated.

86:01 Scan axis servo shutdown, possible paper jam

Call agent:

1. Open the window and check for any visible obstacles restricting the movement of the carriage assembly. If there is a wrinkled mass of paper inside the paper path, lift the pinchwheels and clear the obstruction.
2. Turn off the printer and unplug the power cord. Try to move the carriage manually. Check that the cutter disengages correctly and that the carriage is not blocked by the service station.
3. Perform the scan-axis diagnostic to obtain further information on the problem.


Service engineer:

1. Check the integrity and tension of the carriage belt. If the belt is damaged, replace it.
2. Lubricate the scan axis.
3. Perform a Encoder Strip verification and check it runs successfully.


Additional rework procedure for Service engineer:

Prior to installing Cutter X kit (CR357-67007) please manually readjust encoder strip slightly up as shown below:


1. Partially unfasten screws from Encoder Strip Spring to allow movement of it:

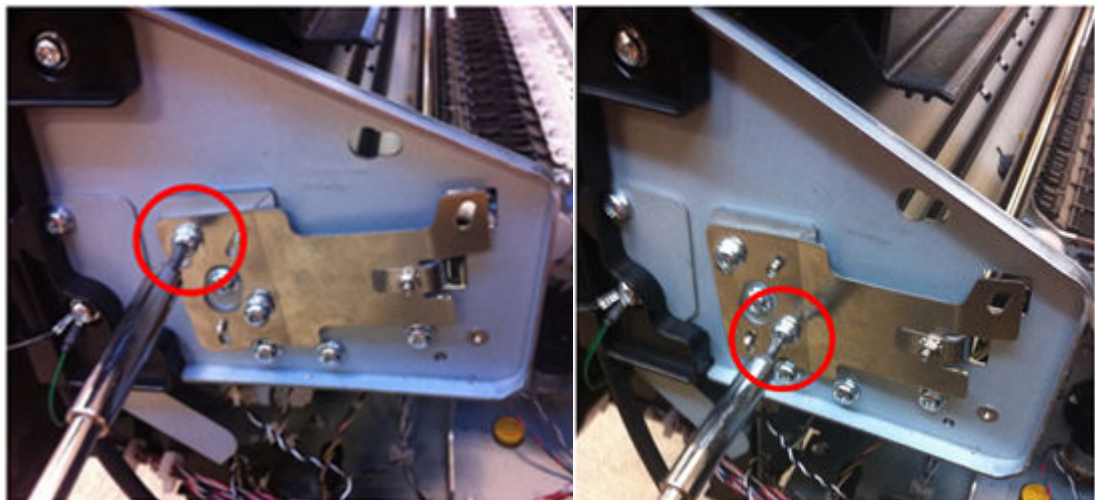

2. Slightly move Encoder Strip Spring up.

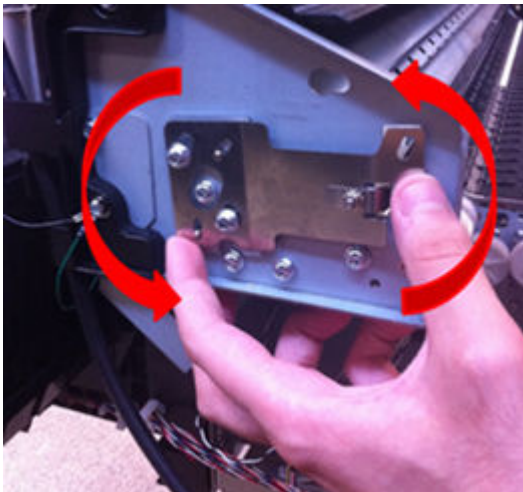

3. Tighten Encoder Strip Spring screws.

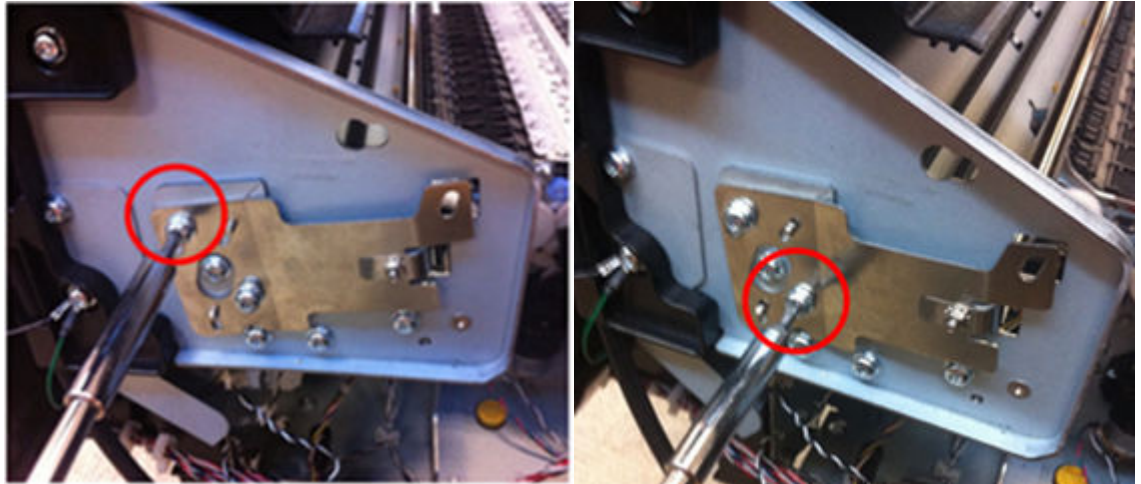

4. Launch SAX Diagnosis.
5. Launch Cutter Diagnosis.

If SE86:01 is still occurring, please readjust again.

87:01 Problem reading the scan-axis encoder (advisory)

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Reconnect the power cord, then turn on the printer.
2. Ensure that the encoder strip is clean. If it is dirty, clean it, paying special attention to the area near the service station.
3. Replace the carriage PCA. See [Engine PCA on page 314](#).

89:03 Stacker ramps motor error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Remove all paper from the stacker and basket.
Reconnect the power cord, then turn on the printer.
2. Perform the stacker ramps motor diagnostic test to troubleshoot the problem further.

Service engineer:

1. Perform the Stacker Ramps Test. In the Diagnostics menu, select **Stacker Ramps**.
2. The product starts the Stacker Ramps PWM control test to check the subsystem. The Front Panel displays the following messages:
 - a. **Initializing.**
 - b. **Performing movements.**

3. Press **OK** to end the test and restart the product.
 - ▲ If it fails try to manually unblock the ramps. See [How to manually move Stacker Ramps on page 429](#).
4. Check that the stacker ramps motor cable is undamaged and correctly connected to the engine PCA.
5. Replace the stacker ramps motor. See [Ramps Motor on page 422](#).

90:03 or 90.0:03 Diverter valves motor error

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Remove all paper from the stacker and basket.
Reconnect the power cord, then turn on the printer.
2. Make sure customer has FW release MRY_03_00_xx or newer.
3. Perform the output valve test to troubleshoot the problem further.
4. Perform the output valves calibration to check system performance, and troubleshoot further.

Service engineer:

1. Check that the diverter valves motor cable is undamaged and correctly connected to the engine PCA.
2. Replace the valves motor and sensor. See [Valves Motor on page 404](#).
3. Perform the diverter valves Service Calibration
4. If the error persists, disassemble the stacker, and perform the output valves test in order to see if the valves are able to move without problems (ignore the result of the test). See [Output Valve Test on page 192](#).
5. If the valves are moving properly, replace the stacker. See [Stacker on page 405](#).
6. Perform the diverter valves, stacker overdrive Service Calibrations.
7. Check the system, initializing the printer, and performing a "form feed and cut" action.

90.1:03 Diverter valves motor error, valves stalled in High position

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Remove all paper from the stacker and basket.
Reconnect the power cord, then turn on the printer.
2. Perform the output valve test to troubleshoot the problem further.
3. Perform the output valves calibration to check system performance, and troubleshoot further.

Service engineer:

1. Check that the diverter valves motor cable is undamaged and correctly connected to the engine PCA.
2. Perform the diverter valves Service Calibration

3. If the error persists, disassemble the stacker, and perform the output valves test in order to see if the valves are able to move without problems (ignore the result of the test). See [Output Valve Test on page 192](#).
4. If the valves are moving properly, replace the stacker. See [Stacker on page 405](#).
5. Perform the diverter valves, stacker overdrive Service Calibrations.
6. Check the system, initializing the printer, and performing a "form feed and cut" action.

90.2:03 Diverter valves motor error, valves stalled in Low position

Call agent:

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
Remove all paper from the stacker and basket.
Reconnect the power cord, then turn on the printer.
2. Perform the output valve test to troubleshoot the problem further.
3. Perform the output valves calibration to check system performance, and troubleshoot further.

Service engineer:

1. Check that the diverter valves motor cable is undamaged and correctly connected to the engine PCA.
2. Replace the valves motor and sensor. See [Valves Motor on page 404](#).
3. Perform the diverter valves Service Calibration
4. Check the system, initializing the printer, and performing a "form feed and cut" action.

93.0.n:10 Ink pressure error in first test during in Printhead filling for color n

n indicates the failing color:

- n=0 stands for photo black
- n=1 stands for gray
- n=2 stands for matte black
- n=3 stands for cyan
- n=4 stands for magenta
- n=5 stands for yellow

Call agent:

- ▲ If no SE 93.2.n:10 appears it means that the issue was fixed after the customer reseated the printhead.

93.1.n:10 Ink pressure error in Second spitting test during in Printhead filling for color n

n indicates the failing color:

- n=0 stands for photo black

- n=1 stands for gray
- n=2 stands for matte black
- n=3 stands for cyan
- n=4 stands for magenta
- n=5 stands for yellow

Call agent:

- ▲ During the tube filling, the first spitting test with the printhead failed the temperature check in color n. If no SE 93.3.n:10 appears it means that the issue was fixed after the customer reseated the printhead.

93.2.n:10 Temperature error in First test during in Printhead filling for color n

n indicates the failing color:

- n=0 stands for photo black
- n=1 stands for gray
- n=2 stands for matte black
- n=3 stands for cyan
- n=4 stands for magenta
- n=5 stands for yellow

Call agent:

1. After the customer reseated the printhead, the printer failed in the second test of ink pressure for color n. This means that color n in the printhead might not be filled with ink, or the tubes are leaking.
2. Run primer and Ink Delivery System tests, and troubleshoot accordingly.
3. If tests run successfully:
 - a. Moisten tube septums with water.
 - b. Upgrade firmware.
 - c. Purge tubes again with new printhead and new supplies (60ml min per color).

93.3.n:10 Temperature error in second spitting test during in Printhead filling for color n

n indicates the failing color:

- n=0 stands for photo black
- n=1 stands for gray
- n=2 stands for matte black
- n=3 stands for cyan
- n=4 stands for magenta
- n=5 stands for yellow

Call agent:

During the tube filling, after the customer reseated the printhead, the second spitting test with the printhead failed the temperature check in color n. This means that color n in the printhead is not filled with ink.

1. Depending on the colors failing the test, troubleshoot according to:
 - a. If colors 0-1-2 are missing, issue might be due to Service Station Side Ink Supply Station. Run Ink delivery System test.
 - b. If colors 3-4-5 are missing, issue might be due to Front Panel Side Ink Supply Station. Run Ink delivery System test.
 - c. If colors 0-1-3-4 are missing, issue might be with upper primer. Run primer test.
 - d. If colors 2-5 are missing, issue might be due to lower primer. Run primer test.
 - e. Any other combination of colors might point to a printhead insertion problem. Run primer and Ink Delivery System tests and troubleshoot accordingly.
2. If tests run successfully:
 - a. Moisten tube septums with water.
 - b. Upgrade firmware.
 - c. Purge tubes again with new printhead and supplies (60ml min per color).

Appendix A: How to troubleshoot system error 79:04 and 79.2:04

Introduction

The system error 79:04 is a generic firmware error (equivalent to a blue screen in Windows). It's the system error that the printer will display when an unknown exception occurs that cannot be identified as relating to any specific subsystem of the printer.

Since this is a generic error, there can be multiple causes behind it. This document will cover the most probable causes behind a system error 79:04 and will recommend the most efficient troubleshooting steps to resolve customer issues.

It is important to mention that, although 79:04 system errors can be caused by a hardware malfunction, the vast majority of 79:04 system errors are pure software or firmware issues. Before doing anything else, you are recommended to try the following general-purpose solutions.

1. Update the printer's firmware to the very latest available firmware version, even if the printer appears to be running the latest firmware already.
2. Restore the factory settings from the front panel's Setup menu.

If these do not solve the problem, continue reading about other possible solutions below.

Possible causes

Since the 79:04 system error is a generic error, the number of possible causes behind it is large. The majority can be grouped, however, into the following groups.

Job-related 79:04

A specific print job that is not correctly formatted for the printer or that is not correctly processed by it can trigger a 79:04 system error.

The incorrect format or processing can come from two sources:

- Incorrect commands in the job itself. For example, a PS job with some commands that do not have the correct PS format.
- Issues applying to the settings in the job

Symptoms

79:04 errors caused by a print job always have the same symptoms:

1. The job is received by the printer and starts to process.
2. In the middle of the processing, the printer stops and displays 79:04.
3. The printer will display the 79:04 system error again after restart. This is due to the fact that the printer will try to reprint the job, which is pending in the queue, after restart.
4. After the second restart, the printer will start up normally
5. If the same job is sent again, it will always produce a 79:04 system error

These types of 79:04 system errors are normally caused by jobs that have been generated by 3rd party applications (RIPs, 3rd party drivers, files exported by an application to PS, PDF, HP-GL/2, RTL, ... or any other format supported by the printer). Jobs generated by HP drivers will not normally generate 79:04

system errors, since the output that our drivers generate is very controlled and has been designed taking into consideration the characteristics of our printer's language interpreters.

There is an exception to this general rule: there are certain applications that can generate their own PS code (Adobe PhotoShop, Adobe Illustrator, Adobe Acrobat, Corel Draw, Freehand, QuarkXpress, ...). When used with a PS driver, these applications generate the output PS themselves, instead of using the driver's rendering capabilities. This is known as PostScript pass-through. So, when using an HP PostScript driver together with an application that has PS passthrough capabilities, the PS code that comes into the printer has not been rendered by the HP driver, and, should the source file contain any PS commands that are not correctly processed by the printer, a 79:04 system error could occur even though an HP driver is being used.

Solutions and workarounds

When a job consistently generates a 79:04 system error, it is either because of a issue in the printer's firmware or because of a defect in the job itself (when it has been generated by 3rd-party software). In order to identify the cause and find out a solution, these issues should always be immediately escalated to the GBU through the GCC. However, there are some workarounds and short-term solutions that can be tried in order to get the customer up and running in the shortest possible time:

1. Send the job using a variety of different settings. Many times, the issue is caused by a combination of the job contents combined with some specific setting(s).
2. If the customer is sending the file directly to the printer, try using the HP driver instead.
3. If the issue is occurring when printing through the HP PostScript driver from an application with PS passthrough, try changing the options in the application so that it prints PS as raster (the option is typically located in the "Advanced" options of the application's printing dialog).
4. In some cases, there may be an unfortunate interaction between the particular job and the I/O connection used to send that job to the printer. Try sending the same job using a print queue that uses a different type of connection. For example, use a network connection instead of USB, or use the LPD network printing protocol instead of port 9100.

Data-related 79:04

HP Designjet printers have hard disks and non-volatile memories that contain databases and files that can be modified with user data. Some examples include:

- The printer's queue
- The hard drive partitions that contain user jobs
- The database that stores the printer settings
- The database that stores accounting information

Some of this data is accessed by the printer at start-up, and some others are accessed as needed.

If any of this fields contains corrupt data or data with characters or values that cannot be correctly processed by the printer, a 79:04 system error may occur.

Symptoms

There are two different types of symptoms for data related 79:04 system errors:


1. When the corrupt data are accessed during start-up:

- a. The printer will display a 79:04 during the start up process
 - b. Switching the printer off and on again will not solve the issue. The printer will continue displaying the 79:04 system error until the corrupt data have been cleared through a service procedure
2. When the corrupt data are accessed during normal printer operation:
- a. The printer will start up normally
 - b. When the data are accessed (for example while printing, while navigating the queue or when changing some settings), the printer displays a 79:04 system error
 - c. The printer can restart normally
 - d. When the data are accessed again (typically, under the same conditions as in step “b”), the 79:04 system error is displayed again

Solutions and workarounds

Data-related 79:04 errors are often resolved by means of hardware intervention. Since data are stored in physical components (RAM, EEROM and Hard Disk), replacing these components with new ones that are empty usually solves the problem. However, there are quicker and more effective solutions to these types of errors:

1. Clear all information that has been introduced by the user using the standard tools available in the printer.
 - a. Delete all jobs from the queue (from the front panel or the EWS).
 - b. Reset to factory defaults to clear the user’s configurations and calibrations.
 - c. Delete any non-standard paper preset in the printer (both the ones that have been created by the user and the ones that have been installed as OMES profiles through the EWS or the HP Utility).
2. If step 1 did not resolve the issue, you can use Service Tools to clear additional information that could be causing the issue.
 - a. Start the printer in Diagnostics Boot Mode.
 - b. Perform an EEROM reset.
3. If step 2 did not resolve the issue, it is possible to run a recovery of the hard disk.
 - a. Start the printer in Diagnostics Boot Mode.
 - b. Perform a Hard Disk Recovery. This will erase data from the hard disk and reinstall the current firmware. It may take up to half an hour.
4. If step 3 did not resolve the issue, you can check the hard disk’s file system.
 - a. Start the printer in Diagnostics Boot Mode.
 - b. Perform a File System Check. This will fix any error in the file system structure. It may take a few minutes, or up to an hour, depending on the state of the hard disk.

 **IMPORTANT:** It is possible that the corrupt data came to be in the printer as a consequence of some activity in the customer’s workflow. In this case, it is possible that the issue will happen again. In these cases, it is very important to understand the sequence of events in the customer’s workflow that led to the error occurring. Once the error can be traced in the customer’s workflow, escalate the issue to the GBU (through the GCC). This is done to implement any changes in the printer’s firmware that can prevent these issues occurring again.

Network-related 79:04

Most HP Designjet printers have built-in networking capabilities. Network settings can be set manually, but in the majority of cases, they are obtained automatically from the printer. These settings include many different fields, such as IP address and subnet mask, available gateways, host and domain names, etc.

In some cases, there can be issues in the firmware that can cause a certain value in one of these fields to be interpreted incorrectly, and this can lead to a 79:04 system error.

Symptoms

There is no single set of symptoms that can absolutely pinpoint a network related 79:04 system error. However, the following guidelines can be applied:

- It can happen when the printer starts up or when accessing the Network Configuration section of the front panel or Embedded Web Server. It can also occur apparently randomly when the printer is connected to the network. It can also occur any time a particular network action is performed, for example when print jobs are sent to the printer, or when connecting to the Embedded Web Server.
- In all these cases, repeating the action after restarting the printer with the LAN cable disconnected does not cause the 79:04 error to occur.

Solutions and workarounds

In the majority of cases, these issues are due to an issue in the printer's firmware. As soon as the conditions in which the issue happens are understood, it should be escalated to the GBU through the GCC. However, the following short-term solutions and workarounds can help the customer to get up and running in the shortest possible time:

1. Disconnect the network cable in order to restart the printer and change network settings.
2. Try resetting the embedded networking settings or Jetdirect settings.
3. In the Network configuration menu in the Front Panel, disable any protocols that you are not using, including IPv6, IPSec, SNMP and WebServices.



NOTE: Disabling SNMP or WebServices means that customers may not be able to see printer status information; and Windows and Mac OS print-queue installers will require the user to specify the printer's IP address and model manually.

4. If the above steps do not work, try using a different type of print queue. For example, if the problems occur when printing to a Port 9100 Socket print queue, try using the LDP protocol instead, or USB. To do this, create a new print queue of the type required and try printing using the new queue instead.
5. If the above steps do not work and the customer is using the printer's embedded LAN connection, try using an accessory Jetdirect card instead. Similarly, if the customer is having problems using an EIO Jetdirect card, try disconnecting the Jetdirect card and using the embedded networking.

In most cases, network problems that seem to occur randomly (when the printer is not being sent print jobs) are caused by an interaction between some other devices in the customer's network and the printer. Isolating the printer from other devices in the network as much as possible by connecting the printer to a private network or a different network subnet may help the customer continue working until the root cause of the problem is understood and solved.

User-interaction-related 79:04

In some cases the printer may not react as expected when a certain set of conditions coincide. In these cases, if the printer doesn't know how to react, it may simply display a 79:04 system error and force a restart.

These errors will most likely only happen in very specific corner cases that have not been identified during the development or the qualification of the printer, so normally, they do not severely impact the customer, as they do not affect their regular working flows.

Symptoms

- The symptoms here are as numerous as the number of possible interactions between the user and the printer. In any case, it's possible to identify the steps that caused the error to occur and avoid them, as the steps will always be the same with no variance.



IMPORTANT: An major element in determining the error is what the state the printer was in at the time the error was displayed. Actions the user has made when the printer is drying, for example, can produce an error, whereas the same action when the printer is doing something else (or is idle) may not produce any errors.

Solutions and workarounds

The recommended plan of action in these cases is to identify the previous steps that caused the error and:

1. Escalate the issue to the GBU through the GCC in order to have it corrected in the firmware.
2. Recommend to the customer that they try to avoid the same steps to prevent the issue
3. If the conditions that cause the error are in the customer's regular workflow, try to identify a different way of achieving the same result out of the printer.

Random 79:04: Concurrency issues and memory leaks

Some 79:04 errors happen randomly when the printer is being heavily used. However, it's impossible to find a single set of conditions that reproduce the problem. It just happens from time to time, without a defined pattern.

These random 79:04 can have two different types of root causes:

- Memory leaks: before a program is executed, it allocates the memory it will need. After the execution is complete, the allocated memory is freed to be used by other programs. If the allocation or the release of the memory are not properly programmed, every time the program is executed some memory will be incorrectly labeled (either as used or as free). This is known as a memory leak. When a program with a memory leak is executed a lot, the memory becomes progressively full (since it is not properly freed). When the leak becomes too big, the printer is left 'out of memory' to execute new processes and a 79:04 is triggered
- Concurrency issues: there are certain resources that can be accessed by multiple programs or by multiple executions of the same program (what is known as multiple threads). Access to these resources must be correctly controlled to prevent unexpected behavior. Issues caused by an incorrect control of these resources are concurrency issues.

In the following you have a simple example: let's imagine that there is a counter that controls the communication between the Jetdirect card and the printer's firmware. Whenever a new packet of information is sent by the Jetdirect card to the printer, the counter increases. When the printer receives the packet and processes it correctly, the counter decreases. Another process checks the counter from time to time to see its value and take conclusions from it. If the counter is near 0, it means that the printer is processing correctly, and if it grows too big, it may mean that there is a bottleneck somewhere and maybe the Jetdirect card throughput is decreased to control its speed to the printer. However, if the access to this counter is not properly controlled, undesirable effects may happen: in a real environment, a Jetdirect card processes thousands of information packets per second, so this counter is updated frequently, both by the Jetdirect and the printer. If at a certain point the Jetdirect and the printer try to access the counter at the same time and the code is not prepared to handle this, it may happen that the Jetdirect cannot increase the counter because the printer is writing to it, and what's worse,

that it does not realize this fact. If this happens a few times each second, it may happen that the counter is decreasing faster than it's increasing and that at a certain point it has a negative value. And then, what will the process that is checking this counter do? Most likely, the process will not be prepared to react to a negative value and will launch an exception that will trigger a 79:04 system error.

Symptoms

This type of 79:04 always occurs in heavy load conditions, so the symptoms will always be similar to this pattern:

- A printer that is being heavily used (printing a project or in a reprographics environment) produces 79:04 errors randomly, forcing the user to restart.
- After restarting, the printer can be used without any issues for an extended period of time, but if the workload is consistently high, a random error will occur again.
- The error can never be associated with a specific file. The file that was being printed when the error occurred the last time can be printed without issues after restart. And a file that has been printed without issues several times can trigger the error in the future.
- This error is very dependant of the workflow the customer has. The most common user workflows have been extensively tested both by HP and by our beta sites, so it is highly unlikely to see random 79:04 issues in these cases. These random issues tend to occur in very specific corner cases, and cannot be reproduced unless the exact conditions of the workflow are replicated. They normally happen when sending files generated by external applications (RIPs, 3rd party drivers, etc.)

Solutions and workarounds

Random 79:04 errors are, by far, the most complex ones to diagnose and to fix. The only solutions available in these cases are:

1. Run the Hard Disk Recovery utility.
2. Identify the root cause (either in the files or in the firmware) and fix it in the code, which requires the intervention of the GBU.
3. Test any options available to modify the customer's workflow and see if any combination of them solves the issue.

In both cases, a profound understanding of the customer's workflow is necessary. In particular, the information that is needed is:

- Front panel settings
- Application that is being used; RIP or driver that is being used
- Application/RIP/driver settings
- Type of output files this application, RIP or driver is generating
- Some sample files that are representative of what the customer is using
- Operating system
- Method of connection to the printer
- A description of the normal flow when the issue occurs and the typical frequency of occurrence (for instance, once every hour when sending several files non-stop, each of them with multiple copies)

You are recommended to use the Diagnostics Package to obtain this kind of information.

With this information, the environment can be replicated in order to try to find workarounds. This is also the information that will be needed at the GBU to investigate and fix the root cause of this issue once it is escalated.

Hardware-related 79:04

Hardware is, by far, the least likely cause of a 79:04 system error. Replacing hardware components does not normally fix the issue and increases the total turn around time in finding a workable solution.

In some cases, a failure in a component in the printer's electronics may cause a 79:04 system error, since the printer's electronics are involved in the execution of the firmware and the processing of jobs. It needs to be noted, however, that hardware failures in the electronics tend to produce specific system errors that point directly to the component that is failing.

Some hardware problems that could cause the 79:04 error are:

- Defective clusters on the hard disk. If these clusters are used to execute the firmware or to process a job, they may produce a 79:04. It needs to be noted however, that most 79:04 errors that are resolved by a hard disk replacement are in fact, data related 79:04 errors that could have been solved more efficiently and quickly following the other steps.
- Defective memory segments. If the RAM memory has some defective segments, a 79:04 may occur when these segments are used.
- Intermittent defects in the electronic components that are involved in the processing of a job: carriage PCA, trailing cable, formatter, and engine PCA. This is a highly unlikely cause, since defects in these components will produce subsystem specific errors.

Symptoms

There's no single set of symptoms behind hardware-related 79:04 system errors. The most usual ones, however are:

- 79:04 during startup. Restarting the printer may or may not solve the problem
- 79:04 while processing or printing a job. Restarting the printer and printing the same job does not always produce the error.

Solutions and workarounds

In the following procedure perform each step as it appears in the list and only move on to the next step once you are sure the 79:04 error has not been cleared:

1. Restart the printer in Diagnostics Boot mode and execute the service tests to validate the functionality of all the electronics components.
 - Perform the troubleshooting for "data related 79:04" system errors, refer to [Appendix A: How to troubleshoot system error 79:04 and 79.2:04 on page 164](#).
2. Replace the hard disk drive.
3. Replace the replace the formatter.
4. Escalate the issue before replacing any additional parts.

Troubleshooting based on symptoms

This section describes which troubleshooting steps to perform for a 79:04 system error based on the symptoms of the issue. Perform each step as it appears in the list and move on to the next step only once you are sure the 79:04 error has not been cleared.

Front panel displays 79:04 at startup

1. Restart the printer twice. If the system error has been caused by a job because it is in an incorrect format, restarting twice will clear the error (the first time after restart, the printer will attempt to print the job again, and this will cause the error to reoccur). If restarting the printer twice solves the issue, then it is an issue related to the job and you should refer to the section on a Job Related SE79:04.
2. Upgrade the printer's firmware. Even if the currently installed firmware version is the latest one, re-install it. Since the printer cannot start normally, you will need to upgrade the firmware while restarting the printer in Diagnostics Boot Mode. For this, a special file and a special upgrade process will be needed. For more information, see [Appendix B: Updating firmware in boot mode on page 176](#).
3. Disconnect the network cable and restart the printer. If this solves the problem, then it is a network related 79:04 and you should follow the guidelines for this type of 79:04.
4. Remove all cartridges, printheads and printhead cleaners (if available). Unload the paper. Restart the printer. If the printer can start normally, insert the consumables one by one until you isolate the one that is causing the error. Do **not** insert any of the replaced consumables in another printer
5. Restart the printer in Diagnostics Boot Mode and perform the "Electronics test". If an electronic component is identified as faulty, replace it.
 - Restart the printer in Diagnostics Boot Mode and Reset the EEROM. If the issue is solved by this, this is a data-related 79:04 system error and you should follow the guidelines for this type of error.
6. If the unit has been used for some time and suddenly has started to show this behavior, replace the hard disk drive.
7. If the issue is new and the issue happens since the first startup, do **not** replace the hard disk drive.
8. If none of the previous steps solved the issue, escalate the issue with the following information:
 - Unit information: S/N, P/N, accessories
 - Conditions where the problem occurs and conditions prior to the first occurrence of the problem
 - The results of the previous 8 steps
 - The System Error detailed information (this can be obtained by pressing CANCEL + Down)
 - In order to obtain the diagnostic package, see [Appendix C: Obtaining the diagnostics package on page 177](#).

Front panel displays 79:04 during printer operation, not while sending jobs

1. Restart the printer.
2. Upgrade the printer's firmware. Even if the currently installed firmware version is the latest one, re-install it.
3. Reset the printer to factory defaults
4. In order to narrow the scope of the issue, try the following:

- a. Disable the queue.
 - b. Disable any unused network protocols.
 - c. Disable SNMP and WebServices (if they are available in the printer).
 - d. Disable “Sleep mode” from the Service Utilities menu.
 - e. Delete any paper presets that you may have uploaded or created using the printer's spectrophotometer.
5. Restart the printer in Diagnostics Boot Mode and perform the “Electronics test”. If an electronic component is identified as faulty, replace it.
 6. Restart the printer in Diagnostics Boot Mode and Reset the EEROM. If the issue is solved by this, this is a data-related 79:04 system error and you should follow the guidelines for this type of error.
 7. Format the hard disk drive. To do so, you will need to start the printer normally, enter the Service Utilities menu and then the Secure Disk Erase option. Set the Erase method to “Fast Erase” and then perform the disk erase process. This will take 45–75 minutes and will erase all user information from the disk, resolving any issue caused by corrupt data. After the erase process, a firmware update will be required. If this solves the issue, this is a data-related 79:04 system error and you should follow the guidelines for this type of error.
 8. Try to identify the combination of settings or actions that led to the system error and try to reach the same result with a different combination. Escalate the issue to fix the original problem.
 9. If none of the previous steps could solve the issue, escalate it with the following information:
 - Unit information: S/N, P/N, accessories
 - Conditions where the problem occurs and conditions prior to the first occurrence of the problem
 - The result of the previous 8 steps
 - The printer information pages (either printed and faxed or obtained through the Embedded Web Server)
 - The System Error detailed information (it can be obtained by pressing CANCEL + Down)
 - In order to obtain the diagnostic package, see [Appendix C: Obtaining the diagnostics package on page 177](#).

Front panel displays 79:04 while printing a single job

The error happens after a single job is sent. It's easy to identify which job that has produced the error, since every time that this same job is sent, the error is replicated.

1. Restart the printer twice (after the first restart, the printer will show the 79:04 system error again, since the printer will attempt to reprint the last job in the queue, which is the one that caused the issue)
2. If you are using an HP driver, update the driver to the latest version
3. Upgrade the printer's firmware. Even if the currently installed firmware version is the latest one, re-install it. Send the job using different print settings. The following ones can be helpful:
 - a. Try sending the job without selecting a paper profile in the driver
 - b. Try changing the Image Quality settings

- c. If you are using the HP-GL/2 driver, try the option “Send job as bitmap”
 - d. If you are using the PS driver, try using the HP-GL/2 driver instead
 - e. If you are using the PS driver from an Adobe application (or any other application that can handle PS), try changing the application’s print settings so that the PS is generated as Raster.
4. Try the following front panel settings:
- a. Change the Print Language option from “Automatic” (which is the default setting) to the language that is being printed (PS, HP-GL/2, ...)
 - b. Queue = OFF
 - c. Start Printing = After processing
 - d. For PS SKUs, try changing the encoding setting (“Automatic” by default) to Binary or ASCII
5. If you are using a 3rd-party application that does not print through the HP driver, try modifying the printing workflow by:
- a. Using an HP driver
 - b. Changing the settings in the application’s printing dialog
6. If you are using an accessory Jetdirect card, try using the internal network connector or USB (if available).
7. Escalate the issue, providing the following information:
- Unit information: S/N, P/N, accessories
 - Conditions where the problem occurs and conditions prior to the first occurrence of the problem.
 - The result of the previous 7 steps
 - The printer information pages (either printed and faxed or obtained through the Embedded Web Server)
 - The system error detailed information (it can be obtained by pressing CANCEL + Down)
 - Information on the workflow:
 - Operating system
 - Application
 - Driver
 - Settings in the driver and the application
 - Settings in the printer
 - Connection method and settings
- The original file along with the information on how to reproduce the issue
- A print to file that can reproduce the issue
- In order to obtain the diagnostic package, see [Appendix C: Obtaining the diagnostics package on page 177](#).

Random 79:04 during continuous printing

The error does not happen with a single job. It happens randomly during continuous printing, normally while the printer is managing a heavy load (printing a project or in a reprographics environment).

This type of error is caused either by memory leaks or by concurrence issues in the printer's firmware. They normally happen in unusual environments in which these memory leaks or concurrence issues that have not been detected during qualification have occurred. These issues cause the printer to crash at a completely random moment during printing, and are not associated to a specific job.

Because of this, troubleshooting these issues is normally quite complex.

1. Restart the printer twice (after the first restart, the printer will show the 79:04 system error again, since the printer will attempt to reprint the last job in the queue. If the issue continues occurring randomly, continue troubleshooting)
2. If you are using an HP driver, update the driver to the latest version
3. Upgrade the printer's firmware. Even if the currently installed firmware version is the latest one, re-install it.
4. Try restoring the factory default settings from the printer's front panel.
5. Try the following changes in the workflow:
 - a. Change the Print Language option in the Front Panel from "Automatic" (which is the default setting) to the language that is being printed (PS, HP-GL/2, ...)
 - b. Queue = OFF
 - c. Start Printing = After processing
 - d. For PS SKUs, try changing the encoding setting ("Automatic" by default) to Binary or ASCII
 - e. If you are using the HP-GL/2 driver, try sending the job as a bitmap
6. If you are using a 3rd-party application that does not print through the HP driver, try modifying the printing workflow by:
 - a. Using an HP driver
 - b. Changing the settings in the application's printing dialog
7. Escalate the issue with the following information:
 - Unit information: S/N, P/N, accessories
 - The printer information pages (either printed and faxed or obtained through the Embedded Web Server)
 - The system error detailed information (it can be obtained by pressing CANCEL + Down)
 - Information on the workflow:
 - Operating system
 - Application
 - Driver
 - Settings in the driver and the application

- Settings in the printer
- Connection method and settings
- Exact information on how to replicate the environment that reproduces the issue, including some example files that can be sent to the printer to replicate a heavy load environment. These files will need to be:
 - Original application files, if the issue happens printing from an application through our driver
 - Print to files if the issue happens printing from a 3rd-party application
- Information on the approximate frequency of the occurrence of the issue
- In order to obtain the diagnostic package, see [Appendix C: Obtaining the diagnostics package on page 177](#).

Appendix B: Updating firmware in boot mode

If the printer is displaying a 79:04 system error during start up and will not start normally, then services like the Embedded Web Server will not work.

If it is not possible to perform a firmware upgrade using the normal procedures (for instance, if there is a System Error and the Embedded Web Server is unavailable), it is possible to perform an emergency firmware upgrade using a USB flash drive. Follow these steps:

1. Copy a valid FMW firmware file onto a USB flash drive. This file is provided in HP Designjet Online. Remove all other contents from the flash drive.
2. Turn off the product.
3. Connect the USB flash drive to the USB host port in the front panel.
4. Turn on the product, and follow the front panel instructions.

Appendix C: Obtaining the diagnostics package

Printers keep an internal log of their own actions. When a system error occurs, the diagnostic package may help to find the cause and the solution. By default, whenever it restarts, the printer deletes the current log and starts a new one, in order to avoid using a lot of hard disk space.

There are three types of diagnostic package:


- Diagnostic package (reduced level)
- Extended diagnostic package (medium level)
- Extended diagnostic package from USB (verbose level)


There are two ways of retrieving the information:

- From the front panel with a USB flash drive (all levels)
- From the Embedded Web Server (reduced or medium level)

 **NOTE:** If the extended diagnostic package is available, it will be visible from the Embedded Web Server.

When the information has been obtained, it should be attached to the customer case.

 **NOTE:** The extended diagnostic package enabled from USB is always preferred as it includes extra level logging.

 **NOTE:** Once the case is solved, the extended diagnostic package must be disabled in order to preserve disk space.

Front panel USB method

This method works only with a standard USB flash drive (without a flash drive, use the Embedded Web Server method). The Front Panel USB method has the advantage of working with very minimal printer functionality: just the printer OS and the USB connection. It can work without connectivity and the front panel. The level of logging is more detailed than the extended package that can be enabled from EWS. It is recommended to use the USB method whenever possible.

1. Take a standard USB flash drive, formatted as FAT32.
2. Create an empty file in the USB flash drive (right-click, **New > Text Document**) and name it **pdipu_enable<action code>.log**. You can also find these files attached to this document.

Empty file to load in the USB	Actions
pdipu_enable_elog.log	Enable verbose logging. Printer needs to restart to take effect. The file with "scanner" allows to enable logs for the scanning subsystem in T2500 and T3500.
pdipu_enable_scanner_elog.log	
pdipu_enable_loggz.log	Extract the logs to the USB. After downloading check the size. If it's OKB try downloading with another USB key.
pdipu_enable_loggz_dlog.log	Disable the verbose logging. It is important to run this after the case is solved to prevent the disk getting full from logs. The file with "scanner" works for the T2500 and T3500 scanning subsystem.
pdipu_enable_scanner_dlog.log	

3. The recommended flow to get an extended diagnostic package through USB is:

- a. Create an empty file called “pdipu_enable_elog_loggz.log” and copy it in a USB flash drive.
 - b. Plug in the USB and switch on the printer. You will hear the message “Traces are now enabled. You must reboot the printer”. Unplug the USB and reboot the printer.
 - c. After reboot, reproduce the issue.
 - d. Plug again the USB. You will hear the message “Generating diagnostic package, please wait” “You can now detach the USB pen drive”
 - e. The extended diagnostic package has been saved in the USB. Copy it into your computer.
 - f. To disable the logs, erase the information stored previously into the USB, create an empty file caller “pdipu_enable_dlog.log” and plug it into the printer.
4. The printer gives audio messaging detailing the progress. The audio messages available are:
- a. “Generating diagnostic package, please wait.”
 - b. “Diagnostic package successfully complete”
 - c. “Error. Diagnostic package failed”
 - d. “You can now detach the USB pen drive”
 - e. “Traces are now enabled. You must reboot the printer”
 - f. “Generating package without printer.log”
 - g. “Encrypting package”

Embedded Web Server method

- ▲ Access the Embedded Web Server by typing the IP address of the printer in a Web browser. In the **Support** tab, click **Service support** to display the following page.

If the problem persists and is difficult to debug, try the extended diagnostics package. To enable the extended diagnostics package, click **Enable the extended diagnostics package**. The printer needs to be restarted after enabling or disabling the extended diagnostics package.

At any time after enabling the extended diagnostics package, you can download the package and the printer logs by clicking **Download the extended diagnostics package**.


When you have finishing using the extended diagnostics package, remember to disable it; otherwise it could affect printer performance or cause undesirable side-effects.

4 Diagnostics, Service Utilities and Calibrations

- [Introduction](#)
- [Diagnostic Tests and Utilities](#)
- [Service Utilities](#)
- [Service Calibrations](#)

Introduction

This chapter explains how to use the product's diagnostic tests and utilities, and what to do in the event of any failure.

 **NOTE:** If possible, always perform a diagnostic test on a component that you are about to replace, to make sure that is the component that has failed. If the test on that component passes, there is no need to replace it.

Initialization Self Test

Initialization sequences

Whenever the product is switched on, it automatically performs a series of internal self-tests and mechanical initialization sequences. If any part fails, a system error will appear and you should consult [System error codes on page 115](#).

Auto-Diagnostics Test


In the event of a paper or scan-axis jam triggering a system error 86:01, a message will appear on the Front Panel.

After restarting, the product will exercise several electromechanical subsystems involved in Paper or Scan Axis movement. If necessary, you may be asked to move the carriage manually or check whether the main roller is moving. You may also be asked to launch an Auto-Diagnostics Test.

- In the event of a paper jam, if another paper jam occurs during the first 15 paper advance movements after the product restarts, the product will ask you to launch the Paper Axis Auto-Diagnostics.
- In the event of a scan-axis jam, if another scan-axis jam occurs during the first 50 carriage movements after the product restarts, the product will ask you to launch the Scan Axis Auto-Diagnostics.

A final result will be shown with all the collected data.

Phone Support

 **NOTE:** In certain circumstances, a Call Agent can try to troubleshoot the product by requesting the customer to perform a Service Test over the phone. Using this process, it can be determined whether the product requires any on-site maintenance.

Remember that the key combination for the customer to enter the Service Tests and Utilities is the same as the one that the engineer will use.

Diagnostic Tests and Utilities

The following is a list of all diagnostic test and utilities available in the product. For instructions on entering the Diagnostics menu, see [Entering the Diagnostics Menu when booting the printer on page 183](#).

+ [Scan Axis Test on page 183](#)

- Star-wheel lifter
- PRS
- Scan axis
- Cutter

[Paper Drive Test on page 186](#)

[Electronics Module Test on page 187](#)

[Carriage Assembly Test on page 188](#)

[Sensors Test on page 191](#)

[Stacker Empty Sensor Test on page 191](#)

[Output Valve Test on page 192](#)

[Output Valve Calibration on page 192](#)

[Pinches Lifter Test on page 194](#)

[Stacker Ramps Test on page 194](#)

[Stacker Overdrive Test on page 195](#)

[Stacker Jam Sensor Test on page 196](#)

[Stacker Capacity Sensor Test on page 196](#)

+ [Ink Delivery System \(IDS\) Test on page 196](#)

- Ink Delivery System
- Check ink supplies
- Check leakage

+ [Service Station Test on page 199](#)

- Service station
- Primers

[Enable I/O Interfaces Utility on page 200](#)

[Unit Information Utility on page 200](#)

[EEROM Reset Utility on page 200](#)

[Front Panel Lock Reset on page 201](#)

[Hard Disk Recovery on page 201](#)

[File System Check on page 201](#)

[Enable Special Margin on page 201](#)

[Set margin on page 201](#)

[Enable HP-GL/2 palette options on page 202](#)

[Content thresholds on page 202](#)

[Stacker ramps test on page 202](#)

[Set I/O factory defaults on page 203](#)

Entering the User Diagnostic Menu

1. Go to the printer's Main Menu.
2. Go to the Diagnostics Menu.
3. Type the code "1714."
4. Go to Diagnostic Tests.
5. Allow the printer to reboot.

Printer will remain in "User Diagnostics Menu" until it is setup to go back to Printer mode.




To go back to Printer mode:


1. From "User Diagnostics Menu" go to "Reboot in printer mode."
2. Allow the printer to reboot.

The "User Diagnostics Menu" has a limited set of Diagnostics and allows one to perform only the following actions:


- [Scan Axis Test on page 183](#)
- [Paper Drive Test on page 186](#)
- [Electronics Module Test on page 187](#)
- [Sensors Test on page 191](#)
- [Stacker Jam Sensor Test on page 196](#)
- [Stacker Capacity Sensor Test on page 196](#)
- [Stacker Empty Sensor Test on page 191](#)
- [Output Valve Test on page 192](#)
- [Pinches Lifter Test on page 194](#)
- [Stacker ramps test on page 202](#)
- [Stacker Overdrive Test on page 195](#)
- [Ink Delivery System \(IDS\) Test on page 196](#)
- [Service station on page 199](#)
- [Enable I/O Interfaces Utility on page 200](#)
- [Unit Information Utility on page 200](#)


Entering the Diagnostics Menu when booting the printer


1. Make sure the product is switched off with the **Power** key on the side of the Touch Screen Panel, and **not** with the power switch on the back of the product.
2. Press and release the **Power** key to switch on the product.
3. Wait for the **Home** button to come on.
4. Press the **Home** button; the button acknowledges by flashing.
5. All LED come on. Press and release them, one after another:
 - The Cancel icon 
 - The Home icon 
 - The Help icon 

 **NOTE:** Do not push the icons all at the same time, push each one in the order shown above and release each icon before pressing on the next icon.

6. The 6 buttons on the Front Panel will then blink twice; then wait until the product completes the initialization sequence and shows the **Diagnostics menu**.
7. In the **Diagnostics menu** scroll up and down sliding the finger vertically on the Front Panel and press on the desired option.

 **NOTE:** The Diagnostic Tests and Utilities work in a special mode that does **not** require the full initialization of the product. Therefore, whenever you have finished a test, you **must** power off the product and power on again before trying to print or before executing another test.

 **NOTE:** In some cases a quick press of a button may not be recognized by the product. When pressing a button, be sure to press it deliberately for about 1 second.

 **NOTE:** If the product hangs up during a test, switch the product off and restart from step 1.

Scan Axis Test

The complete Scan Axis test consists of individual tests for the different components related to the Scan Axis. The subsystems included in this assembly are:


- Star Wheel Lifter
- Automatic PRS Adjustment.
- Scan Axis Servosystem
- Cutter


You must perform the Scan-Axis Test after:

- System Error Code 42:XZ.
- System Error Code 47:XZ.
- System Error Code 73:XZ.

- System Error Code 87:XZ.
- System Error Codes related to Scan-Axis shutdown or Carriage jam.

Diagnostic tests also need to be performed after removing or replacing certain product components. If you have removed or replaced product components, check the user guide to see which tests and calibrations you need to perform.

 **CAUTION:** ALL THE COVER SENSORS ARE DISABLED WHEN IN THE SERVICE TESTS MENU. IF THE CARRIAGE IS MOVING IT WILL NOT STOP IF THE SCANNER IS OPEN, SO BE VERY CAREFUL NOT TO PUT YOUR HANDS INSIDE.

 **NOTE:** IF POSSIBLE, ALWAYS PERFORM THIS TEST BEFORE REPLACING ANY COMPONENT OF THE SCAN-AXIS.

Star Wheel Lifter test

The Star Wheel Lifter subassembly is designed to move the Star Wheel support to the up and down positions. This is used to load roll or sheet paper and avoid damage to the Star Wheel caused by paper jams etc.

Perform the Scan Axis - Star Wheel Lifter test as follows:

 **NOTE:** Perform this test with the Printheads and the Tubes System installed in order to get values that can be compared correctly.


1. In the Diagnostics menu, select **Scan Axis**.
2. The Front Panel will display a screen, select **Star Wheel Lifter**.

If there is a failure at any point during the tests, the Front Panel will display the relevant **System Error Code**. To troubleshoot any displayed error codes, see [System error codes on page 115](#).
3. The product then starts the Star wheel lifter PWM control test to check the subsystem. As the test executes the Front Panel displays the following messages:
 - Initializing
 - Checking movement
 - Testing...
4. The Front Panel displays the test results and prompts you to continue by ending the test and restarting the product.

PRS Test

The PRS subsystem is designed to move the carriage assembly between two predetermined vertical positions with respect to the plane of the print platen. This allows different papers of different thicknesses to be used without losing print quality.

Perform the Scan Axis - PRS test as follows.

 **NOTE:** Perform this test with the Printheads and the Tubes System installed in order to get values that can be compared correctly.

1. In the Diagnostics menu, scroll to **Scan Axis** and press on this menu option.
2. The Front Panel will display a screen, select **PRS**.

3. In the **Scan Axis** submenu, scroll to **PRS** and press **OK** to start the test

The product will start the Scan Axis subsystem Common Initialization and PRS test initialization. If there is a failure at any point during the tests, the Front Panel will display the relevant system error code. To troubleshoot any displayed error codes, see [System error codes on page 115](#).
4. The product then starts the PRS test to check the subsystem. As the test executes, the Front Panel displays the following messages:
 - Initializing
 - Checking movement
5. Once the test has completed, the Front Panel prompts you to confirm that the PRS moved.
6. If the PRS moved, press **OK** to accept the results. If the PRS did not move, press **Cancel** to reject the results and exit the test.
7. Press **OK** to end the test and restart the product.

Scan Axis Test

The Scan Axis subsystem is designed to move the carriage assembly between two predetermined horizontal positions with respect to the plane of the print platen. This allows papers of different widths to be used without losing print quality.

Perform the Scan Axis - Scan Axis test as follows:



NOTE: Perform this test with the Printheads and the Tubes System installed in order to get values that can be compared correctly.

1. In the Diagnostics menu, select **Scan Axis**.
2. The Front Panel will display a screen, select **Scan Axis**.
3. The product checks the Scan Axis motor. The Front Panel displays the following messages:
 - Initializing
 - Checking motors
4. Depending on the results of the tests, you may be asked to perform the following operations.
 - a. Open the main window.
 - b. Manually move the carriage to another position. The carriage should not offer resistance to manual movement. Do not force any product part while moving the carriage. The Front Panel will show a text describing the action and an animation as an example of the requested operation. Press **OK** when you have finished moving the carriage.
 - c. Close the main window.
5. Afterwards, the test will automatically continue checking for possible Scan Axis errors. The carriage will move automatically along the Scan Axis several times, taking a few minutes. As the test executes, the Front Panel displays the following messages:

- Checking paper jam
 - Checking movement
 - Checking life counters status
6. If the Scan Axis passes the test, the Front Panel displays a message, otherwise it displays an error code. Press **OK** to continue.

Cutter test

The Cutter is designed to cut roll paper after printing to the defined sheet size. Before executing this test you should run the Scan Axis, Media Drive and Carriage tests to ensure that each of these subsystems is operating correctly.

Perform the Scan Axis - Cutter test as follows.

1. In the Diagnostics menu, select **Scan Axis**.
2. The Front Panel will display a screen, select **Cutter**.
3. A screen is displayed, check that the paper is unloaded and all the covers are closed, and select **OK**.

If there is a failure at any point during the tests, the Front Panel will display the relevant system error code. To troubleshoot the displayed error code, see [System error codes on page 115](#).

4. A is displayed. With the Media Lever lowered, feed a roll of paper (not a sheet) into the paper path until it reaches the product roller. Then press **OK** to continue.

If you have not fed enough paper into the product, the diagnostic will show a message saying that the paper was not detected and the test will fail and the product will reboot. In this case, try again, taking care to feed more paper. If the problem continues, check that the sensors are working correctly. If necessary, perform the Sensors Test (see [Sensors Test on page 191](#)).

5. The product then starts an actual test cut of the paper. As the test executes the Front Panel displays the following messages:
 - Advancing paper
 - Preparing cutter
 - Cutting paper
 - Disengaging cutter
6. Once the test has completed the Front Panel displays the test result and prompts you to confirm that the cutter worked.
7. Press **OK** if the cutter worked or **Cancel** if the cutter did not work.
8. Press **OK** to end the test and restart the product.


Paper Drive Test


The Paper Drive test diagnoses failures of components of the Paper Axis.

You must perform the Paper Drive Test after:


- System Error Code 81:XZ.
- System Error Code 41:XZ.
- System Error Code 73:XZ.

Diagnostic tests also need to be performed after removing or replacing certain product components. If you have removed or replaced product components, check the user guide to see which tests and calibrations you need to perform.

 **CAUTION:** ALL THE COVER SENSORS ARE DISABLED WHEN IN THE SERVICE TESTS MENU. IF THE CARRIAGE IS MOVING IT WILL NOT STOP IF THE SCANNER IS OPEN, SO BE VERY CAREFUL NOT TO PUT YOUR HANDS INSIDE.

 **NOTE:** IF POSSIBLE ALWAYS PERFORM THIS TEST BEFORE REPLACING ANY COMPONENT OF THE MEDIA-AXIS.

Perform the Paper Drive test as follows:

 **NOTE:** Perform this test with the Printheads and the Tubes System installed in order to get values that can be compared correctly.

1. In the Diagnostics menu, select **Paper Drive**.
2. The Front Panel displays a screen, select **OK** to continue with the process. Unload paper if loaded, and select **OK** again.
3. The Front Panel then displays the Analog Encoder calibration results.
The GAIN for channels A and B should be lower than 5.
4. If the results are correct, press **OK** to accept the results. If the results are not correct, press **Cancel** to reject the results and fail the test.
5. If you accept the results, the Front Panel will continue with the tests. It will ask you to press **OK** to continue with the process. When prompted, unload paper if any is loaded.
6. The Front Panel then displays the test results.
 - The first PWM avg result (forward move) should be between 7700 and 10560 and the second Pwm avg (backward move) between 7600 and 10450.
 - The first Speed error result should be no more than 78.65 and the second no more than 112.5.
 - The first PWM StDev result should be no more than 162.5 and the second no more than 187.5.
 - The first PWM max result should be no more than 12250 and the second no more than 12125.
7. If the results are correct, press **OK** to accept the results. If the results are not correct, press **Cancel** to reject the results and FAIL the test.
8. If you accept the results, the Front Panel shows a screen, press **OK** to finish.

Electronics Module Test

This diagnostic test gives information about the electronics. Several modules can be tested, and the user is asked whether he want's to test each specific module.

1. In the Diagnostics menu, select **Electronics Module**.
2. **Engine Board Module:** The Front Panel then prompts you to test the Engine Board, press **OK** to run the test, **CANCEL** to skip it. It checks the presence of the required devices in the Engine Board. If the board is **OK**, 4 Hannibal devices should be listed (from Hannibal1 to Hannibal4).
3. **Power Supply Module:** This test checks the correct function of the E-Box Fans.
4. The Front Panel then prompts you to test the Power Supply, press **OK** to run the test, **CANCEL** to skip it.
5. If the fans are working properly, the test displays: PSU fan status; **OK**
6. **Formatter Module:** The purpose of this test is to diagnose a failure in the operation of the Formatter. The Front Panel then prompts you to test the Formatter, press **OK** to run the test, **CANCEL** to skip it.

The information shown in the Front Panel is:

- The memory size
- Type and size of the partitions on the Hard Disk
- Size and percentage used of the data and boot partitions on the Hard Disk

Carriage Assembly Test


The Carriage Assembly test diagnoses failures of any components of the Carriage. This test should be run in any of the following circumstances.

- Before replacing the Carriage Assembly.
- After removing or replacing certain product components. If you have removed or replaced product components, check the user guide to see which tests and calibrations you need to perform.
- If printhead alignment fails repeatedly.
- If, when loading paper, the search for the edge of the paper fails repeatedly.
- If no printheads are detected (check more than one).
- If the system error message 02.1:10 appears.


If an error is detected during the test, the Front Panel will display an error code and message. The test will not continue after that point.

1. To execute the Carriage Assembly diagnostic, select the “Carriage Assembly” option in the diagnostic menu and press **OK**.
2. The diagnostic starts testing the subsystem. After a time a message appears: Initializing, Getting information, or Checking voltages; this indicates that the diagnostic test is in progress.


3. A message appears asking to remove the printheads. Open the printer window, open the carriage latch, remove the printheads from the carriage. Close the carriage cover, printer window, and press the **OK** button.

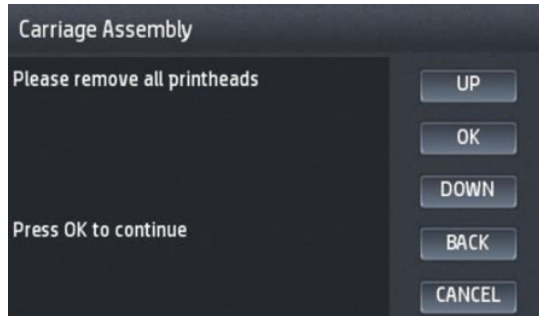

If the printheads were not correctly removed after pressing the **OK** button, a message appears asking to remove them. To do so, repeat the previous steps. If the printheads were correctly removed (it is clear there are no printheads installed in the carriage), and the message still appears, press the Cancel (X) key; the test will finish, and the appropriate error code will appear.

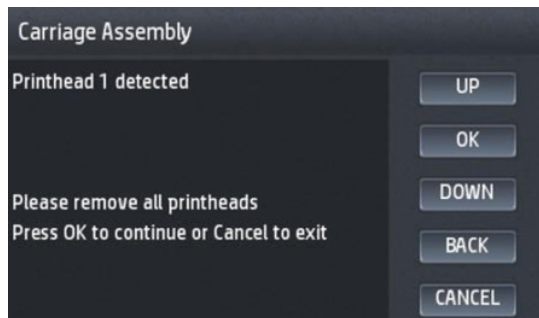


4. Once all the printheads are removed, some additional parameters are checked and their values and/or ranges are displayed in the front panel:

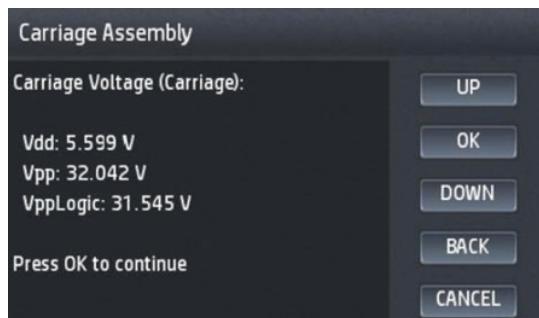


5. The diagnostic test will check the carriage LEDs and sensors. This can take some minutes. The following message appears in the front panel:




6. After the line sensor has been checked, you're asked to insert the printheads again. To do so, open the printer window, open the carriage cover, and insert the printheads into the carriage. Then, close the carriage cover, printer window, and then press **OK**.

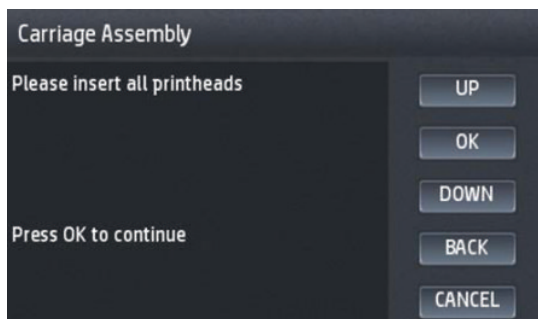

If the printheads were not correctly installed after pressing the **OK** button, a message appears asking to install them. To do so, repeat the previous steps. If on checking, the printheads were correctly installed (it is clear there are printheads installed in the carriage), and the message still appears, press the Cancel (X) key; the test will finish, and the appropriate error code will appear.

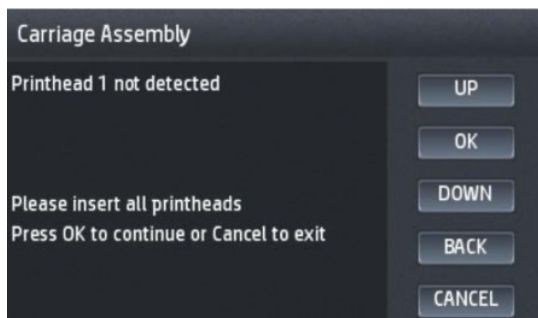

7. After installing all printheads, more checks take place, if everything was is correct, the following message appears:

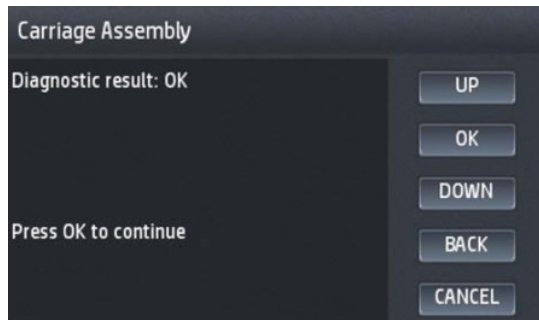

If an error has been found in any of the steps of this diagnostic (parameter values are out of the allowed range; printhead improperly detected or not detected, sensor errors, etc.) the diagnostic test will automatically detect it and stop the test (checks will stop), and the error description will be shown in the front panel. The error description will contain the System Error code (for determining the recovery action) and the specific error cause, if known.

Sensors Test

The Sensors test diagnoses failures of any sensors of the product. Always run this test before replacing any of the following sensors:

- Window Position sensor
- Upper or lower roll cover sensor
- Stacker arm sensor

Diagnostic tests also need to be performed after removing or replacing certain product components. If you have removed or replaced product components, check the user guide to see which tests and calibrations you need to perform.

1. In the Diagnostics menu, scroll to **Sensors** and press on this menu option, press **OK** to start the test.
2. The Window Position sensor test starts and the Front Panel prompts you to open the Window cover.
Open the Window cover, and press **OK** to continue.

 **NOTE:** Make sure that no object is interfering with the sensor.

3. The Front Panel prompts you to close the Window cover, and the sensor, on detecting the cover closing.
Close the Scanner and press **OK** to continue.
4. Follow the same procedure for the Roll 1, Roll 2, and the Stacker Cover.
5. When the tests are complete, the Front Panel displays a final message. Press **OK** to shutdown.

Stacker Empty Sensor Test

The stacker empty sensor test diagnoses failures of the stacker empty sensor. This test checks the connectivity and the proper operation of the sensor.

1. In the diagnostic menu select **Stacker empty sensor**. The printer will take a while to verify the sensor connectivity. If the sensor is not connected, on the Front Panel the following code appears; **53.6:10**, and

the message **“Stacker empty sensor connectivity failure”**. Press **OK** to continue and return to the diagnostic menu.

2. If the sensor is connected, the test asks to place a paper to cover the stacker sensor, do so, then press **OK** to continue, or **Cancel** to exit.
3. After putting the paper and pressing **OK**, the test will ask you to remove it and select between **OK** or **Cancel**.
4. If during the two steps described above the test detects a non proper operation, the Front Panel displays the following error code; **53.6:10**, and the message **“Stacker empty sensor fails to detect paper”**. In this case make sure that there are not objects covering the sensor and repeat the test.

Output Valve Test

Perform the Output Valve test as follows:



NOTE: Perform this test with the printheads and the tubes system installed in order to get values that can be correctly compared.

1. In the Diagnostics menu, select **Output Valve**.
2. The product starts the Output Valve PWM control test to check the subsystem. As the test executes the Front Panel displays the following messages:
 - Initializing
 - Performing movements

If there is a failure at any point during the test, the Front Panel displays the relevant **System Error Code**. To troubleshoot any displayed error codes, see System Error Codes.

3. Press **OK** to end the test and restart the product.

Output Valve Calibration

The purpose of this Service Calibration is to calibrate the valve that directs the print to the stacker or basket.


This valve also detects output jams to the basket by performing several movements to see if there's any paper obstruction.

It has to be done when:


- Reinstalling or replacing the complete stacker.
- When reinstalling or replacing the diverter - cutter platen assy.
- When replacing the output valve motor.

Follow these steps:


1. Prior to calibration; remove all the prints from the stacker and basket, and also any paper loaded in the printer.

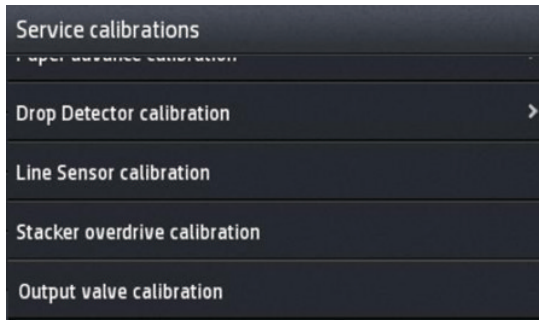


2. To select this calibration, go to 'output valve calibration':

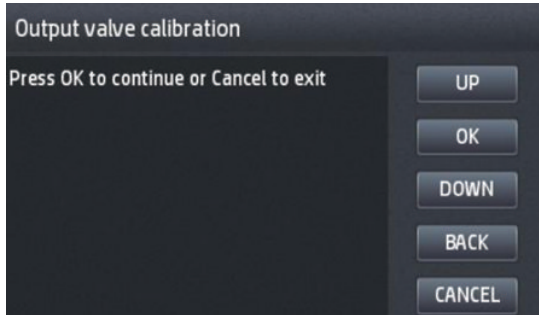


3. The screen will show the 'calibrating status' during some minutes, while the output valve is performing some movements.

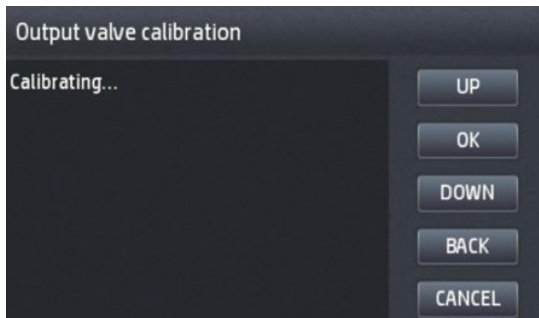

4. At the end of the process, you will have the result of the calibration. The screen will show also a recommendation to verify the calibration (print a plot to stacker). Typical values for the calibration range from 1015 to 1225.

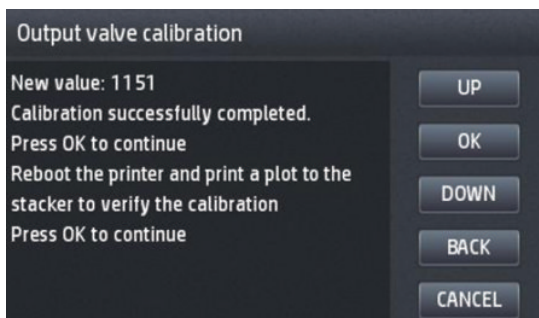


- By pressing **OK** in the next screen, the printer will shut down automatically.

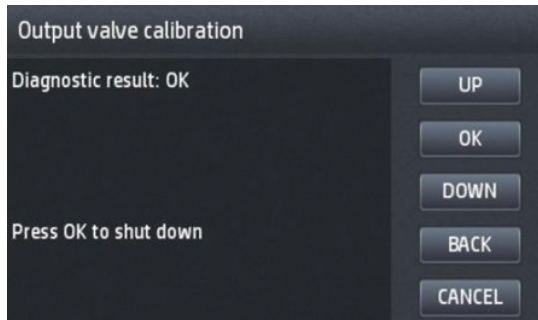

- Power – on the printer, and print (for example a Drawing Demo print) to the stacker, to verify the success of the calibration.

Pinches Lifter Test

Perform the Pinches Lifter test as follows:

 **NOTE:** Perform this test with the printheads and the tubes system installed in order to get values that can be correctly compared.


- In the Diagnostics menu, select **Pinches Lifter**.
- The product starts the Pinches Lifter PWM control test to check the subsystem. As the test executes the Front Panel displays the following messages:
 - Initializing
 - Performing movements

If there is a failure at any point during the test, the Front Panel displays the relevant **System Error Code**. To troubleshoot any displayed error codes, see System Error Codes.

- Press **OK** to end the test and restart the product.

Stacker Ramps Test


Perform the Stacker Ramps test as follows:

 **NOTE:** Perform this test with the printheads and the tubes system installed in order to get values that can be correctly compared.

 **NOTE:** The diagnostic has two options:

- Stacker ramps without wheels
- Stacker ramps with wheels


Please check if the ramps in the stacker have wheels at the top and select the test accordingly.

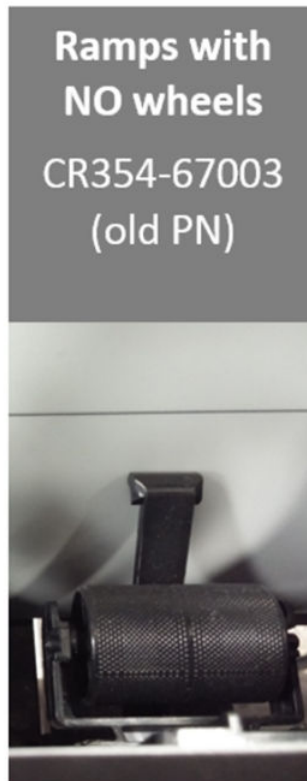

1. In the Diagnostics menu, select **Stacker Ramps**.
2. The product starts the Stacker Ramps PWM control test to check the subsystem. As the test executes the Front Panel displays the following messages:
 - Initializing
 - Performing movementsIf there is a failure at any point during the test, the Front Panel displays the relevant **System Error Code**. To troubleshoot any displayed error codes, see System Error Codes.
3. Press **OK** to end the test and restart the product.

Stacker Overdrive Test

Perform the Stacker Overdrive test as follows:

 **NOTE:** Perform this test with the printheads and the tubes system installed in order to get values that can be correctly compared.

1. In the Diagnostics menu, select **Stacker Overdrive**.
2. The product starts the Stacker Overdrive PWM control test to check the subsystem. As the test executes the Front Panel displays the following messages:
 - Initializing
 - Performing movements

If there is a failure at any point during the test, the Front Panel displays the relevant **System Error Code**. To troubleshoot any displayed error codes, see System Error Codes.

3. Press **OK** to end the test and restart the product.


Stacker Jam Sensor Test

This test diagnoses Stacker Jam Sensor failure. Always run this test before replacing the sensor.

Perform the Stacker Jam Sensor test as follows:

1. In the Diagnostics menu, scroll to **Stacker Jam Sensor**, select it, and press **OK** to start the test, or **Cancel** to exit.
2. The sensor test starts, and the Front Panel prompts you to lift the first wheel holder containing the jam sensor.

Lift the wheel holder, and press **OK** to continue.

 **NOTE:** Make sure that no object is interfering with the sensor.

3. The Front Panel prompts you to lower the first wheel holder.
Lower the wheel holder, and press **OK** to continue.
4. When the test is complete, the Front Panel displays a final message. Press **OK** to shutdown.


Stacker Capacity Sensor Test

This test diagnoses Stacker Capacity sensor failure. Always run this test before replacing the sensor.

Perform the Stacker Capacity sensor test as follows:

1. In the Diagnostics menu, scroll to **Stacker Capacity Sensor**, select it, and press **OK** to start the test, or **Cancel** to exit.
2. The sensor test starts, and the Front Panel prompts you to lift the first wheel holder containing the capacity sensor.

Lift the wheel holder, and press **OK** to continue.

 **NOTE:** Make sure that no object is interfering with the sensor.

3. The Front Panel prompts you to lower the first wheel holder.
Lower the wheel holder, and press **OK** to continue.
4. When the test is complete, the Front Panel displays a final message. Press **OK** to shutdown.

Ink Delivery System (IDS) Test

The complete Ink Delivery System test consists of three individual tests for the different components related to this subsystem. These three tests and their associated functions are:

- Ink Delivery System

- Check the Ink Supply Station subsystem.
- Show tubes usage (as a percentage of expected life).
- Test communication with Ink Supplies.
- Check Ink Supplies
 - Test communication with Ink Supplies.
 - Show ink levels.
 - Check that Ink Supplies are ready for purging: the remaining ink is enough for the setup process and the ink supply is not faulty.
- Check Leakage
 - Check the Ink Supply Station subsystem.
 - Check for ink supplies or tubes leakage.

Diagnostic tests also need to be performed after removing or replacing certain product components. If you have removed or replaced product components, check this Service Manual to see which tests and calibrations you need to perform.

Ink Delivery System

If there is a failure at any point during the tests, the Front Panel will display the relevant **System Error Code**.

1. In the Diagnostics menu, scroll to **IDS** and press on this menu option.
2. The Front Panel shows the **IDS** submenu.
3. In the **IDS** submenu, scroll to **Ink Delivery System** and press **OK** to start the test.
4. The Ink Delivery System test starts and the Front Panel prompts you to remove all the Ink Supplies.
5. Remove all the Ink Cartridges.
6. Press **OK** to continue.
7. The Front Panel then prompts you push down Piston 0.
8. Press and hold down Piston 0, which is located at the furthest left Ink Cartridge position.
9. Press **OK**.
10. The Front Panel then prompts you to release Piston 0.
11. Release Piston 0.
12. Press **OK** to continue.
13. Repeat the steps above for each piston.
14. The Front Panel then displays the tubes usage, expressed in percentage of the expected subsystem life.
15. Press **OK** to continue.
16. The Front Panel prompts you to insert all the Ink Cartridges.

17. Install all the Ink Cartridges.
18. Press **OK** to continue.
19. The Front Panel then displays Acumen Supplies test results.
20. Press **OK** to end the test and return to the Diagnostics menu.

Check Ink Supplies

If there is a failure at any point during the tests, the Front Panel will display the relevant **System Error Code**. To troubleshoot any displayed error codes, see [System error codes on page 115](#).

1. In the Diagnostics menu, scroll to **IDS** and press on this menu option.
2. The Front Panel shows the **IDS** submenu.
3. In the **IDS** submenu, scroll to **Check Ink Supplies** and press **OK** to start the test.
4. The Front Panel prompts you to insert all the ink cartridges.
5. The Front Panel shows the ink levels of all the cartridges. A list of the “colors not valid” for purge are shown below. If all of the cartridges are valid for purging, the “Colors not valid” item will not be shown on the Front Panel.
6. Press **OK** to exit.
7. The Front Panel then displays the test results.
8. Press **OK** to end the test and return to the Diagnostics menu.

Check Leakage

If there is a failure at any point during the tests, the Front Panel will display the relevant **System Error Code**.

1. In the Diagnostics menu, scroll to **IDS** and press on this menu option.
2. In the **IDS** submenu, scroll to **Check Leakage** and press **OK** to start the test.
3. The Ink Delivery System test starts and the Front Panel prompts you to remove all the Ink Cartridges.
4. Remove all the Ink Cartridges and press **OK** to continue.
5. The Front Panel prompts you to push down all the pistons.
6. Use your fingers to push all of the pistons down, and press **OK** to continue.
7. If the Ink Supply Station is working properly, the Front Panel prompts you to insert all the Ink Cartridges.
8. Install all the Ink Cartridges and press **OK** to continue.
9. The leakage check starts and the Front Panel displays the remaining time until the leakage check is finished.
10. The Front Panel then displays Check Leakage test results.
11. Press **OK** to end the test and return to the Diagnostics menu.

Service Station Test

The complete Service Station test consists of individual tests for the different components related to this subsystem.

These tests are:

- Service Station
- Primer Motor

Diagnostic tests also need to be performed after removing or replacing certain product components. If you have removed or replaced product components, check [Diagnostics, Service Utilities and Calibrations on page 179](#) to see which tests and calibrations you need to perform.

Service station

1. In the Diagnostics menu, scroll to **Service Station** and press on this menu option.
2. The Front Panel will show the **Service Station** submenu.
3. In the **Service Station** submenu, scroll to **Service Station** and press **OK** to start the test.
4. The Front Panel then prompts you to check the status of the product.
5. Check that:
 - The Scanner is closed.
 - All Printheads are inserted.
 - Valid Cartridges are inserted.
6. Press **OK** to continue.
7. The product performs a series of movements numbered from 1 to 10. It takes about a minute to perform all movements.
8. The Front Panel then asks if you want to cap the printheads.
9. Press **OK** to cap the Service Station or **Cancel** to skip this test.
10. The Front Panel prompts you to shut down the product to complete the test.
11. Press **OK** to shut down the product.

 **TIP:** If a system error message is displayed during the procedure, follow the procedure described in the System Errors section. A system error 21 indicates that the service station is not working properly.

Primer motor

1. In the Diagnostics menu, scroll to **Service Station** and press on this menu option.
2. The Front Panel will show the **Service Station** submenu.
3. In the **Service Station** submenu, scroll to **Primer Motor** and press **OK** to start the test.
4. The Front Panel then prompts you to check the status of the product.
5. Check that:

- The Cover is closed.
 - The Printhead is inserted.
 - Valid Cartridges are inserted.
6. Press **OK** to continue.
 7. The Front Panel asks you to open the window cover.
 8. Open the window cover.
 9. The Front Panel then prompts you to check the pressure in the upper tube. You need to put your hand inside and check with your finger that the air comes out of the tube.
 10. If the tubes are working properly press **OK** to continue.
 11. Repeat two last steps for bottom tube.
 12. The Front Panel asks you to close the window cover.
 13. Close the window cover.
 14. The product performs a series of movements numbered from 1 to 5. It takes about two minutes to perform all movements.
 15. The Front Panel prompts you to shut down the product to complete the test.
 16. Press **OK** to shut down the product.

Enable I/O Interfaces Utility

This utility is used to enable/disable the LAN connection.

1. In the Diagnostics menu, scroll to Enable I/O Interfaces and press on this menu option.
2. The Front Panel prompts you to enable the connectivity. Press **OK** to confirm or, UP or Down to change the option YES or NO.
3. The connectivity is enabled if YES option is confirmed. Press **OK** to restart.

Unit Information Utility

1. The Unit Information test retrieves the Firmware Version, Serial Number and Part Number of the product.
2. In the Diagnostics menu, scroll to **Unit Information** and press on this menu option.
3. The Unit Information test starts and the Front Panel displays the following message:
 - Initializing
 - Getting information
4. The Front Panel displays the firmware level, serial number of the product and the part number.
5. Press **OK** to continue and return to the menu.

EEROM Reset Utility

The EEROM Reset test resets the product to the factory defaults and delete any user information/files.

1. In the Diagnostics menu, scroll to **EEROM** and press on this menu option.
2. The EEROM Reset test starts and the Front Panel asks whether you want to continue.
3. Press **OK** to continue the test or **Cancel** to cancel it.
4. The EEROM Reset test continues and the Front Panel displays the following message:
 - Initializing
 - Setting default configuration
5. The Front Panel prompts you to shut down the product to complete the test.
6. Press **OK** to shut down the product.

Front Panel Lock Reset

This utility enables the Front Panel to be unlocked when it has been locked by mistake and cannot be remotely unlocked from Web JetAdmin.

1. In the Diagnostics menu, scroll to **Front Panel lock reset** and press on this menu option.
2. The Front Panel prompts you to unlock Front Panel access. Press **OK** to unlock access or **Cancel** to exit.
3. The Front Panel lock is reset. Press **OK** to end the utility and return to the main menu.

Hard Disk Recovery

The purpose of this Service Utility is to restore the firmware and erase data from the Hard Disk.

In this insecure mode, all pointers to the information are erased. The information itself is **not** erased, and remains on the hard disk until the disk space it occupies is needed for new print jobs.

File System Check

The File System Check checks the file system on the hard disk and automatically corrects any problems that it finds. This option is also available from the Service Menu.

1. In the Diagnostics menu, select **File System Check** and press on this menu option.
2. The Front Panel asks you if you want to proceed with the File System Check.
3. Press **OK** to proceed or **Back/Cancel** to exit.

If you press **OK**, the product restarts and the File System Check is performed.

Enable Special Margin

This utility allows you to reduce the paper margins on the left and right side of the page down to 2mm.

Set margin

The aim of this feature is to provide the capability of setting any of the margins to a value between 2mm - 50mm.

Enable HP-GL/2 palette options

This option was available on legacy T series printers.

It allows the user to be able to configure HP-GL/2 palette options, selecting color/width for the different pens.

Content thresholds


This menu allows you to change the default threshold values of HP Designjet Partner Link Pay-Per-Use usage categories.

- **Color** value is the maximum % of color pixels in a Mono Lines Category.
- **LDI** value is the minimum % of non-white pixels with respect to the total pixels on a page to be considered as the Low Density Image category.
- **HDI** value is the minimum % of non-white pixels with respect to the total pixels on a page to be considered as the High Density Image category.

The default values are Color—1%, LDI—10% and HDI—50%. Don't change these values unless you are sure about what are you doing.

Please refer to the HP Designjet Partner Link Pay-Per-Use user manual for deeper information about printing usage categories.

Stacker ramps test

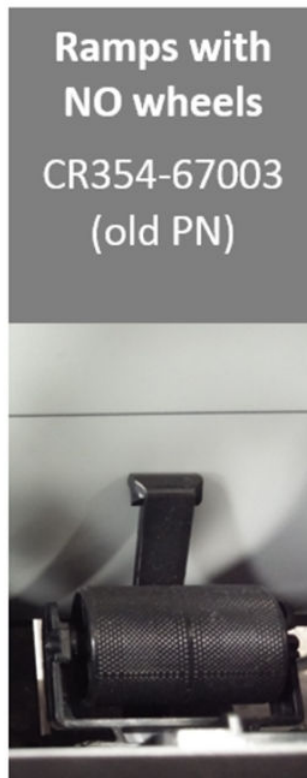

Set I/O factory defaults

This option is the same as the option available in the User Menu (which sets network card default settings: Setup -> Connectivity -> Network Connectivity -> Advanced -> Restore Factory Settings), however this can reset additional internal areas of the NVM in case it has been corrupted.

Service Utilities

The following is a list of all internal Service Utilities available in the product. To access them, see [Entering the Service Utilities Menu on page 204](#).

[Turn Drive Roller on page 205](#)

[Purge Tubes on page 205](#)

[Mark Printhead as Filled on page 206](#)

+ [Reset Life Counters on page 206](#)

+ Reset Maintenance Kit usage

Reset life counters PMK1

Reset life counters PMK2

+ [Diagnostics Print on page 207](#)

Image Quality Service (Best and Normal)

+ Advanced Diagnostic Print

Paper advance plot

Nozzle Health

Printhead Alignment

Force drop detection

Print reference plot (Normal, Best and Fast)

[Set I/O factory defaults on page 203](#)

+ [Disk Wipe DoD 5220.22-M on page 212](#)

Insecure mode

1-pass mode

5-pass mode

+ [Secure File Erase Mode on page 213](#)

Insecure mode

1-pass mode

5-pass mode

[Show/Hide Front Panel Information on page 214](#)

[File System Check on page 214](#)

+ [Rewinder Adjust on page 214](#)

Adjust rewinder 1

Adjust rewinder 2

[Disable Upper Roll Cover on page 215](#)

[Enable Upper Roll Cover on page 215](#)

+[Double Cut for Borderless Printing on page 215](#)

Enable

Disable

[Remove non Factory Papers on page 215](#)

[Scanner Validation on page 215](#)

[Adjustment scanner Y-Axis scale on page 223](#)

[Reset Access Control on page 227](#)

[Uninstall Applications on page 228](#)

+ [Accounting Mode on page 229](#)

None

Mode 1

Test

+[Content thresholds on page 202](#)

COLOR

LDI

HDI

+[Advance media stop position on page 229](#)

ON

OFF

[View startup code on page 229](#)

Entering the Service Utilities Menu

1. From the Home Screen press the Information icon on the top left corner of the screen. For information regarding the Front Panel keys.
2. From the product Information Area, press the Main Menu tool icon on the bottom right corner of the screen.
3. Scroll down to the lowest menu option and press on the **Service menu** option.
4. Enter the 4-digit 1st level access code “3174” and press **OK**.
5. Press on the **Service utilities** menu option.
6. From the **Service utilities** menu you can scroll up and down the available utilities. Press on the selected menu option.

Turn Drive Roller


The purpose of this Service Utility is to rotate the Drive Roller and the Overdrive in order to clean them.


 **NOTE:** Remove the media from the product before proceeding with the procedure.

Perform the Turn Drive Roller utility as follows:

1. Remove Media from the paper path.
2. In the Service Utilities submenu, scroll to **Turn Drive Roller** and press on this menu option.
3. The test begins and the Front Panel displays the following message:
 - Rotation started.
4. If paper is loaded, the service utility will be cancelled. In this case, unload the paper and start again from **step 1**. If no paper is loaded, the test will continue.
5. The Drive Roller begins to turn slowly and a message is displayed on the Front Panel.
6. To clean the drive roller and overdrive, see the user guide.
7. Once you have finished cleaning the Drive Roller and the Overdrive, press the Cancel key to stop the roller.

Purge Tubes

 **NOTE:** Make sure that NEW Ink Cartridges are installed or that the ink volume remaining in the Ink cartridges is above 60cc before starting to fill the tubes. If you do not comply, you will get a warning message and the printer will force you to replace the cartridges.

 **NOTE:** Before using the Purge Tubes utility, you must make sure you have a new printhead.

Perform the Purge Tubes utility as follows:

1. In the Service Utilities submenu, scroll to Purge Tubes and select it.
2. The printer reboots.
3. After a time, a cartridge replacement screen appears.
4. Insert all cartridges and press **OK**.
5. If any of the cartridges have insufficient ink, the cartridge replacement will not allow you to leave until they have all been purged. You have to replace cartridges that are not valid, and press **OK** again.
6. When the cartridge replacement process has successfully completed, a printhead replacement will be opened.
7. The Front panel will prompt you to install a new printhead. Please follow the instructions.
8. The Front Panel prompts you to confirm that the printhead is replaced with a correctly inserted new one. If it's correctly inserted, press **OK**.
9. The product will now perform the Printhead Alignment and Front Panel will prompt you to continue with the Printhead Alignment, select Align now and press the **OK** key.
10. Once the Printhead Alignment is completed, the following message will be displayed on the Front Panel. Press the **OK** key to continue.

Mark Printhead as Filled

The printer will flag the printhead as if it has gone successfully through the filling process (See [HP 727 Printhead Start-up process on page 28](#) for more details). Once flagged, the printer will recognize the printhead as filled, and will try to use it accordingly: print with it, run servicing routines, etc.

Mark printhead as filled in case that the HDD and NVM back ups have been replaced in the printer.

Reset Life Counters

The purpose of this Service Utility is to reset the internal life counters.

There are two submenus that allow you to:

- Reset **all** the counters related to a Preventive Maintenance Kit (PMK).
- Reset only the counters related to a specific replaced part.



NOTE: ALWAYS RESET THE LIFE COUNTER OF A CORRESPONDING PART AFTER REPLACING IT.

Perform the Reset Life Counters utility as follows:

1. In the Service Utilities submenu, scroll to **Reset Life Counters** and press this menu option.
2. Enter the 4-digit 2nd level access code “5494” and press **OK**.
3. Select **Reset Maintenance Kit usage** to reset the Life Counter for **all** parts included in a Preventative Maintenance Kit (PMK).

You can choose from the following Preventive Maintenance Kits:

- Preventive Maintenance Kit 1 (PMK1).
- Preventive Maintenance Kit 2 (PMK2).



NOTE: For more information about the counters that are reset, See the user guide.

It is also advisable to check the status of the Life Counters related to the other Preventive Maintenance Kits to avoid multiple trips to the customer.

4. Select **Reset usage counters** to reset the Life Counter of a single part.
 - Tubes and Trailing Cable
 - Scan-Axis Belt with Tensioner
 - Scan Motor
 - Full Bleed Foams
 - Carriage
 - Service Station
 - Scanner Counters

If you replace a part, you should reset the Life Counters as follows:

Replaced part	Reset Life Counters
Ink supply tubes (with trailing cables)	Tubes and Trailing Cable
Belt assembly	Scan-Axis Belt with Tensioner
Scan-axis motor	Scan-Axis Motor
Foams	Full Bleed Foams
Carriage assembly	Carriage
Service station	Service Station
Drop detector	Drop Detector Working Time

- Once you have selected the Life Counters to reset, a message similar to the following will be displayed on the Front Panel. Press the **OK** key to reset the selected Life Counters or press **Cancel** to exit without resetting the Life Counters.

Diagnostics Print

This is a set of diagnostic prints used to highlight printhead reliability, or other printer problems that can affect the Image Quality of the printer.

To print any of the Image diagnostics prints:

- Use the same paper type that you were using when you detected the problem.
- Check that the selected paper type is the same as the paper type loaded into the printer.

3. In the printer's front panel, select **Diagnostic image**.



In Diagnostic Print, you can select the **Image Quality Service** prints or the **Diagnostic Print**:



You have the option to print the **Image Quality Service** in Normal or Best mode.

Image Quality Service plots allow checking the print quality that the printer can deliver for every color of the printer separately: Cyan/Magenta/Yellow/Matte Black/Black/Gray.

Besides the **Image Quality Service** plots, also available is the **Print Reference Plot in Fast/Normal/Best**. This plots allows checking print quality using jobs that contain user images that have been already ripped.

Advance Diagnostic Print has the following Diagnostics available:



All the diagnostic Prints (except **Force Drop Detection**) require that the printer be ready to print (paper loaded, printhead and supplies installed). At the beginning of each diagnostic, you will see the following screen:

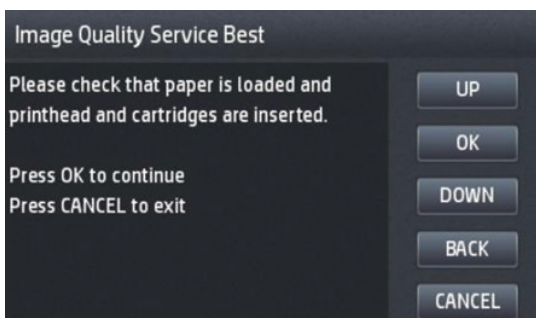



Image Quality Service (Best and Normal)

This diagnostic helps you to check the performance of the printhead, and whether it suffers from clogging, lack of ink in any color, or other problems.

This diagnostic is quite similar to the Diagnostic Print available in the user level, except that the image quality level (best, normal) can be chosen.

Use a level of Image Quality similar to the settings of the prints with Image Quality problems.

Use the “normal” level to troubleshoot problems in normal and fast mode, and the “best” one for prints in best mode.

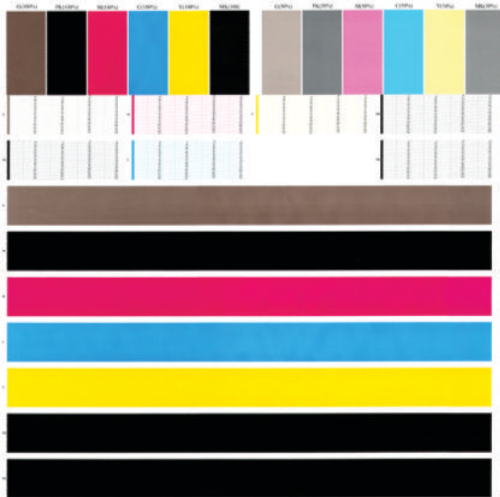

The print is divided into three parts:

- **Part 1 (top):** consists of rectangles of pure colors at 100% and 50%; one for each ink. This part represents the print quality that you will get from each color in the selected level of quality (best or normal).
- **Part 2 (mid):** consists of small dashes; one for each printhead nozzle. This part complements the first, and aims more specifically to detect how many faulty nozzles each printhead has.

Please look carefully at the print. The names of the colors are shown above the rectangles and to the left of the patterns of dashes.

Before printing this image, perform a **Force Drop Detection** action (available on the Advance Diagnostic Print Menu), in order to update the status of faulty nozzles, and print the printhead nozzle health more accurately.

First look at the upper part of the print (part 1). Each colored rectangle should be a uniform color without any horizontal lines.

Then look at the bottom part of the print (part 2). For each individual colored pattern, check that most of the dashes are present.

If you see horizontal lines in part 1, and also missing dashes in part 2 (same color), you should clean the printhead, selecting the relevant color group. If the rectangles look solid, do not worry about just a few missing dashes in part 2; these are acceptable as the printer can compensate for a few clogged nozzles.

- **Part 3 (bottom):** consists on several bars from side to side of the print, one for each ink. The aim of this part is to detect a high number of consecutive faulty nozzles during continuous printing (for example caused by air ingestion or lack of ink in the printhead).

In the case of detecting a high number of consecutive faulty nozzles in any of the color bars, you should clean the printhead, selecting the relevant color group.

If the problem persists after recovering the printhead, consider replacing it.

Paper advance plot

The Visual Paper Advance Diagnostic prints a test plot to check that the paper advance is operating correctly.

It consists of three plots printed at the left, center, and right of the paper. These three plots are the same, and contain several numbered columns. The following illustrations shows an example of the Visual Paper Advance Diagnostic plot:



The most uniformly centered will be the white/lightest band; better the media advance the printer has.


This should be true for all three plots or the printer will have differential banding (a difference of advance between the left and right).

When the white / light band is clearly not uniform (in the same band or comparing to the other bands), perform a user paper advance calibration, in the Image Quality maintenance menu (see User Guide for more details).

Nozzle Health

Nozzle health print is an extended version of the Image Quality Service prints, focused exclusively on nozzle health. It's not intended to help to understand overall banding problems, used only for specific nozzle health problems.

For each individual colored pattern, check that most of the dashes are present. If you see missing dashes in one color, you should clean the printhead, selecting the relevant color group.

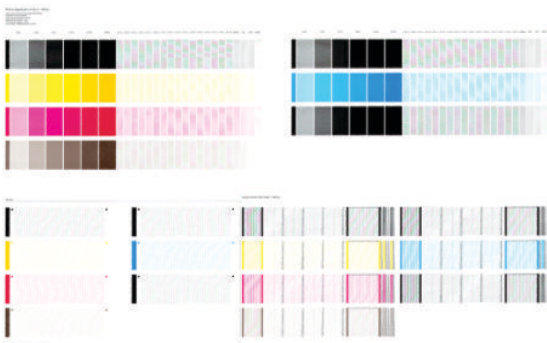


Printhead Alignment

The printhead alignment diagnostic print shows several groups of vertical lines, each one printed in one color and with different carriage speeds (30, 40 and 60 inches per second).

The aim of the diagnostic is to detect printhead alignment problems by looking at how straight the three groups of thin vertical lines that go from top to the bottom are.

If the diagnostic shows severe straightness / continuity problems in any of these lines, perform a printhead alignment.

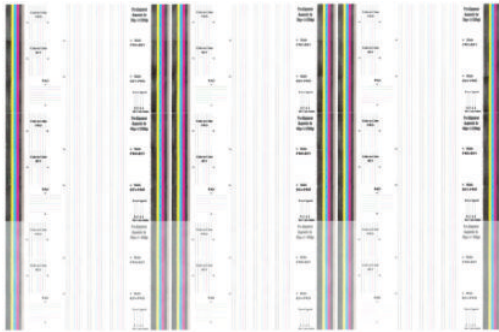

Force drop detection

If the Nozzle Print Test plot has persistent white-point banding in only one color that cannot be fixed with a printhead recovery, you can use this option to resolve the problem by resetting the nozzle health database so that all nozzles are assumed to be correct. Once the nozzle health database has been reset, drop detection is forced.

The normal cause of this white-point banding in a single color is the incorrect detection of failed nozzles by the drop detector.

Perform the test as follows:


1. Go to the Service utilities menu and select **Diagnostic Print**.
2. Select **Advanced Diagnostic Print**.
3. Select **Force Drop Detection**.
4. Make sure that the ink system is ready, and the covers and doors are closed, then press **OK**.
5. The printer performs drop detection.
6. When the process has ended, press **OK** to return to the menu.

Print Reference Plot

The reference plot is a sRGB HPGL2 image that can help to check some Print Quality attributes:

- Banding
- Grain
- Ink quantity
- Line quality

The image is printed to the stacker on the media type currently loaded and in "ready" state.

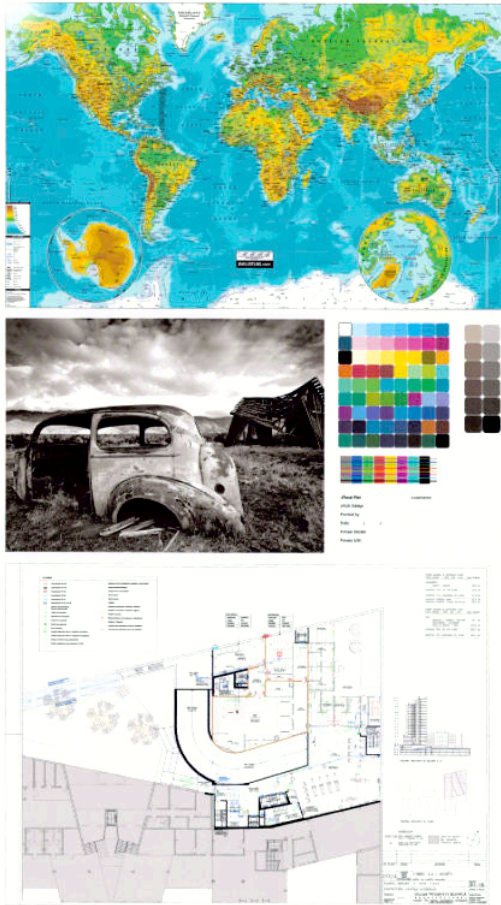

Set I/O to factory defaults

Disk Wipe DoD 5220.22-M

The purpose of this Service Utility is to erase data from the Hard Disk securely, according to the directive DoD 5220.22-M.

The product's hard disk is used as a temporary storage area for print jobs. The Secure Disk Wipe utility can erase user information from the hard disk to prevent unauthorized access.

Secure Disk Wipe provides three different levels of security:

- **Unsecure Mode:** All pointers to the information are erased. The information itself is **not** erased, and remains on the hard disk until the disk space it occupies is needed for new print jobs. The new print information overwrites the old information. While the information remains on the disk, it is difficult for most people to access, but may be accessed using software designed for that purpose. This is the normal

method in which files are erased on most computer systems; it is the fastest method but the least secure. This is the default security level when using Secure Disk Erase.

- **1 Pass Mode:** All pointers to the information are erased, and the information itself is impapertely overwritten with a fixed character pattern. This method is slower than Non-Secure Fast Erase, but more secure. It may still be possible to access fragments of the erased information by using special tools to detect residual magnetic traces.
- **5 Pass Mode:** All pointers to the information are erased, and the information itself is repetitively overwritten using an algorithm designed to eliminate any residual traces. This is the slowest method, but the most secure. Secure Sanitizing Erase meets the US Department of Defense 5220-220M requirements for clearing and sanitization of disk paper.

Execute the Disk Wipe DoD 5220.22-M utility as follows:

1. In the Service Utilities submenu, scroll to **Disk Wipe DoD 5220.22-M** and press this menu option.
2. In the Disk Wipe DoD 5220.22-M submenu, scroll to **Sanity Level** and press **OK**.
3. In the Sanity Level submenu, scroll to the required Sanity Level and press **OK**.



NOTE: Erasing the Hard Disk drive using either of the Secure Sanitize Levels is a very slow process, 6 hours for the 1 Pass mode and 40 hours for the 5 Pass mode.

4. When the Sanity Level has been changed, the Front Panel displays a message, or an error message if there is some problem.
5. In the Disk Wipe DoD 5220.22-M submenu, scroll to **Disk Wipe (DoD 5220.22-M)** and press **OK**.
6. A message appears on the Front Panel, you must select whether you would like to perform a complete erase of the Hard Disk Drive using the previously selected erase mode by pressing **OK**. Press **Cancel** to exit the utility.
7. A message appears on the Front Panel, you must select whether you want to continue and completely erase the Hard Disk Drive by pressing **OK**. Press **Cancel** to exit the utility.
8. The erase process starts and the Front Panel shows a setup progress bar.
9. The product reboots into the Disk Wipe mode, and continues with the disk erase until it is completed.



CAUTION: Do not try to interrupt this process. All Front Panel keys are disabled while the product erases the Hard Disk Drive.

Secure File Erase Mode

The purpose of this Service Utility is to erase data from the printer's Hard Disk.

The product's hard disk is used as a temporary storage area for print jobs. The Secure File Erase Mode utility can erase information from the hard disk to prevent unauthorized access.

It provides three different levels of security:

- **Insecure Mode:** In this mode, all file pointers to the data (table indexes) are erased. The contents of the file remain on the hard disk until the disk space they occupy is needed for other purposes, the space is then overwritten. This is the fastest mode of operation.
- **1-Pass Mode:** In this mode, file pointers are erased and the disk space where the contents of the file were stored is overwritten with a fixed character pattern. This mode of is slower than Non-Secure Fast Erase, but all data is overwritten.
- **5-Pass Mode:** In this mode, file pointers are erased and the disk space where the contents of the file were stored is overwritten 5 times using an algorithm that prevents any residual data. This mode may affect product performance.

Execute the Secure File Erase utility as follows:

1. In the Service Utilities submenu, scroll to Secure File Erase Mode and press this menu option.
2. In the Secure File Erase Mode submenu, choose the mode you want to execute (Insecure Mode, 1-Pass Mode or 5-Pass Mode).
3. Wait for the diagnostic result and press **OK**.



NOTE: Erasing the files of the Hard Disk drive using either of the 1-Pass Mode or 5-Pass Mode is a very slow process; 6 hours for the 1-Pass mode and 40 hours for the 5-Pass mode.

Show/Hide Front Panel Information

The purpose of this utility is to prevent network information from being viewed directly from the EWS or the screen of the Front Panel.

1. In the Service Utilities submenu, scroll to and select **Show/Hide Front Panel Info**.
2. Use the **Up** and **Down** button to change if network information is viewable, press **OK** to confirm.
3. The change is complete, press **OK** to return to the main menu.

File System Check

The File System Check checks the file system on the hard disk and automatically corrects any problems that it finds.

1. In the Diagnostics menu, select **File System Check** and press on this menu option.
2. The Front Panel asks you if you want to proceed with the File System Check.
3. Press **OK** to proceed or **Back/Cancel** to exit.

If you press **OK**, the product restarts and the File System Check is performed.

Rewinder Adjust

The Rewinder Adjust utility clears the calibration parameters associated with a Rewinder motor when it has to be replaced.

The changes made by this utility take effect only after the product has been restarted. Therefore, you are recommended to proceed in the following order.

1. Use the Rewinder Adjust utility to reset the calibration parameters.

- a. In the Service Utilities submenu, scroll to **Rewinder Adjust** and press on this menu option.
 - b. Enter the 4-digit 2nd level access code “5494” and press **OK**.
 - c. Select the Rewinder for roll 1 or roll 2 and press **OK**.
 - d. Confirm your selection by pressing **OK**.
 - e. The product resets the calibration parameters and checks that the default values have been correctly saved inside the NVM memory. If the check fails, a 79:04 error is generated, and the procedure is interrupted. Otherwise, the product confirms success.
2. Turn off the product.
 3. Replace the Rewinder motor.

Disable Upper Roll Cover

Disables the functionality that makes the printer unload the roll every time the roll cover is opened.

Enable Upper Roll Cover

This utility re-enables the upper roll cover without restarting the product.

1. In the Service Utilities submenu, scroll to, and select **Enable upper roll cover**.
2. Close the roll cover when requested by the Front Panel.
3. Wait until you see the a message.
4. Press **OK**.

Double Cut for Borderless Printing

This utility disables the double cut that the printer makes in order to print borderless images on photo media.

Remove non Factory Papers

This utility removes the paper profiles that were installed by the user. It does not remove any original paper profile shipped with the printer.

Use this utility when a paper profile installed by the user could be the cause of the problem.


1. In the Service Utilities submenu, scroll and select **Remove non factory papers**.
2. Press **OK** to confirm the removal.


Scanner Validation

By executing this validation, the product will perform the following scanner tests:

- ScanDump
- Focus
- Skew
- Dead/hot pixels

- Alignment/Stitching
- Chromatic aberration
- Streak
- Gray matching
- Signal noise

 **NOTE:** Before running the scanner validation check that the calibration sheet is free from dust, spots or stripes. Check that the calibration sheet is not dirty, wrinkled, scratched or folded.

 **NOTE:** Before running the scanner validation open the scanner to check that the glass plate is free of dirt, dust and scratches. Clean the glass plate if necessary before proceeding.


1. In the Service Utilities submenu, scroll down and select the **Scanner validation** option.



2. Enter the 4-digit 2nd level access code "5494" and press **OK**.




3. The Touch Control Panel will then prompt you to load the calibration sheet.

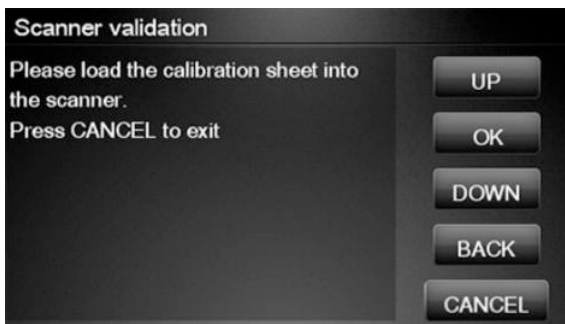


4. Hold the calibration sheet from both sides and place it facing the arrow in the centre of the sheet in front of the Page icon present on the input tray of the scanner. Push the sheet with both hands on both sides at the same time to load the sheet with no skew. Press OK to continue with the test.



5. Press OK to continue with the test.

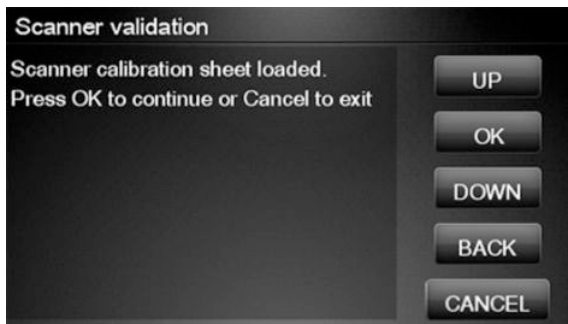

6. The Touch Control Panel will then display a percentage with the progress of the validation.

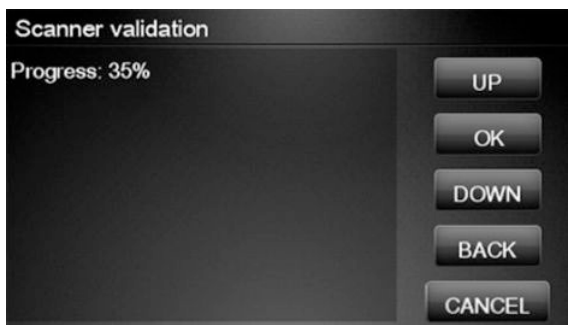

7. Wait until the scanner validation test has completed. The Touch Control Panel will then show the test results. Press OK to continue




 **NOTE:** If scanner validation result is **FAIL** then:

- Check that the calibration sheet is in good condition according to previous note. Replace with a new one if necessary.
- Check that the 5 glass plates are in good condition. Replace with new ones if necessary.
- Inspect that the 5 glass plates are correctly installed, and that they are clean.
- Perform a scanner calibration and repeat the validation.
- If the scanner validation result is FAIL with error CWS_RC_VAL_DEADPIXEL_FOUND, replace the individual CIS module accordingly.

After the validation, a set of files is saved in the CWS_validation folder. SCANDump and log files will be written every time a validation is being executed. TIFF files will only be written if a test fails. If the validation is performed again the files are overwritten. The following files are written:

File name	CWS_validation folder
SCANDump_Xxx.con	SCANDump files can be opened with SCANview. (part of SCANTest)
scanTRUSTresult.log	Results file, contains the following: <ul style="list-style-type: none"> • Measured values and limits • Error codes (if any)
scanTRUST.log	The Log file. Primarily contains information that can help troubleshoot where an error has occurred.
*.tif	Scanned images of failed tests. These are mainly for escalation to division for troubleshooting purposes.

 **NOTE:** The Diagnostic package (reduced level) will contain only all LOG and CON files. Extended diagnostic package (full level) will contain all files.

SCANDump


SCANDump is an archive file that can be viewed with SCANview (SCANTest). The SCANDump file consists of the following:

- Four light profiles (see below for an explanation on Light Profiles).
 - RGB: Unadjusted.
 - RGB: Adjusted.
 - Grey: Unadjusted.
 - Grey: Adjusted.
- A statistic file and documentation about how to use the system.


Light Profiles

The light profiles are a snapshot of what the image sensor sees at the time the SCANDump was made. The light profiles will in some degree be affected by wear and tear, cleanness, and also the condition of the calibration sheet that was used to calibrate the unit. There are two types of light profile, adjusted and unadjusted.

The Unadjusted light profile is a raw picture of the light source. All imperfections of the sensors and the light guide (in one, the CIS elements), are visible. Only the general light level has been manipulated.

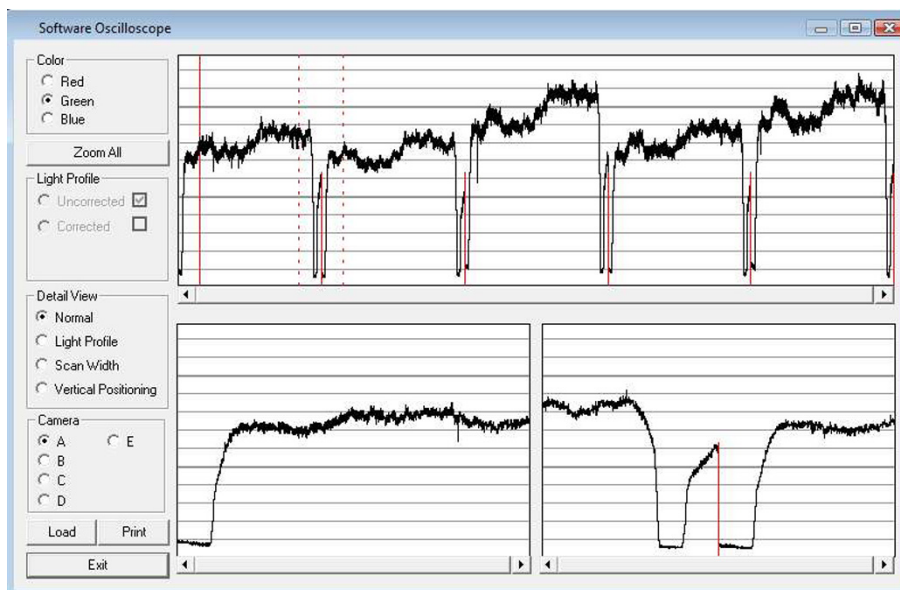


The Adjusted light profile is corrected according to the calibration sheet, in other words, the calibration sheet has been used as a reference to correct the imperfection of the CIS elements.

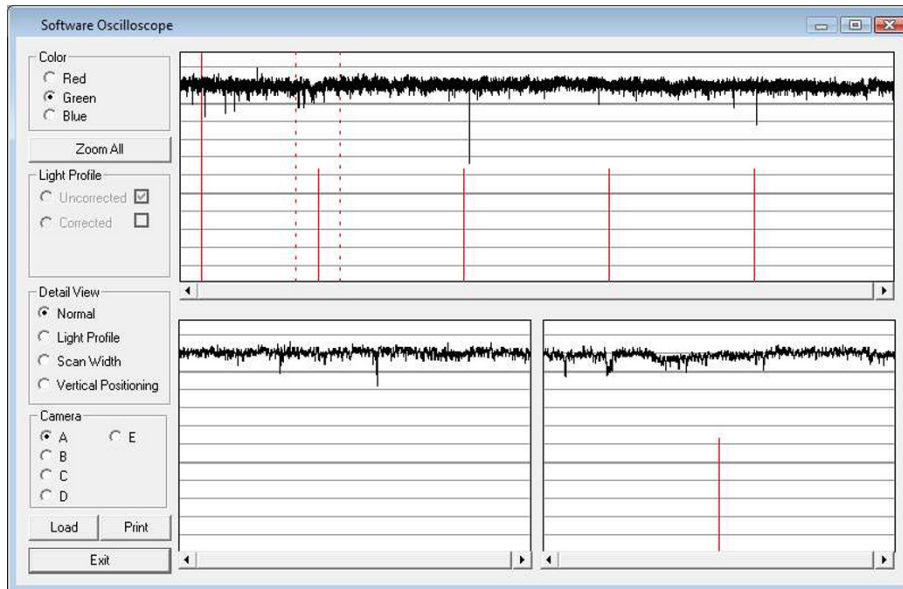

Since we do the basic calibration in two modes, one for the color channels and one for Gray, two sets of profiles are included in the SCANDump file.


General view of the light profile

This is the overview screen of the profiles of the CIS elements, here shown as A, B, C, D, E. Each arc represents a CIS element. The lower half of the screen can be used to amplify the profile of a selected CIS element, for a closer look.

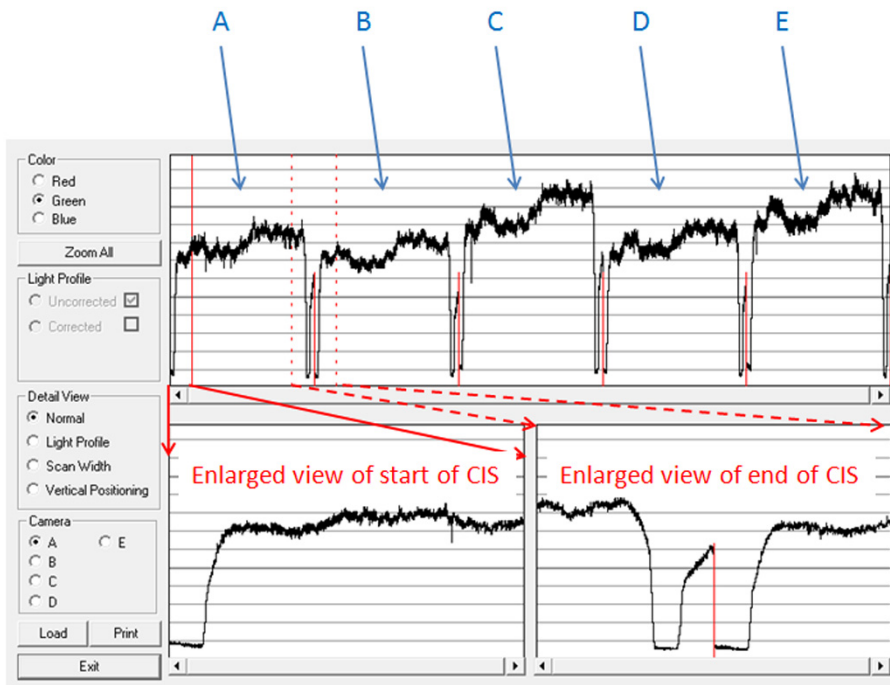


Reading the Uncorrected Light Profile

A uncorrected light profile should be within the Min/Max shown here. Since the Light source is located at the end of the CIS element it is normal that the light profile's level is higher here and that the level drops a little towards the center of the CIS.

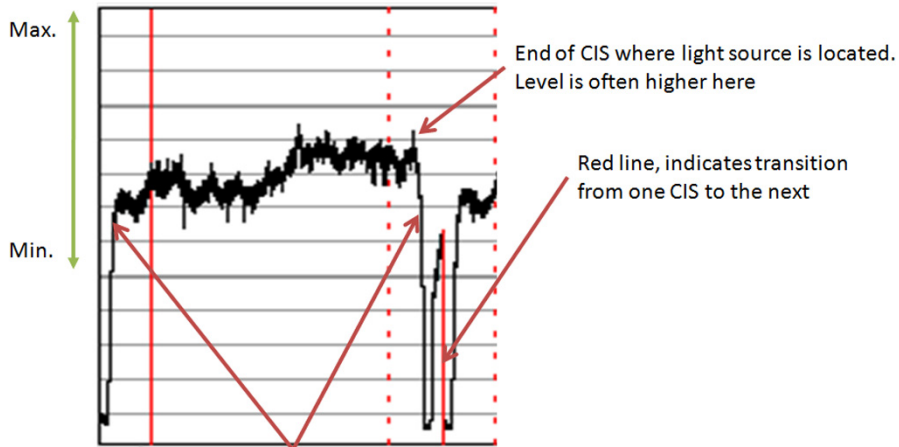


A drop in the light level in the active part of the CIS is often caused by dirt or scratches on the glass plate

A white patch is located at each end of the CIS element. The one at the start of the CIS is a bit smaller than the one at the end, it makes a black point, unlike the end which makes a Black and a White point.

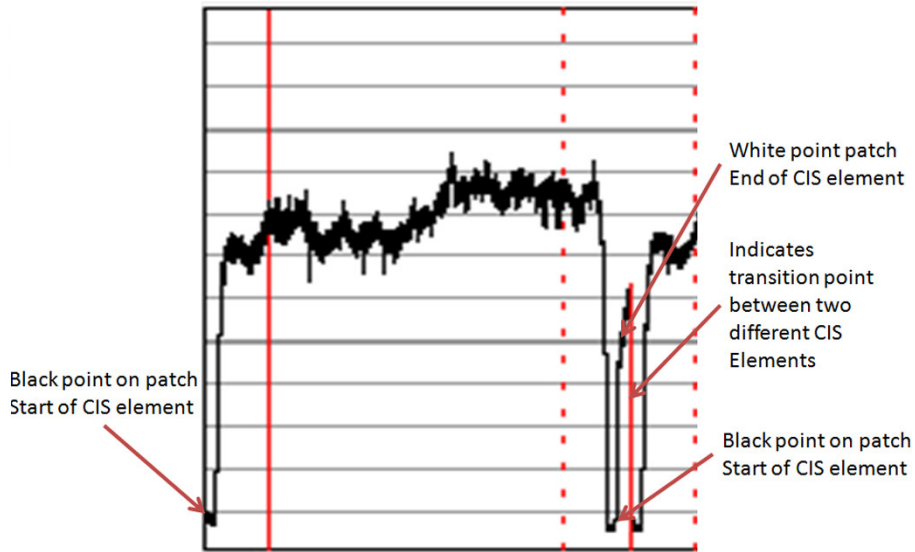

Reading the Corrected Light Profile

A corrected light profile should be within the Min/Max shown here.

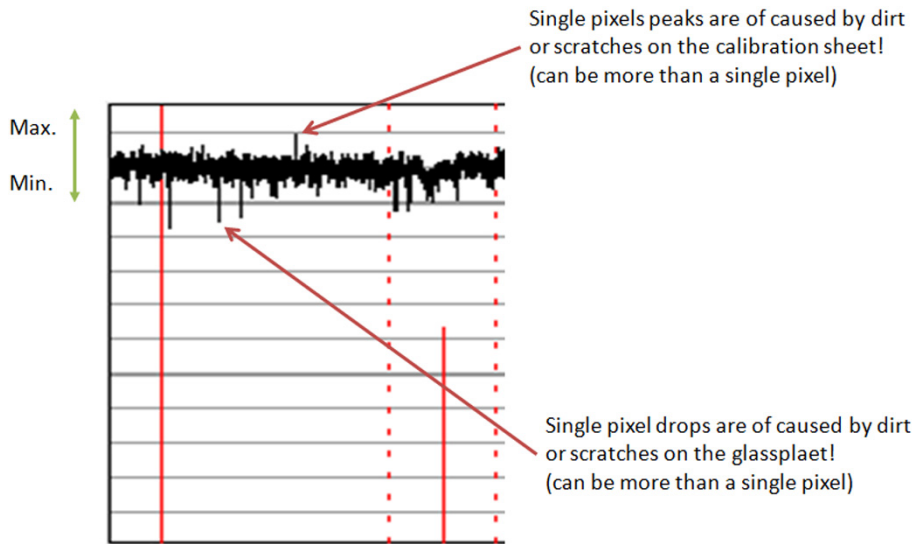

Peaks will show up in a scan as a lighter color and not necessarily in all colors, it depends on which color channels are being affected by the dirt/ scratch.

Drops will be seen as a dark line in the scan and again not necessarily in all colors, it depends on which color channels are being affected by the dirt/ scratch.


If the peak or the drop is within 1-2 div (lines) it is usually not noticeable in the scan and is just general noise. The dirt or the scratch can be from one pixel to several!

Statistics File

This file contains useful information about the usage of the system, along with firmware version and last calibration date.


Troubleshooting image quality using the light profiles

A drop in the light profile is often caused by dirt/dust on the glass plate A spike is related to the calibration, either dirt or dust on the glass plate during the calibration or a dirty calibration sheet.

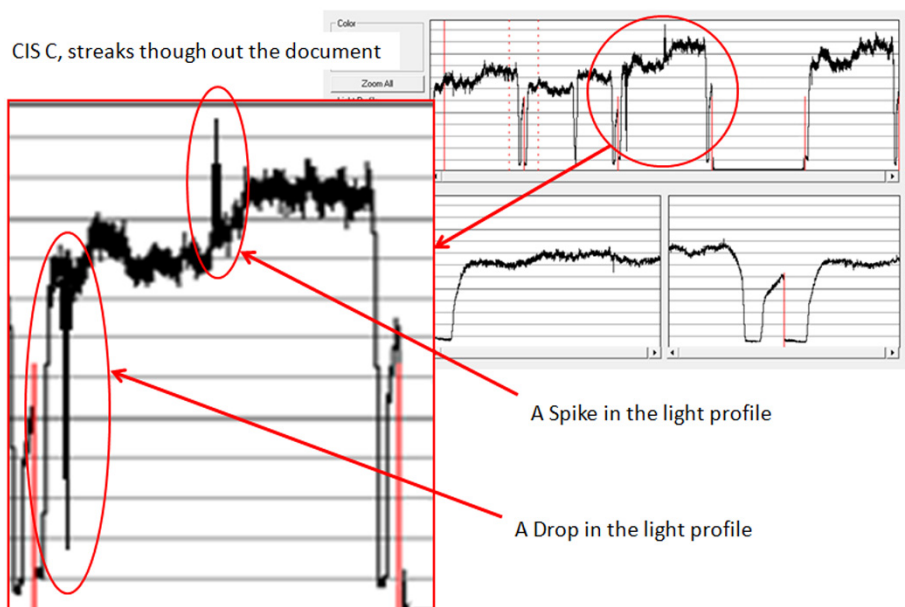


A light profile with an about 20 pixel drop can be a contaminated lens in the CIS module.

CIS B, a black line though out the document

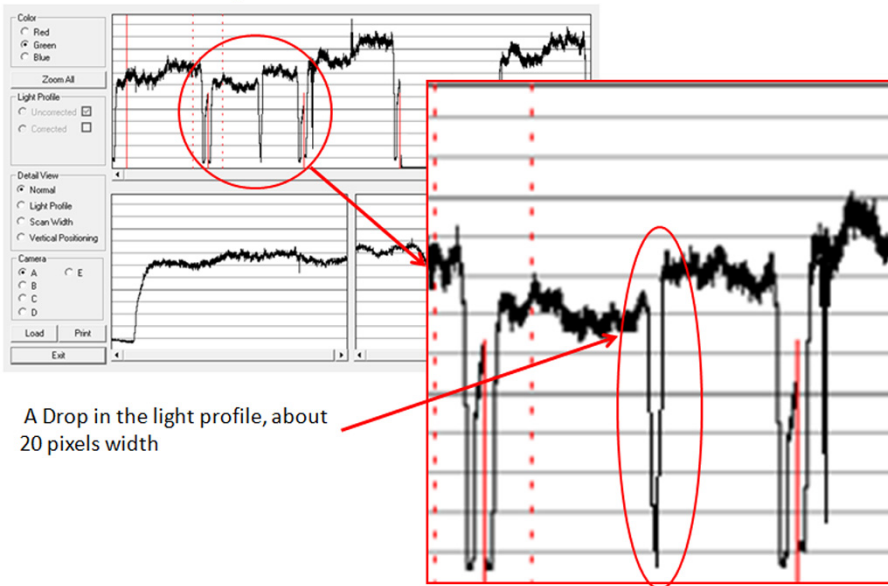

A light profile with an about 20 pixel drop can be a contaminated lens in the CIS module.

CIS D, a complete flat light profile

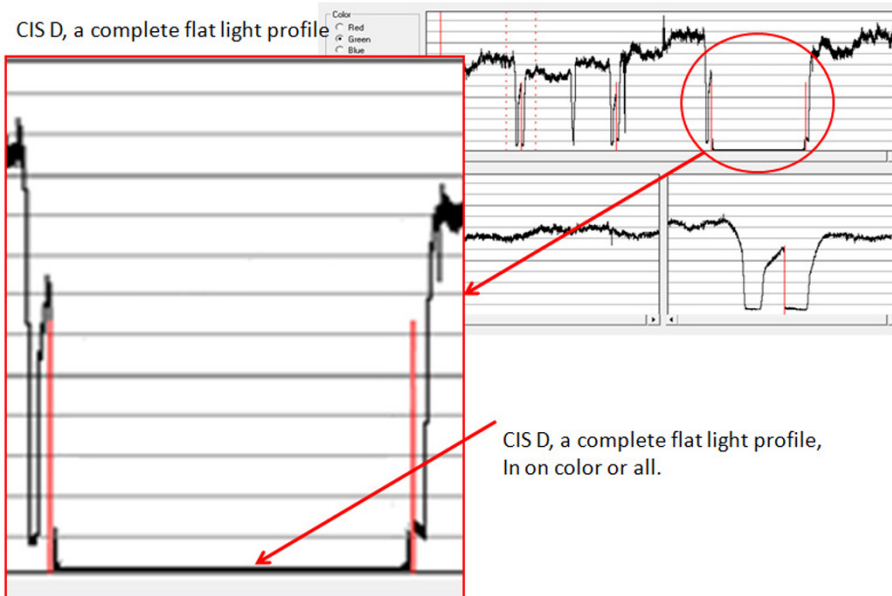


A completely flat light profile in one color or all colors can either be one specific LED or the entire CIS module that is faulty.

Adjustment scanner Y-Axis scale


The scanner may produce a vertical distortion in scanned images. It is important in CAD plots to maintain the aspect ratio of the originals. The purpose of this utility is to correct this vertical distortion. This sections describes how to calculate and set the Y-Axis adjustment scale.

Use the following procedure to print the Scanner IQ plot.

1. From the Home Screen press the Information icon on the top left corner of the screen. For information regarding the Touch Control Panel keys.
2. From the product Information Area, press the Main Menu/tool icon on the bottom right corner of the screen.

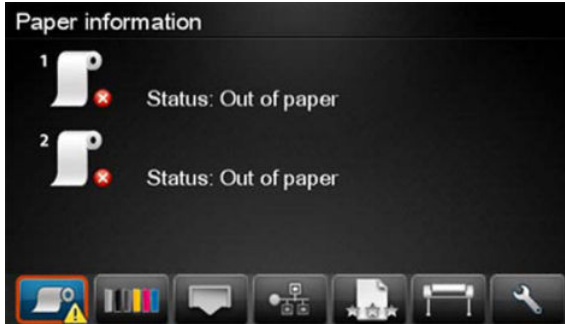

3. From the Main Menu, scroll down and select the **Image-quality maintenance** option.

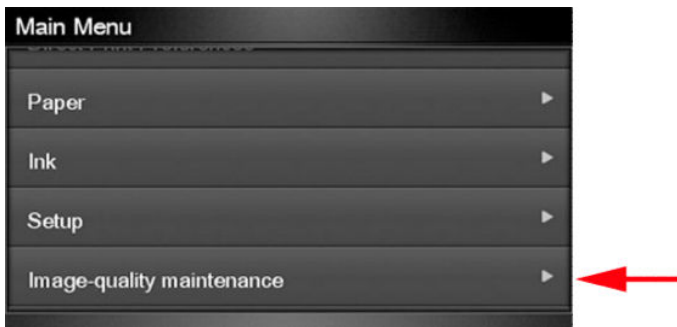


4. From the Image-quality maintenance menu, scroll down and select the **Scanner IQ plot** to print.




5. The next procedure describes how to copy the Scanner IQ plot:

- From the Home Screen press the **Copy** icon on the left side of the screen

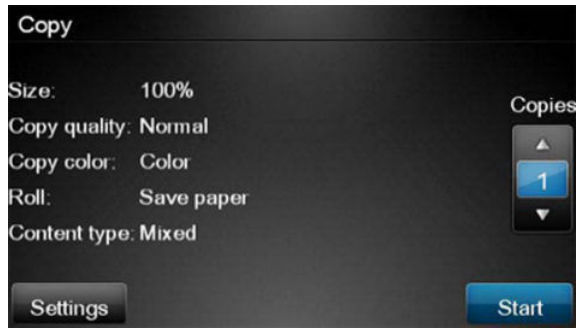


- Press **Start**.

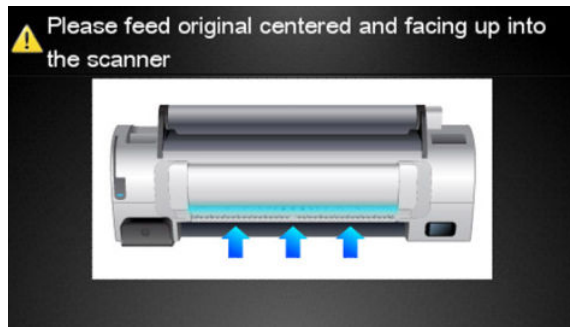


- The Control Panel prompts you to feed the original. Load the Scanner IQ plot that you printed previously in the Scanner input tray. Wait then for the product to scan and print the image.



9. Follow the next steps to calculate the Y-Axis adjustment scale: Measure the total length of the two vertical rules at both sides of the copied plot (we call it M1 and M2).

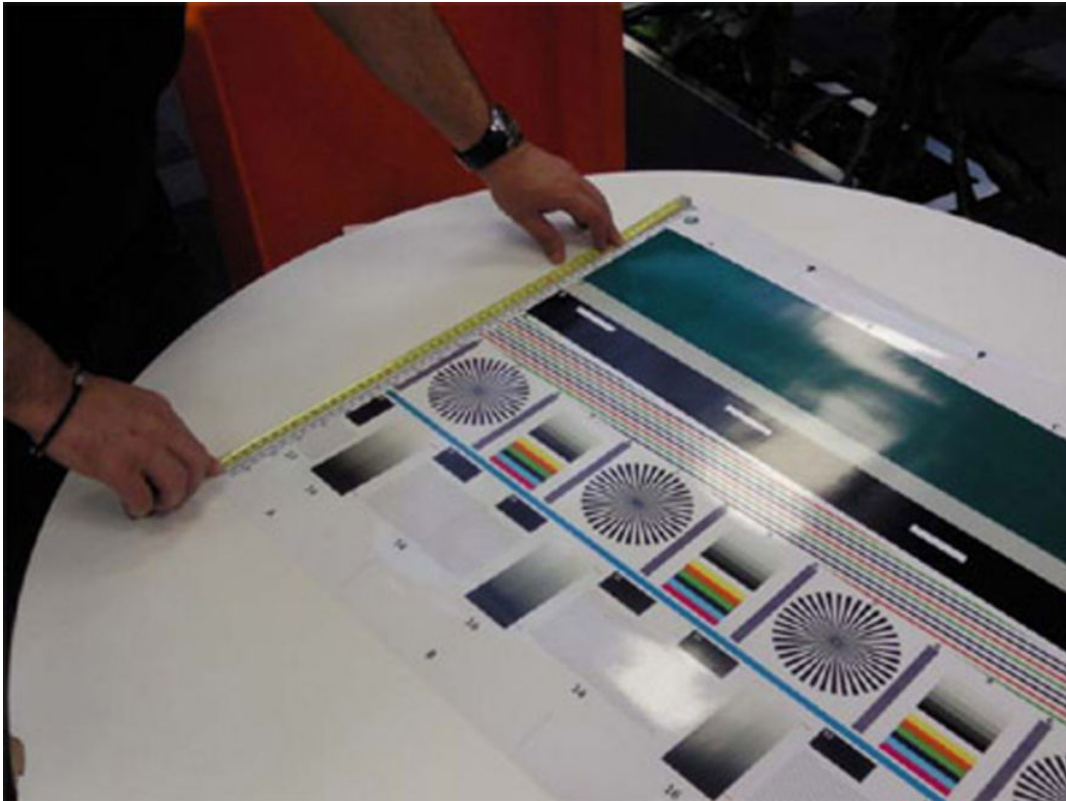


 **NOTE:** If M1 is quite different from M2 (more than 1mm or 1/16th inch) then refer to incorrect paper advance, skew during scanning, or horizontal wrinkles in the Image-quality troubleshooting.


10. If M1 and M2 are similar (within 1mm or 1/16th inch) then consider $M1 = M2 = M$ and calculate P as: Y-Axis adjustment scale = $-100 \times (M - T) / T$ Where T is the total length of the vertical rules ($T = 22$ inches or 570 mm). Follow the next steps to set the Y-Axis adjustment scale:
11. In the Service Utilities submenu, scroll to the **Adjustment scanner Y-Axis scale** and press on this option.



12. Press **OK** to continue.

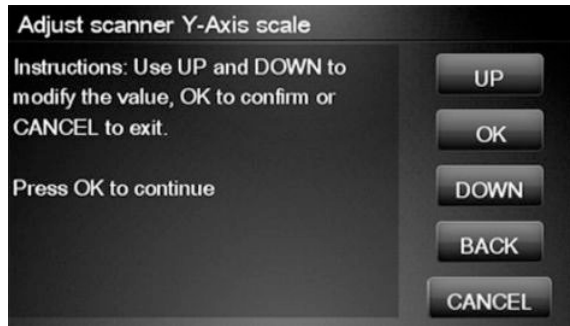

13. Press **UP** and **DOWN** to pre-set the new value of Y-Axis adjustment scale and press **OK**.

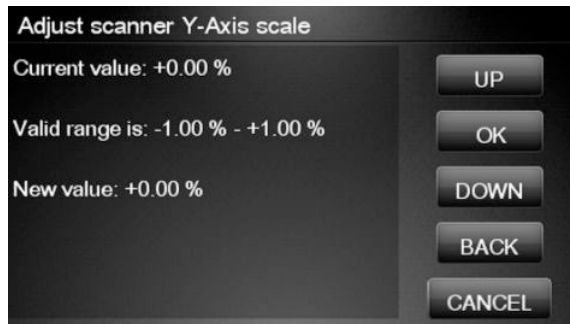

14. Repeat the process from step 6 onwards until M is equal to T.


Reset Access Control

The purpose of this Service Utility is to reset the Embedded Web Server access control to default; both the admin username and password, and other users passwords are set to “ ”.

1. In the Service Utilities submenu, scroll to **Reset access control** and select it.



2. Press OK to confirm and continue with the reset or Cancel to exit.

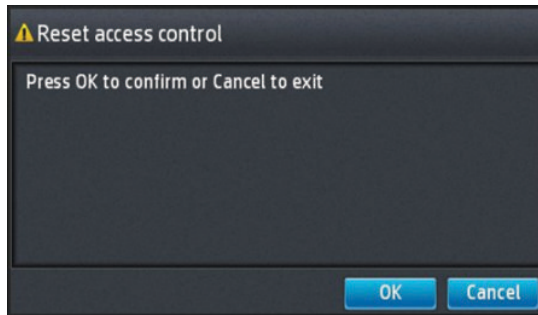


Uninstall Applications

With this Utility all the applications that currently are installed in the printer will be removed.


1. In the Service Utilities submenu, scroll to **Uninstall applications** and select it.



2. A message similar to the following will be displayed in the Front Panel. Press the **OK** button to remove the installed applications, or press **Back** or **Cancel** to exit.

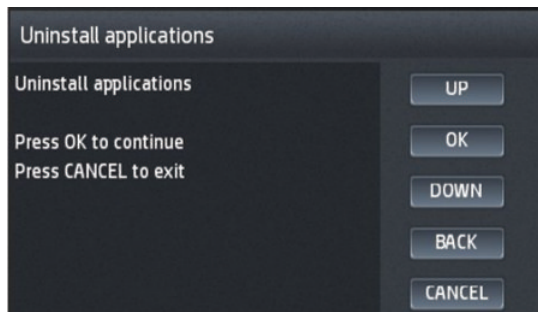

3. If **Cancel** was selected, the screen below is displayed; press **OK** to exit to the Service Menu.

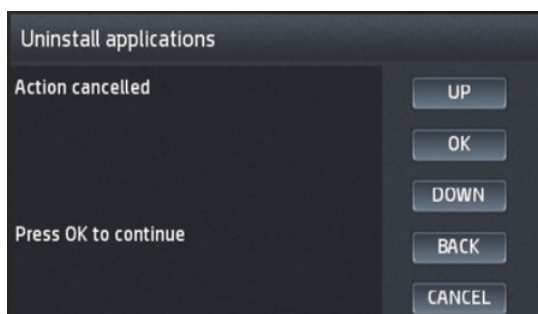

Accounting Mode

Used to enable the Abacus accounting tool (available in the US only).

Content thresholds

This menu allows you to change the default threshold values of HP Designjet Partner Link Pay-Per-Use usage categories.


- The **Color** value is the maximum % of color pixels in a Mono Lines Category.
- The **LDI** values are the minimum % of non-white pixels with respect the total pixels in a page to be considered to be in the Low Density Image category.
- The **HDI** values are the minimum % of non-white pixels with respect the total pixels in a page to be considered to be in the High Density Image category.

The default values are Color:1%, LDI:10% and HDI:50%. Don't change these values unless you are sure about what are you are doing.

Please refer to the HP Designjet Partner Link Pay-Per-Use user manual for deeper information about printing usage categories.

Advance media stop position

This utility allows to make the paper stop further from the pinch rollers. This helps to prevent the leading edge of the page to crash against the ribs of the platen generating marks on the top of the print.

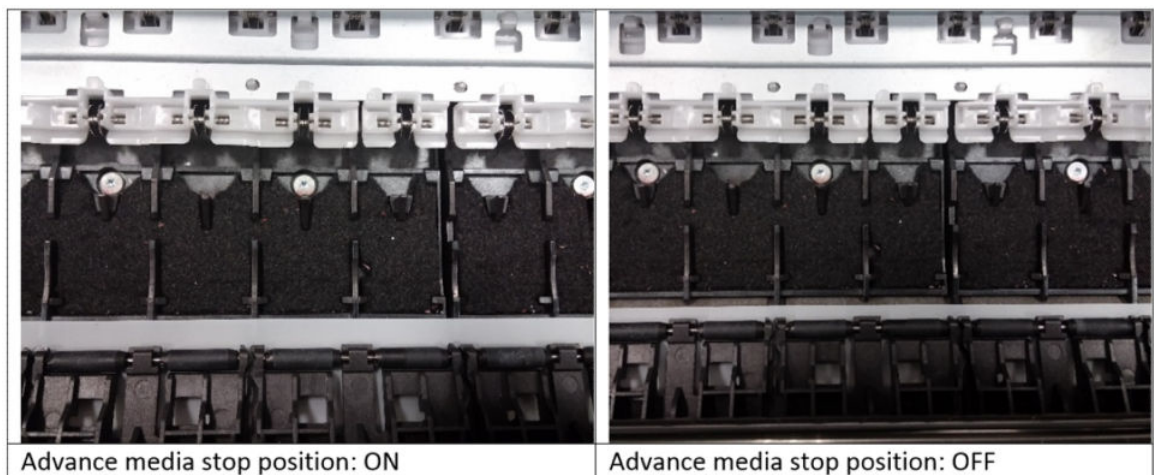

View startup code

This option provides a hexanumeric code that allows you to verify the status of printhead installation according the following table:

Table 4-1 PHA status decoding table

0x	
0000	Current PHA status
0000	PHA status after servicing

Table 4-1 PHA status decoding table (continued)

0000		Pk
00		G
00		Mk
00	First temperature check deltas	C
00		M
00		Y
00	First optotrip check results	
00	Second optotrip check results	
00	Third optotrip check results	
00	Fourth optotrip check results	
00	Fifth optotrip check results	
00	Sixth optotrip check results	
00	Seventh optotrip check results	
00	Eighth optotrip check results	
00	Ninth optotrip check results	
00	Tenth optotrip check results	
00	Eleventh optotrip check results	
00	Twelfth optotrip check results	

PH status (current, EE and after servicing)

See [Printhead 727 Error codes on page 82](#).

Temperature check result

There are a total of four distinct cases for Printhead temperature:

0x00	0x01–0xFD	0xFE	0xFF
The delta* is less than or equal to 0 degrees	You must convert the value to decimals and divide by 5 to obtain the delta* temperature	The delta* is higher than 50 degrees	The Printhead detected that the temperature is too high

*Delta: the difference between the temperature before and after spitting. A high delta indicates that there might not be enough ink in the Printhead.

Optotrip check

Every bit of an optotrip check represents a color slot:


b	0	0	0	0	0	0	0	0
	-	-	Pk	G	Mk	C	M	Y

The bit is set to 0 if the NOA of that color does not open or to 1 otherwise. If the test is not run the bits are not flagged and remain 0.

Es: 3F all colors open, 00 no colors open (or test not run).

Service Calibrations

The product has several calibration procedures that must be performed under certain conditions.

 **NOTE:** REMEMBER THAT CERTAIN CALIBRATIONS ARE REQUIRED EVEN IF AN ASSEMBLY HAS BEEN DISASSEMBLED TO GAIN ACCESS TO ANOTHER ASSEMBLY OR COMPONENT.

The following is a list of all internal service calibrations available in the product. For instructions to enter the service calibrations menu, see [Entering the Service Calibrations Menu on page 232](#).

+ [Paper Advance Calibration on page 232](#)

Print

Scan


+ [Drop Detector Calibration on page 235](#)

Calibrate drop detector

Reset calibration flag


[Line Sensor Calibration on page 236](#)

[Stacker overdrive calibration on page 238](#)

 **NOTE:** If **all** the Calibrations need to be performed (for example, when both the Formatter and the Engine PCA have been replaced), you must perform them in the above order.

Entering the Service Calibrations Menu


1. From the Home Screen press the Information icon on the top left corner of the screen. For information regarding the Front Panel keys, see [The front panel on page 35](#).
2. From the product Information Area, press the Main Menu tool icon on the bottom right corner of the screen.
3. Scroll down to the lowest menu option and press on the **Service menu** option.
4. Enter the 4-digit 1st level access code “3174” and press **OK**.
5. Press on the Service calibrations menu option.
6. From the Service calibrations menu you can scroll up and down the available utilities. Press on the selected menu option.

 **NOTE:** In some cases a quick press of a button may not be recognized by the product. When pressing a button, be sure to press it firmly.

Paper Advance Calibration

The purpose of this Service Calibration is to calibrate the nominal advance of the paper. This calibration is necessary to control the exact movement of the paper in order to avoid print quality problems like banding.

If you need to perform a Paper Advance Calibration to solve a print quality problem, it is recommended that you first try the Paper Advance Calibration from the user's menu, which will calibrate the product to a specific paper type.

 **NOTE:** You can perform Paper Advance Calibration on a sheet or roll, but the paper type should always be HP Universal Instant-dry Photo Gloss. You are recommended to order the Paper Advance Calibration Kit (36 in model: CR357-67079), which contains two sheets of HP Universal Instant-dry Photo Gloss paper. You can also perform this calibration by using cutsheets created from a roll, with a minimum width of 23 inches and a minimum length of 18 inches.

Perform the Service Accuracy Calibration whenever:

- Banding is detected in prints.

Service calibrations also need to be performed after removing or replacing certain product components. If you have removed or replaced product components, check the user guide to see which tests and calibrations you need to perform.

The Paper Advance Calibration is split into two parts and should always be done in this order:

1. Print Calibration Pattern - The product first calibrates the Analog Encoder and then prints the Paper Advance Calibration pattern.
2. Scan Calibration Pattern - The product scans the Paper Advance Calibration pattern in order to calibrate the nominal advance of the paper.

 **NOTE:** Only scan the Calibration Pattern in the product that was used to actually print it. Using the Calibration in a different product could cause it to experience paper advance problems. After scanning the Calibration Pattern, it should be discarded.

Perform the Paper Advance Calibration as follows.

1. Unload paper from the product.
2. In the Service Calibrations submenu, scroll to **Paper advance calibration** and press **OK**.
3. In the Paper Advance Calibration submenu, scroll to **Print Calibration Pattern** and press **OK**.
4. When the following message appears on the Front Panel, you must select whether you would like to continue with the calibration by pressing the **OK** key. Press **Cancel** to exit the calibration.
5. If paper is detected, the product will prompt you to remove it. If paper is **not** detected, the calibration will continue.
6. The product will start to calibrate the Analog Encoder and the following message will be displayed on the Front Panel.

If the Calibration is not done or if the values are out of the limits, a warning message will appear on the Front Panel. In this case, try the following:

- Check that the product has the latest firmware version. If not, update the firmware to the latest version.
 - Retry the Paper Advance Calibration.
7. Once the Analog Encoder has been calibrated correctly, the Front Panel prompts you to select the type of paper you will use. Use the **Arrow** keys to choose roll or sheet paper. Press the **OK** key to start loading the paper.
 8. The Front Panel prompts you to load the paper. Make sure you load the paper that corresponds to your paper type selection.

9. The Front Panel prompts you to select the paper category you will use for the calibration. Scroll to your paper category and select it to continue the paper load process.
10. The Front Panel prompts you to select the specific type of paper you will use for the calibration. Scroll through the menu and select your paper type.
11. The Front Panel displays the following screen, press **ok**.
12. Once the paper is loaded into the product, a message will appear on the Front Panel.
13. Press **OK** to continue.
14. The product advances and reels in about a meter of paper. The Front Panel displays the following messages:
 - Advancing Paper
 - Printing Pattern
15. The product will start to print the Paper Advance Calibration Pattern. This could take several minutes during which a message will be displayed on the Front Panel.
16. When the Calibration Pattern has been printed successfully, the Front Panel reminds you to leave it to dry for a while.
17. When the Calibration Pattern is dry, the Front Panel will prompt you to continue. Press **OK**.
18. Return to the Paper Advance Calibration submenu, scroll to **Scan Calibration Pattern** and press **OK**
19. When the following message appears on the Front Panel, you must select whether you would like to continue with the calibration by pressing the **OK** key. Press **Back** or **Cancel** to exit the calibration.
20. A message will appear advising you that you will need to load the Calibration Pattern into the product. Make sure that you rotate the printed pattern 90° clockwise and reload it printed-side down, so that the black arrows go into the product first. Press the **OK** key to continue.



NOTE: Only scan the Calibration Pattern in the product that was used to actually print it. Using the Calibration in a different product could cause it to experience paper advance problems.

After scanning the Calibration Pattern, it should be discarded. When loading the Calibration Pattern, use the Cutter blade on the Print Platen to align the edge of the sheet. If you follow this advice, you will prevent the cutter from cutting a section of the Calibration Pattern, which could cause the Calibration to FAIL.

21. The Front Panel prompts you to select the paper category you used for the calibration. Select the same paper that you used to perform the Paper Advance Calibration print. Use the **Arrow** keys to scroll to your paper category and press the **OK** key to continue the paper load process.
22. The Front Panel prompts you to select the specific type of paper you used for the calibration. Use the **Arrow** keys to scroll through the menu and the **OK** key to select your paper type.
23. Load the calibration pattern into the product and the Front Panel displays the normal sheet loading procedure.

24. When the Calibration Pattern is successfully loaded the Front Panel displays the following screen, press **OK** to start the scan.
25. The Front Panel displays the following screen. The product will scan the Calibration Pattern which could take several minutes. Once the calibration is completed successfully, a message will be displayed on the Front Panel. Press the **OK** key to continue.

If the Paper Advance Calibration fails for any reason, a warning message will appear on the Front Panel. In this case, try the following:

- Check that the Calibration Pattern was not incorrectly cut (trimming the actual pattern) during the paper load process. If this is the case, perform the Paper Advance Calibration again from **step 1**.
- Perform a Line Sensor Calibration. See [Line Sensor Calibration on page 236](#).
- Replace the Line Sensor. See the user guide.
- If the problem continues, replace the Media Advance Driver. See the user guide.

Drop Detector Calibration

The purpose of this Service Calibration is to calibrate the Drop Detector (located in the Service Station) in relation to the Carriage Assembly. There are two menu options to calibrate the Drop Detector:

- Calibrate Drop Detector
- Reset Calibration Flag

Always perform the Reset Calibration Flag calibration BEFORE calibrating the drop detector.

Service calibrations also need to be performed after removing or replacing certain product components. If you have removed or replaced product components, check the user guide to see which tests and calibrations you need to perform.

Reset Calibration Flag

Run this option before replacing the drop detector (service station), so that the product will not try to perform a drop detection until the new drop detector has been calibrated.


1. In the Service Calibrations submenu, select **Drop Detector calibration** and press **OK**.
2. In the Drop Detector Calibration menu, scroll to **Reset Calibration Flag** and press **OK**.
3. When the following message appears on the Front Panel, you must select whether you would like to continue with the calibration by pressing the **OK** key. Press **Cancel** to exit the calibration.
4. The product resets the calibration flag. Press **OK** to return to the menu.
5. Shut down the product and replace the drop detector.
6. Start the product and calibrate the drop detector.

Calibrate Drop Detector

1. In the Service Calibrations submenu, scroll to **Drop Detector calibration** and press **OK**.
2. In the Drop Detector Calibration submenu, scroll to **Calibrate Drop Detector** and press **OK**.

3. A message is displayed on the Front Panel, select the **OK** button.
4. The product will start to calibrate the Drop Detector, which takes about 30 seconds.
5. Once the Drop Detector has been calibrated, the results will be displayed on the Front Panel. Press **OK** to finish the calibration.

The offset is the displacement from the nominal carriage position for doing the drop detection. width refers to values captured by the drop detector sensor. The offset should be within the valid range, and the window width should be at least the minimum shown. If the values are correct, press **OK** to accept them. If not, the drop detector is not correctly installed, either because the service station has not been correctly installed in the scan axis or because the drop detector is not correctly installed or not working properly. Press **Cancel** to reject the values.

 **CAUTION:** Do not accept these values if they are not within the right range, as the product will not work properly.

6. Press **OK** to end the calibration.

Line Sensor Calibration

The purpose of this Service Calibration is to calibrate the intensity of the line sensor in the Carriage PCA. An incorrect calibration can result in edge-detection failures during paper loading and incorrect reading of prints that are used for alignment or calibration.

Perform the Line Sensor Calibration in the following cases.

- If the edge detect procedure fails during paper loading.
- If the Carriage is disassembled or replaced.
- If the Line Sensor is disassembled or replaced.
- If banding is detected in prints.
- If misalignment between colors is detected.
- If the cutter platen has been disassembled or replaced.

This Service Calibration only performs the Cutter Line Offset Calibration if the line sensor has been calibrated previously.

Service calibrations also need to be performed after removing or replacing certain product components. If you have removed or replaced product components, check the Service Calibration Guide to Removal and Installation to see which tests and calibrations you need to perform.

The full calibration process

1. If possible, load a roll of Glossy or Bond and Coated type (HP Bond, HP Brightwhite, Plain, HP Coated, HP Heavyweight Coated, HP Superheavyweight Coated or photo matte) with a width of at least 24 inches into the product before starting the calibration.
2. In the Service Calibrations submenu, scroll to, and select **Line Sensor calibration**.
3. When a message appears on the Front Panel, press the **OK** key to continue or the **Cancel** key to exit the calibration. If the product detects no paper, see [The manual paper loading process on page 237](#).
4. The Front Panel displays a message while the calibration is in progress.

5. The product calibrates the intensity of the LEDs and displays the results on the Front Panel. Press **OK** to continue or press **Cancel** to exit the calibration.

If the values are not within the range specified, an error appears on the Front Panel. In this case, repeat the calibration from the beginning. If necessary, replace the Line Sensor.
6. The next step is to calibrate the Line Sensor position. The product prints a line of black dots and then scans it.
7. Once the Line Sensor position has been calibrated, the results are displayed on the Front Panel. Press **OK** to continue or **Cancel** to exit.
8. If the calibration fails or the values are out of range, try the following solutions:
 - Reseat the line sensor.
 - Repeat the calibration again from the beginning.
 - Replace the Line Sensor.

At this point the calibration finishes and continues with the step 13.
9. The next step in this is the cutter line offset calibration. This calibration moves the media and cuts it. The Front Panel shows several numbers and a message communicating if the calibration has passed or failed.
10. The product now tries to align the printheads. When a message appears on the Front Panel, press to continue or **Cancel** to exit.
11. If printhead alignment cannot be completed, try the following.
 - Enter the Front Panel menu and retry printhead alignment from there. If the alignment completes successfully, then perform color calibration.
 - If the alignment fails again, check the alignment pattern to see whether any of the printheads are printing incorrectly. If necessary, perform a printhead recovery through the Front Panel and retry printhead alignment.
12. If the printhead alignment ends successfully, you have completed the full Line Sensor calibration process.
13. Now the Front Panel shows a summary of the line sensor and cutter line offset calibration results.

The manual paper loading process

1. If the product detects no paper, a message is displayed. If you think you can load paper normally, press **Cancel** and resume the full calibration process (see [The full calibration process on page 236](#)) Otherwise, press **OK** to proceed with manual loading.



NOTE: The manual loading process performs only a partial calibration, after which you should try again to load roll paper and perform the full calibration.

2. The Front Panel prompts you to load the paper manually.
3. Feed a sheet of paper manually into the product (the product will not try to move it) until it fully covers the right-hand side of the print platen. It must cover the line sensor so that the product detects it. An A4 or US Letter paper size is sufficient.

4. When you have loaded the paper, press **OK**. The product starts the calibration process, and displays the results on the Front Panel if successful. Press **OK** to continue.

If the calibration fails, start again from the beginning. If necessary, try replacing the Line Sensor.

5. The Front Panel asks you to unload the paper. It then reminds you to reload roll paper in the normal way and perform the full Line Sensor calibration (see [The full calibration process on page 236](#)).

Stacker overdrive calibration


The purpose of this Service Calibration is to calibrate the stacker overdrive friction against the printer.

It has to be done when:


- Reinstalling or replacing the complete stacker.
- When replacing the stacker overdrive motor with transmission part.

Follow these steps:


1. Prior to calibration, remove all the prints in the stacker and any paper loaded in the printer.
2. To select this calibration, go to 'stacker overdrive calibration':

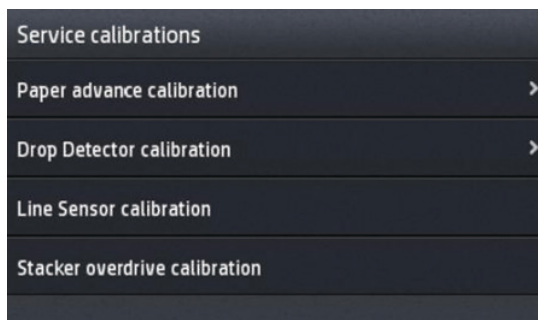


3. After selecting it, press **OK** to start calibration.

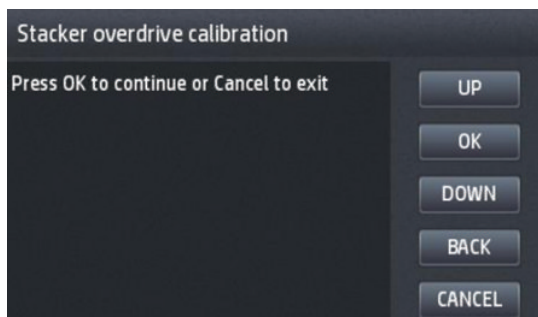


- The screen will show 'calibrating status' during some minutes while the stacker overdrive is moving at different speeds.

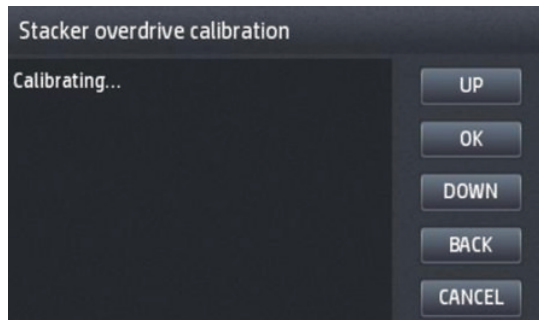

- At the end of the process, the result of the calibration is shown.

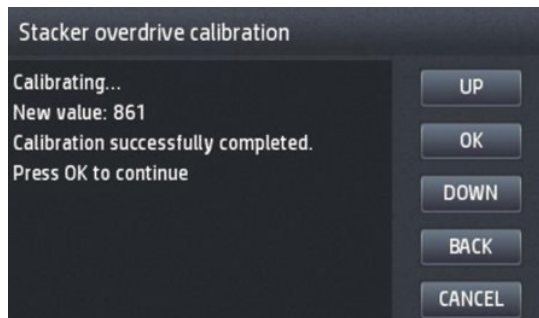

- Press **OK** to finish the calibration.

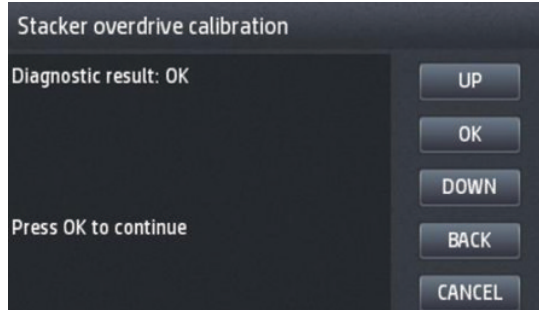

5 Parts and diagrams

- [Introduction](#)
- [Printer support](#)
- [Center and Roll covers](#)
- [Rear covers](#)
- [Cover Front Panel Side](#)
- [Cover SVS Side](#)
- [Center Assemblies](#)
- [Front Panel Side Assemblies](#)
- [SVS Side Assemblies](#)
- [Scan Axis Assemblies](#)
- [Paper Path Assemblies \(Front\)](#)
- [Paper Path Assemblies \(Center\)](#)
- [Stacker Parts \(Rear\)](#)
- [Stacker Parts \(Front\)](#)
- [Carriage Assembly](#)
- [Electrical Parts](#)
- [Miscellaneous Parts](#)
- [CIS Unit Construction](#)
- [Scanner Control Unit](#)


Introduction

The list of parts in this chapter include the notation CSR for parts that can be replaced by the customer. All other parts must be replaced by an engineer. See [Customer Self Repair parts on page 277](#).

For information on the preventive maintenance kits, see [Preventive Maintenance Kits on page 472](#).


Unless otherwise indicated, service parts are compatible with all SKUs. Any limitations are indicated in the tables below:

Printer support

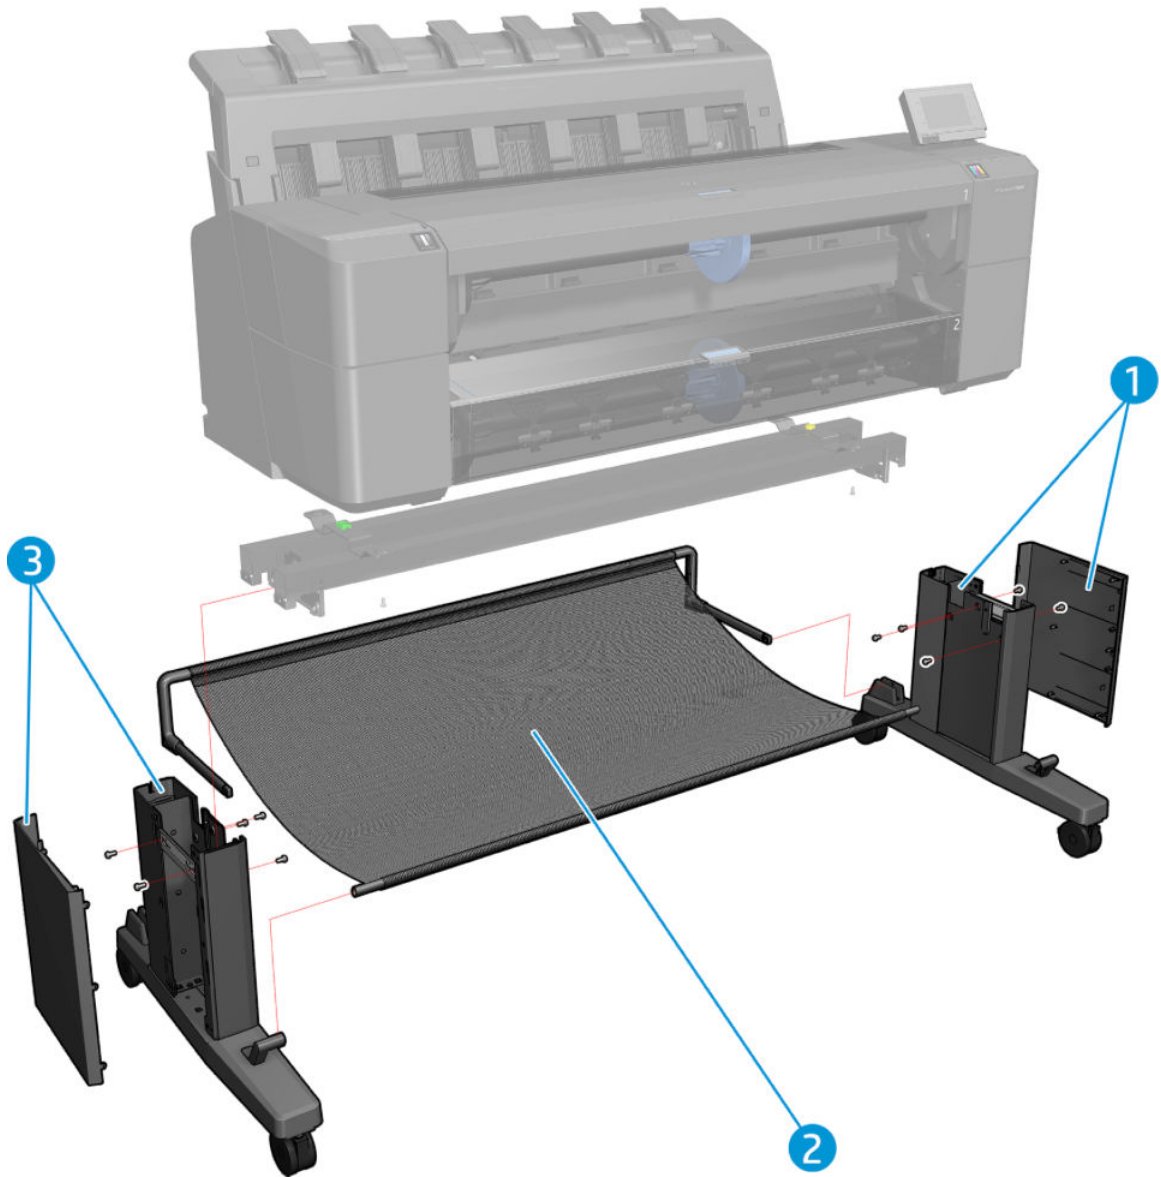


	Part number							Description	Cross-reference
	T920	T930	T1500	T1530	T2500	T2530	T3500		
1	CR357-6 7064	N/A	CR357-6 7064	N/A	CR357-6 7064	N/A	CR357-6 7064	Leg FP Side Assy W/ Cover	Customer Self Repair Flyers on page 473
2	CR357-67066							Basket Assy	Customer Self Repair Flyers on page 473
3	CR357-6 7065	N/A	CR357-6 7065	N/A	CR357-6 7065	N/A	CR357-6 7065	Leg SVS side Assy W/ C	Customer Self Repair Flyers on page 473

Center and Roll covers

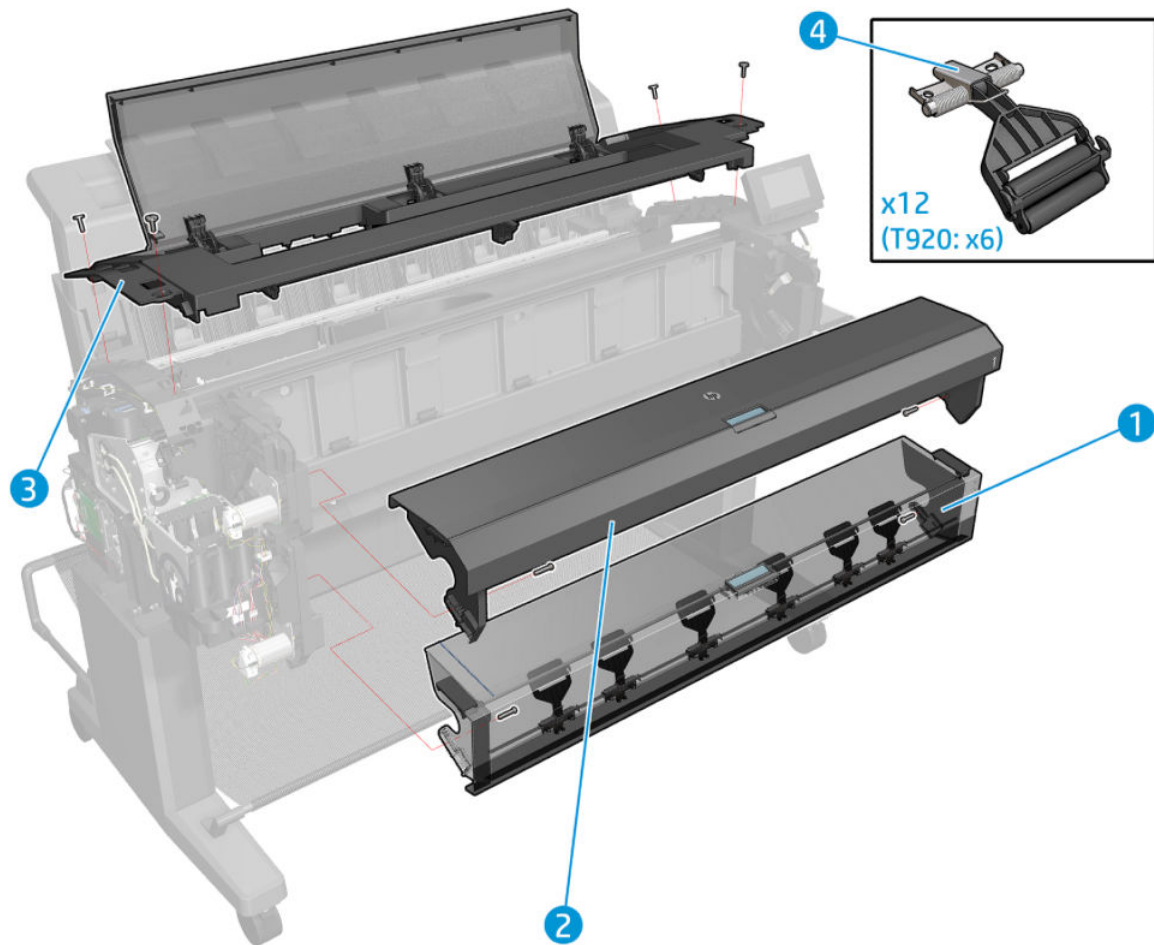


	Part number				Description	Cross-reference
	T9x0	T15x0	T25x0	T3500		
1	N/A	CR357-67036		B9E24-6 7003	Bottom Roll Cover Assy	Customer Self Repair Flyers on page 473
2	CR355-6 7001	CR357-67039		B9E24-6 7002	Top Roll Cover Assy	Customer Self Repair Flyers on page 473
3	CR357-67054		N/A		Center Cover Assy	Center cover (T920 only) on page 285
4	CR357-67067			B9E24-6 7022	ARS Arm Assy	Customer Self Repair Flyers on page 473

Rear covers

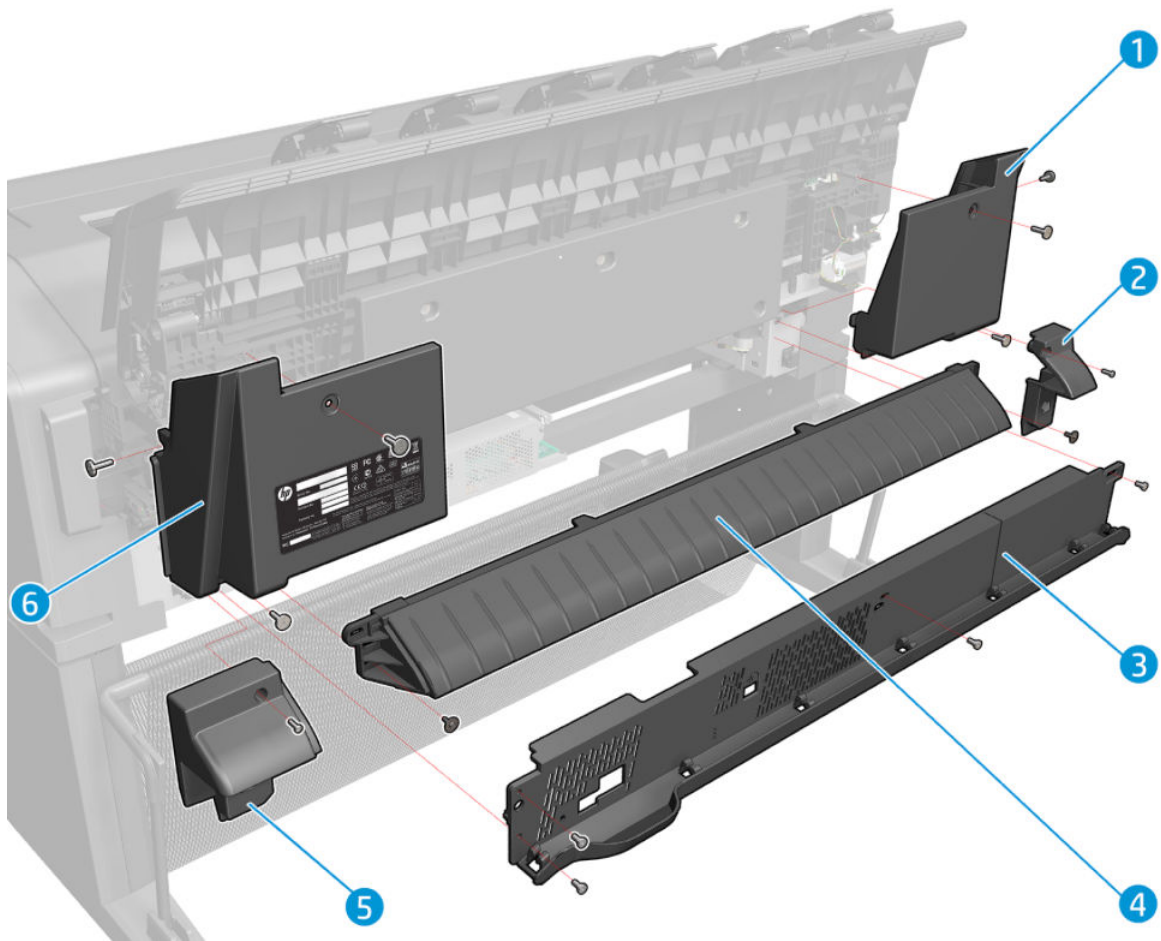


	Part number	Description	Cross-reference
1	CR357-67061	Cover Fixed Tray SVS side	Fixed tray cover (service station side) on page 292
2	CR357-67063	Cover Sidewall SVS side	Arch sidewall cover (service station side) on page 294
3	CR357-67055	Rear Cover (T920, T1500 and T2500 only)	Rear cover on page 295
N/A	L2Y21-67007	Rear Cover (T930, T1530 only)	Rear cover on page 295
4	CR357-67014	Output Platen	Arch sidewall cover (service station side) on page 294
5	CR357-67062	Cover Sidewall FP side	Arch sidewall cover (front panel side) on page 293
6	CR357-67060	Cover Fixed Tray FP side	Fixed tray cover (Front Panel side) on page 291

Cover Front Panel Side

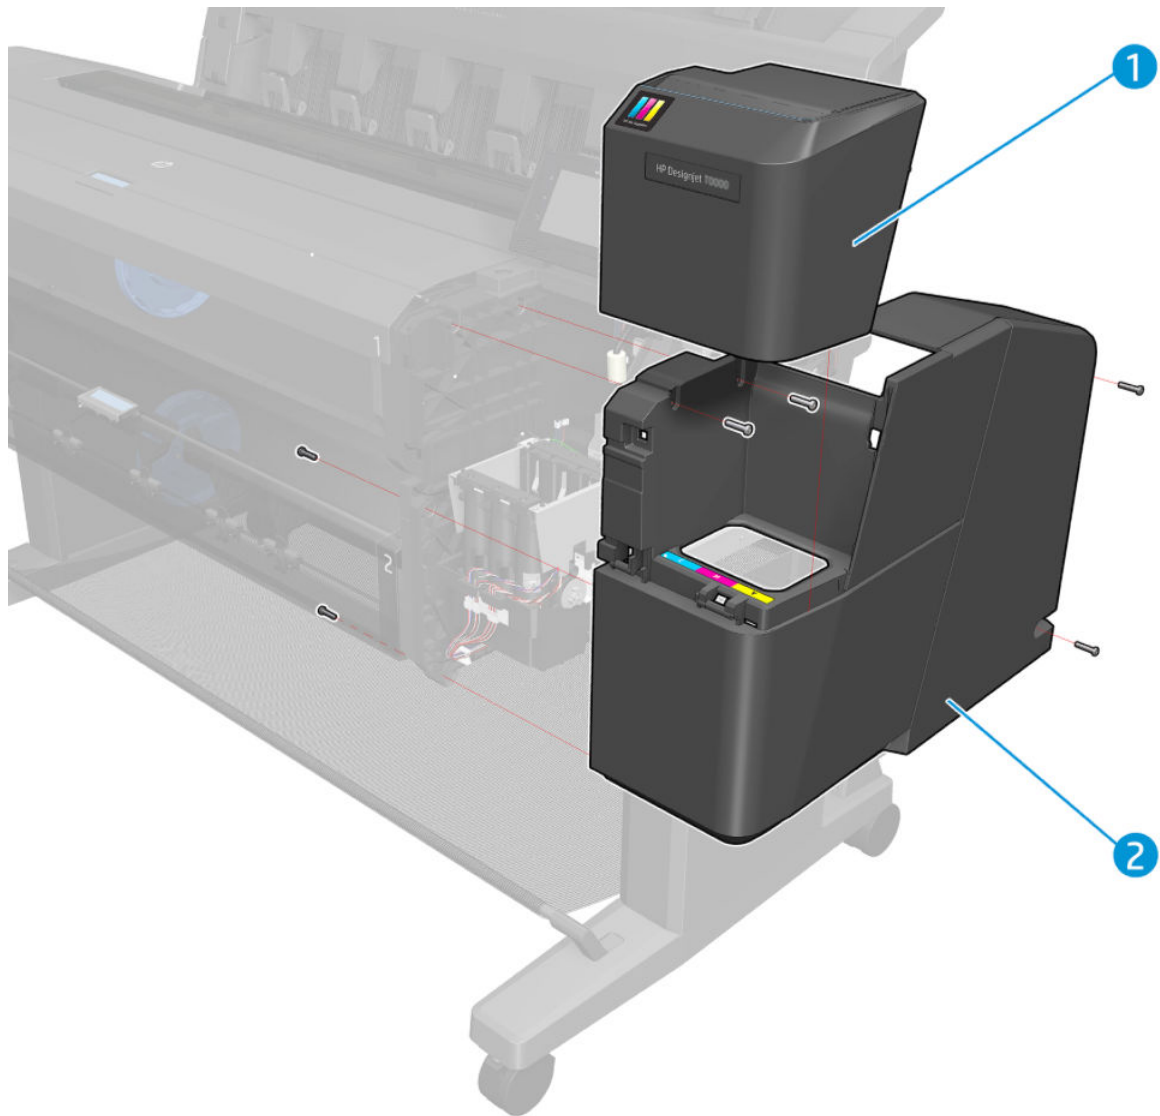


	Part number							Description	Cross-reference
	T920	T930	T150 0	T153 0	T2500	T2530	T3500		
1	CR357-67058	L2Y21-67002	CR357-67058	L2Y21-67002	CR357-67058	L2Y21-67002	B9E24-67013	Ink Door FP side	Customer Self Repair Flyers on page 473
2	CR357-67059						B9E24-67011	Cover Main FP side	Main cover (front panel side) on page 281

Cover SVS Side

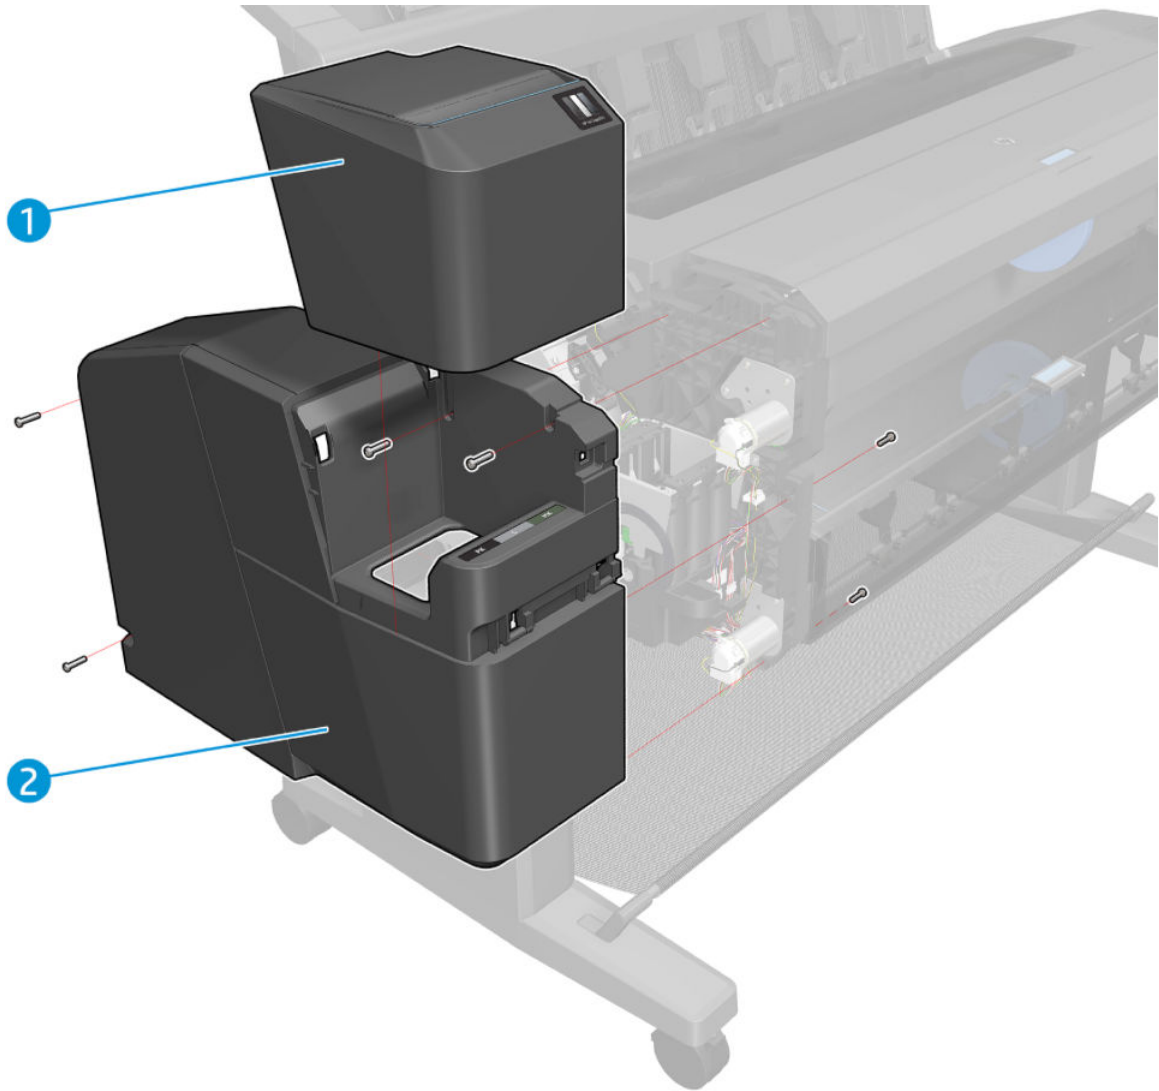

	Part number				Description	Cross-reference
	T9x0	T15x0	T25x0	T3500		
1	CR357-67057			B9E24-6 7014	Ink Door SVS side	Customer Self Repair Flyers on page 473
2	CR357-67056			B9E24-6 7012	Cover Main SVS side	Main cover (service station side) on page 283


Center Assemblies

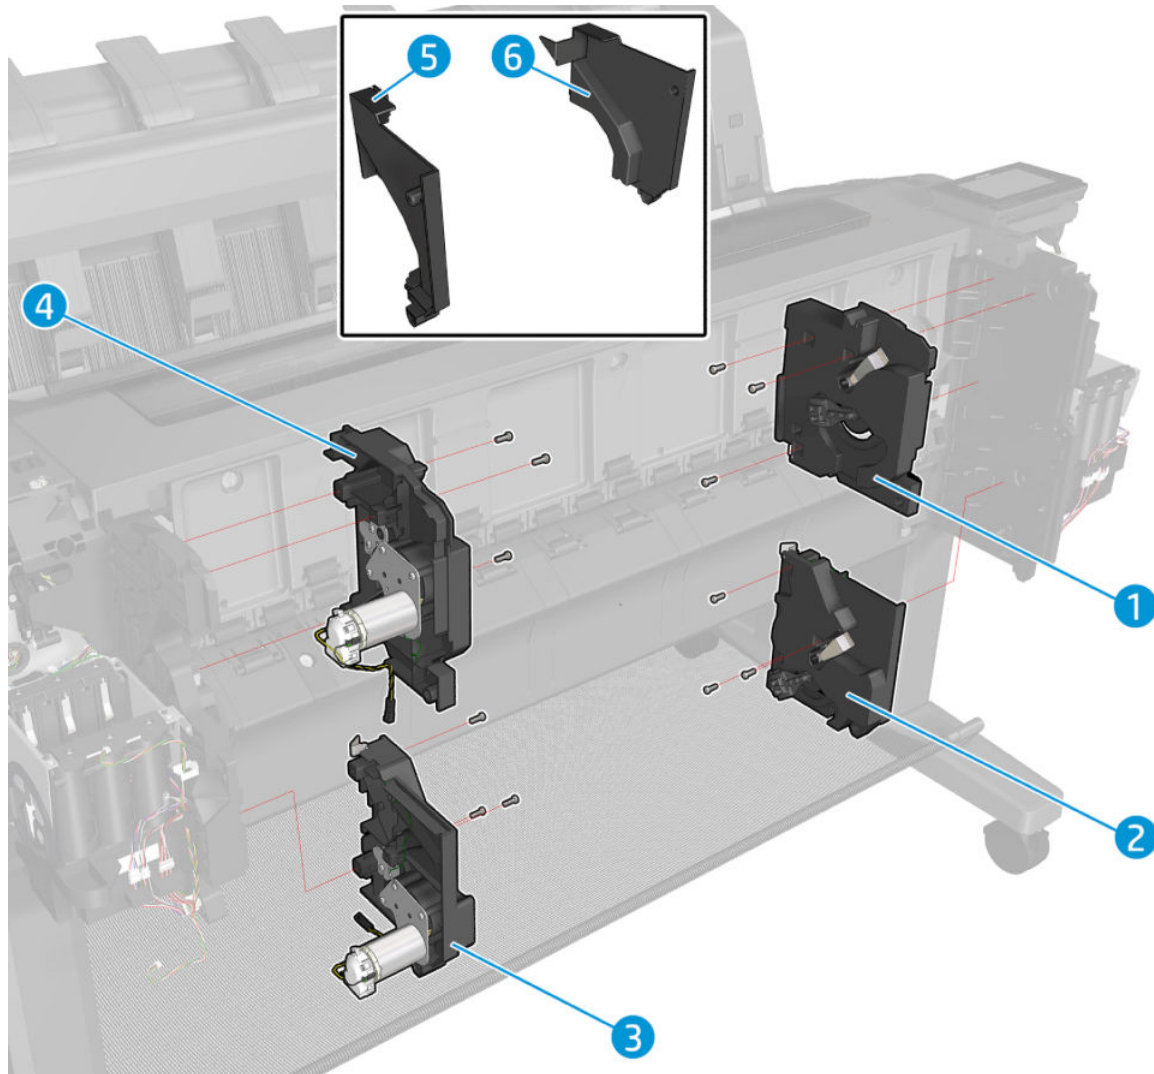

	Part number				Description	Cross-reference
	T9x0	T15x0	T25x0	T3500		
1		CR357-67038		B9E24-67005	Top Tip Support Assy	Top Tip Support on page 363
2	N/A	CR357-67035		B9E24-67010	Bottom Tip Support	Bottom Tip Support on page 364
3	N/A	CR357-67034		B9E24-67009	Bottom Rewinder Support	Bottom Rewinder Support on page 359
4		CR357-67037		B9E24-67004	Top Rewinder Support A	Top Rewinder Support on page 361


	Part number				Description	Cross-reference
	T9x0	T15x0	T25x0	T3500		
5	CR355-6 7005	N/A			Cover Arch SVS side (1 roll)	Arch sidewall cover (service station side) on page 294
6	CR355-6 7004	N/A			Cover Arch FP side (1 roll)	Arch sidewall cover (front panel side) on page 293

Front Panel Side Assemblies

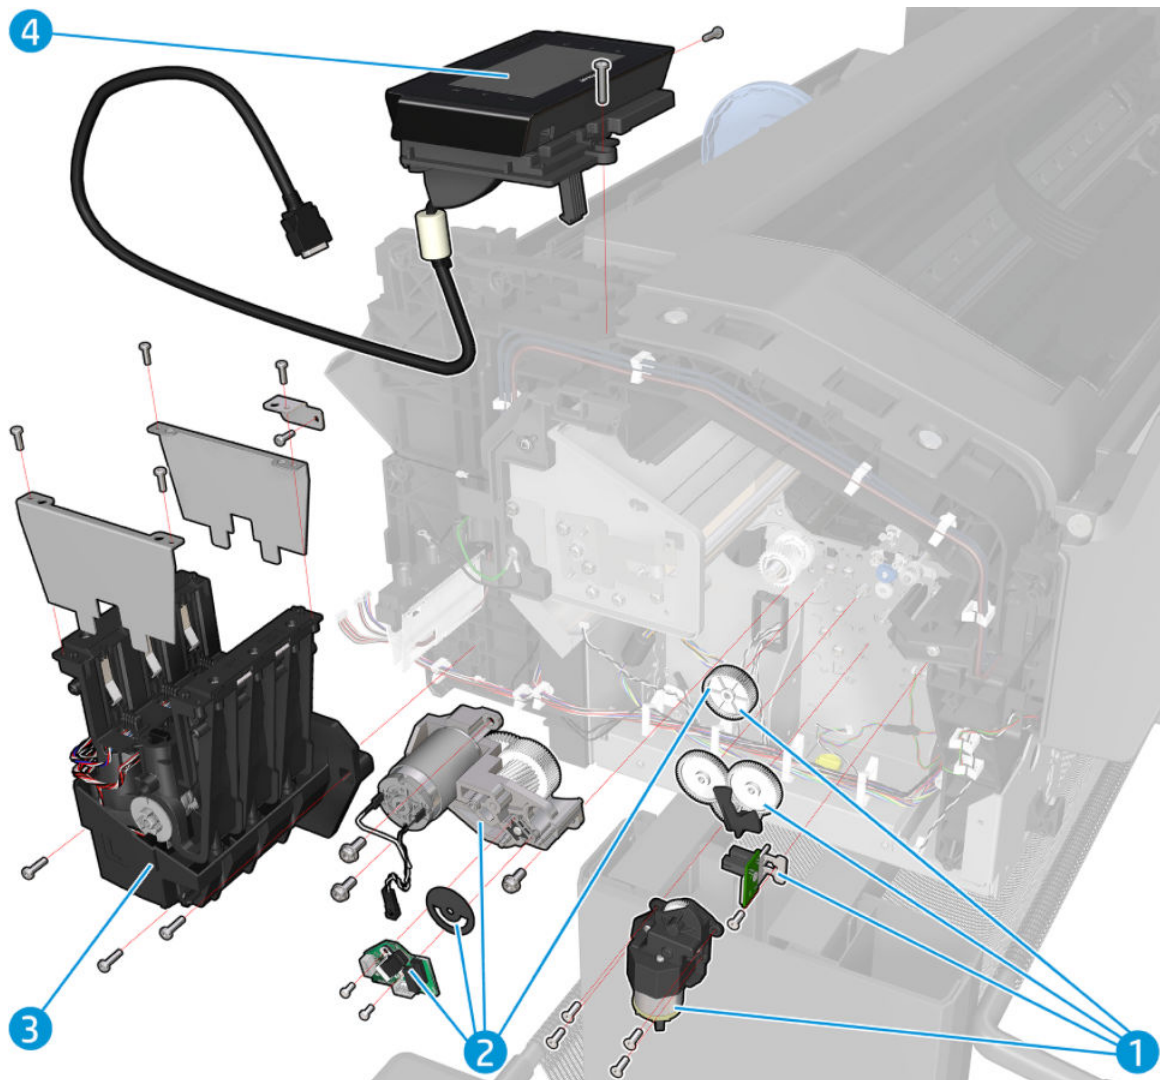


	Part number	Description	Cross-reference
1	CR357-67010	Starwheel Motor	Starwheel Motor on page 387
2	CR357-67009	Motor Media Advance Transmission with Encoder	Motor Media Advance Transmission with Encoder on page 379
3	CR357-67028	ISS FP side	ISS (Ink Supply Station) Front Panel Side on page 346
4	CR357-67052	Front Panel Assy	Front panel on page 318

SVS Side Assemblies

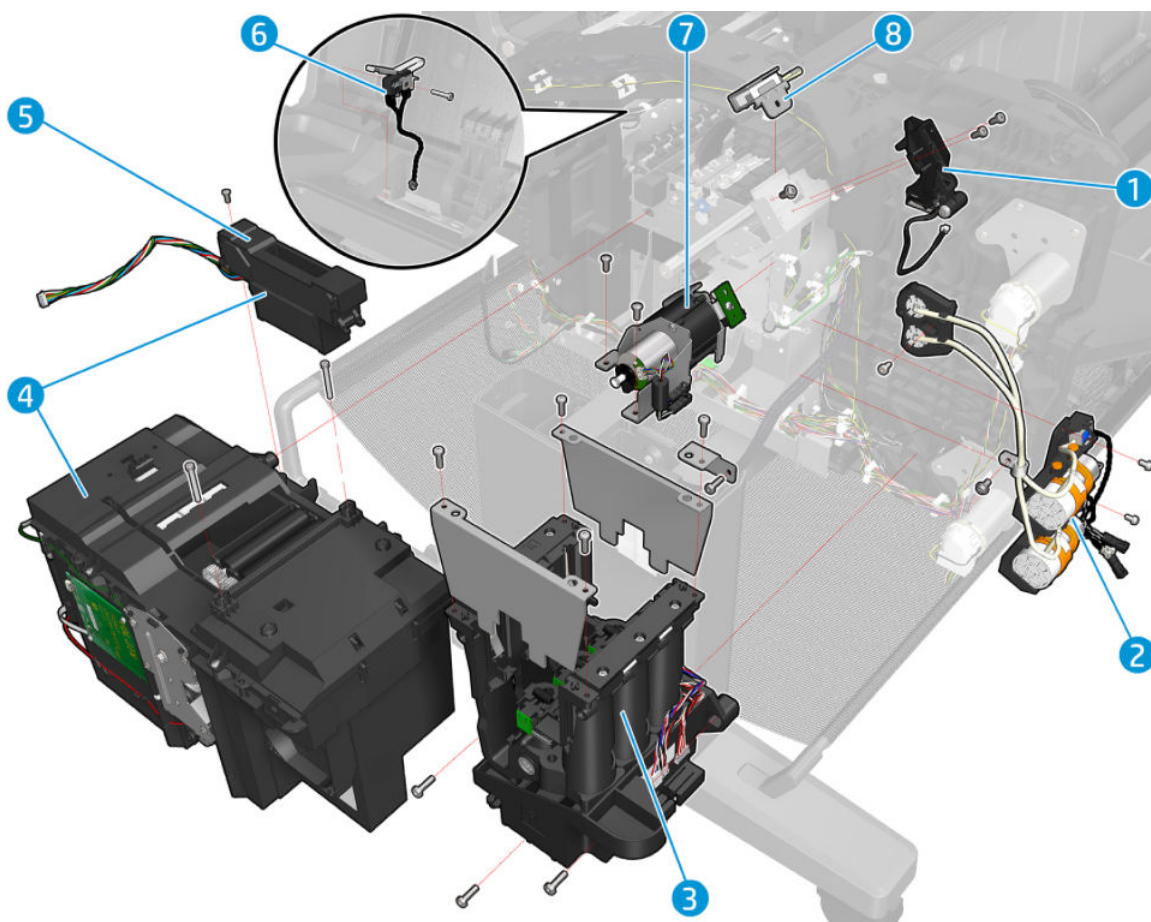


	Part number	Description	Cross-reference
1	CR357-67003	PRS Actuator	PRS Actuator on page 330
2	CR357-67024	Primer Assy	Primer Assembly on page 343
3	CR357-67029	ISS SVS side	ISS SVS Side on page 350
4	CR357-67025	SVS W/ DD	Service Station with Drop Detector on page 339
5	CR357-67026	Drop Detector	Drop Detector on page 338
6	CR357-67080	microswitch (sensor)	Stacker Arm Sensor on page 424
7	CR357-67005	Auto Pinch Lifter Assy	Auto Pinch Lifter on page 370
8	Q6675-60043	Rail Oiler	Rail Oiler Kit on page 329

Scan Axis Assemblies

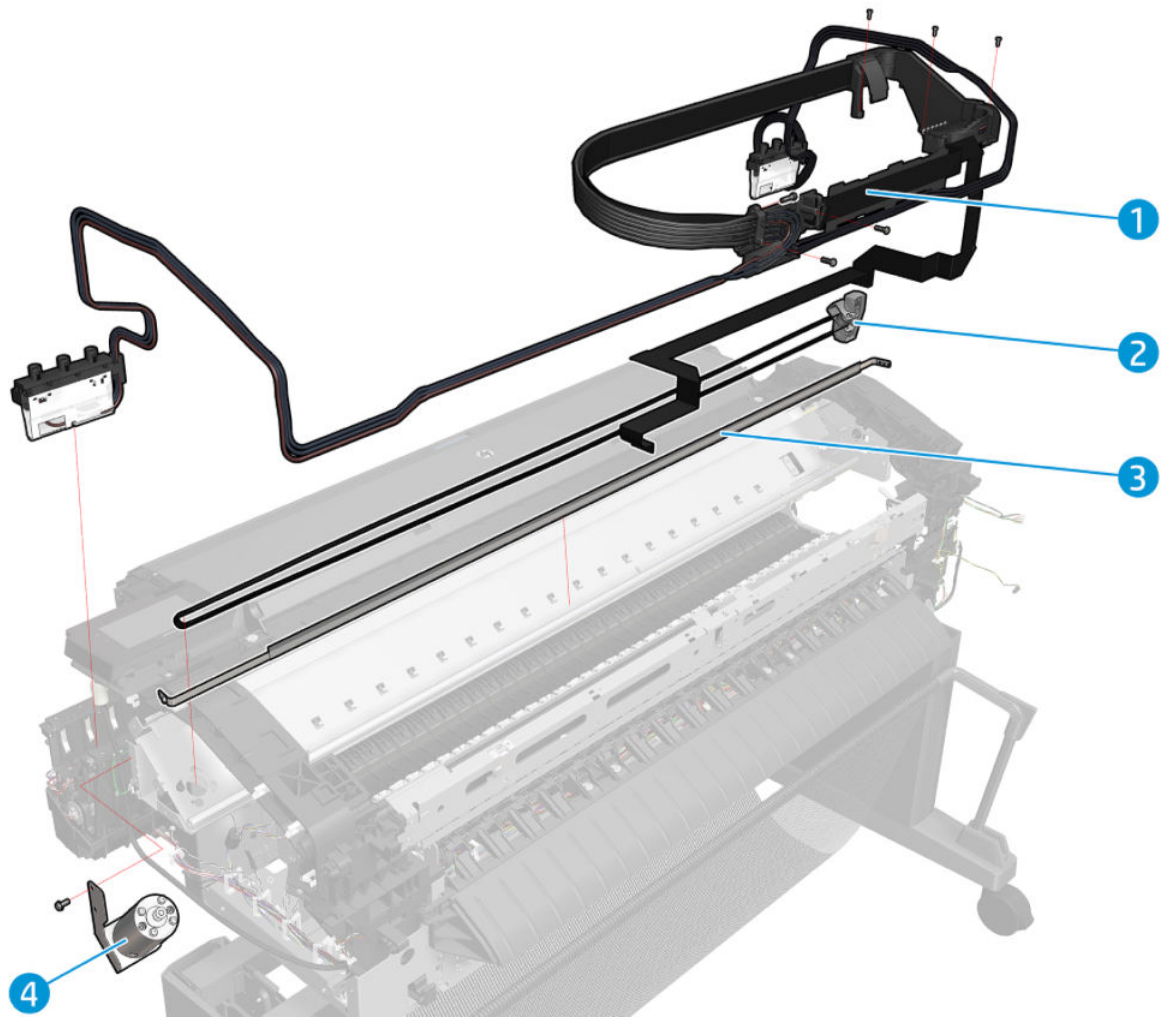

	Part number	Description	Cross-reference
1	CR357-67027	Ink Tubes and Trailing Cable	Ink Tubes and Trailing Cable on page 354
2	CR357-67021	Belt with Tensioner	Belt on page 332
3	CR357-67022	Encoder Strip (for all machines except T15x0 Postscript printers CR357A and L2Y24A)	Encoder Strip on page 333
4	CR357-67023	Scan Axis Motor	Scan Axis Motor on page 335

Paper Path Assemblies (Front)

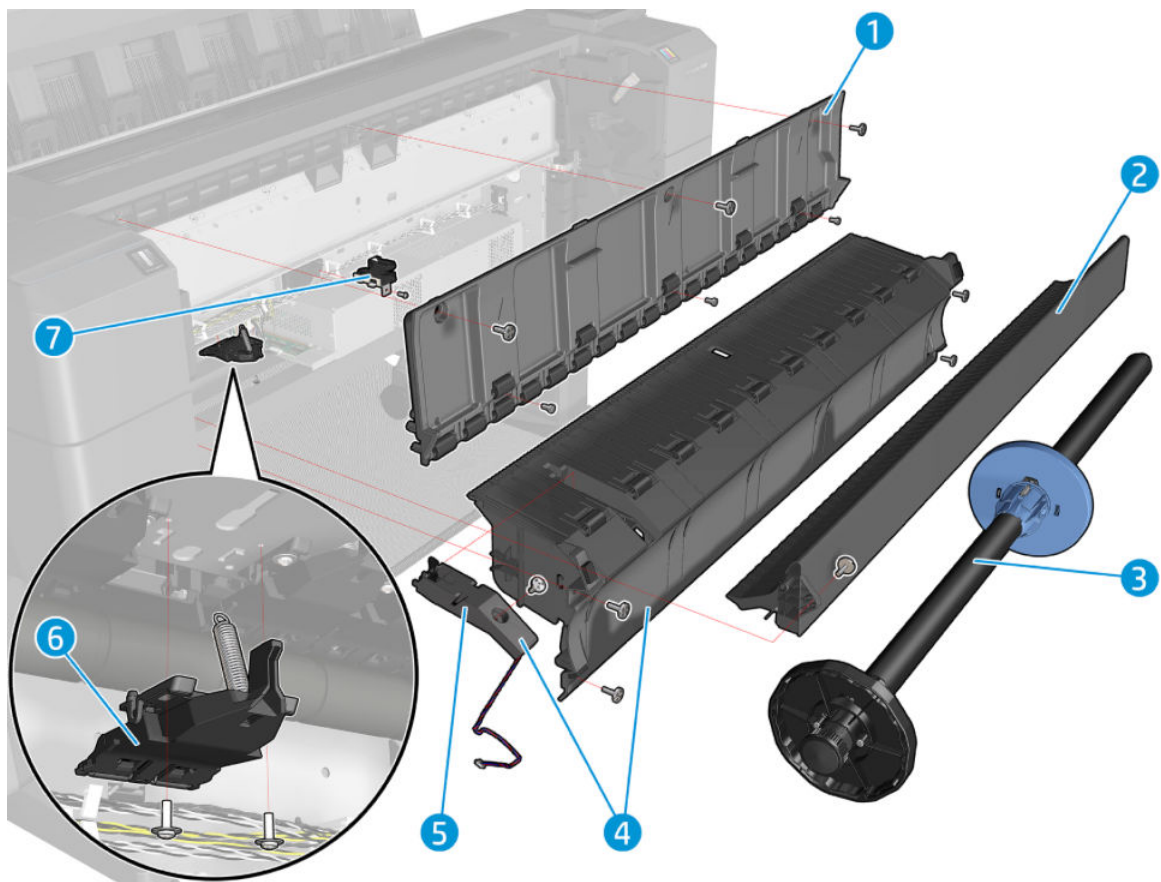


	Part number				Description	Cross-reference
	T9x0	T15x0	T25x0	T3500		
1	CR357-67033			B9E24-67021	Vertical Media Guide A	Vertical Media Guide on page 366
2	CR357-67032			B9E24-67008	Converger Assy	Converger Assembly on page 287
3	CR357-67093	CR357-67093*	CR357-67040**	B9E24-67007	Spindle 36 Assy	
4	CR354-67006**	CR357-67030		B9E24-67006	Cleanout Assy	Cleanout on page 288
5	CR357-67031				Media Sensor	Media Sensor on page 357
6	CR357-67004				Pinch Wheel Assy	Pinch Wheel Assembly on page 376
7	CH538-67074				Center support Assy	Center Support on page 368

*For all T15x0 and printers except the T1530 Rev. B Postscript printer. For the following T25x0 printers: T2500 Rev. B Postscript printer; T2530 printer and T2530 Postscript printer.

**For the T2500 eMF and T2500 Postscript printer CR359A only. For the T2500 Rev. B Postscript Printer, T2530 eMF, and T2530 Postscript printers, use part number CR357-67093.

***For all T9x0 machines except the T930 Postscript printer CR355B.

Paper Path Assemblies (Center)

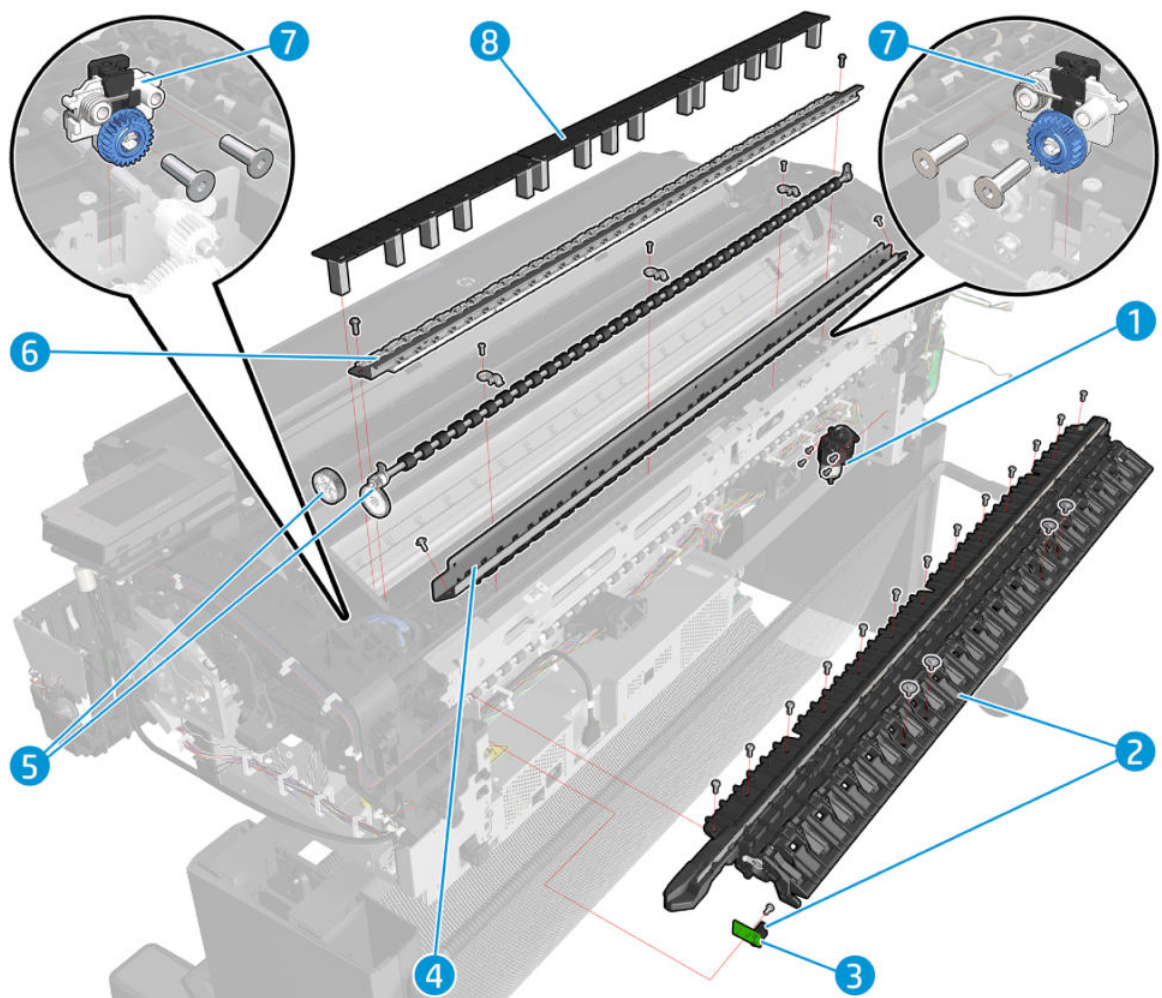


	Part number							Description	Cross-reference
	T920	T930	T1500	T1530	T2500	T2530	T3500		
1	CR357-67015							Ramps and valves motor	Ramps Motor on page 422 and Valves Motor on page 404
2	Old CR357-67013* / New L2Y24-67001**							Cutter Platen	Cutter Platten on page 398
3	CR357-67006							Opto sensor	OPTO Sensor on page 417
4	CR357-67016	CR357-67098	CR357-67016	CR357-67098	CR357-67016	CR357-67098	CR357-67016	2nd Starwheel Rail	Second Starwheel Rail on page 394
5	CR357-67011							Overdrive	Overdrive on page 396
6	CR354-67004							36 Sheet Metal Starwheel	Customer Self Repair Flyers on page 473

	Part number							Description	Cross-reference
	T920	T930	T1500	T1530	T2500	T2530	T3500		
7	CR357-67086							Starwheel Support	Starwheel Support on page 392
8	N/A		CR357 -6700 2		CR357 -6700 2		CR357 -6700 2	Full Bleed	Full Bleed on page 369

*For T2500 Rev. A printers only.


**Not for T2500 Rev. A printers.

Stacker Parts (Rear)

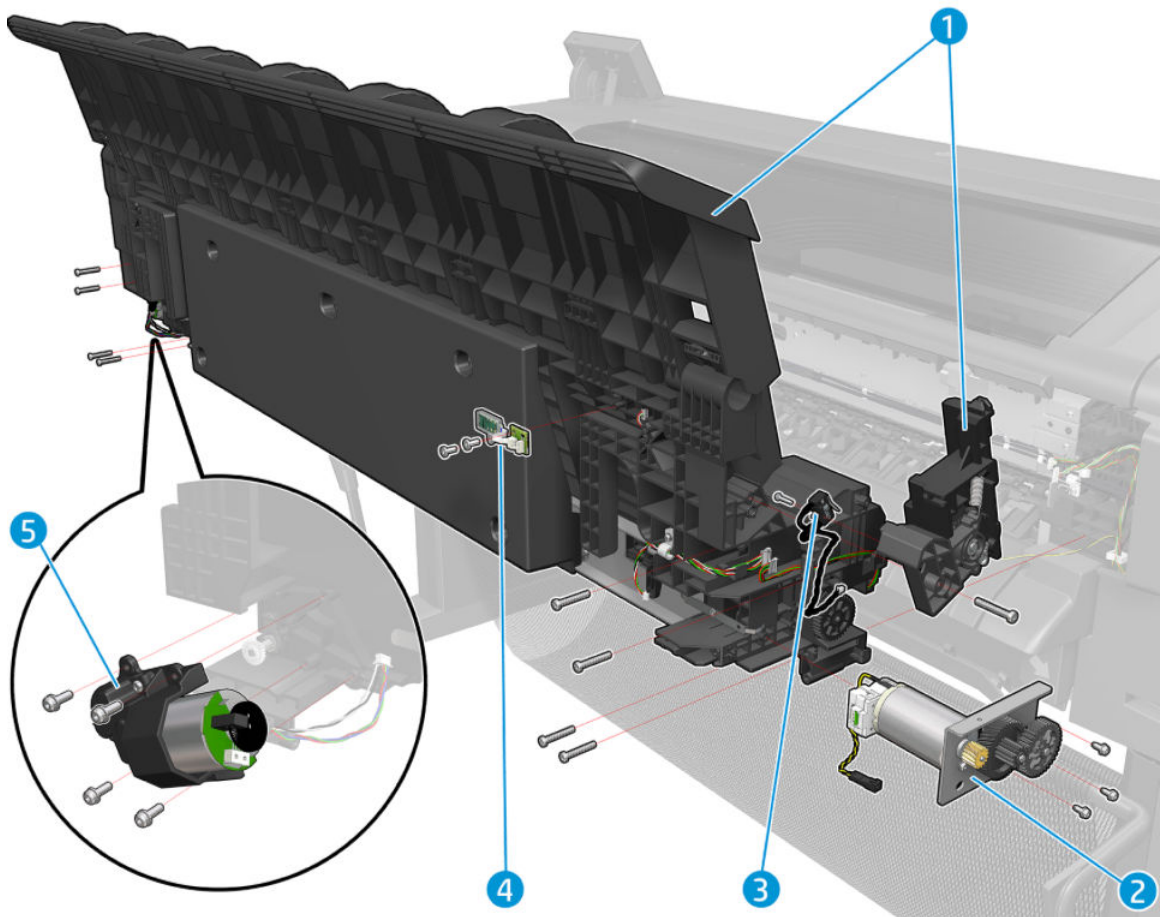

	Part number	Description	Cross-reference
1a	CR354-67003	Stacker (Single Function CR354A, CR355A, CR355B, CR356A, CR357A, CR357B, L2Y21A, L2Y22A, L2Y22B, L2Y23A, L2Y24A, L2Y24B) For T2500 MFP, part number CR359-67006 Stacker adaptor for MFP needs to be ordered additionally	Stacker on page 405 and Stacker adaptor for MFP on page 407
1b	CR354-67003 & CR359-67006	Stacker & T9x0/T15x0/T2500 Stacker Adaptor for MFP (Multifunction CR358A, CR359A, CR359B)	Stacker on page 405 and Stacker adaptor for MFP on page 407
1c	B9E24-67025	Stacker T3500 (Production eMFP B9E24A, B9E24B)	Stacker on page 405 and Stacker adaptor for MFP on page 407
2	CR357-67043	Stacker OVD Transmission W/ Motor	OVD Transmission with Motor on page 420
3	CR357-67080	microswitch (sensor)	Stacker Arm Sensor on page 424
4	CR357-67045	T920/T1500/T2500 REDI Sensor (removed from T920/T1500 starting from SN 493xxxxx)	REDI sensor on page 419
5	CR357-67015	Ramps and valves motor	Ramps Motor on page 422 and Valves Motor on page 404

Stacker Parts (Front)

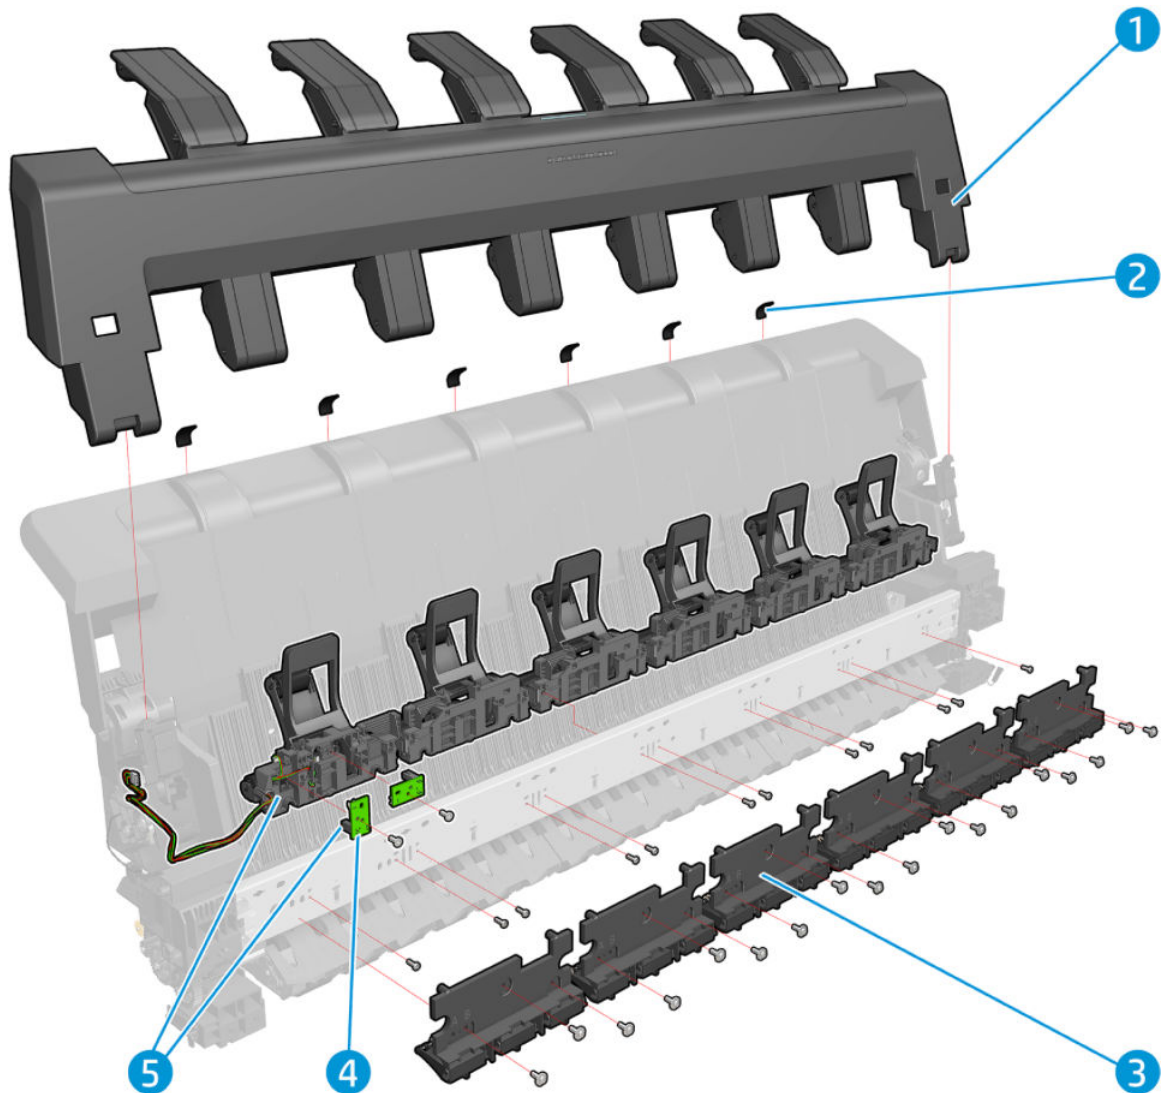

	Part number							Description	Cross-reference
	T920	T930	T1500	T1530	T2500	T2530	T3500		
1	CR357-6 7082 (CR354- 67002 old PN)	L2Y23-6 7006	CR357-6 7082 (CR354- 67002 old PN)	L2Y23-6 7006	CR357-6 7082 (CR354- 67002 old PN)	L2Y23-6 7006	L2Y23-6 7006	Stacker Arms	Customer Self Repair Flyers on page 473
2	CR357-6 7078	CR357-6 7078	CR357-6 7078	CR357-6 7078	CR357-6 7078	CR357-6 7078	CR357-6 7078	Stack Pad	
3	CR357-6 7074	CR357-6 7074	CR357-6 7074	CR357-6 7074	CR357-6 7074	CR357-6 7074	CR357-6 7074	Stacker Pinches	Stacker Pinches on page 411
4	CR357-6 7006	CR357-6 7006	CR357-6 7006	CR357-6 7006	CR357-6 7006	CR357-6 7006	CR357-6 7006	Opto sensor	OPTO Sensor on page 417

	Part number							Description	Cross-reference
	T920	T930	T1500	T1530	T2500	T2530	T3500		
5a	CR357-6 7041	CR357-6 7041	CR357-6 7041	CR357-6 7041	CR357-6 7041	CR357-6 7041		Stacker Hand Off (except T3500)	Stacker Hand Off Assy Service Kit (CR357-67041) on page 413
5b							B9E24-6 7026	Stacker Hand Off (T3500 only)	Stacker Hand Off on page 412

Printing Graphics and High Density Images


Background

Under certain situations, when printing high density images to the stacker on light media (Coated, Plain paper), the printer may report a jam that customers need to clear in order to continue printing. In some conditions like high humidity, end of media roll, or paper with excessive curling, there may be an increased chance of this issue.


Configuring the printer to print graphics

In order to maximize printer productivity when printing graphic content, the following setup can be used:

1. Download the paper preset “Retail plain paper” from www.hp.com.
2. Upload the paper preset “Retail plain paper”. This media preset has been designed to optimize the Image Quality / Speed / Cost per copy balance for indoor poster applications. It has an optimized ink usage in Normal printing mode (so it prevents jams and reduces cost per copy). It also features a Fast mode with better image quality than the “Bright White” paper preset, which is directed more at drawing applications.
3. Order the service kit **CR357-67089 Stacker tray filler** which gives a smoother stacker paper exit.

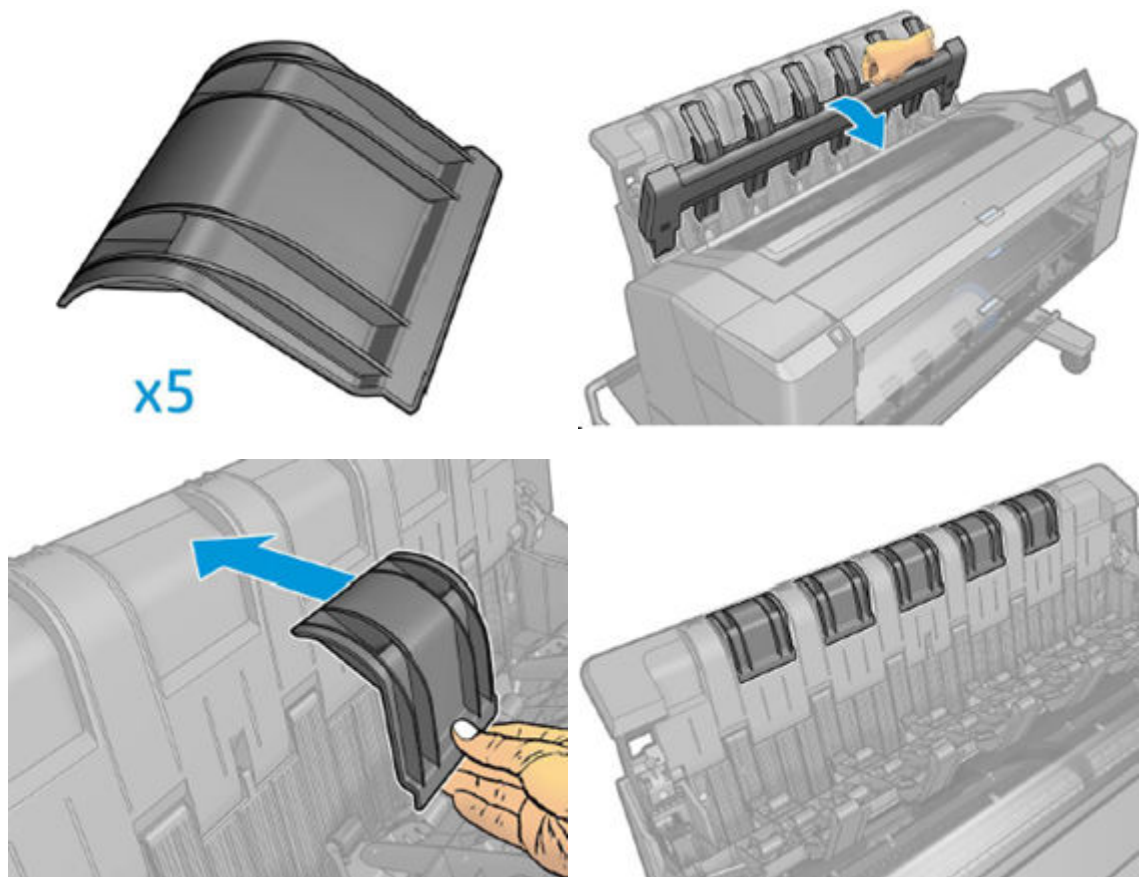

4. The printer should have the latest Stacker Arms design; make sure the printer has a Serial Number starting with CN43 or SG43 in order to ensure so.

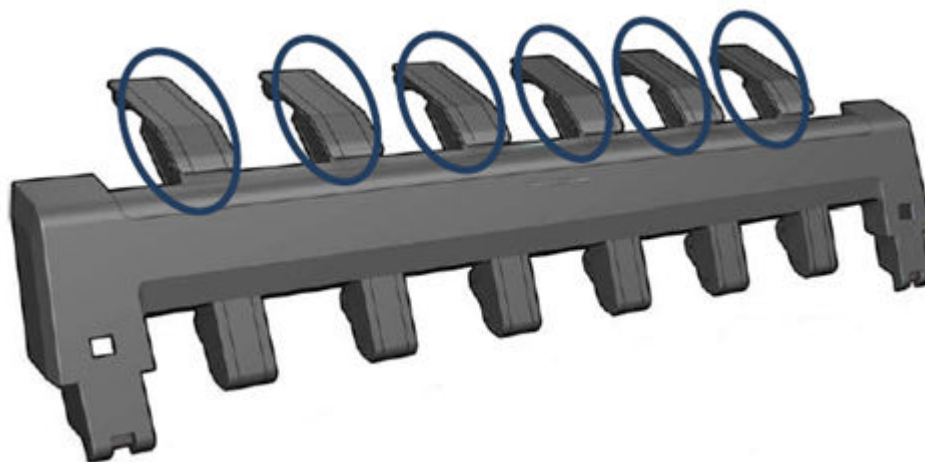



Old design with a long pin



New design with a short pin


5. If the printer has the old design with the long pin, new **CR357-67082 Stacker Arms** can be ordered.

Other workarounds

For optimal graphics reproduction you might want to consider:


- Use Heavy Weight Coated paper. It has fewer cockles and more ink capacity, so when printing high density graphics it performs better than plain and coated papers. Also it has better color.
- Media can be loaded as a paper with a lower ink limit to reduce ink usage and have fewer cockles, for example: load Coated media as Plain Paper.
- In high humidity, try to maintain a drier environment.
- For Coated; 3" core rolls help to have less curling, and thus less jams.

Carriage Assembly

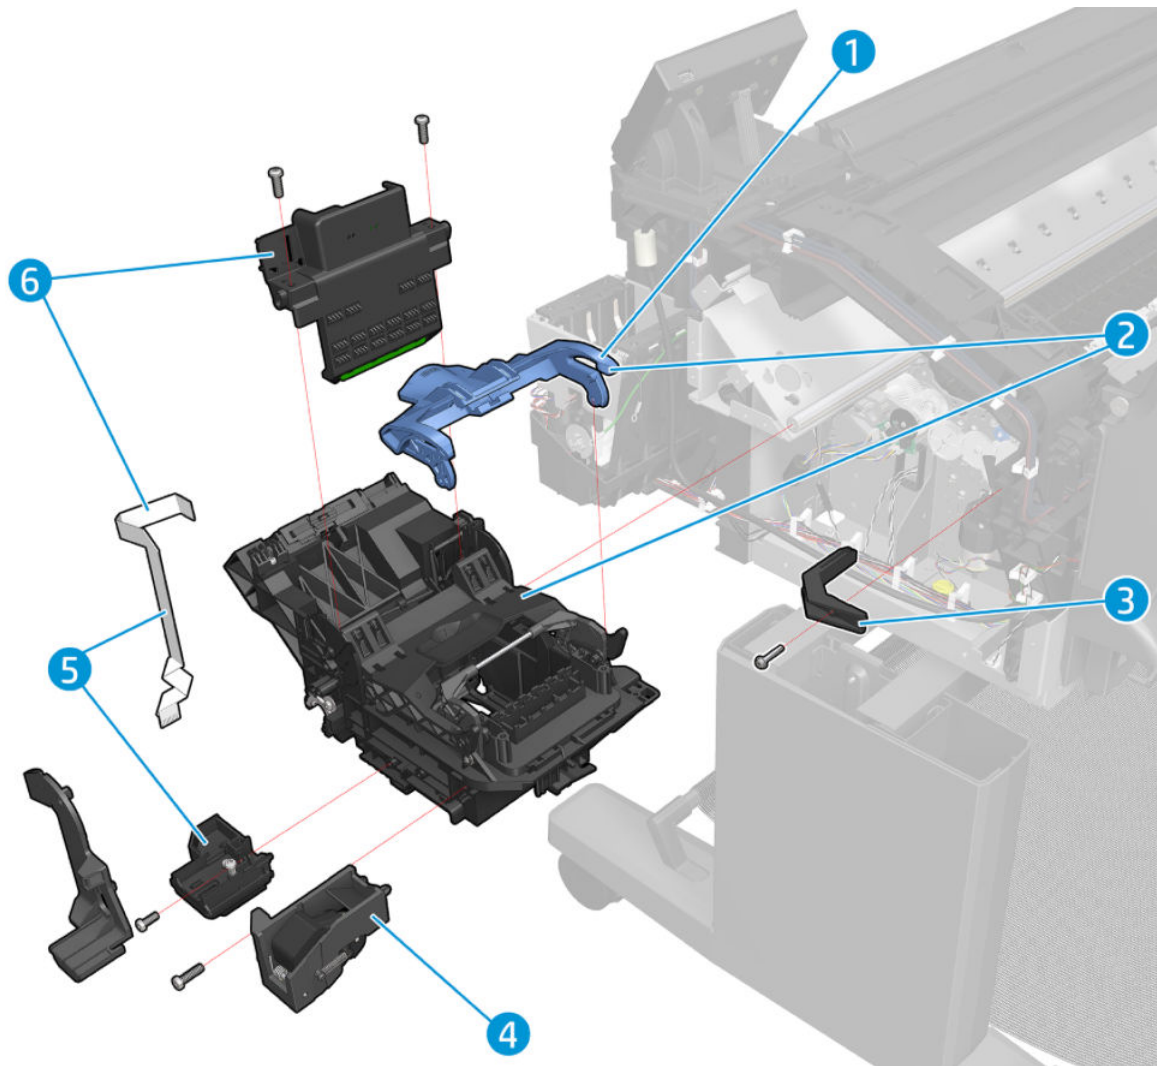

	Part number	Description	Cross-reference
1	CR357-67070	Carriage Latch	Customer Self Repair Flyers on page 473
2	CR357-67081	Carriage W/O PCA / Line Sensor	Carriage on page 322/Line Sensor on page 326
3	CR357-67068	Bump Cutter Actuator	Bump Cutter Actuator on page 426
4	CR357-67007	Cutter X	Customer Self Repair Flyers on page 473
5	CR357-67020	Line Sensor W/ Cable	Line Sensor on page 326
6	CR357-67081	Carriage PCA w/ Line Sensor Cable	Carriage PCA on page 327

Electrical Parts

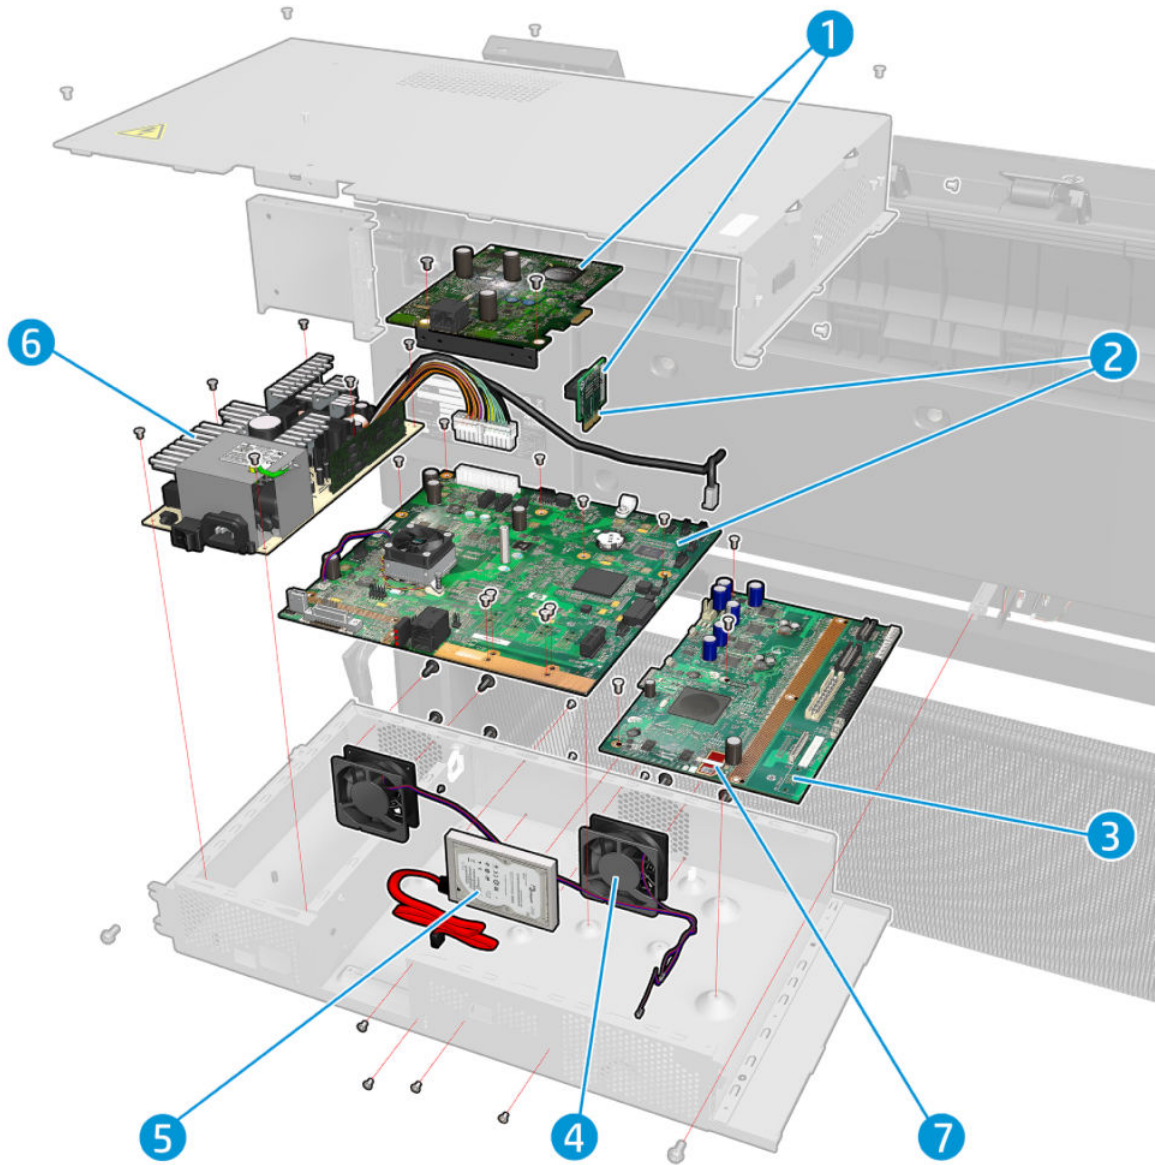

	Part number				Description	Cross-reference
	T920	T1500	T2500	T3500		
1	CR357-67050				Jester plus Riser	Jester PCA on page 310
2a	CR357-67051		CR359-67001	N/A	Formatter Power W/ Riser (For Rev.A models only)	Formatter PCA on page 315
2b	CR357-67085		CR359-67031	B9E24-67015	Formatter power w/ Riser and w/ HDD (for T920, T1500, T2500 only rev B models only, for T3500 all (A and B))	Formatter PCA on page 315
3	CR357-67049			B9E24-67017	Engine PCA	Engine PCA on page 314
4	CR357-67048				E-Box Fan	E-Box fan on page 308

	Part number				Description	Cross-reference
	T920	T1500	T2500	T3500		
5a	CR357-67083			N/A	HDD W/ FW (For Rev.A models only)	Hard disk drive on page 313
5b	CR357-67084			B9E24-67018	HDD Encrypted w/ FW (for T920, T1500, T2500 only rev B models only, for T3500 all (A and B))	Hard disk drive on page 313
6	CR357-67046				PSU	Power supply unit on page 311
7	CR357-67087			B9E24-67023	CryptoAsic SIM	

	Part number			Description
	T930	T1530	T2530	
1	CR357-67050			Jester plus Riser
2a	CR357-67051		CR359-67001	Formatter Power W/ Riser (For Rev.A models only)
2b	L2Y22-67006		L2Y26-67003	Formatter power w/ Riser and w/ HDD (For Rev.B models only)
3	CR357-67049			Engine PCA
4	CR357-67099			E-Box Fan
5a	L2Y21-67004 (320GB)	L2Y23-67005 (500GB)		HDD W/ FW (For Rev.A models only)
5b	L2Y22-67004			HDD Encrypted w/ FW (For Rev.B models only)
6	CR357-67046			PSU
7	B9E24-67023			CryptoAsic SIM


Miscellaneous Parts

Part number	Description
CR354-67005	Support Label T920 Nameplate
L2Y21-67003	Support Label T930 Nameplate
L2Y21-67006	T9XX/T15XX/T25XX Rear Beam SV
CR355-67006	Support Label T920PS Nameplate
CR355-67007	Support LBL US Gov T920PS Nameplate
L2Y22-67001	Support Label T930PS Rev A. printer Nameplate
L2Y22-67003	Support LBL US Gov T930PS Nameplate
CR356-67001	Support Label T1500 Nameplate
CR357-67076	Support Label T1500PS Nameplate
CR357-67077	Support LBL US Gov T1500PS Nameplate
CR357-67094	T9x0/Tx500 Stand
L2Y23-67004	Support LBL T1530 Nameplate
L2Y24-67002	Support Label T1530PS Rev A. printer Nameplate
L2Y24-67003	Support LBL US Gov T1530PS Nameplate
CR358-67001	Support Label T2500 Nameplate
CR359-67028	Support Label T2500PS Nameplate
CR359-67027	Support LBL US Gov T2500PS Nameplate
L2Y25-67002	Support Label T2530 Nameplate
L2Y26-67001	Support Label T2530PS Rev A. printer Nameplate
L2Y26-67002	Support LBL US Gov T2530PS Nameplate
CR359-67032	Serial Label for: <ul style="list-style-type: none"> • T25x0 Rev. A printers
CQ533-60001	Europe Power Cord KIT for <ul style="list-style-type: none"> • T9x0 Rev.A printers • T15x0 Rev.A printers • T25x0 Rev.A printers
CQ533-60002	America Power Cord KIT
CQ533-60003	Asia Power Cord KIT for: <ul style="list-style-type: none"> • T9x0 Rev.A printers • T15x0 Rev.A printers • T25x0 Rev.A printers
CR357-67053	Product Cables for T15x0, T25x0 printers

Part number	Description
CR357-67072	PM Kit-1
CR357-67073	PM Kit-2
CR357-67075	Serial Label for: <ul style="list-style-type: none"> • T920 printers • T930 Rev. A printers • T1500 Rev. A printers • T1530 Rev. A printers
CR357-67079	Paper Advance Calibration
CR355-67002	1R Cables Kit for T9x0 printers

CIS Unit Construction

⚠ WARNING! The CIS unit is factory mounted and must not be Disassembled further than replacing the scanner control unit, paper/lid sensors, glass plate and USB cable. Ignoring this warning may cause failures that can not be corrected in the field.

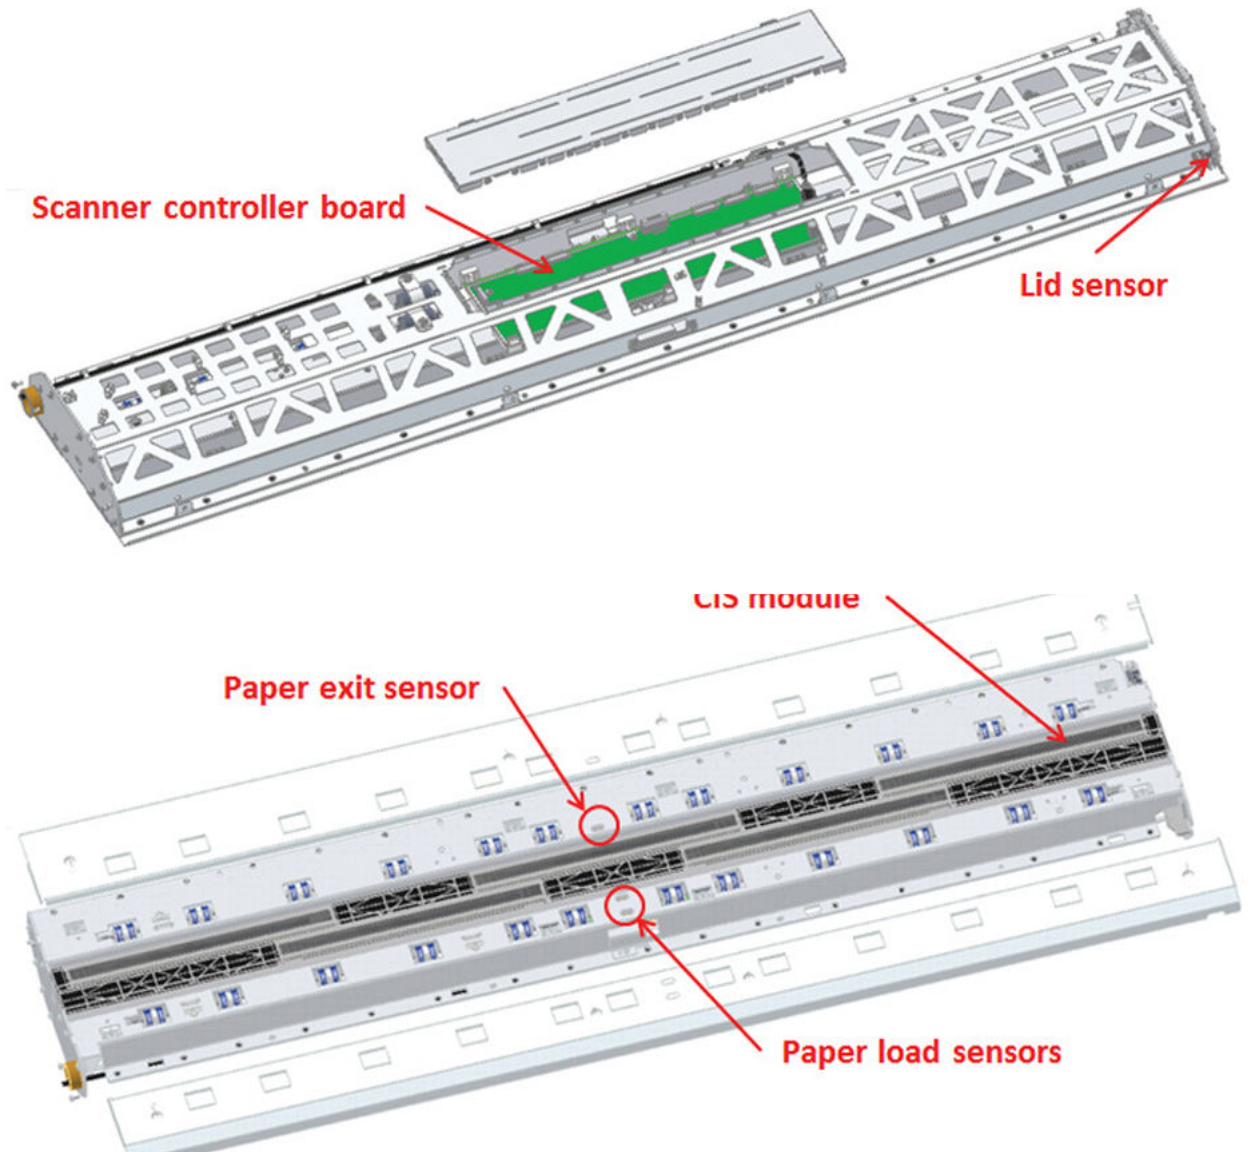

Scanner Control Unit



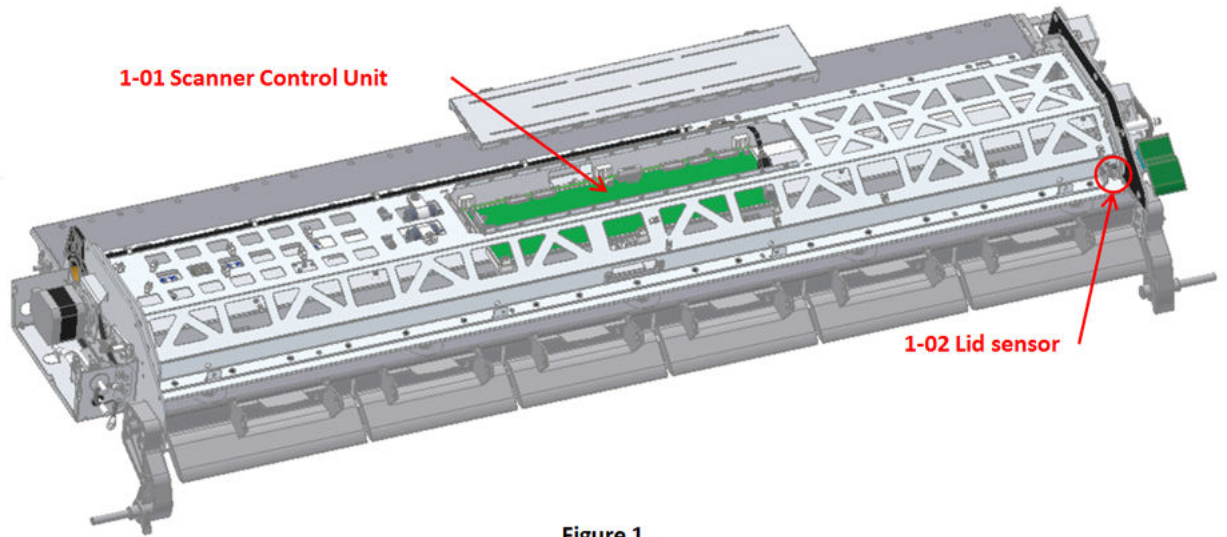


Figure 1.

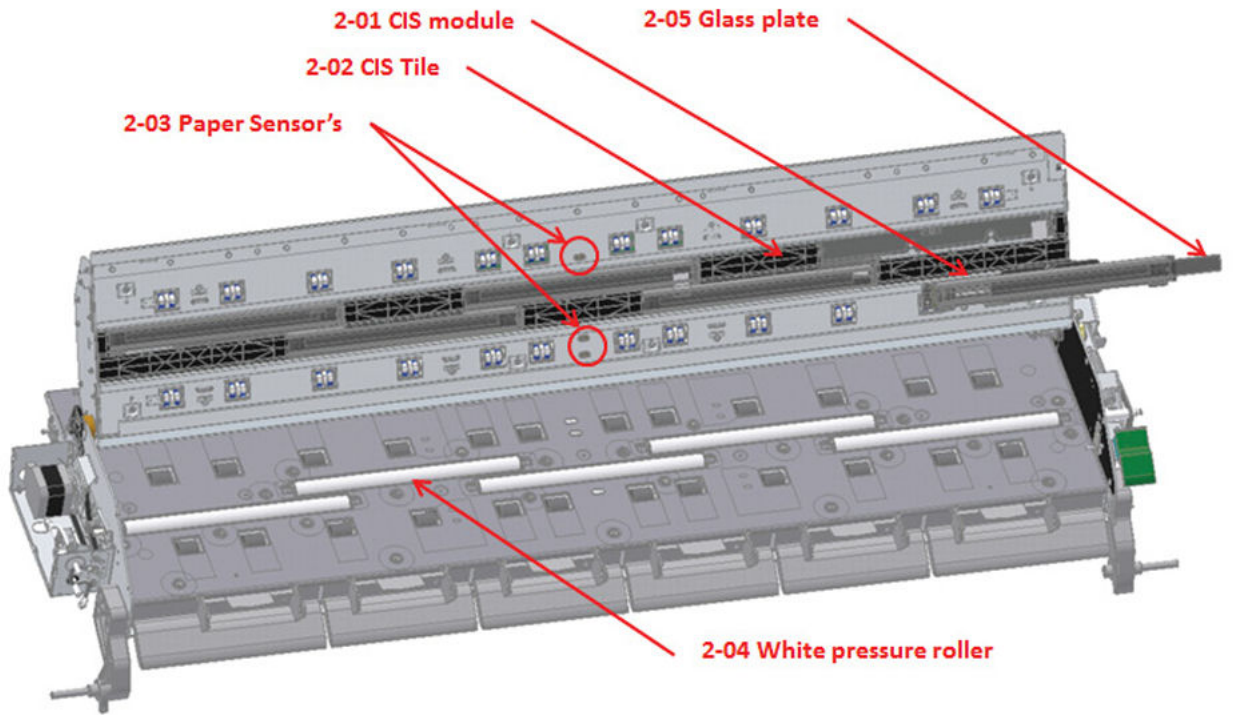

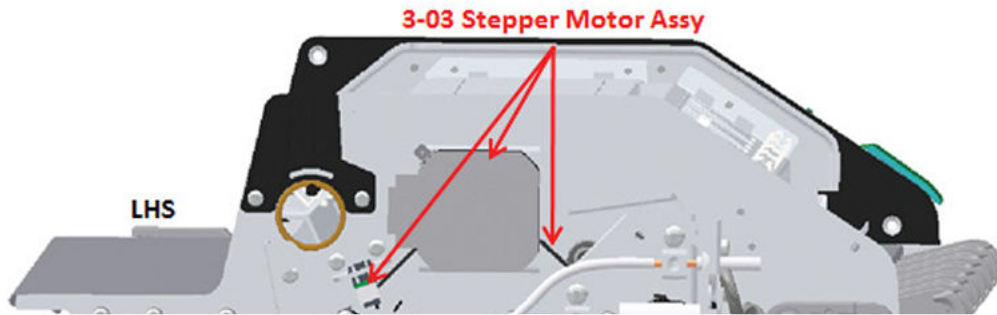

Service Parts

	Part number	Description	Cross-reference
1-01a	CR359-67023	Scanner Controller Unit (except T3500)	Scanner Controller Unit (SUP) on page 430
1-01b	B9E24-67020	Scanner Controller Unit (T3500 and compatible with T2500)	Scanner Controller Unit (SUP) on page 430
2-01	CR359-67024	CIS Module Assembly	CIS Modules on page 432
2-01	CR359-67033	T25x0/T3500 CIS module 5x unit	CIS Modules on page 432
N/A	CR359-67015	FFC Cable Set-Scanner for T25x0 printers	CIS FFC Cables on page 433
2-03	CR359-67018	Paper/Lid Sensor (1 pcs.) for T25x0 printers	Paper and Lid Sensors on page 438

	Part number	Description	Cross-reference
3-03	CR359-67016	Stepper Motor Assembly (including taco sensor) for T25x0 printers	Stepper Motor Assembly (taco sensor, and belt) on page 435
N/A	CR359-67021	Scanner USB & Power/Reset/Awake Cable for T25x0 printers	USB & Awake / Power Cable on page 441
3-01	CR359-67019	Damper Assembly for CIS Bridge for T25x0 printers 3500	CIS Bridge Damper on page 443
2-04	CR359-67017	Pressure Rollers (X pcs.) for T25x0 printers 3500	Pressure Rollers on page 446
3-02	CR359-67012	Latch CIS for T25x0 printers	CIS Scanner Latch on page 445
N/A	CR359-67003	RHS Cover	Front panel side scanner cover on page 447
N/A	CR359-67004	Cover Service Station Side for T25x0 printers	Service station side scanner cover on page 448
N/A	CR359-67005	Cover Scanner Rear SV for T25x0 printers	Rear scanner cover on page 449
N/A	CR359-67006	Stacker adaptor for MFP	Stacker adaptor for MFP on page 407
N/A	CR359-67007	Scanner Bumper bracket Assy SV for T25x0 printers	Bumper bracket on page 450
N/A	CR359-67008	Scanner Deflectors SV for T25x0 printers	Deflector hinge on page 451
N/A	CR359-67009	Scanner Lift Assy SV for T25x0 printers	Lift assembly on page 452
N/A	CR359-67010	Scanner Front Beam Bumper Assy for T25x0 printers	Scanner front beam bumper assembly on page 453
N/A	CR359-67011	Scanner Latch Hook Assy Push SV for T25x0 printers	Scanner latch hook assembly on page 454
N/A	CR359-67025	Top Cover scanner (except T2500 only)	Scanner front beam bumper assembly on page 453
N/A	L2Y25-67004	Top Cover scanner (T2530 only)	Scanner front beam bumper assembly on page 453
N/A	B9E24-67019	Top Cover scanner (T3500 only)	Top scanner cover on page 455
N/A	CR359-67003	Cover scanner CP_side (RHS Cover) for T25x0 printers	
N/A	B9E24-67001	T3500 Batch Scanner Roller SV	Batch scanning piece on page 456

6 Removal and installation

- [Introduction on page 275](#)
- [Customer Self Repair parts on page 277](#)
- [Service Calibration Guide to Removal and Installation on page 278](#)

Parts list; all models

Parts in alphabetical order

[Arch sidewall cover \(front panel side\) on page 293](#)
[Arch sidewall cover \(service station side\) on page 294](#)
[Auto Pinch Lifter on page 370](#)
[Belt on page 332](#)
[Bottom Rewinder Support on page 359](#)
[Bottom Tip Support on page 364](#)
[Bump Cutter Actuator on page 426](#)
[Carriage on page 322](#)
[Carriage PCA on page 327](#)
[Center cover \(T920 only\) on page 285](#)
[Center Support on page 368](#)
[Cleanout on page 288](#)
[Converger Assembly on page 287](#)
[Cutter Platten on page 398](#)
[Drop Detector on page 338](#)
[E-Box fan on page 308](#)
[Engine PCA on page 314](#)
[Fixed tray cover \(Front Panel side\) on page 291](#)
[Fixed tray cover \(service station side\) on page 292](#)
[Formatter PCA on page 315](#)
[Front panel on page 318](#)
[Full Bleed on page 369](#)
[Hard disk drive on page 313](#)
[How to manually move Stacker Ramps on page 429](#)
[How to manually move Valves on page 428](#)
[How to release Service Station Caps on page 427](#)
[HP 727 Printhead installation tips and tricks on page 298](#)
[Ink Service kit on page 303](#)
[Ink Tubes and Trailing Cable on page 354](#)
[ISS \(Ink Supply Station\) Front Panel Side on page 346](#)
[ISS SVS Side on page 350](#)
[Jester PCA on page 310](#)
[Line Sensor on page 326](#)
[Encoder Strip on page 333](#)

Parts in removal order

[Main cover \(front panel side\) on page 281](#)
[Main cover \(service station side\) on page 283](#)
[Center cover \(T920 only\) on page 285](#)
[Converger Assembly on page 287](#)
[Cleanout on page 288](#)
[Output platen on page 290](#)
[Fixed tray cover \(Front Panel side\) on page 291](#)
[Fixed tray cover \(service station side\) on page 292](#)
[Arch sidewall cover \(front panel side\) on page 293](#)
[Arch sidewall cover \(service station side\) on page 294](#)
[Rear cover on page 295](#)
[Window Sensor on page 296](#)
[HP 727 Printhead installation tips and tricks on page 298](#)
[Ink Service kit on page 303](#)
[Open the E-Box on page 304](#)
[E-Box fan on page 308](#)
[Jester PCA on page 310](#)
[Power supply unit on page 311](#)
[Hard disk drive on page 313](#)
[Engine PCA on page 314](#)
[Formatter PCA on page 315](#)
[Front panel on page 318](#)
[Carriage on page 322](#)
[Line Sensor on page 326](#)
[Carriage PCA on page 327](#)
[Rail Oiler Kit on page 329](#)
[PRS Actuator on page 330](#)
[Belt on page 332](#)
[Encoder Strip on page 333](#)
[Scan Axis Motor on page 335](#)
[Drop Detector on page 338](#)
[Service Station with Drop Detector on page 339](#)
[Primer Assembly on page 343](#)
[ISS \(Ink Supply Station\) Front Panel Side on page 346](#)

Parts in alphabetical order

[Main cover \(front panel side\) on page 281](#)
[Main cover \(service station side\) on page 283](#)
[Media Sensor on page 357](#)
[Motor Media Advance Transmission with Encoder on page 379](#)
[Open the E-Box on page 304](#)
[OPTO Sensor on page 417](#)
[OVD Transmission with Motor on page 420](#)
[Output platen on page 290](#)
[Overdrive on page 396](#)
[Pinch Wheel Assembly on page 376](#)
[Power supply unit on page 311](#)
[Primer Assembly on page 343](#)
[PRS Actuator on page 330](#)
[Rail Oiler Kit on page 329](#)
[Ramps Motor on page 422](#)
[Rear cover on page 295](#)
[REDI sensor on page 419](#)
[Scan Axis Motor on page 335](#)
[Second Starwheel Rail on page 394](#)
[Sensor Valves on page 401](#)
[Service Station with Drop Detector on page 339](#)
[Stacker on page 405](#)
[Stacker Arm Sensor on page 424](#)
[Stacker Hand Off on page 412](#)
[Stacker Pinches on page 411](#)
[Starwheel Motor on page 387](#)
[Starwheel Support on page 392](#)
[Top Tip Support on page 363](#)
[Top Rewinder Support on page 361](#)
[Valves Motor on page 404](#)
[Vertical Media Guide on page 366](#)
[Window Sensor on page 296](#)

Parts in removal order

[ISS SVS Side on page 350](#)
[Ink Tubes and Trailing Cable on page 354](#)
[Media Sensor on page 357](#)
[Bottom Rewinder Support on page 359](#)
[Top Rewinder Support on page 361](#)
[Top Tip Support on page 363](#)
[Bottom Tip Support on page 364](#)
[Vertical Media Guide on page 366](#)
[Center Support on page 368](#)
[Full Bleed on page 369](#)
[Auto Pinch Lifter on page 370](#)
[Pinch Wheel Assembly on page 376](#)
[Motor Media Advance Transmission with Encoder on page 379](#)
[Starwheel Motor on page 387](#)
[Starwheel Support on page 392](#)
[Second Starwheel Rail on page 394](#)
[Overdrive on page 396](#)
[Cutter Platten on page 398](#)
[Sensor Valves on page 401](#)
[Valves Motor on page 404](#)
[Stacker on page 405](#)
[Stacker Pinches on page 411](#)
[Stacker Hand Off on page 412](#)
[OPTO Sensor on page 417](#)
[REDI sensor on page 419](#)
[OVD Transmission with Motor on page 420](#)
[Ramps Motor on page 422](#)
[Stacker Arm Sensor on page 424](#)
[Bump Cutter Actuator on page 426](#)
[How to release Service Station Caps on page 427](#)
[How to manually move Valves on page 428](#)
[How to manually move Stacker Ramps on page 429](#)

Parts list; HP Designjet T2500 and T3500 eMultifunction Series only



NOTE: Before replacing any electrical parts such as the Scanner Control Unit, or Cameras, try calibrating the scanner in order to get the scanner to recreate the content of the parameter block. This will solve the problem in most cases.

Parts in alphabetical order

[Bumper bracket on page 450](#)
[CIS Bridge Damper on page 443](#)
[CIS FFC Cables on page 433](#)
[CIS Glass on page 434](#)
[CIS Modules on page 432](#)
[CIS Scanner Latch on page 445](#)
[CIS Tiles on page 431](#)
[Deflector hinge on page 451](#)
[Front panel side scanner cover on page 447](#)
[Lift assembly on page 452](#)
[Paper and Lid Sensors on page 438](#)
[Paper and Lid Sensor Cable on page 440](#)
[Pressure Rollers on page 446](#)
[Rear scanner cover on page 449](#)
[Scanner Controller Unit \(SUP\) on page 430](#)
[Scanner front beam bumper assembly on page 453](#)
[Scanner latch hook assembly on page 454](#)
[Service station side scanner cover on page 448](#)
[Stacker adaptor for MFP on page 407](#)
[Stacker Hand Off Assy Service Kit \(CR357-67041\) on page 413](#)
[Stepper Motor Assembly \(cable\) on page 437](#)
[Stepper Motor Assembly \(taco sensor, and belt\) on page 435](#)
[Top scanner cover on page 455](#)

Parts in removal order

[Stacker adaptor for MFP on page 407](#)
[Stacker Hand Off Assy Service Kit \(CR357-67041\) on page 413](#)
[Scanner Controller Unit \(SUP\) on page 430](#)
[CIS Tiles on page 431](#)
[CIS Modules on page 432](#)
[CIS FFC Cables on page 433](#)
[CIS Glass on page 434](#)
[Stepper Motor Assembly \(taco sensor, and belt\) on page 435](#)
[Stepper Motor Assembly \(cable\) on page 437](#)
[Paper and Lid Sensors on page 438](#)
[Paper and Lid Sensor Cable on page 440](#)
[USB & Awake / Power Cable on page 441](#)
[CIS Bridge Damper on page 443](#)
[CIS Scanner Latch on page 445](#)
[Front panel side scanner cover on page 447](#)
[Service station side scanner cover on page 448](#)
[Rear scanner cover on page 449](#)
[Bumper bracket on page 450](#)
[Deflector hinge on page 451](#)
[Lift assembly on page 452](#)
[Scanner front beam bumper assembly on page 453](#)
[Scanner latch hook assembly on page 454](#)
[Top scanner cover on page 455](#)

Parts list; HP Designjet T2500 eMultifunction Series only

Parts in alphabetical order

[Card Reader Accessory on page 457](#)

Parts in removal order

[Card Reader Accessory on page 457](#)

Parts list; HP Designjet T3500 eMultifunction Series only

Parts in alphabetical order

[Batch scanning piece on page 456](#)

Parts in removal order

[Batch scanning piece on page 456](#)

Introduction


This chapter is a step-by-step guide to removal and installation of the key components of the product. It may be useful to check off the steps as they are performed. Use the illustrations for each procedure to identify the parts referred to in the text.

Some of the procedures have a video available which can be downloaded. When a video is available the following graphic is shown:




Click on the graphic to download the video. These videos and others, are also available from the **Service Media Library**.

- Employees and contingent workers: <http://thesml.hp.com>
- HP Channel partners, external call centers (requires registration): <http://h20181.www2.hp.com/plm>
- HP Customers: <http://www.hp.com/go/sml>

 **NOTE:** Before using this chapter to remove and install a new component, always make sure that you have performed the relevant service test. If the test passes you will not need to replace the component.

Safety Precautions

Review the instructions identified by WARNING and CAUTION symbols before servicing the product. Follow these warnings and cautions for protection and to avoid damaging the product.

 **NOTE:** Serious shock hazard leading to death or injury may result if you do not take the following precautions:

- Ensure that the AC power outlet (mains) has a protective earth (ground) terminal.
- Switch the product off, and disconnect it from the power source prior to performing any maintenance.
- Prevent water or other liquids from running onto electrical components or circuits, or through openings in the module.

Electrostatic Discharge (ESD) Precautions

To prevent damage to the product's circuits from high-voltage electrostatic discharge (ESD):

1. Do not wear clothing that is subject to static build-up.
2. Do not handle integrated circuits (ICs) in carpeted areas.
3. Do not remove an IC or a printed circuit assembly (PCA) from its conductive foam pad or conductive packaging until you are ready to install it.
4. Ground (earth) your body while disassembling and working on the product. 202 Chapter 6 Removal and Installation ENWW.
5. After removing a cover from the product, attach an earthing (ground) lead between the PCA common and earth ground. Touch all tools to earth ground to remove static charges before using them on the product.
6. After removing any PCA from the product, place it on a conductive foam pad or into its conductive packaging to prevent ESD damage to any ICs on the PCA.

Required Tools

All the special tools and equipment required to disassemble, service and repair the product are provided in the Toolkit. Some tools can be ordered separately from the toolkit.

Toolkit Q6683-67001 contains the following tools:

Description/Comments	HP Part Number
Alcohol	Q6675-60091
Allen Key #2	Q6675-60041
Cleaning Cloth	9300-2531
Lubricant Oil	Q6675-60061 (included in "Lubrication kit Q5669-60692" as well)
Oil Dispenser	Q6675-60062 (included in "Lubrication kit Q5669-60692" as well)
Spring Insertion Tool	Q5669-20594
Protective Plastic Gloves	Q6675-60035 (included in "Lubrication kit Q5669-60692" as well)
Screwdriver	8710-2456
Tweezers	Q6675-60037
T Series Cleaning Assembly	C6071-60218

You will also need the following standard hand tools:

Description/Comments	Size
Long Torx Screwdriver	1/4 inch drive
Torx Bit (75 mm) magnetic end	8/9/10 straight, 15/20 straight and angled
Philips Screwdriver	PH1
Pliers	N/A
Snips	N/A
Flat-bladed Screwdriver	N/A
Pipe Spanner	5.5 mm
Wrench	7.0 mm
Long Torx Screwdriver	1/4 inch drive

Customer Self Repair parts

Some product parts are designated Customer Self Repair (CSR) parts, which means that a faulty part can be replaced by the customer. Non-CSR parts need to be replaced by an engineer.

The CSR parts are listed below:

Part number	Description	Flier
CR354-67004	Starwheel	Yes
CR357-67007	Cutter	Yes
CR354-67002	Stacker Arm	Yes
CR357-67057	Ink cover, service-station side (except T3500)	Yes
B9E24-67014	Ink cover, service-station side (T3500 only)	Yes
CR357-67058	Ink cover, front-panel side (except T3500)	Yes
B9E24-67013	Ink cover, front-panel side (T3500 only)	Yes
CR357-67064	Leg, front-panel side	Yes
CR357-67065	Leg, service-station side	Yes
CR357-67036	Bottom roll cover (except T3500)	Yes
B9E24-67003	Bottom roll cover (T3500 only)	Yes
CR355-67001 / CR357-67039	Top roll cover (except T3500)	Yes
B9E24-67002	Top roll cover (T3500 only)	Yes
CR357-67070	Carriage latch	Yes
CR357-67066	Basket	Yes
CR357-67067	Pinch arm top roll (except T3500)	Yes
B9E24-67022	Pinch arm top roll (T3500 only)	Yes
CR359-67014	CIS Tiles Kit for T25x0 printers	No
CR359-67020	Glass Plate Assembly for T25x0 printers	Yes
CN727-69006	Calibration Sheet for T25x0 printers	No

For further information

- CSR Corporate Standards: <http://standards.corp.hp.com/smc/hpstd/AHP0001501.htm>
- CSR Web site: <http://www.hp.com/go/csraparts/>
- Part Surfer: <http://partsurfer.hp.com/search.aspx>
- HP Parts Page: <http://partpage.corp.hp.com/default.asp>

Service Calibration Guide to Removal and Installation

Using the Service Calibration Guide

When you remove most product components, you will need to perform a particular set of Service Calibrations and Diagnostic tests to ensure proper product performance.

The Service Calibration Table explains which service calibrations and diagnostic tests need to be performed whenever you remove and install particular product components.

The calibrations and tests must be performed in the order in which they are listed.



NOTE: Even if you do not replace the removed component with a new component, you still need to perform the calibrations indicated in the table.

Diagnostics and Calibration Table

Component	Diagnostic Tests	Calibrations	Service Utilities
Auto Pinch Lifter	Pinches lifter	—	—
Belt	Scan Axis / Scan Axis	—	After replacement, reset "scan axis belt" usage counters
Bump Cutter Actuator	Scan Axis / Cutter.	—	—
Carriage Assembly	Carriage Assembly, Scan Axis /Scan Axis, Scan Axis / Cutter	Line Sensor Calibration	After replacement, reset "carriage" usage counters
Carriage PCA	Carriage Assembly	Line Sensor Calibration	—
Center support	Paper Drive	Paper Advance Calibration	—
Cutter	Scan Axis / Cutter	—	—
Cutter platen - Output Valves	Output Valve, Scan Axis / Cutter	Output Valve Calibration, Line Sensor Calibration	—
Drop Detector	—	Before replacement, run Drop Detector Calibration / Reset Calibration Flag. After replacement, run Drop Detector Calibration / Calibrate Drop Detector	After replacement, reset "drop detector working time" usage counters
Encoder Strip	Scan Axis / Scan Axis	—	—
Formatter PCA, Hard Disk Drive, Engine PCA, Jester PCA, Front Panel, Power Supply Unit, PSU Fan	Electronics Module	—	—
Full Bleed Foams	—	—	After replacement, reset "full bleed foams" usage counters
Ink Supply Station Front Panel Side	Ink Delivery System	—	—
Ink Supply Station SVS side	Ink Delivery System	—	—


Component	Diagnostic Tests	Calibrations	Service Utilities
Ink Tubes and Trailing Cable	Scan Axis / Scan Axis, Ink Delivery System	—	After replacement, reset "tubes and trailing cable" usage counters
Line Sensor	Carriage Assembly	Line Sensor Calibration	—
Motor Media Advance Transmission with Encoder	Paper Drive	Paper Advance Calibration	—
Overdrive	Paper Drive	—	—
Pinch Rollers	Paper Drive	—	—
Preventative Maintenance #1	Carriage Assembly, Scan Axis / Scan Axis, Scan Axis / Cutter	Line Sensor Calibration	After replacement, reset "Life PMK1" counters
Preventative Maintenance #2	Service Station, Carriage Assembly	Before replacement, run Drop Detector Calibration / Reset Calibration Flag. After replacement, run Drop Detector Calibration / Calibrate Drop Detector. Line Sensor Calibration	After replacement, reset "Life PMK2" counters
Primers	Service Station / Primer motor	—	—
PRS Actuator	Scan Axis / PRS	—	—
Rail Oiler	Scan Axis / Scan Axis	—	—
Scan Axis motor	Scan Axis / Scan Axis	—	After replacement, reset "scan motor" usage counters
Stacker (w/o Arms assy)	Stacker Overdrive, Stacker Ramps	Stacker Overdrive Calibration, Output Valve Calibration	—
Stacker Arm sensor (microswitch)	Sensors	—	—
Stacker capacity sensor (opto)	Stacker capacity sensor	—	—
Stacker jam sensor (opto)	Stacker jam sensor	—	—
Stacker OVD Transmission W/ Motor	Stacker Overdrive	Stacker Overdrive Calibration	—
Stacker Ramps Motor	Stacker Ramps	—	—
Stacker REDI Sensor	Stacker Empty Sensor	—	—
Stacker Valves motor	Output Valve	Output Valve Calibration, Line Sensor Calibration	—
Stacker Valves sensor	Output Valve	Output Valve Calibration, Line Sensor Calibration	—
Starwheel lifter mech	Scan Axis / Starwheel Lifter	—	—

Component	Diagnostic Tests	Calibrations	Service Utilities
Starwheel supports	Scan Axis / Starwheel Lifter	—	—
SVS W/ Drop Detector	Service Station	Before replacement, run Drop Detector Calibration / Reset Calibration Flag. After replacement, run Drop Detector Calibration / Calibrate Drop Detector	After replacement, reset ""SVS"" usage counters. After replacement, reset ""drop detector working time"" usage counters
Top or Bottom Rewinder	Rewinder	—	—
Upper or Lower Roll Cover Sensor (microswitch)	Sensors	—	—
Window Position Sensor (microswitch)	Sensors	—	—


Main cover (front panel side)

Removal

1. Remove 2 T-15 screws.

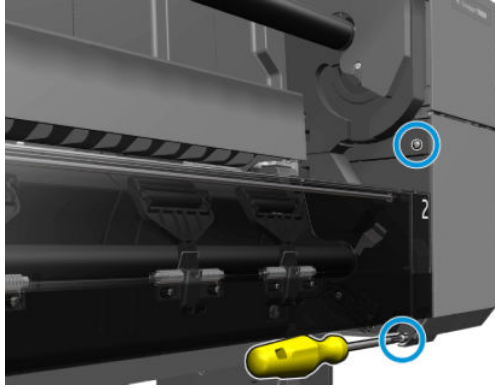


2. Remove 2 T-15 screws.

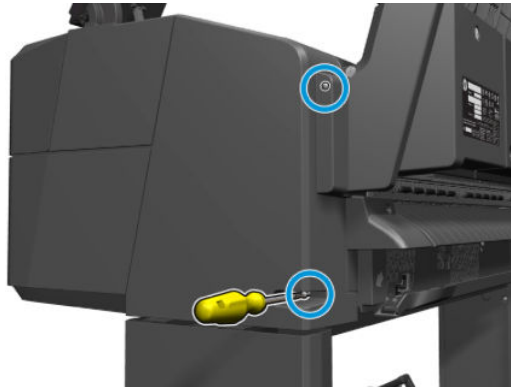


3. Open the ink cartridge cover.




4. Remove the ink cartridges.

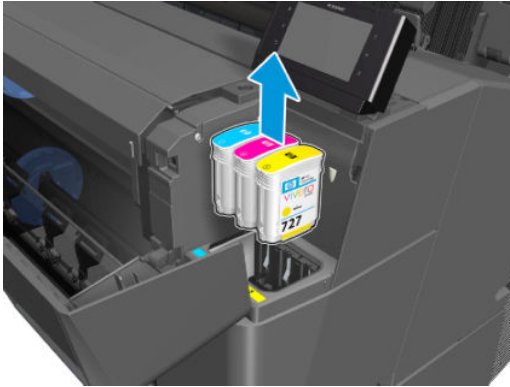

5. Remove 2 T-15 screws.

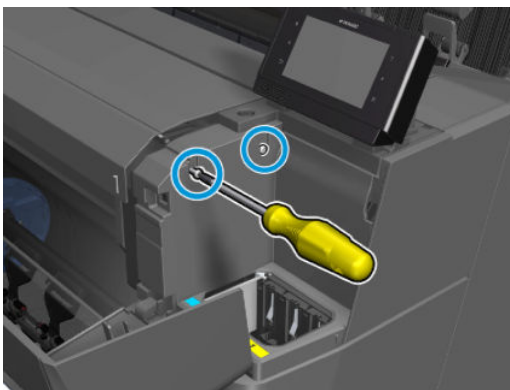


6. Remove the cover.

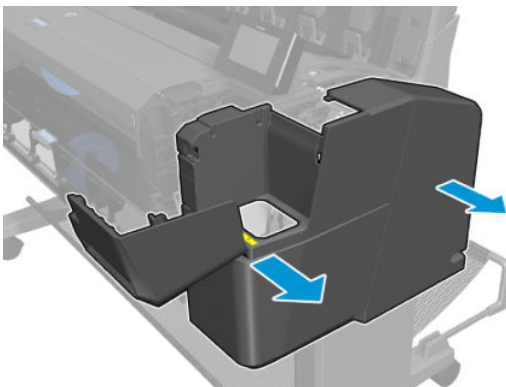

Main cover (service station side)

Removal


1. Remove 2 T-15 screws.

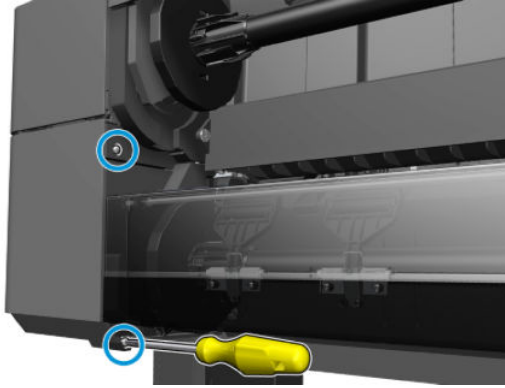


2. Remove 2 T-15 screws.




3. Open the ink cartridge cover.

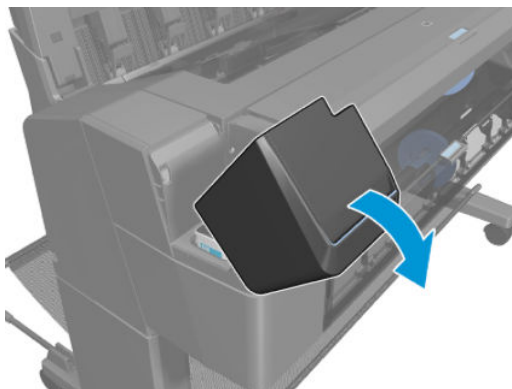


4. Remove the ink cartridges.

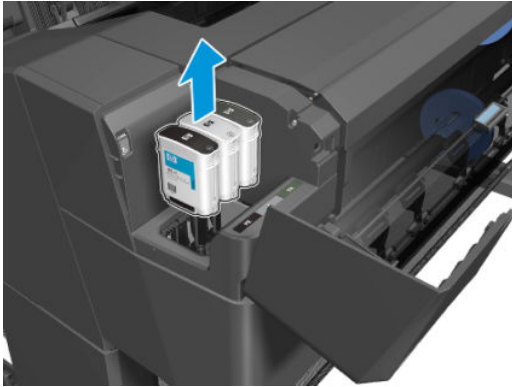

5. Remove 2 T-15 screws.

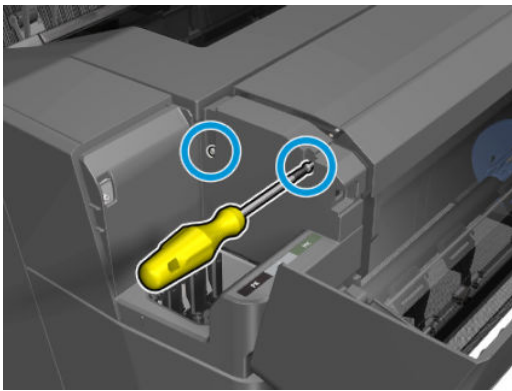


6. Remove the cover.

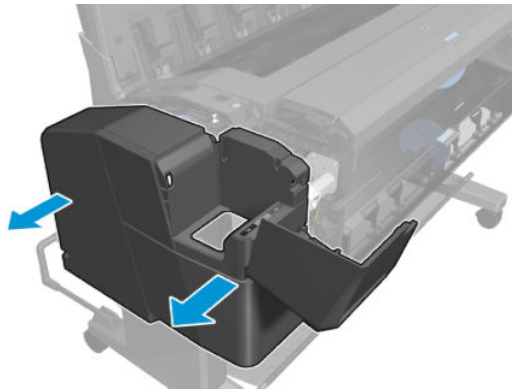


Center cover (T920 only)

Removal




1. Remove the main front panel cover. See [Main cover \(front panel side\) on page 281](#).
2. Remove the main svs cover. See [Main cover \(service station side\) on page 283](#).
3. Open the roll cover.

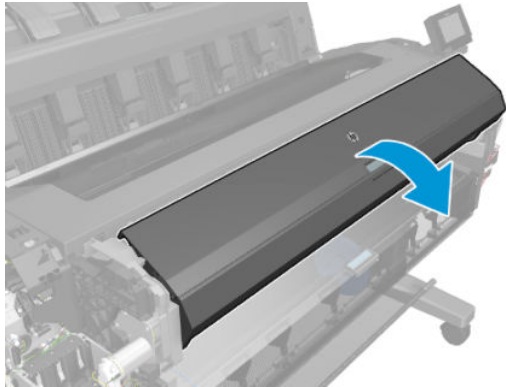


4. Remove the spindle.

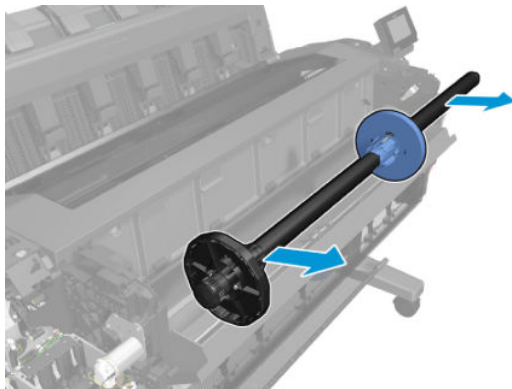

5. Remove the 7 T-15 screws.

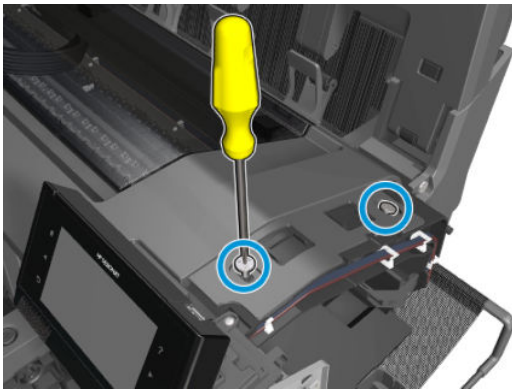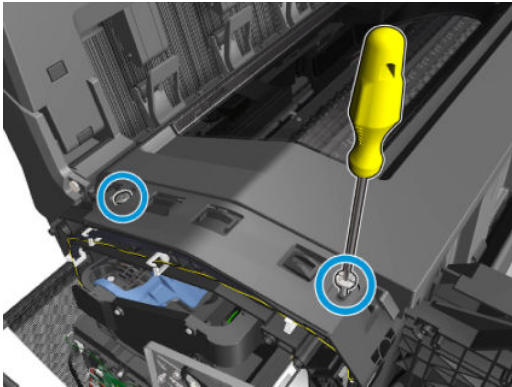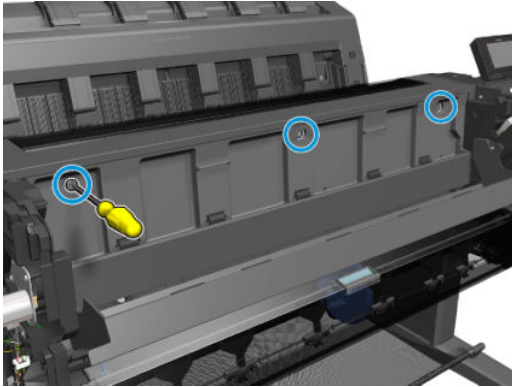


6. Lift up the center cover, and remove it from the printer.

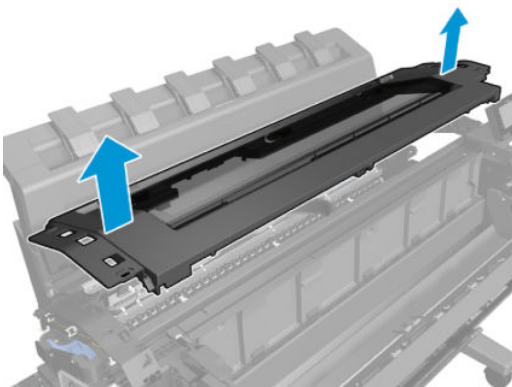


Converger Assembly

Removal


1. Remove the top spindle and close the top cover.
2. Open the bottom roll cover.

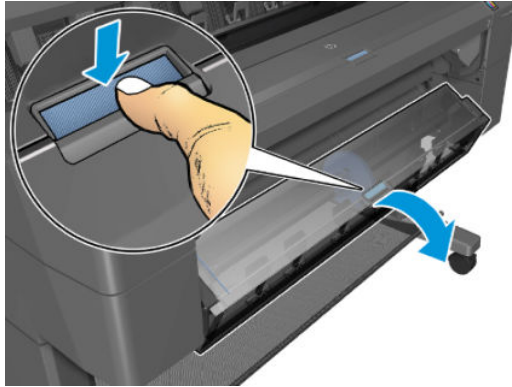

3. Remove the T-15 screw.

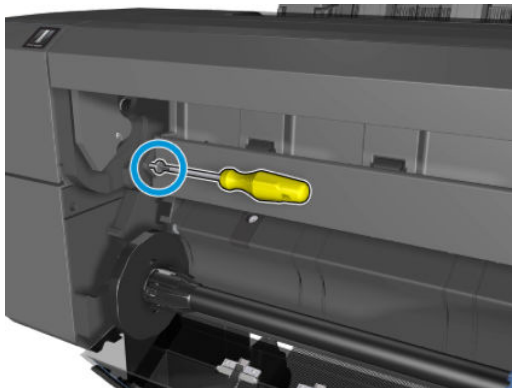


4. Remove the converger.

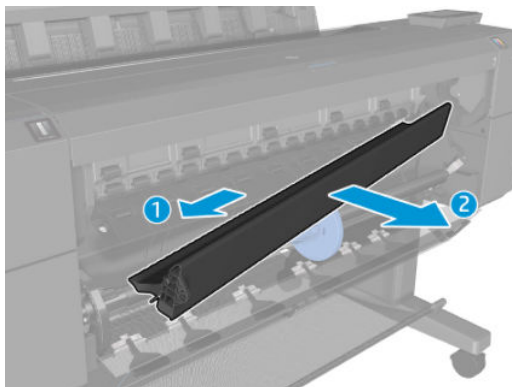


Cleanout

Removal


1. (T3500 only) Remove the bottom tip support. See [Bottom Tip Support on page 364](#).
2. (T3500 only) Remove the control panel side cover. See [Main cover \(service station side\) on page 283](#).
3. Remove the bottom roll cover. See [Customer Self Repair Flyers on page 473](#).
4. Remove the converger. See [Converger Assembly on page 287](#).
5. Disconnect the media sensor cable underneath the printer.

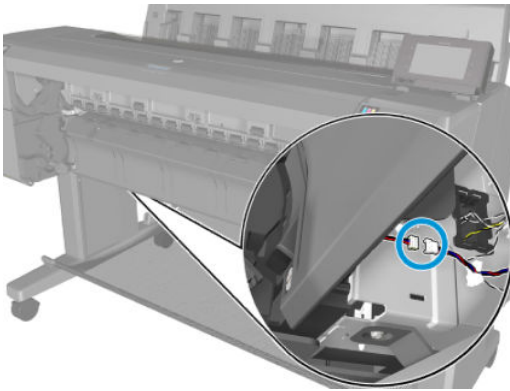


6. Remove 4 T-15 cosmetic screws.

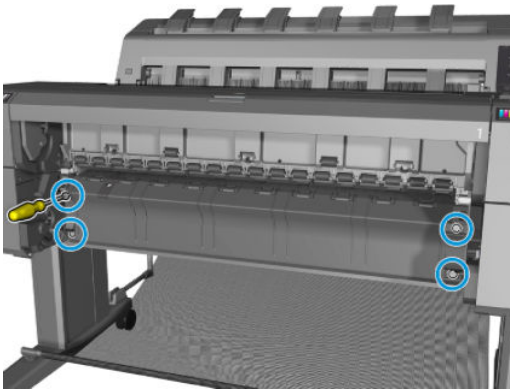

7. Rotate the 2 supports outward.

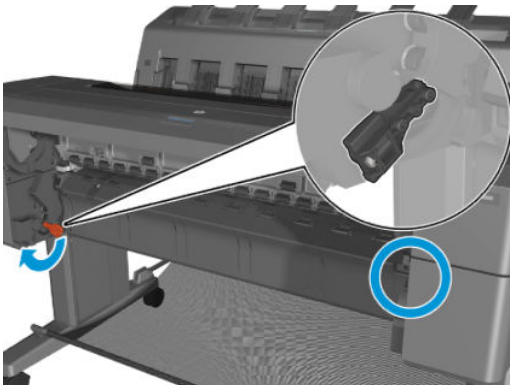


8. Remove the cleanout.

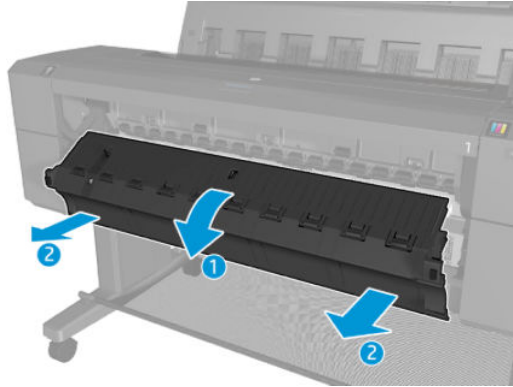

Installation



- ▲ Insert at an angle, and when in, rotate upwards.

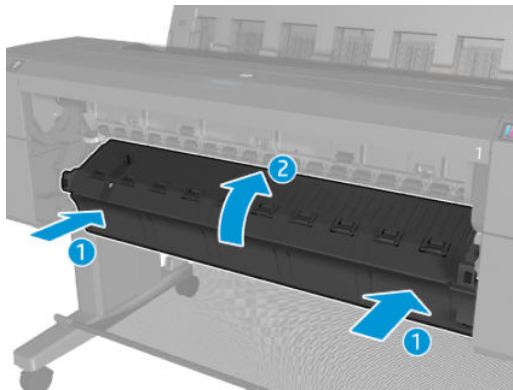


Output platen

Removal

1. Remove the 2 arch sidewall covers. See [Arch sidewall cover \(service station side\) on page 294](#).
2. Remove two T-15 screws.

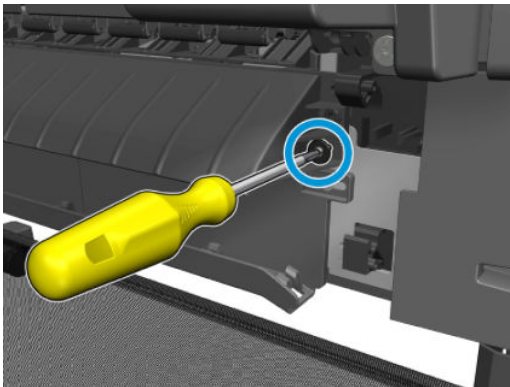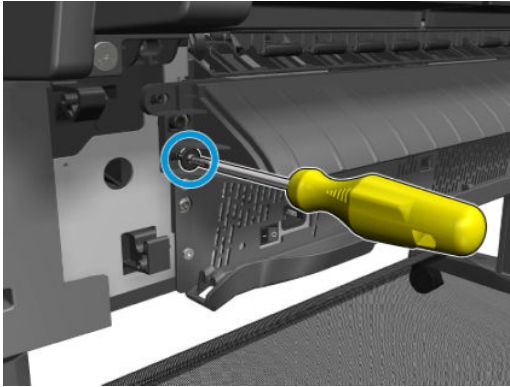


3. Remove the output platen.

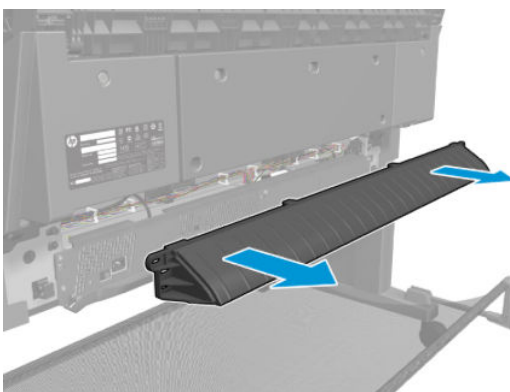


Fixed tray cover (Front Panel side)

Removal

1. Remove 3 cosmetic T-15 screws.

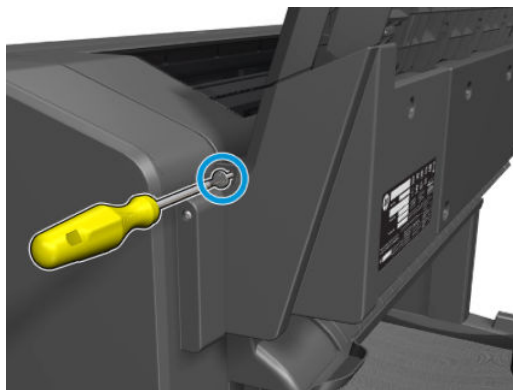



2. Remove the fixed tray cover from the front panel side.

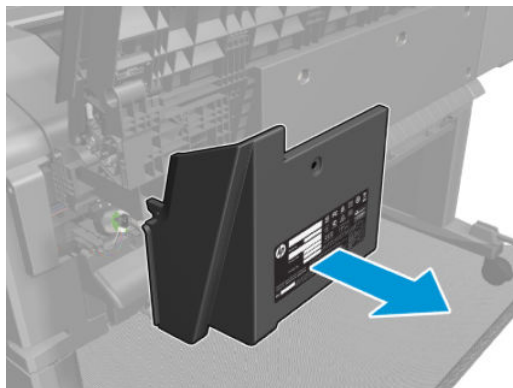


Fixed tray cover (service station side)

Removal

1. Remove 3 cosmetic T-15 screws.

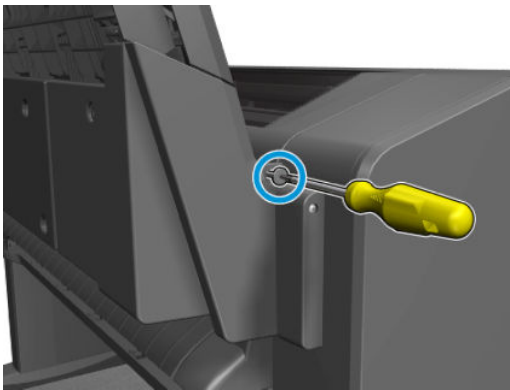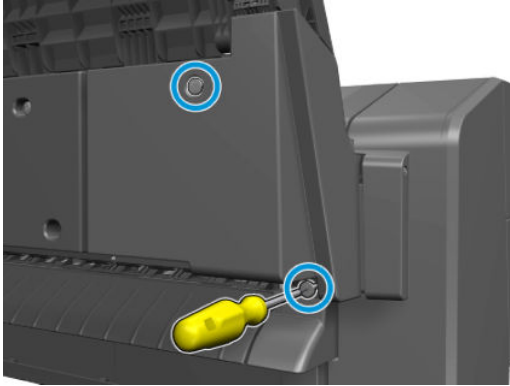


2. Remove the fixed tray cover from the service station side.

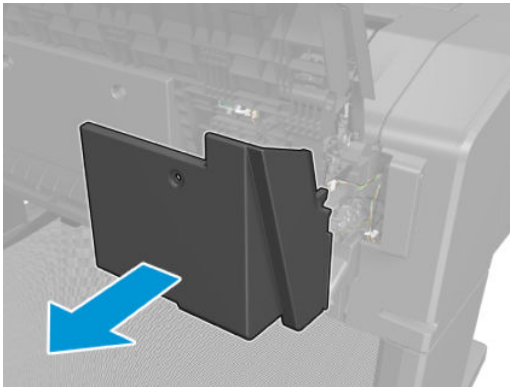


Arch sidewall cover (front panel side)

Removal

1. Remove the T-15 screw.

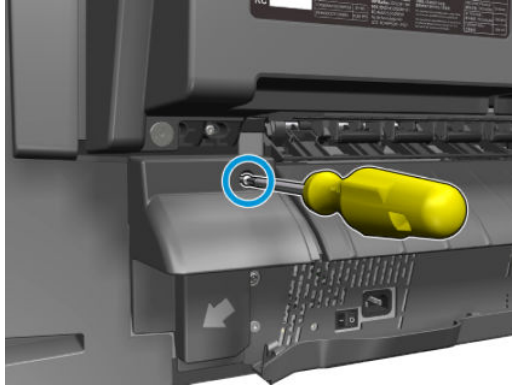


2. Remove the arch sidewall cover from the front panel side.

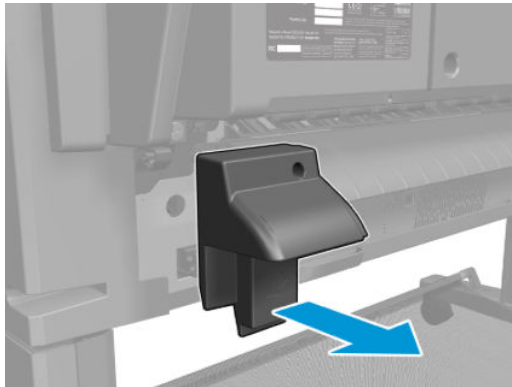


Arch sidewall cover (service station side)

Removal

1. Remove the T-15 screw.

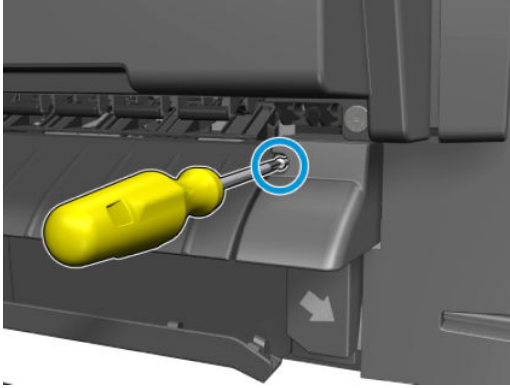


2. Remove the arch sidewall cover from the service station side.

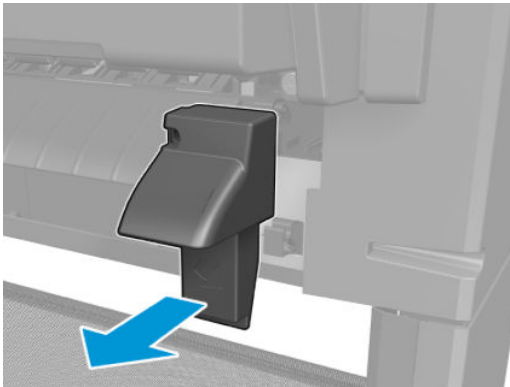



Rear cover

Removal

1. Remove 4 T-15 screws.

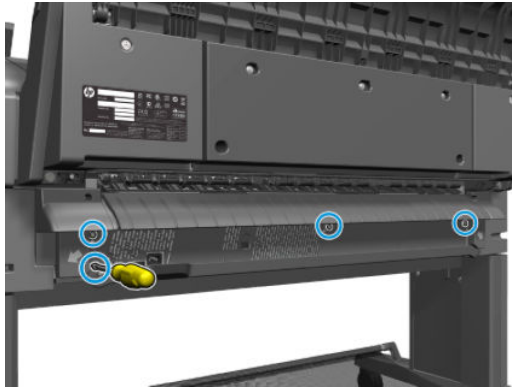

2. Remove the rear cover.

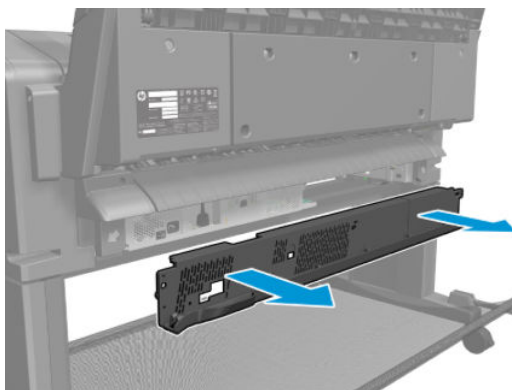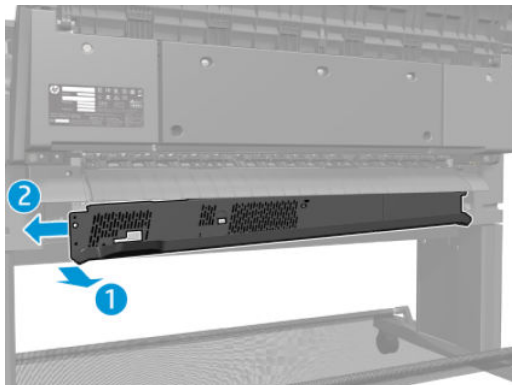


Window Sensor

Removal




1. Open the window.



2. Remove the T-8 screw.

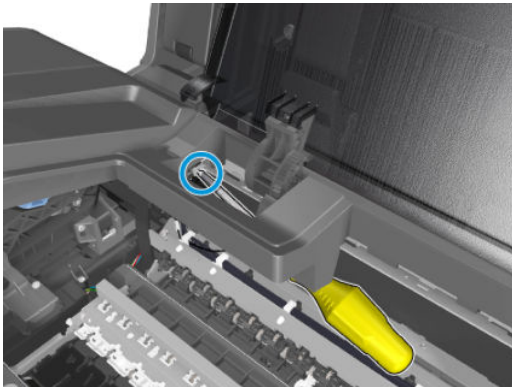


3. Unroute and disconnect the cable.

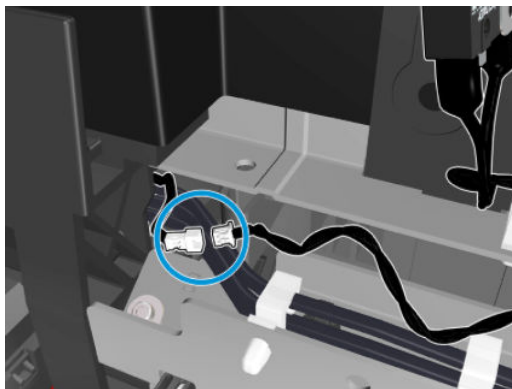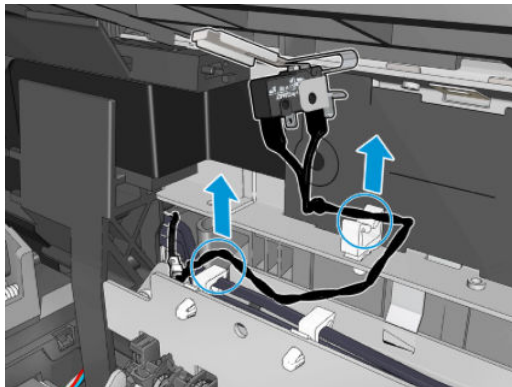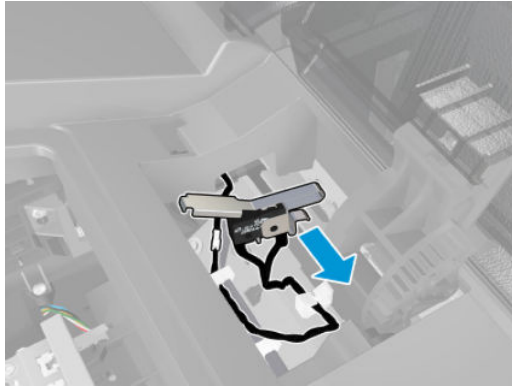


HP 727 Printhead installation tips and tricks


The new printers come with a whole new set of innovations, such as an output stacker tray, a new printhead, and new network capabilities. In order to ensure the implications of these new designs and different installation processes are well understood, HP has developed this document to assist in the installation process.

First checks

 **NOTE:** Don't forget to install the latest firmware!

Over the last few months new firmware versions have been generated improving product stability and adding new features.

 **TIP:** Download the latest firmware from www.hp.com/go/T1500/software to a USB. When booting the printer for the first time, the printer will request to select the Front Panel Language. After the selection and before installing the inks, plug the USB with the latest Firmware to upgrade the printer.

 **NOTE:** The firmware is the same for all printers.

Also, if the printer has a firmware previous to the release MRYMFP_02_00_02.5 you will be requested to install this one first. So it's useful to have two USBs: one with the newest version and one with the MRYMFP_02_00_02.5.2.

How to install the HP 727 printhead successfully

The HP 727 printhead requires a new installation process.

You can get familiar with it following the instructions on the printer Front Panel when installing it. Also, watch the video **Installing a printhead on the HP Designjet T920, T1500 and T2500** on YouTube <http://www.youtube.com/watch?v=XaqEA81ggAw>.

Make sure tube connectors are moistened:

1.



2.



3.



4.




TIP: If the carriage latch is particularly stiff or hard to close, or if the blue latch is not staying completely flat with the printhead inserted, please moisten the tube connectors with a Q-Tip/cotton bud that is wet with water or PEG (Polyethylene glycol) as shown above. After doing it, re-insert the printhead and check again that the blue latch is completely flat.

While closing the printhead, pay special attention to the following steps:


1. The Carriage

TIP: In order to close the carriage, the blue lever must fully engage with the metal bar before you push it down.

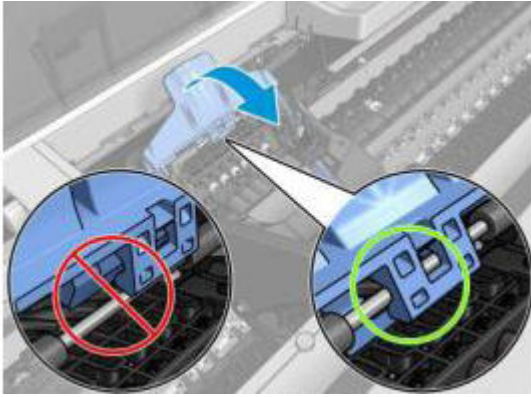


2. The Latch

- 💡 **TIP:** Once closed down the latch should remain flat over the printhead. This ensures that the **Printhead** is properly inserted in the tubes.

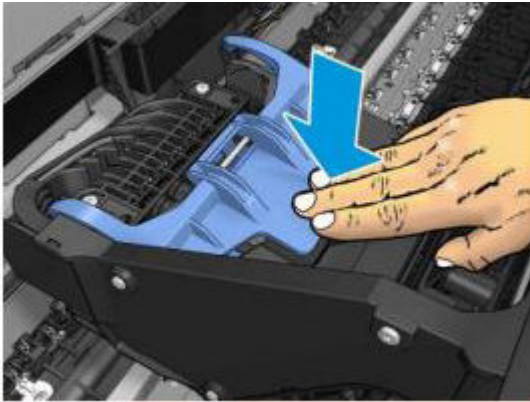

3. The Rear

- 💡 **TIP:** Once closed, you can still push against the rear side of the carriage to ensure it is properly closed.

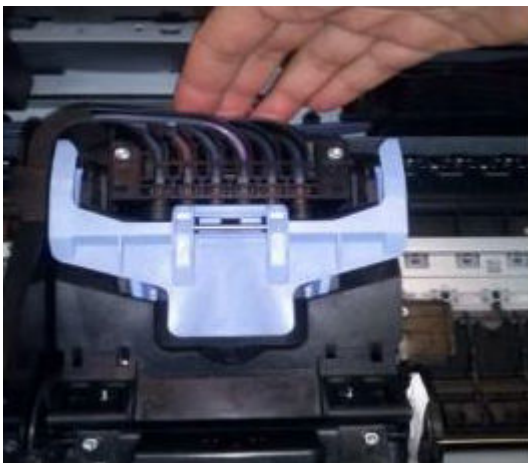

After the installation don't forget to...

- Before finishing installing the printer, it's recommended to enable the Automatic Firmware Upgrade in order to help customers to have the printer up-to-date easily. Follow the steps provided at **Connectivity ► Connectivity Wizard**.



- Check that the ink tubes are completely filled. This can be done by launching a printhead replacement. This will move the carriage to the center of the printer and allow visual access. Once the tubes are visually verified, the printhead replacement can be canceled.

Filled tubes are darker, and yellow tube looks reddish:



Empty tubes have a bluish shade:



Resolving issues

When having any problem you can contact HP Service for further assistance. To get the most effective help, the following information can be helpful:

- When did you have the problem? Was there a printhead message before filling the tubes or after?
- When there is a printhead reset/replace message, are all the tubes filled or only some? Which ones?
- What is the printhead Error Code?
 - This information is available at the Embedded Web Server: **Support ► Service support ► Printer information**. This will open a new page. Select the **All pages** tab. Download this page or print it to a PDF file.

Current Printhead Kit Info (I)				
Kit Name	Inventory Status	Status	Error ID Code	Product Number
1 - Photo 200ml-Gray-White-back-Cyan-Magenta-Yellow	In Inventory	OK	0	80100A

Current Printhead Kit Info (II)				
Kit Name	Product Name	Serial Number	Install Date	Warranty Date
1 - Photo 200ml-Gray-White-back-Cyan-Magenta-Yellow	HP 827	2320110-001942019	2013-06-06	2014-03-22

If you happen to have an issue during the Printhead & Ink initialization, you will need to cancel the process in order to get straight to the network setup.

At the end of the network setup you will be able to access the Embedded Web Server by typing the printer IP Address in your Web Browser.


What should I do if the printhead is rejected?

1. The printhead is rejected **before filling the tubes.**

If the printer persistently gives a Printhead Reseat message before filling the tubes with ink, the most common solution is to replace the printhead for a new one. HP Limited Warranty covers the printhead for a period of 1 year from date of installation or 4000 ml of HP ink have been cycled through it, whichever occurs first.

2. The printhead is rejected **after filling the tubes and tubes:**

- a. In order to discard any Hardware issue, it is recommended to run the diagnostics for **Service Station ► Primer and Ink Delivery System** diagnostics available in the Service Menu.
- b. Once any Hardware issue is discarded, the most common solution is to launch a **new Tubes Purge** again with new set of ink and a new printhead.

 **TIP:** If any tube or printhead channel is still empty, remove all the cartridges before doing any troubleshooting. Otherwise, the empty tube can mislead the printer and cause to detect it as faulty or empty. Contact HP and a Service Engineer will lead you through testing the printer subsystems and confirm that only a new tube purge is required.

HP is committed to improve the installation experience of these products and has:

- Evaluated printhead shipping methods, developing a new packaging strategy both for printhead and printer.
- Created new firmware versions to address common installation problems.
- Developed a video and this 'tips and tricks' document to clarify the installation steps, highlighting differences versus previous products.

Ink Service kit

As of March 2014 the service kit **CR357-67088 Ink Kit** is available.

The kit includes a set of 69cc ink cartridges for all HP 727 inks: matte black, gray, photo black, cyan, magenta, and yellow.


The kit should be used when troubleshooting printhead issues, as it allows the following:

- Install a new printhead.
- Run a tube purge.

Open the E-Box

Removal


1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
2. Remove the output platen and Rear Cover. See [Output platen on page 290](#) and [Rear cover on page 295](#).
3. Remove two T-20 screws.

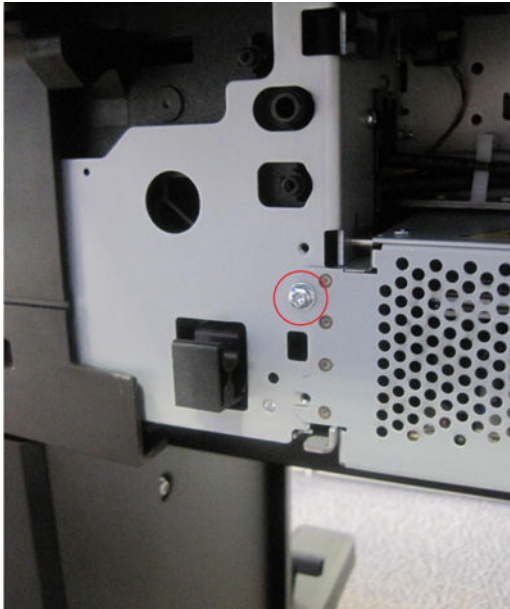

4. Remove the front panel cable and the T-10 screw. For the T2500 and T3500, you will also need to disconnect the USB cable.




5. Move forwards 15 cm and then disconnect the cables.

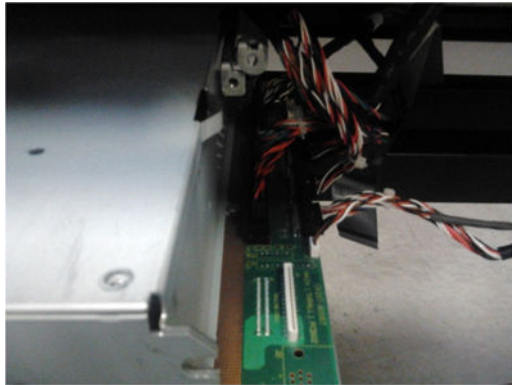

6. Remove the E-Box from the printer.



7. Remove six T-8 screws.

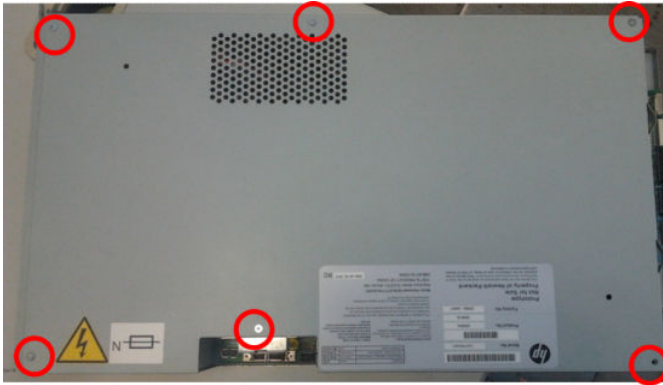


8. Remove four T-8 screws.



9. Remove two T-8 screws.




10. Slide out the E-Box cover.

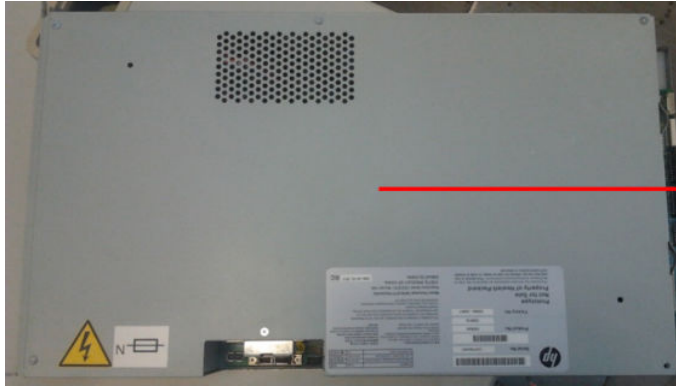

E-Box fan

Removal


1. Open the E-Box. See [Open the E-Box on page 304](#).
2. Remove four screws from each fan.

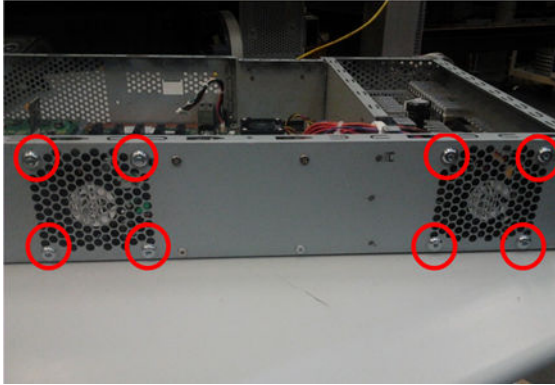


3. Unroute the cables, remove the T-20 screw, and remove the clamp.



4. Remove the cable tie.

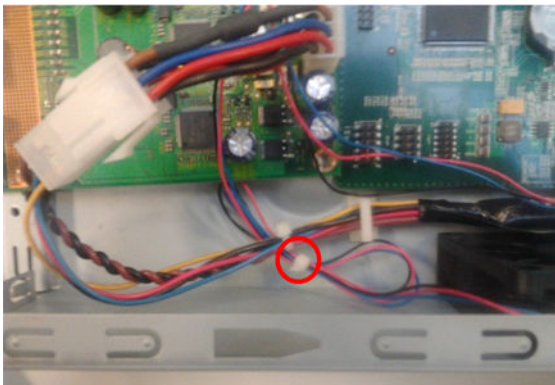

5. Disconnect the cables.

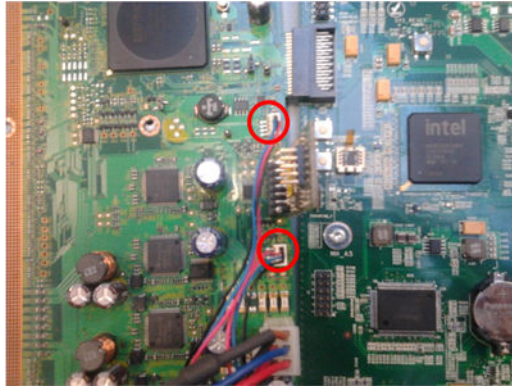


6. Remove the E-Box fans.

Jester PCA

Removal

1. Open the E-Box. See [Open the E-Box on page 304](#).
2. Remove two screws.

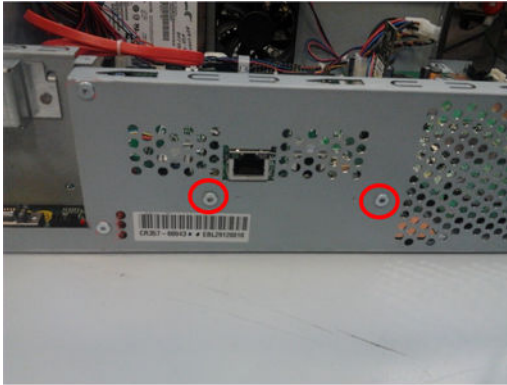


3. Remove the T-8 screw.



4. Remove the Jester PCA.




 **NOTE:** When replacing the Jester PCA, also replace the small inter-connector provided with the kit.


Power supply unit

Removal


1. Open the E-Box. See [Open the E-Box on page 304](#).
2. Disconnect the cables.

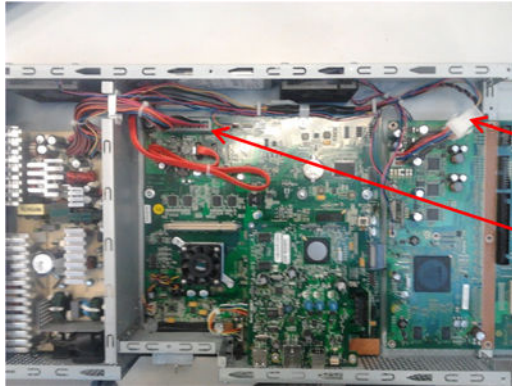


3. Unroute the cables and remove one T-10 screw.

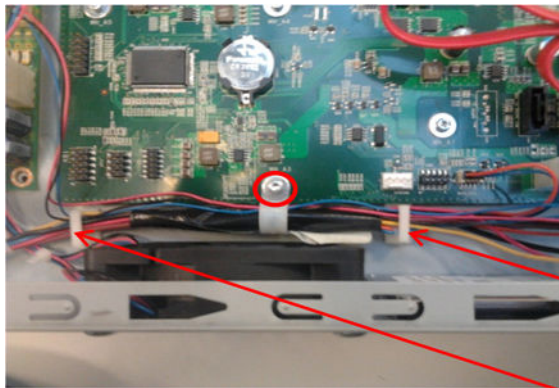


4. Open the clamp.

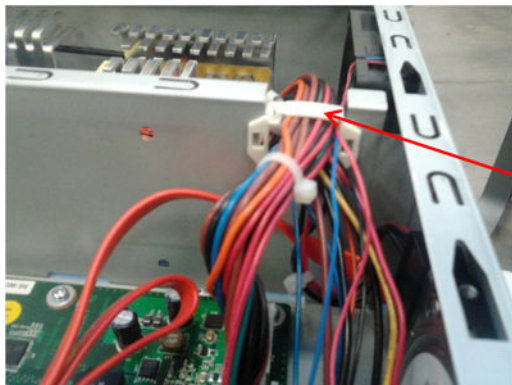

5. Remove grounding cable T-25 screw.

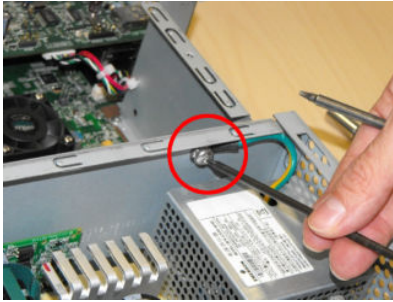


6. Remove the power supply unit.

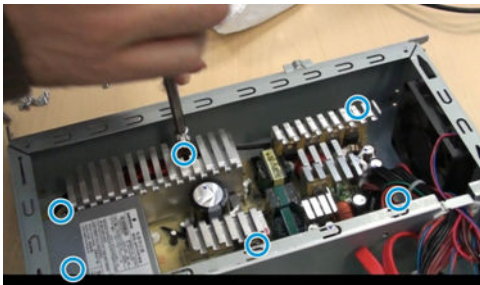


Hard disk drive

Removal

 **NOTE:** If you try to insert a previously used hard disk drive, the product displays a System Error, and will not start successfully.


1. Open the E-Box. See [Open the E-Box on page 304](#).
2. Remove 4 PH1 screws.

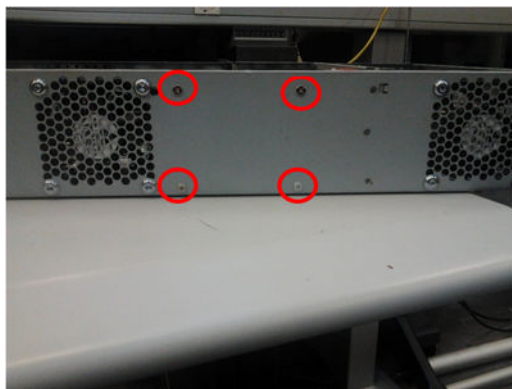

3. Disconnect the cable.



4. Remove the hard disk drive.

 **NOTE:** Remember that after installing a new Hard Disk Drive all previous custom paper presets and printer applications may need to be reinstalled.


Engine PCA


Removal

1. Open the E-Box. See [Open the E-Box on page 304](#).
2. Disconnect cables and remove three T-8 screws.



3. Slide out and remove the engine PCA (which is connected to the formatter PCA).

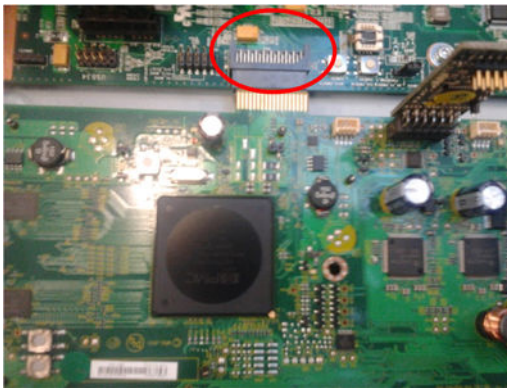

 **NOTE:** The red PCA, Cryptoasic sim, must be installed in the new engine PCA.

Formatter PCA


Removal

1. Use the power switch at the rear to turn off the printer, then disconnect the power cord.
2. Remove the engine PCA. See [Engine PCA on page 314](#).



⚠ WARNING! If the engine PCA is not removed before the formatter, the bridge connections may be damaged.


3. Remove the Jester and Riser PCAs. See [Jester PCA on page 310](#).

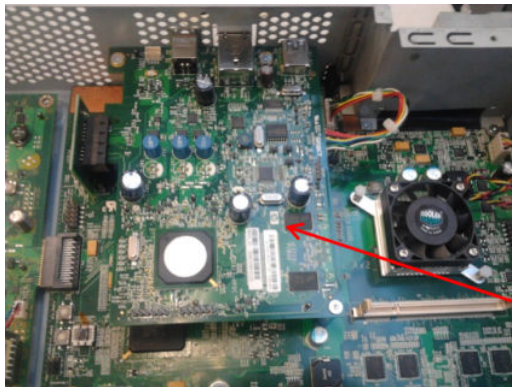



4. Remove the two screws shown.




5. Disconnect the cables and remove the clamp.

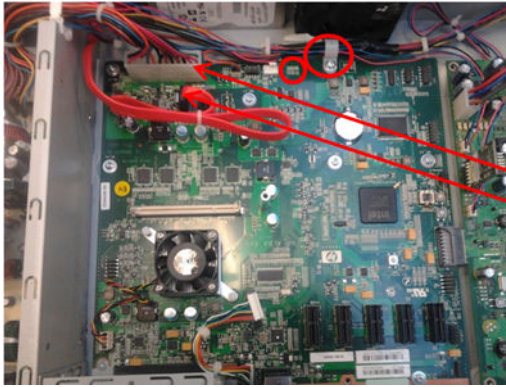


6. Remove four T-8 screws and the L-shaped metal sheet.

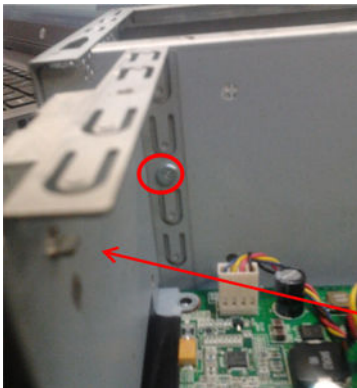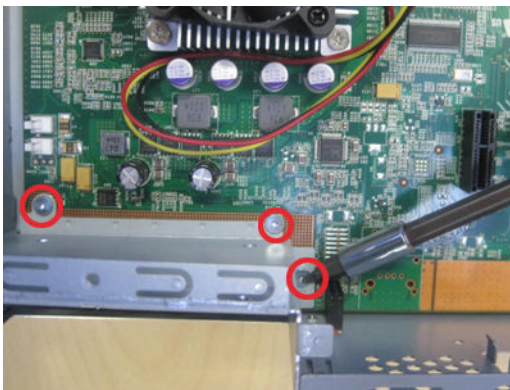

7. Remove four T-8 screws.

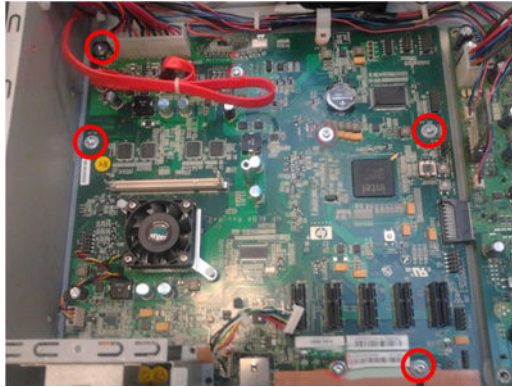


8. Remove the formatter PCA.

 **NOTE:** For T920, T1500, T2500 revB SKU, and T3500 all SKUs (A and B), remember to replace the formatter together with the Hard Disk Drive.



Front panel

Removal




1. Remove the main cover on the front panel side. See [Main cover \(front panel side\) on page 281](#).
2. Remove the output platen. See [Output platen on page 290](#).
3. Remove the rear cover. See [Rear cover on page 295](#).
4. Remove the T-20 screw from the clamp.

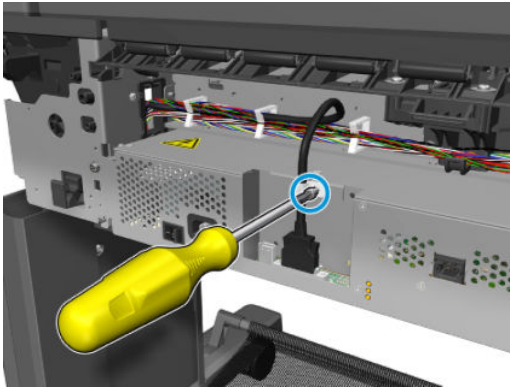


5. Disconnect and unclip the front panel cable.

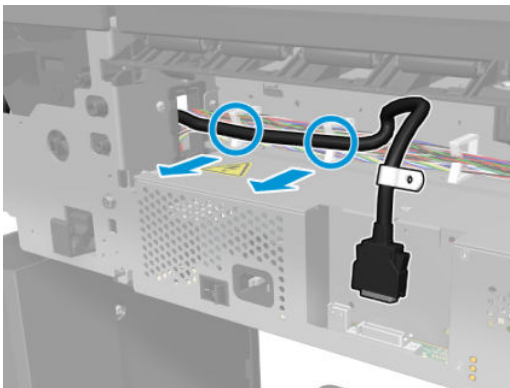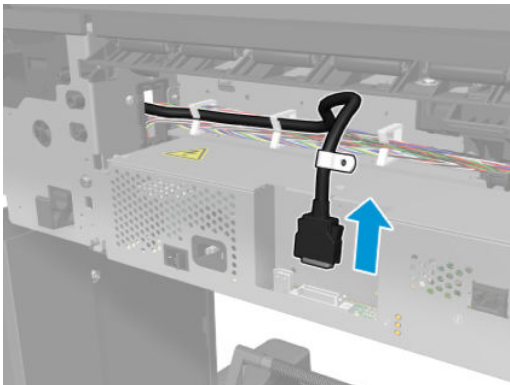


6. Remove the screw, pull the cable through the hole, and unclip it.

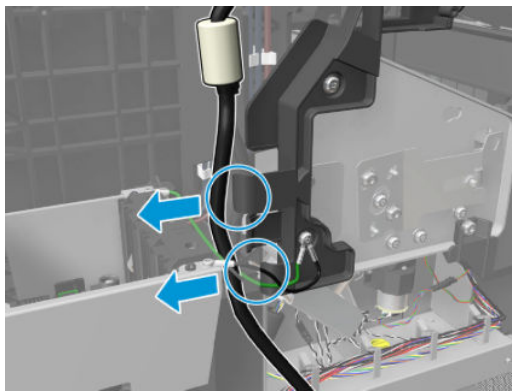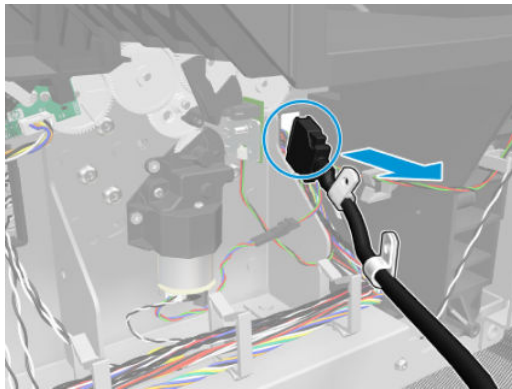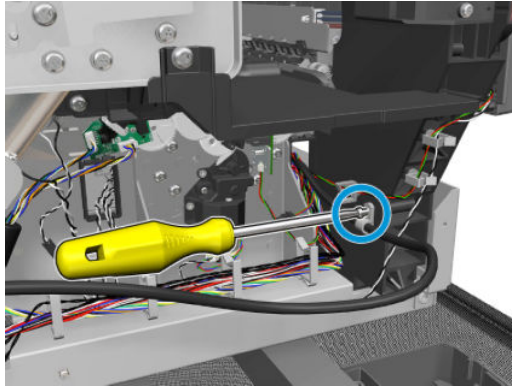


7. Remove the front panel screw.

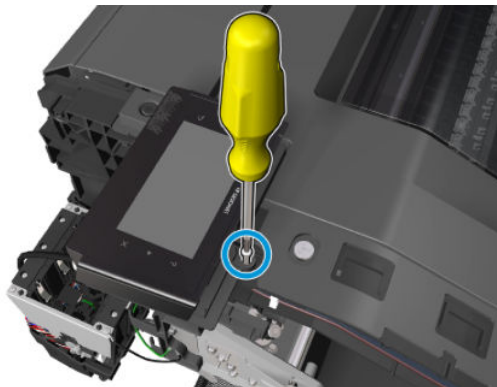



8. Open the top roll cover.

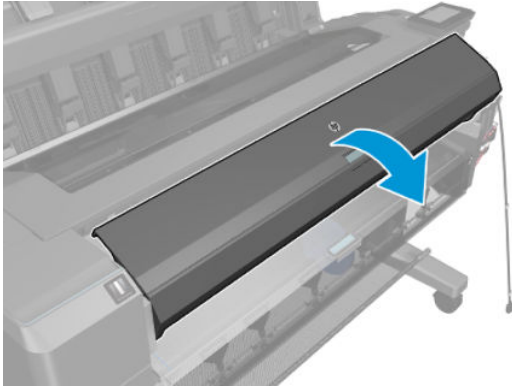

9. Remove the hidden screw.

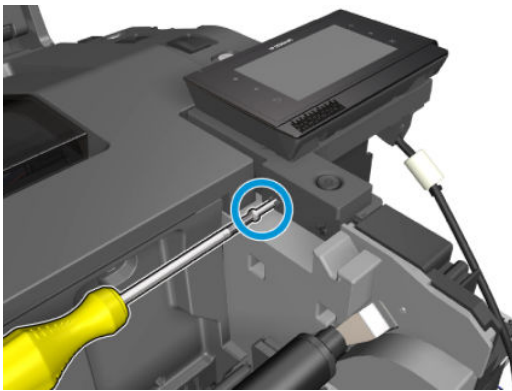


10. Remove the front panel.

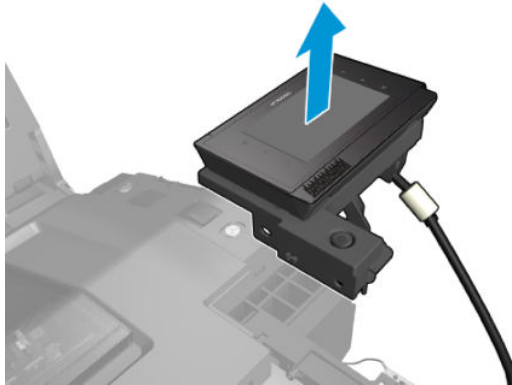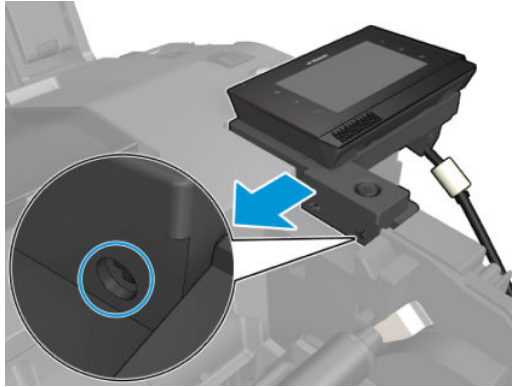


Carriage

Removal

1. Remove the top cover and Window.
2. Remove the SVS main cover. See [Main cover \(service station side\) on page 283](#).
3. Remove the Front Panel main cover. See [Main cover \(front panel side\) on page 281](#).
4. Loosen the T-20 screw belt tensioner.

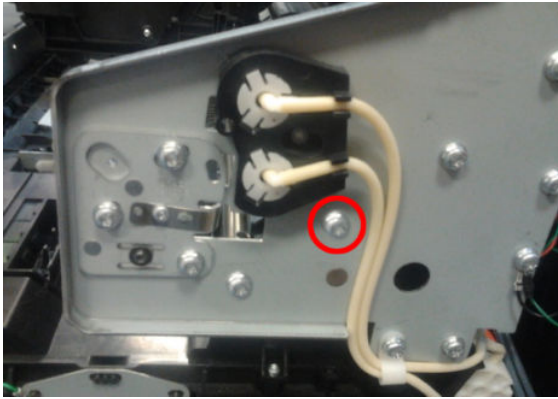


5. Remove the starwheel lifter cover and actuator.

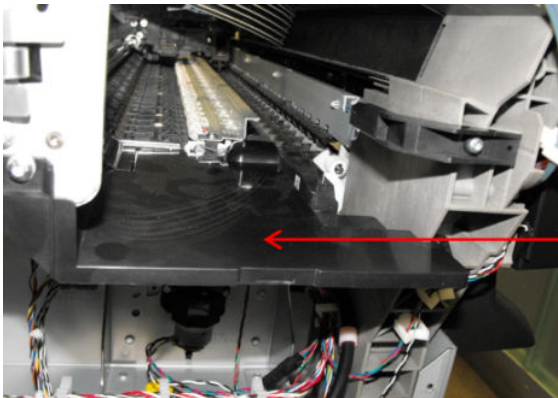


6. Remove the encoder strip. See [Encoder Strip on page 333](#).


7. Remove 2 T-20 screws from the front panel wire rest.

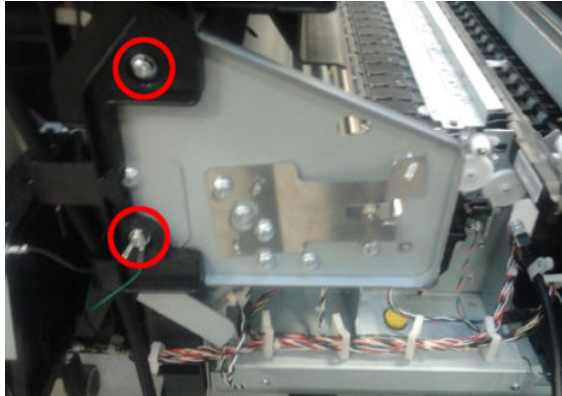

8. Remove the Scan Axis Motor. See [Scan Axis Motor on page 335](#).
9. Remove 5 T-20 screws and the Front Panel bracket.


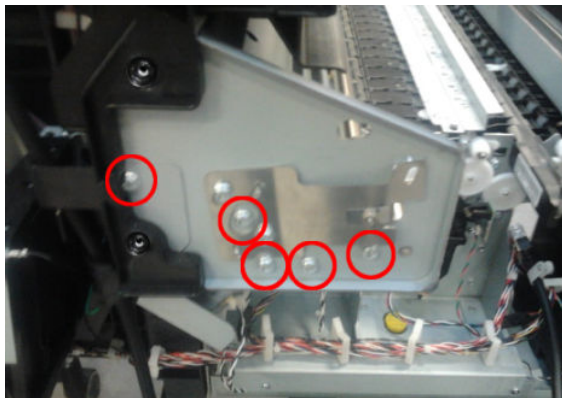


10. Remove the tube guide.

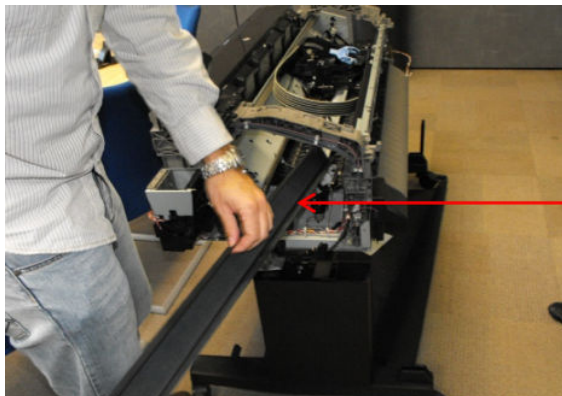


11. Remove 6 screws and the printheads.

⚠ WARNING! When unplugging the trailing cable, be careful not to damage the corners of the cable end.

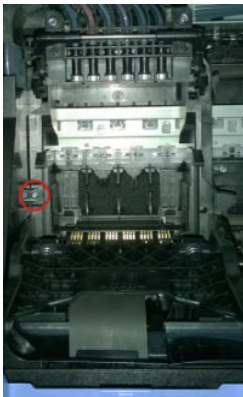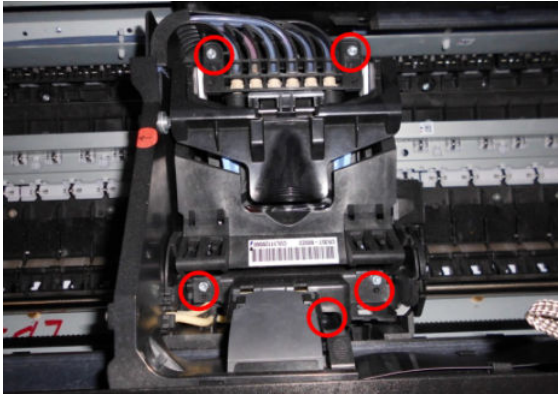


12. Remove the carriage.

To install the carriage, put the tubes into position first.

 **NOTE:** When installing the crane, check that the needles support is properly attached with the levers on the sides. The levers help to move the needles down inside the printhead when the carriage latch is closed.





 **NOTE:** After installing the carriage, when closing the latch, make sure the carriage is placed in the printhead replacement position so the carriage doesn't interfere with the rear guide.

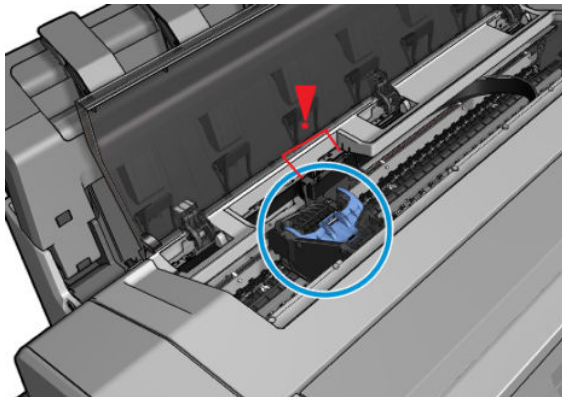


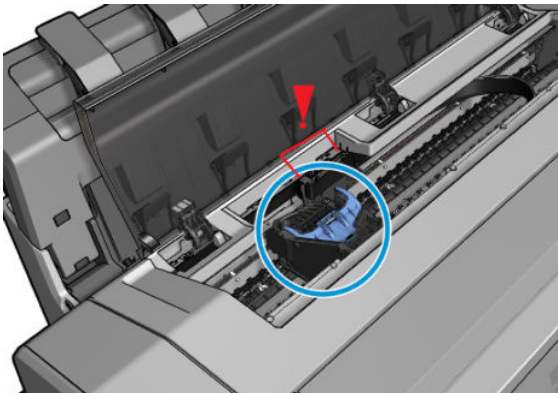
Line Sensor

Removal

1. Open the window.
2. Move the carriage to create a good position for manipulating the carriage.
3. Remove the carriage PCA. See [Carriage PCA on page 327](#).
4. Remove the screw and the Line Sensor.

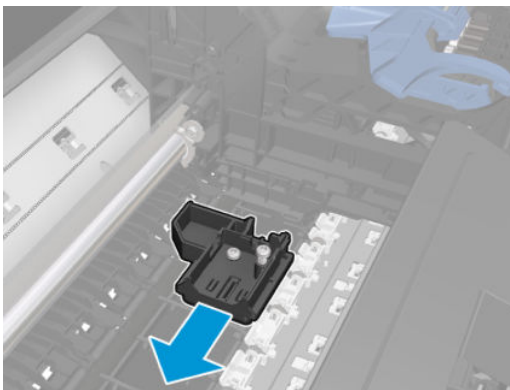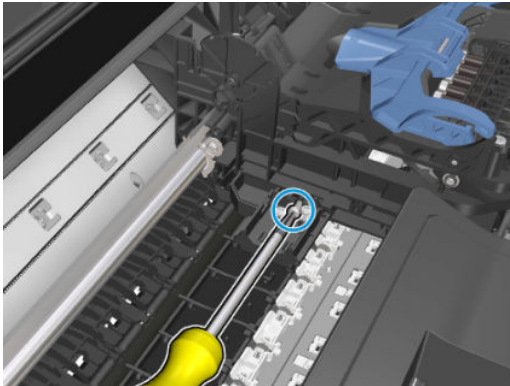




 **NOTE:** After installing the carriage, when closing the latch, make sure the carriage is placed in the printhead replacement position so the carriage doesn't interfere with the rear guide.



Carriage PCA



Removal

1. Open the window and initiate printhead replacement in order to move the carriage to the middle of the printer.
2. Remove the T-15 screw and disconnect the Line Sensor cable.

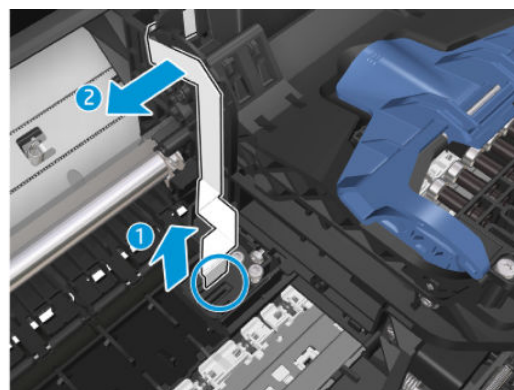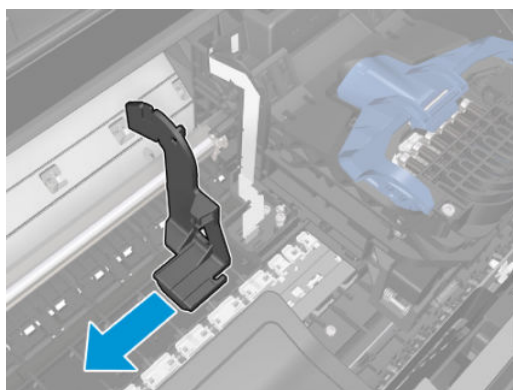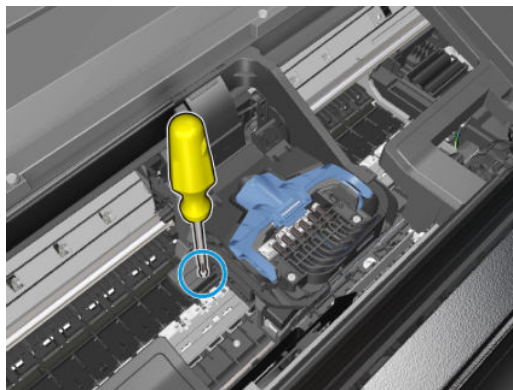


3. Unclip the mylar, and disconnect trailing cable.


⚠ WARNING! When unplugging the trailing cable, be careful not to damage the corners of the cable end.

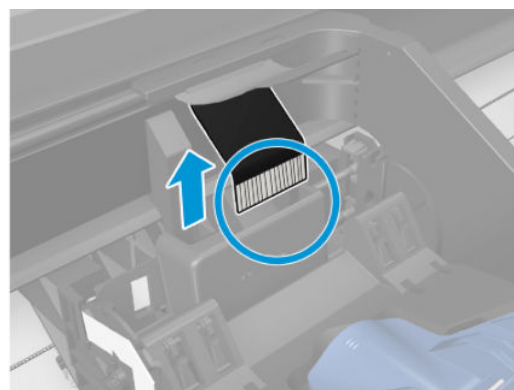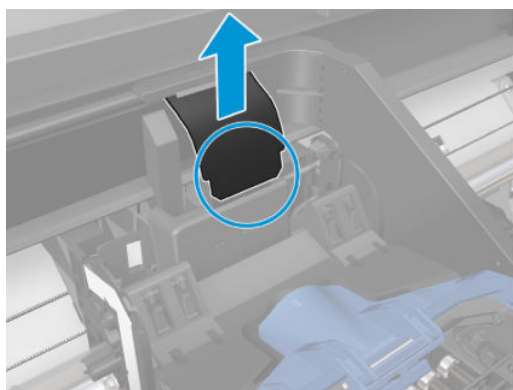


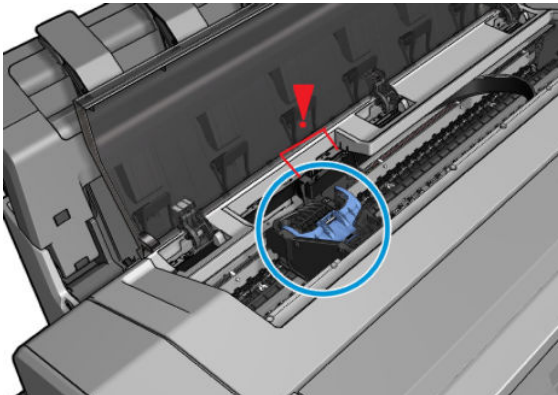
4. Remove the 2 T-15 screws.

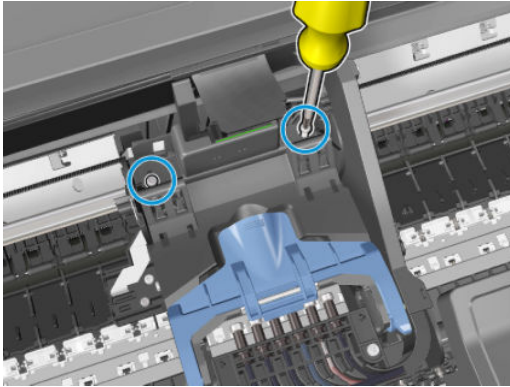

5. Remove the carriage PCA.

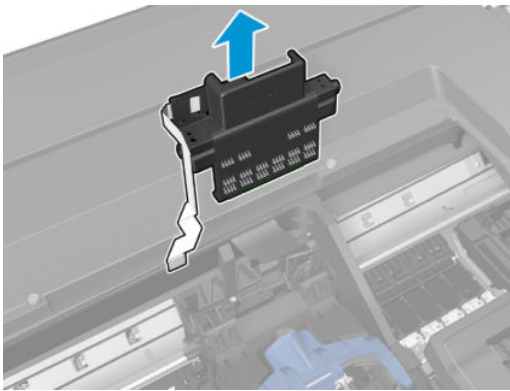


 **NOTE:** After installing the carriage, when closing the latch, make sure the carriage is placed in the printhead replacement position so the carriage doesn't interfere with the rear guide.




Rail Oiler Kit

Removal

1. Remove the SVS main cover. See [Main cover \(service station side\) on page 283](#).
2. Remove the T-20 screw.

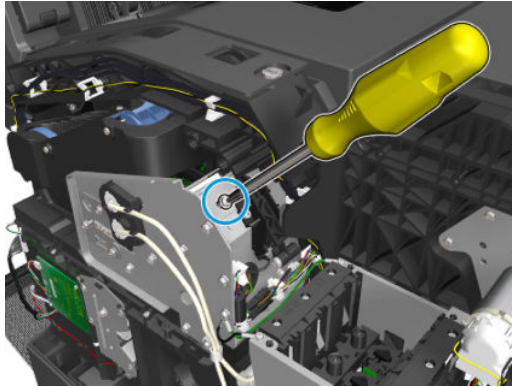



3. Remove the rail oiler kit.

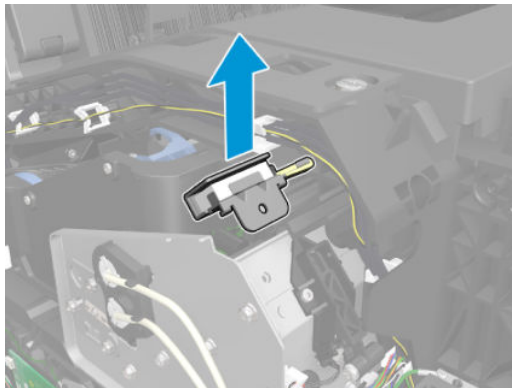



PRS Actuator

Removal

1. Remove the SVS main cover. See [Main cover \(service station side\) on page 283](#).
2. Disconnect and unclip the cable.

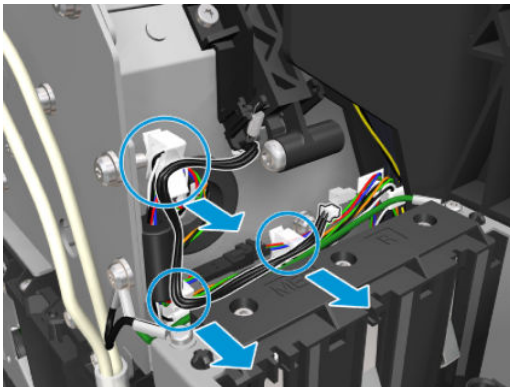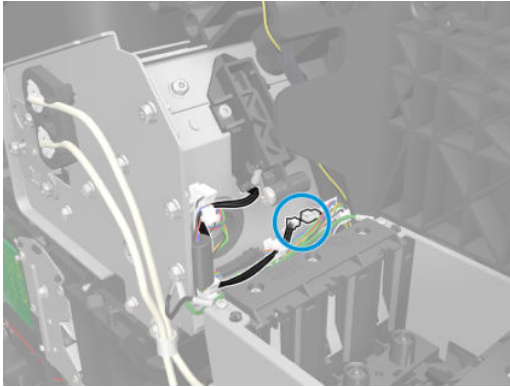


3. Remove the 2 T-20 screws, and the PRS actuator.

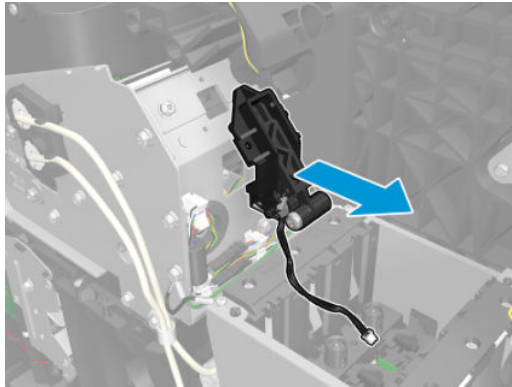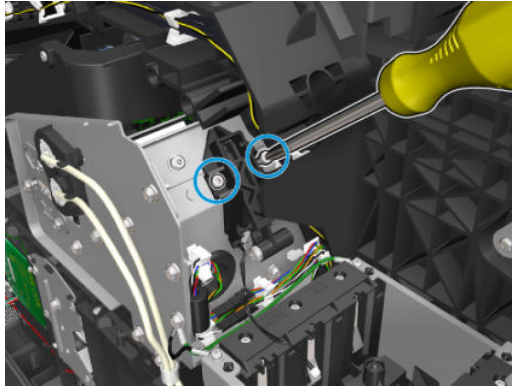


Belt

Removal

1. Remove the carriage. See [Carriage on page 322](#).
2. Remove the belt.

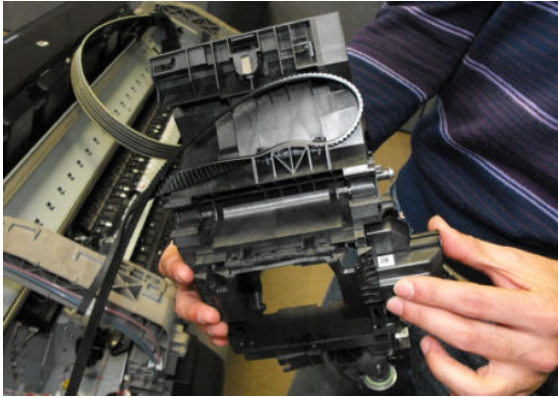


 **NOTE:** When assembling the belt, make sure that it is correctly attached to the tensioner and scan axis motor pin. If not, the belt can rapidly become worn out, and/or make noise.




Encoder Strip

Removal


1. Remove the SVS main cover. See [Main cover \(service station side\) on page 283](#).
2. Remove the Front Panel main cover. See [Main cover \(front panel side\) on page 281](#).
3. Remove the T-10 screw.

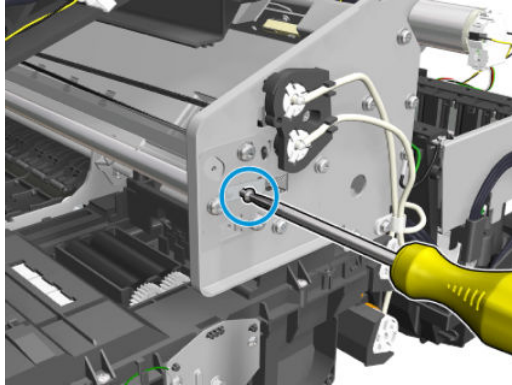



4. Press the bracket to release the encoder strip tension.

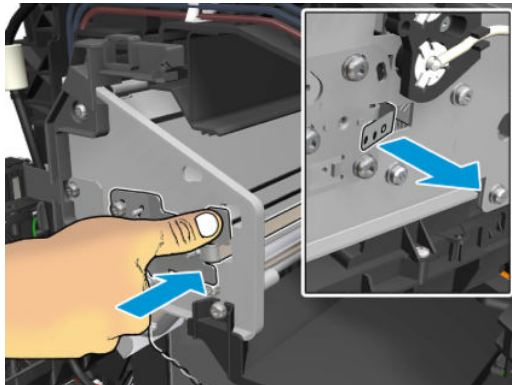

5. Remove the 5.5 mm nut.

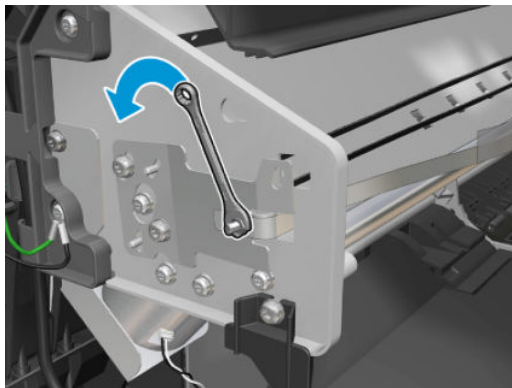


6. Remove the Encoder Strip.

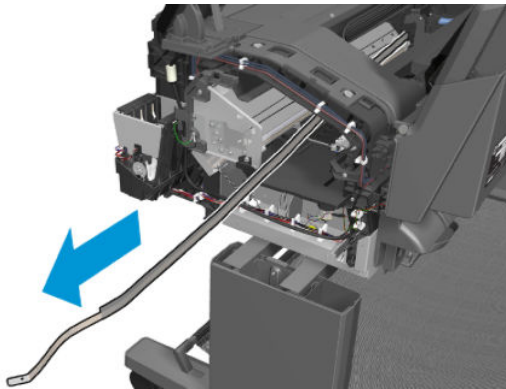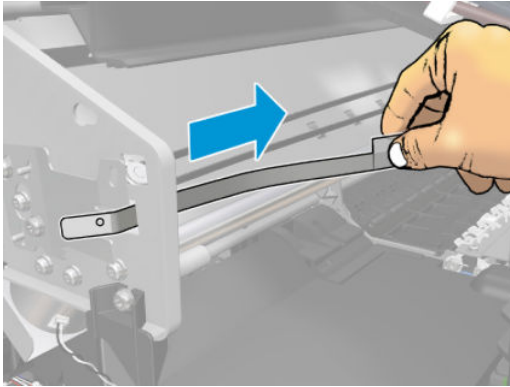


Installation

1. Position the encoder strip.
2. Press the spring to allow the encoder to fit into the nut.
3. Tighten the nut manually.

 **NOTE:** Do not tighten with a tool, the force would be too much and the encoder could slide down.

4. Tighten the T10 screw while hand holding the encoder to prevent it from sliding.

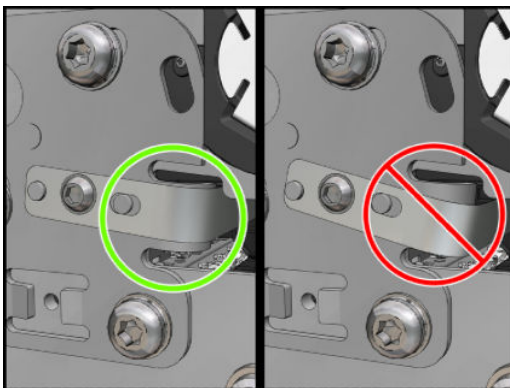


 **NOTE:** Run feed and cut.


Scan Axis Motor

Removal


1. Remove the center cover. See [Center cover \(T920 only\) on page 285](#).
2. Loosen the belt tensioner T-20 screw, SVS side.

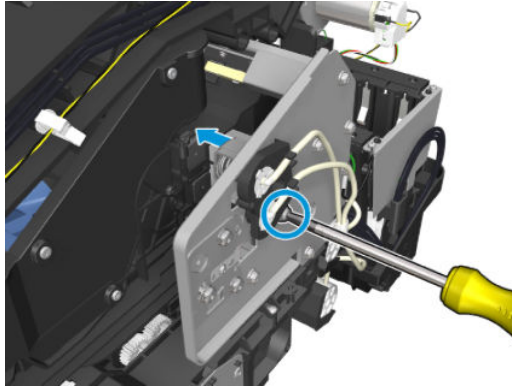


3. Untighten the 4 T-20 screws, FP side.

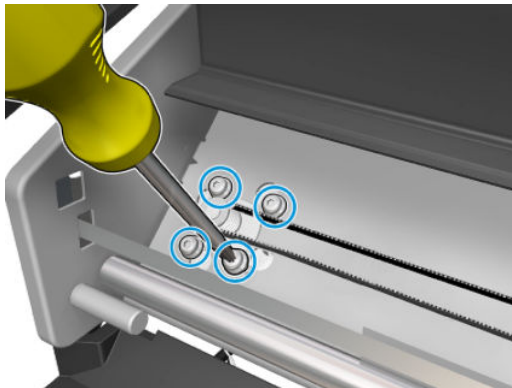


4. Disconnect the belt.


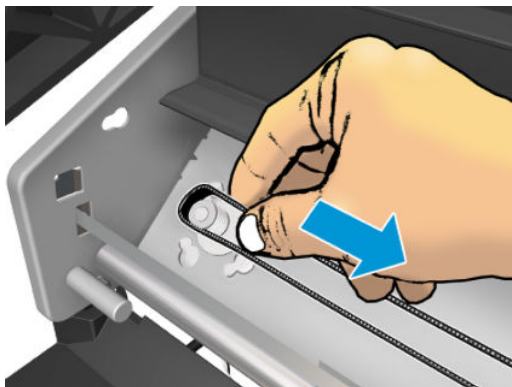


5. Disconnect the cable.

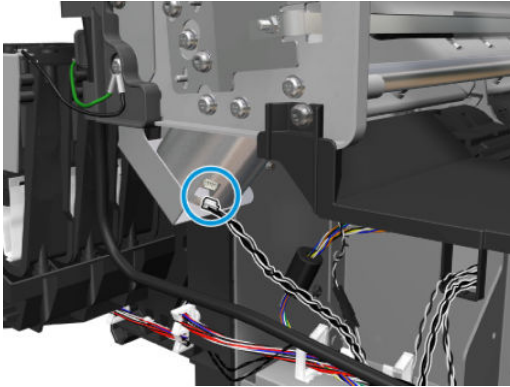


6. Remove the 2 screws in order to remove the piece.


 **NOTE:** Hold the Scan Axis Motor in place when removing the screws.

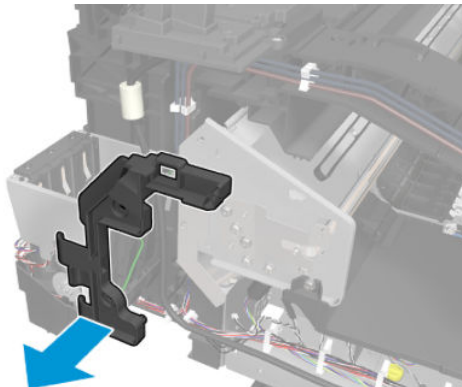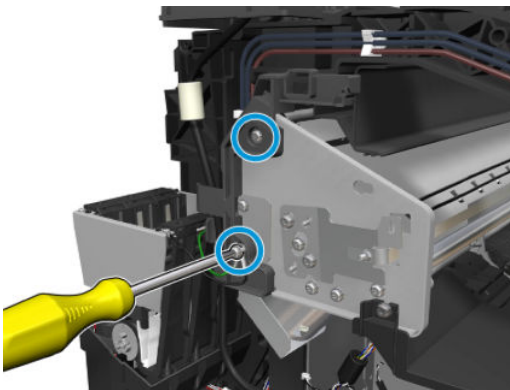

7. Remove the screw in order to remove the metallic piece.

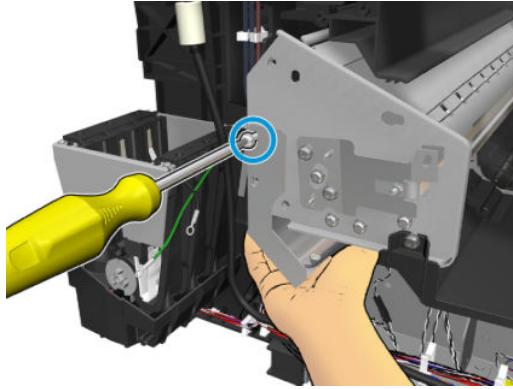


8. Remove the Scan Axis Motor.

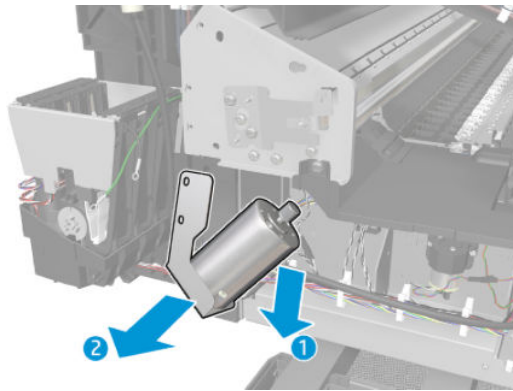


Drop Detector

Removal


1. Remove the service station. See [Service Station with Drop Detector on page 339](#).
2. Disconnect the cable.

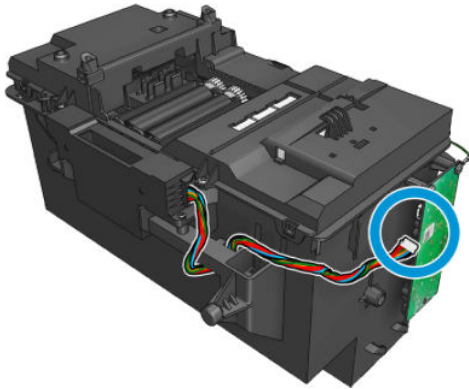

3. Remove the T-15 screw.

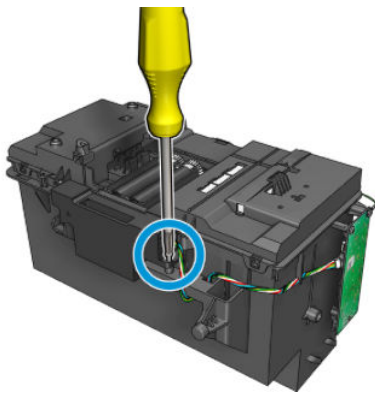



4. Remove the Drop Detector from the service station.

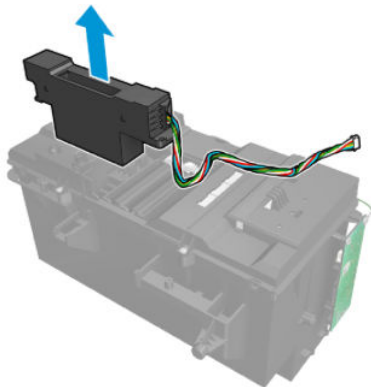



Service Station with Drop Detector

Removal


1. Remove the Center Cover. See [Center cover \(T920 only\) on page 285](#).
2. Release the carriage.

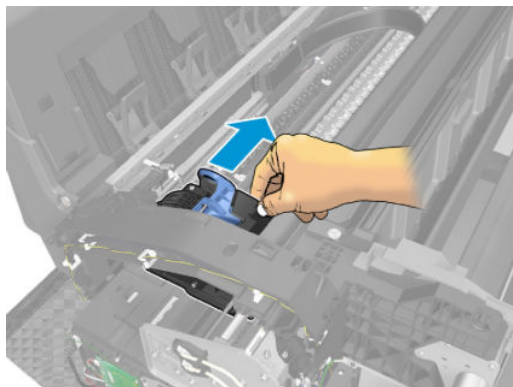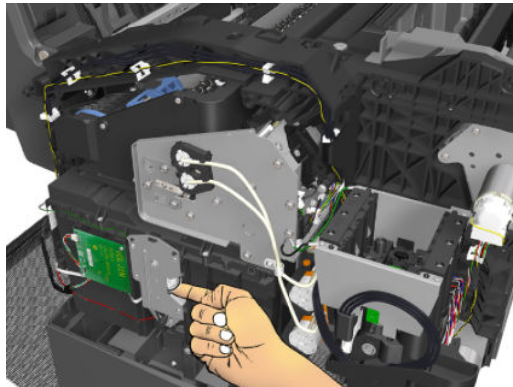

3. Disconnect and unroute the cables.

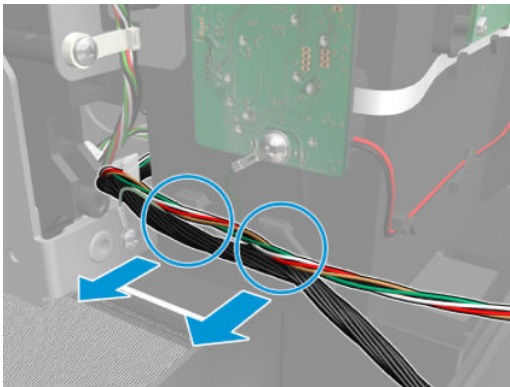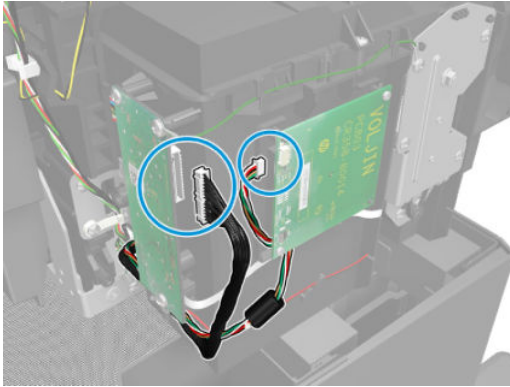


4. Remove the grounding screw.


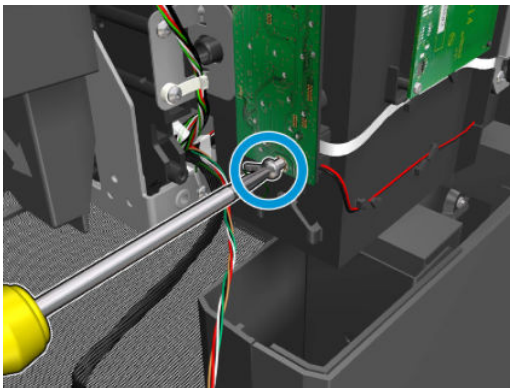


5. Remove the 2 allen screws from the Slider Rod.


💡 **TIP:** Cover the service station with a A4/E size sheet of paper to prevent it from getting dirty and to protect against screws falling into the ink container.

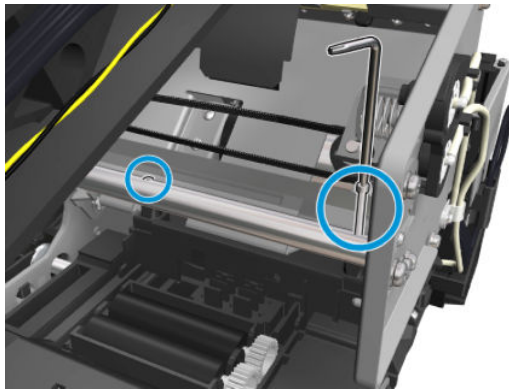

6. Remove the 2 T-15 screws and the left bracket.

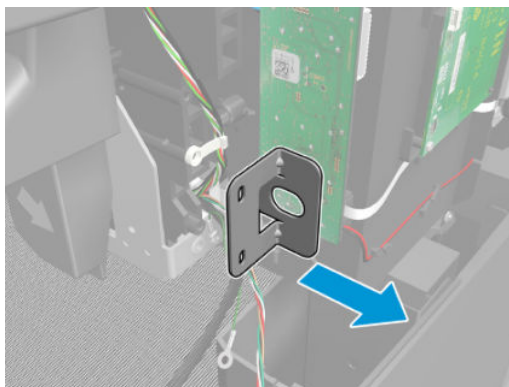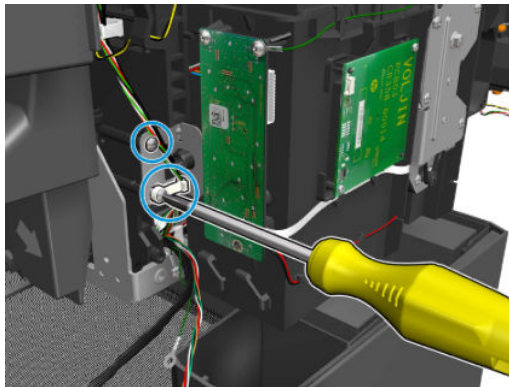




7. Remove the Service Station.

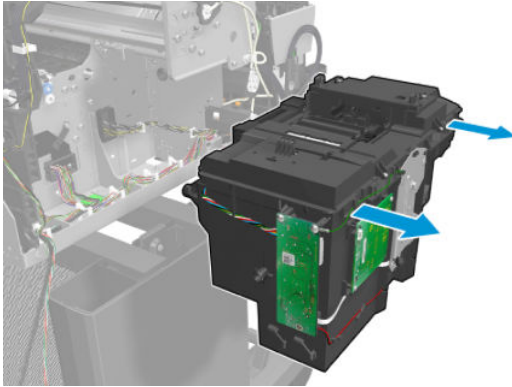



Primer Assembly


Removal

1. Remove the ISS SVS Side. See [ISS SVS Side on page 350](#).
2. Disconnect, and unroute the primer cables.

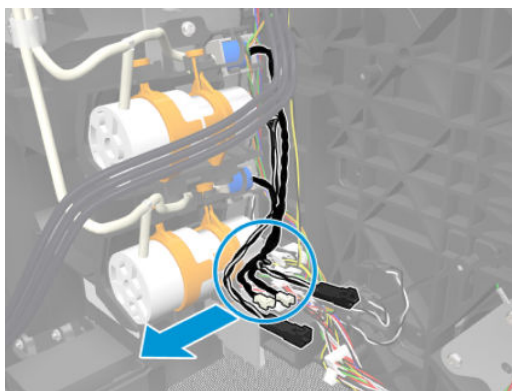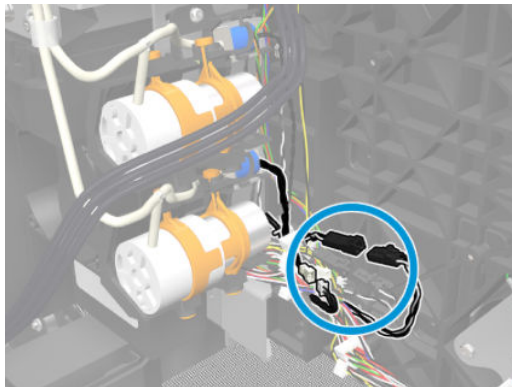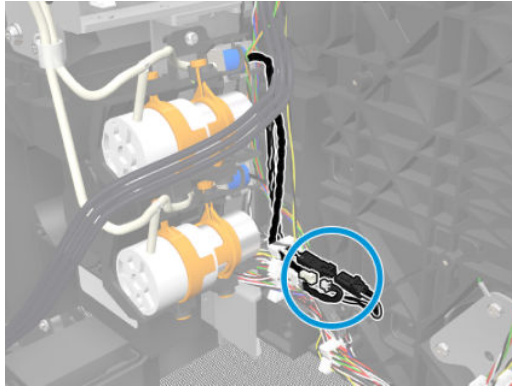


3. Remove the T-20 screw, the T-10 screw, the tubes, and the plastic pieces.

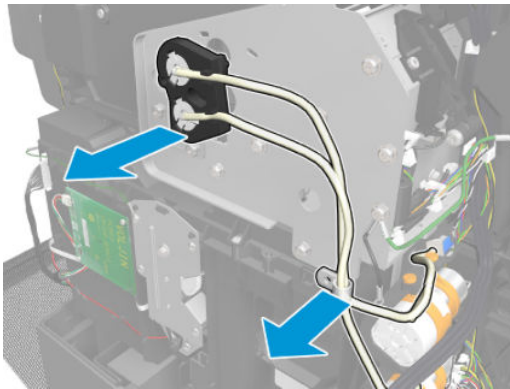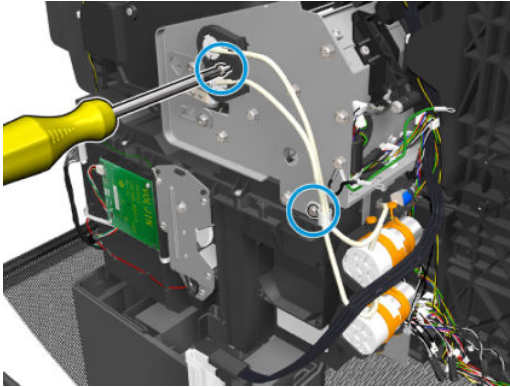



 **NOTE:** On the first primer tubes holder make sure the holes are aligned with the holes of the carriage.

4. Remove a T-20 screw from each primer.

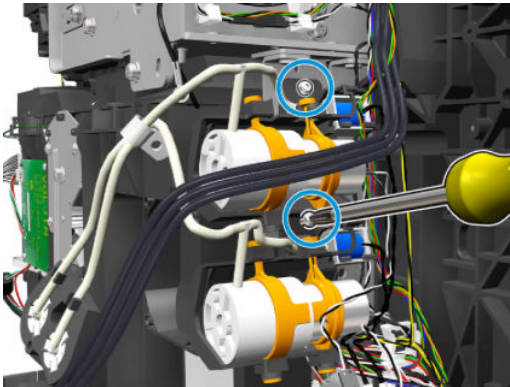

5. Remove the primer.

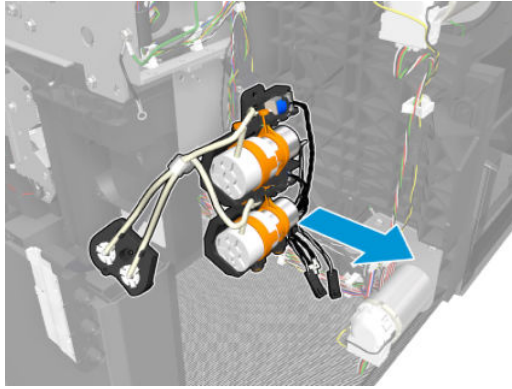


 **NOTE:** The primer service kit includes the valves, the plastic, and the tubes.


ISS (Ink Supply Station) Front Panel Side

Removal



1. Remove the Front Panel side main cover. See [Main cover \(front panel side\) on page 281](#).
2. Disconnect the cables.

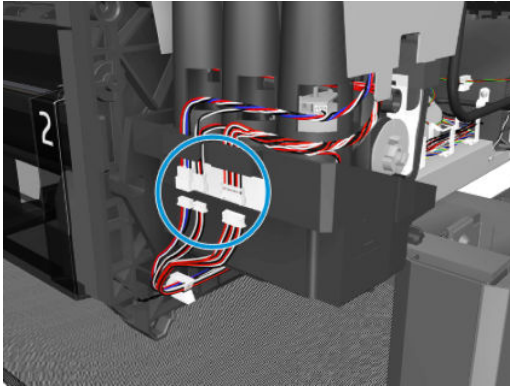



3. Remove 3 T-10 screws.

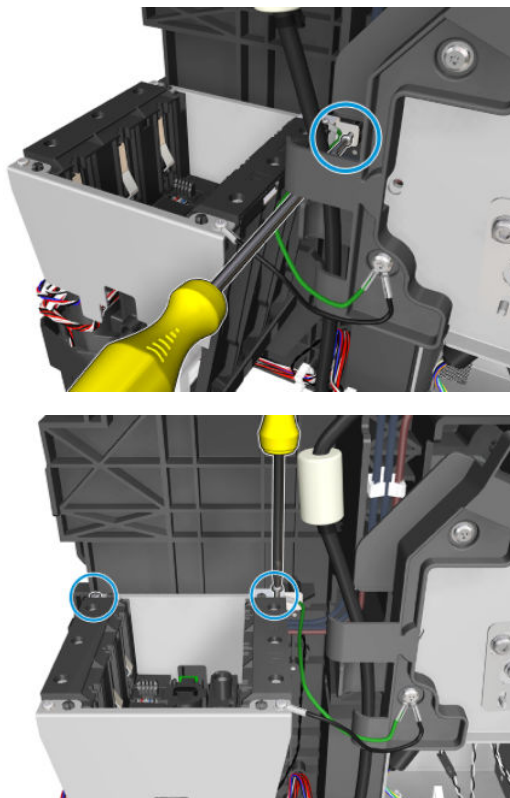


4. Remove the bracket and side plate.

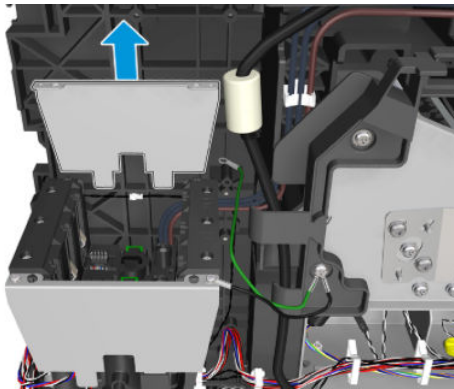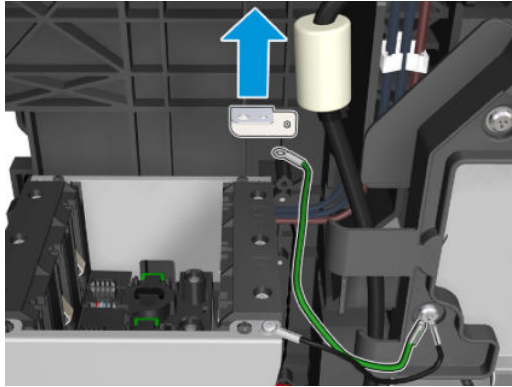



5. Remove 2 screws and the side plate.

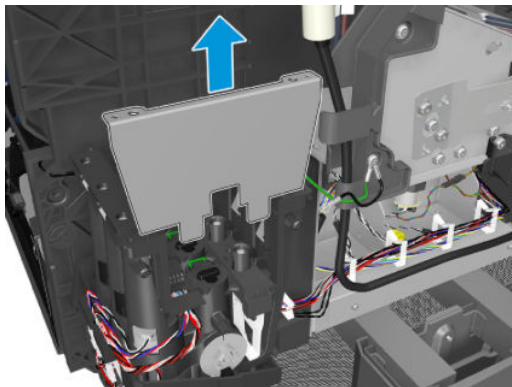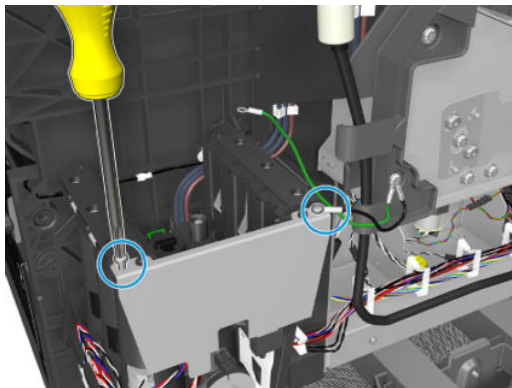


6. Remove the fluid inter-connector.

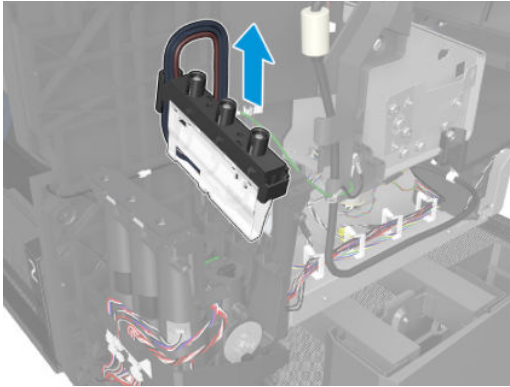

7. Remove 3 T-10 screws.

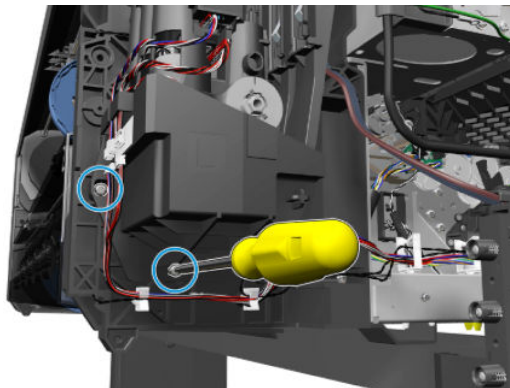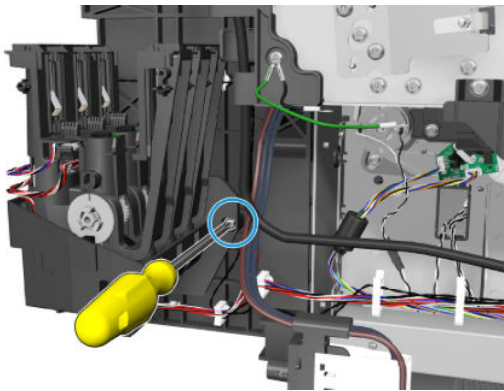



8. Remove the ISS Front Panel Side.

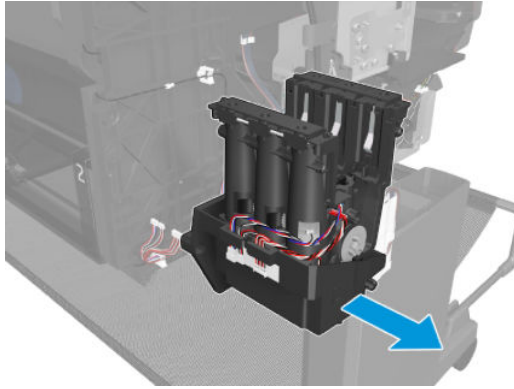



ISS SVS Side

Removal



1. Remove the ISS SVS Side main cover. See [Main cover \(service station side\) on page 283](#).
2. Disconnect the and unrout the cables.

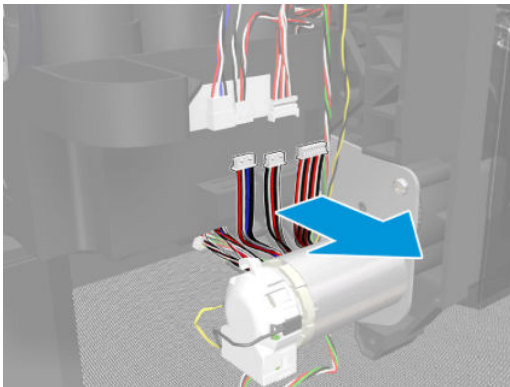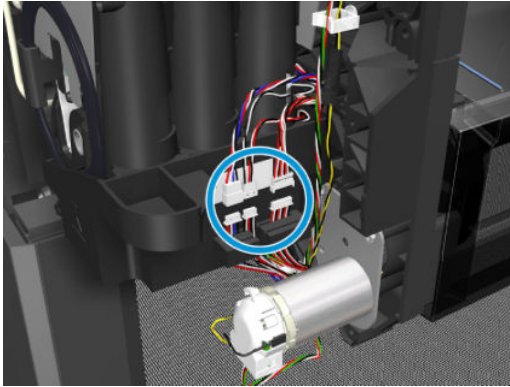



3. Remove 3 T-10 screws.

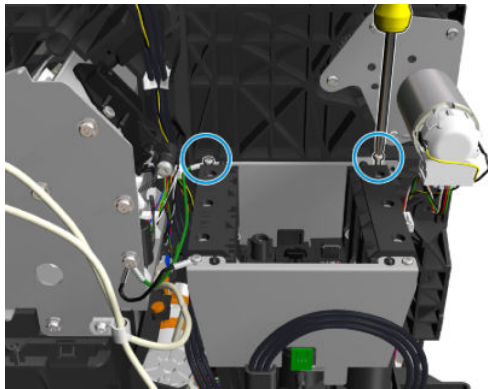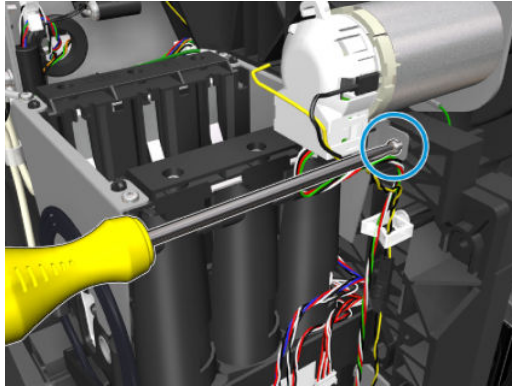


4. Remove the bracket and side plate.

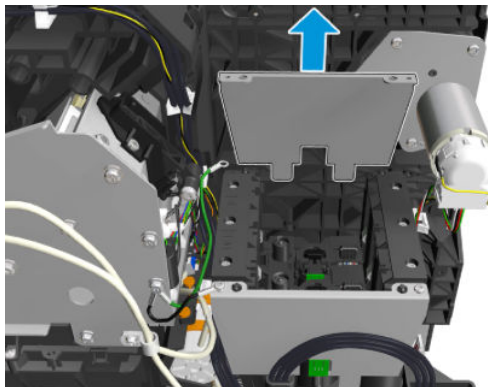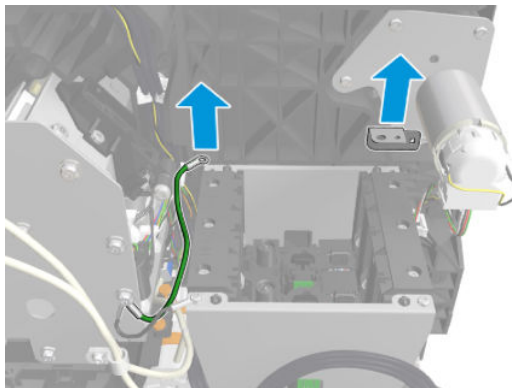



5. Remove 2 screws and the side plate.

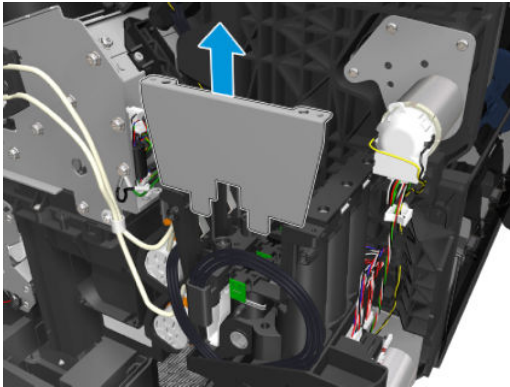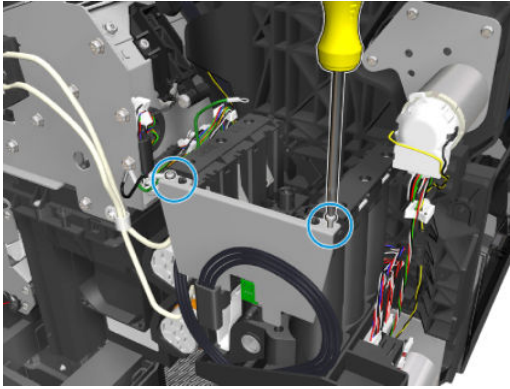


6. Remove the fluid inter-connector.

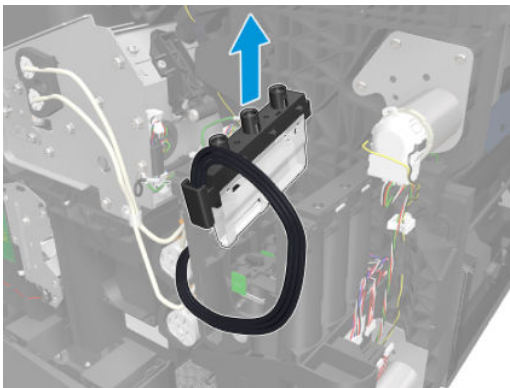

7. Remove 3 T-10 screws.

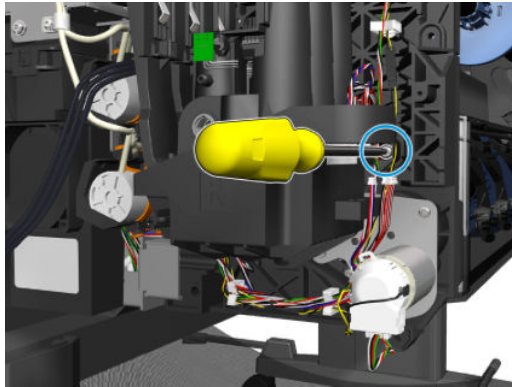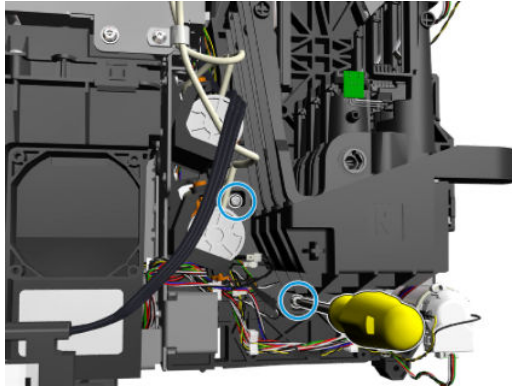


8. Remove the ISS SVS side.

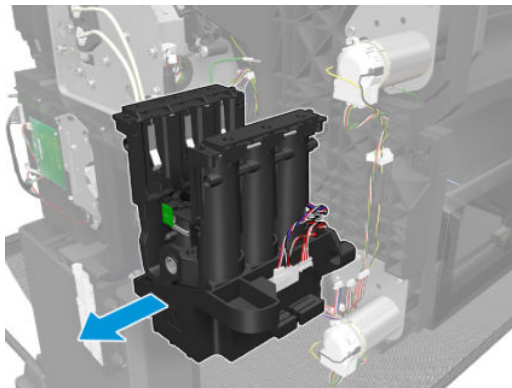



Ink Tubes and Trailing Cable

Removal


1. Remove the Front Panel main cover. See [Main cover \(front panel side\) on page 281](#).
2. Remove the SVS main cover. See [Main cover \(service station side\) on page 283](#).
3. Remove the center cover. See [Center cover \(T920 only\) on page 285](#).
4. Remove the stacker. See [Stacker on page 405](#).
5. Remove the rear beam.

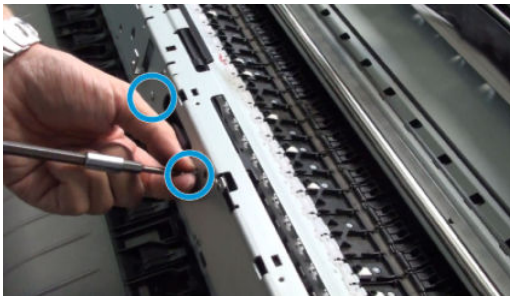



6. Remove the ISSWALL (removing 2 T-10 screws).

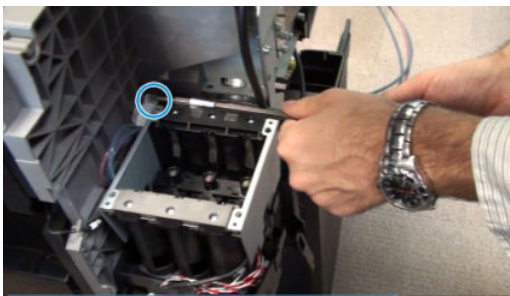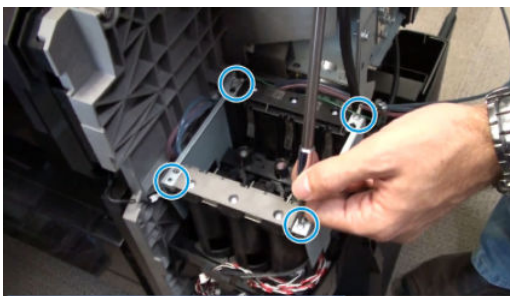


7. Remove the service station. See [Service Station with Drop Detector on page 339](#).
8. Remove the holder.

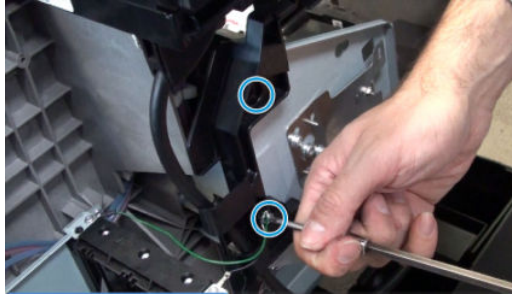



9. Remove the rear plate.

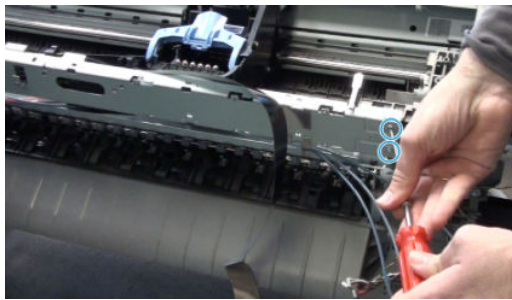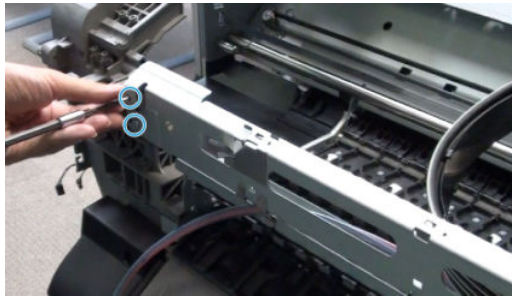




10. Remove the Carriage PCA. See [Carriage PCA on page 327](#).
11. Remove the ink tubes and trailing cable from the carriage.

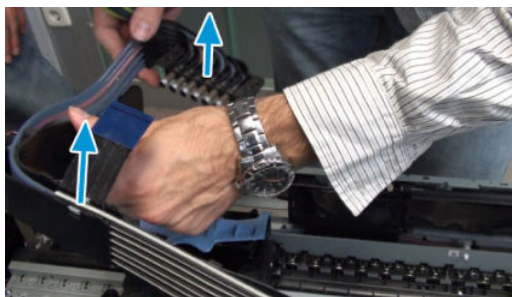

12. Unroute the trailing cable.

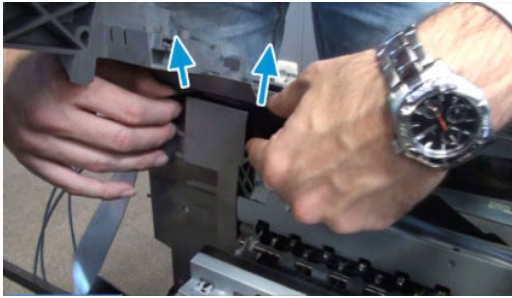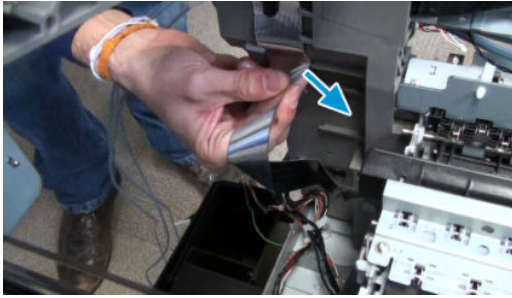



13. Unroute the end tubes.

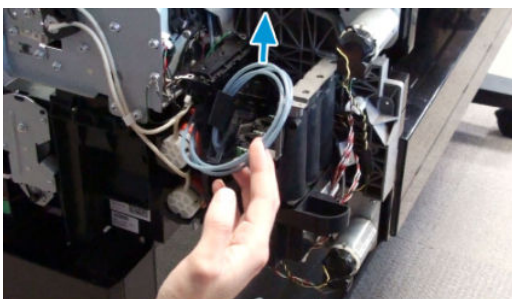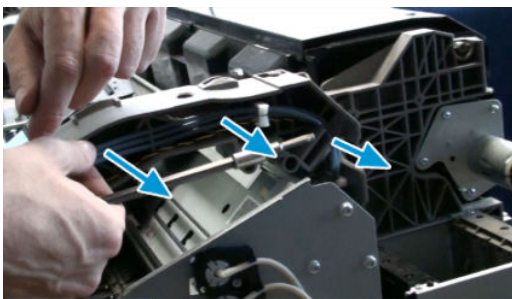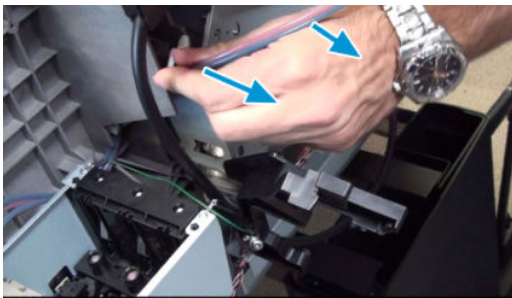


Media Sensor

Removal


1. **T920, T1500 and T2500 only:** Remove the converger. See [Converger Assembly on page 287](#).
2. Disconnect, and unroute the sensor from under the printer.

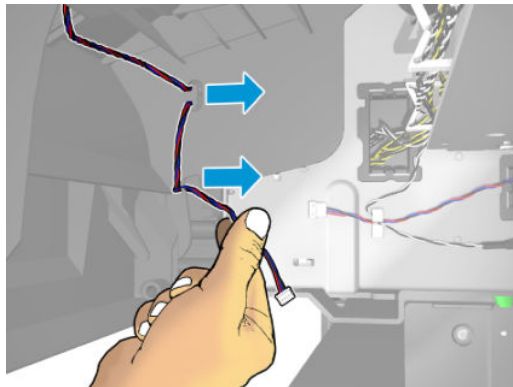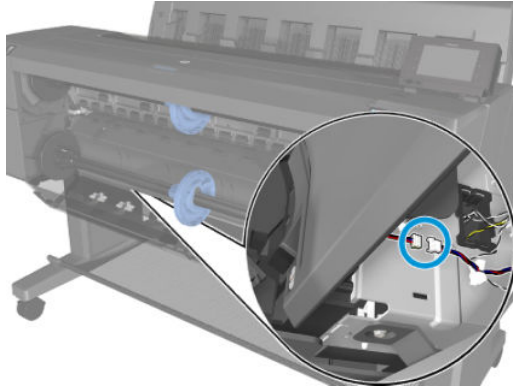

3. Remove the T-15 cosmetic screw.

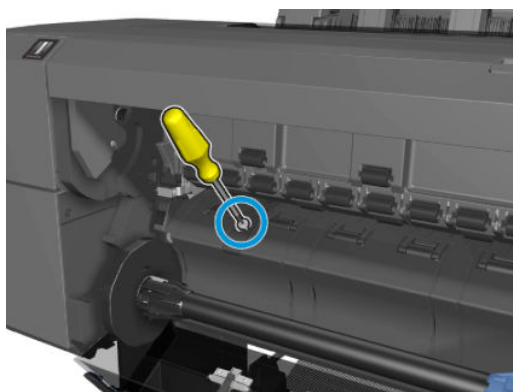



4. Remove the media sensor.

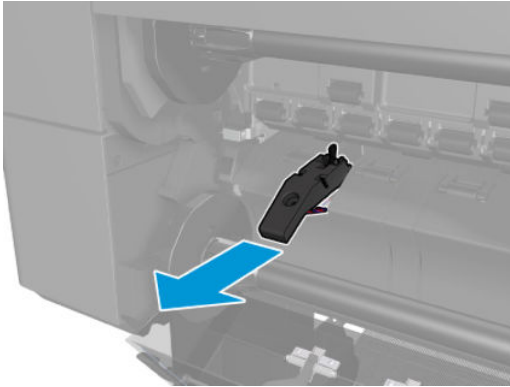


Bottom Rewinder Support

Removal


1. Remove the SVS side main cover. See [Main cover \(service station side\) on page 283](#).
2. Remove the bottom roll cover. See [Customer Self Repair Flyers on page 473](#).
3. Remove the converger. See [Converger Assembly on page 287](#).
4. Disconnect, and unroute the cables.

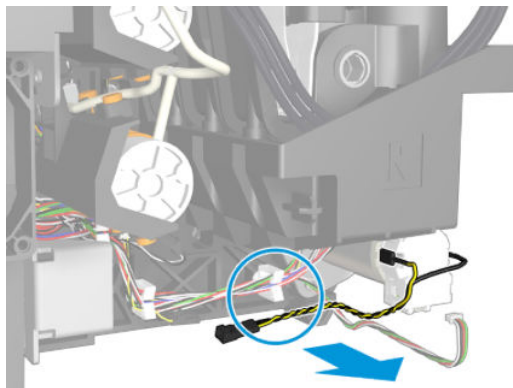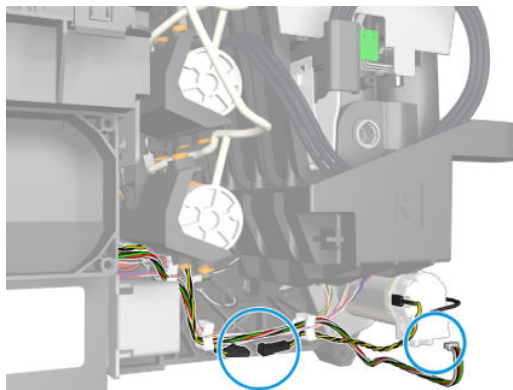


5. **T3500 only:** Remove 1 T-15 screw.

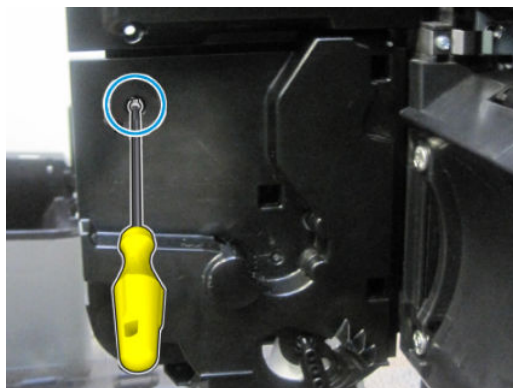

6. Remove 3 T-15 screws and the rewriter.

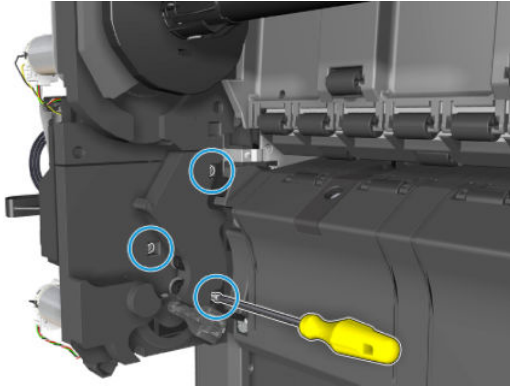



7. Remove the bottom rewriter support.

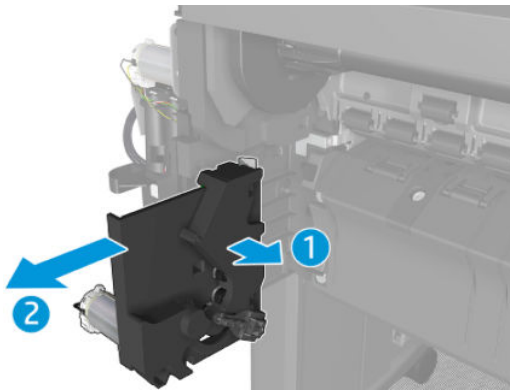


Top Rewinder Support

Removal


1. Remove the SVS side main cover. See [Main cover \(service station side\) on page 283](#).
2. Remove the top roll cover. See [Customer Self Repair Flyers on page 473](#).
3. Remove the converger. See [Converger Assembly on page 287](#).
4. Disconnect, and unroute the cable.

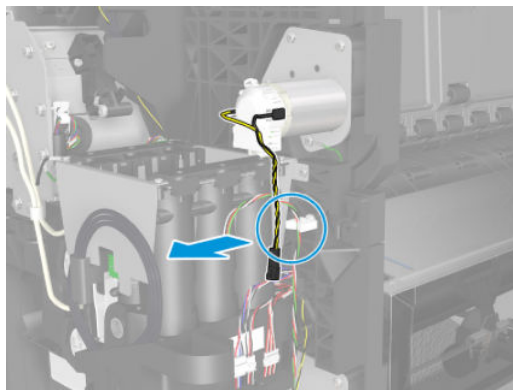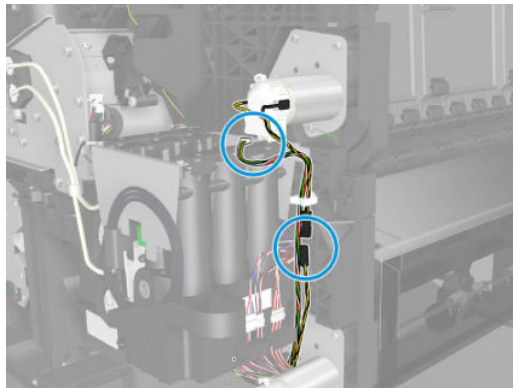

5. Remove 3 T-15 screws and the rewriter.

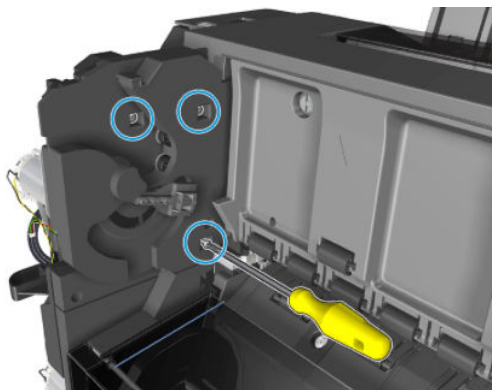


6. Remove the top rewinder support.

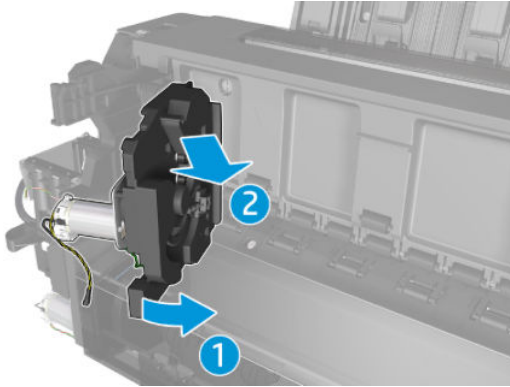


Top Tip Support

Removal


1. Remove the top roll cover. See [Customer Self Repair Flyers on page 473](#).
2. Remove the converger. See [Converger Assembly on page 287](#).
3. Remove the front panel side cover. See [Main cover \(front panel side\) on page 281](#).
4. Disconnect, and unroute the cable.

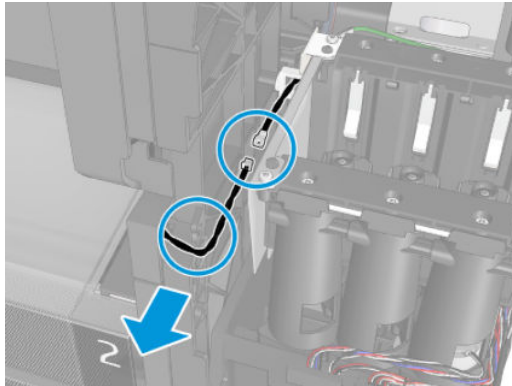

5. Remove 3 T-15 screws.

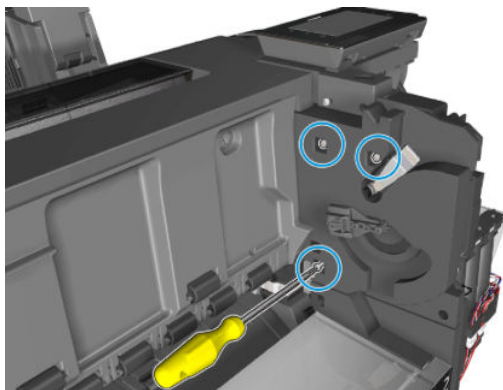



6. Remove the tip top support.

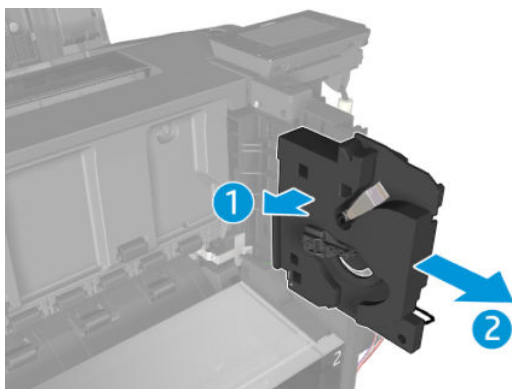


Bottom Tip Support

Removal


1. Remove the bottom roll cover. See [Customer Self Repair Flyers on page 473](#).
2. Remove the front panel side cover. See [Main cover \(front panel side\) on page 281](#).
3. Remove the converger. See [Converger Assembly on page 287](#).
4. Disconnect, and unrout the cable.

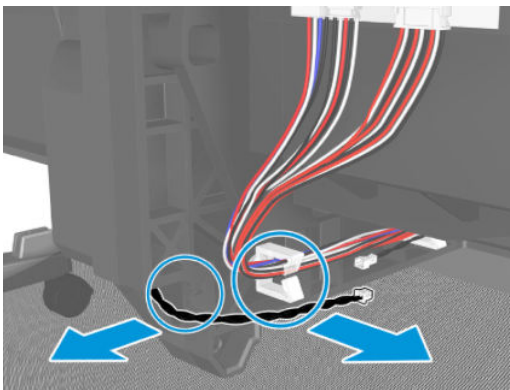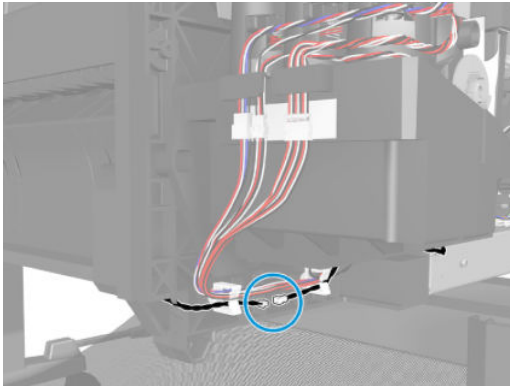


5. **T3500 only:** Remove 1 T-15 screw.

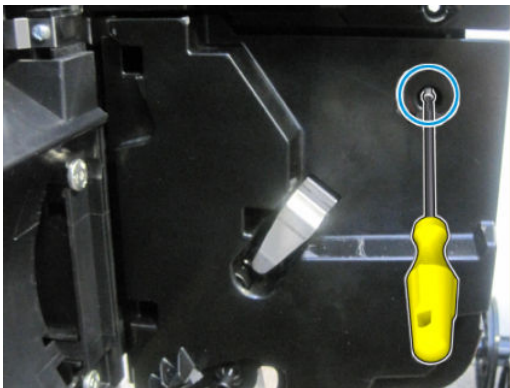

6. Remove 3 T-15 screws.

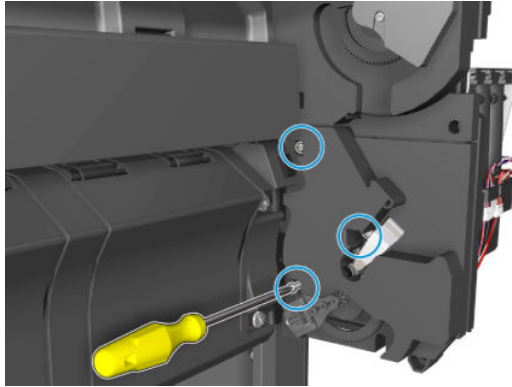


7. Remove the bottom tip support.

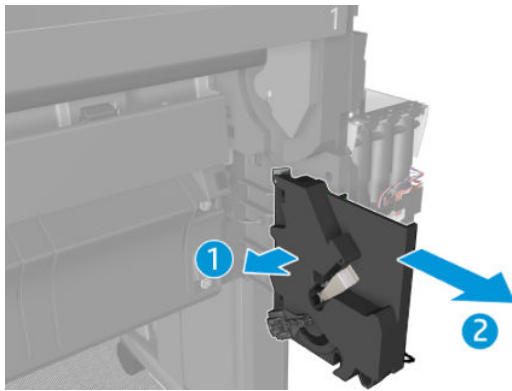


Vertical Media Guide

Removal


1. Remove the top roll cover. See [Customer Self Repair Flyers on page 473](#).
2. Remove the converger. See [Converger Assembly on page 287](#).
3. Remove 3 T-15 cosmetic screws.

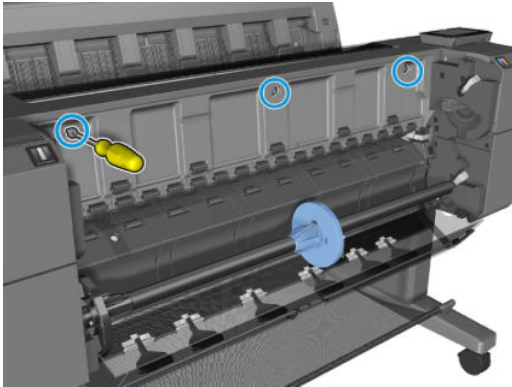


4. T920, T1500 and T2500 only: Remove the wheels.

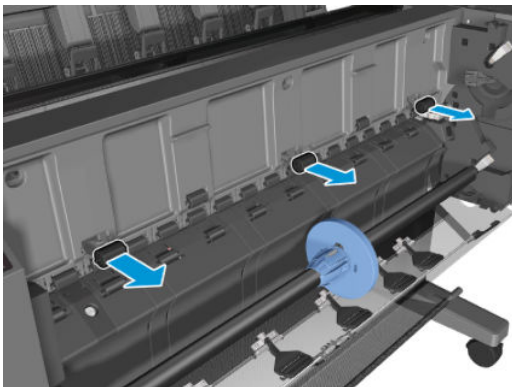

5. Remove the 3 T-15 screws underneath.

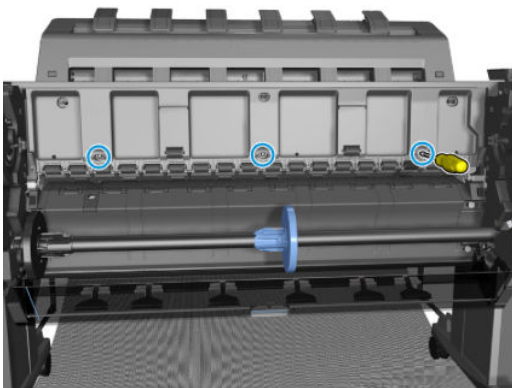


6. Remove the vertical media guide.

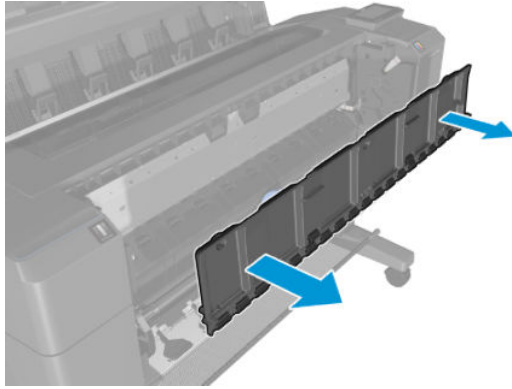


Center Support

Removal

1. Remove the bottom roll cover. See [Customer Self Repair Flyers on page 473](#).
2. Remove the spindle.
3. Remove the cleanout. See [Cleanout on page 288](#).
4. Remove the T-20 screw.

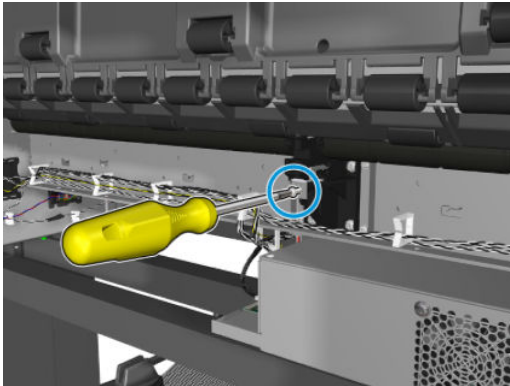


5. Remove the center support.

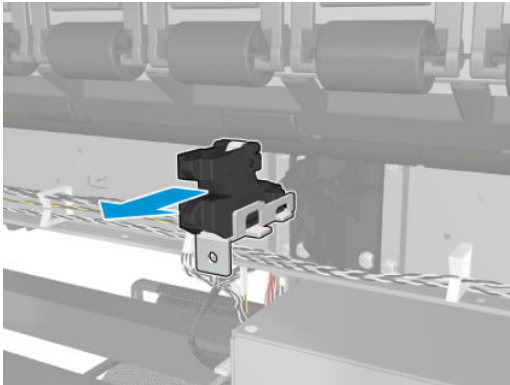

Full Bleed

Removal


1. Open the window.
2. Remove the full bleed foams.

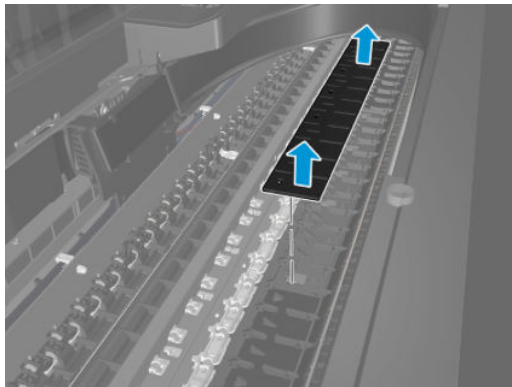


Auto Pinch Lifter

Removal



1. Remove the main SVS cover. See [Main cover \(service station side\) on page 283](#).
2. Turn the SVS wheel until the carriage is released from the SVS station.

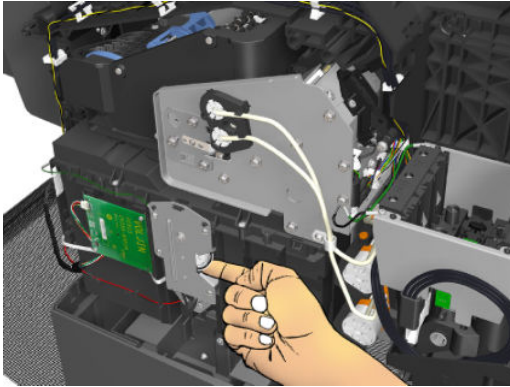



3. Move the carriage.

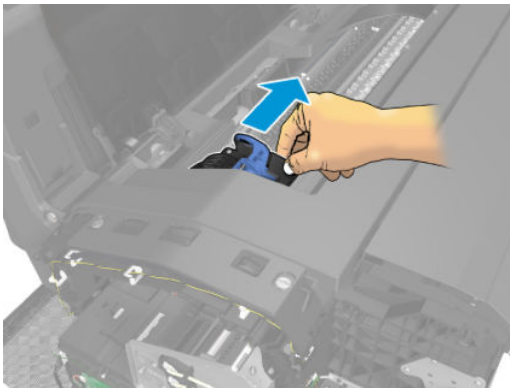


4. Release the Encoder Strip.

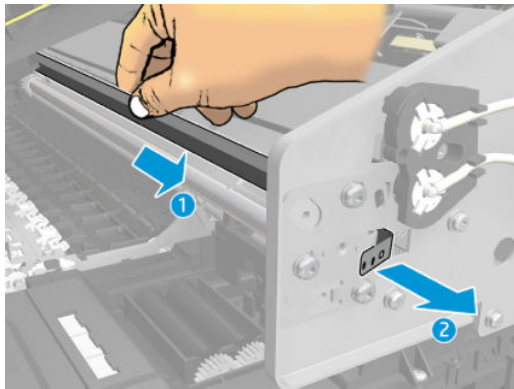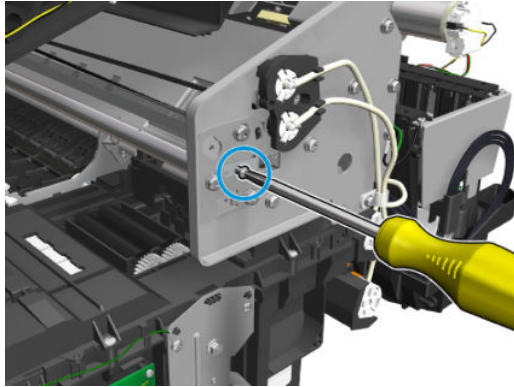


5. Remove 2 screws, and remove the primer tubes.

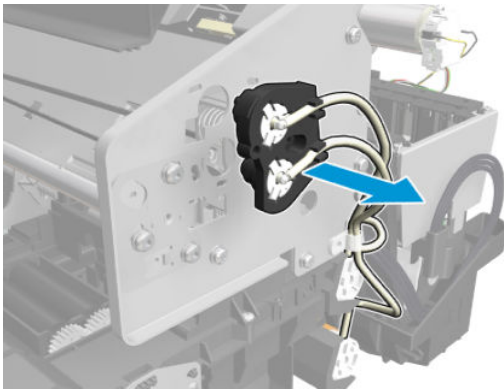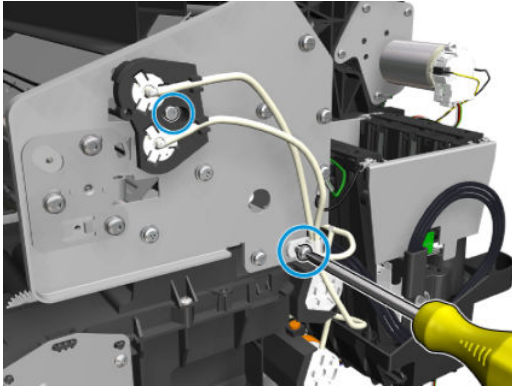


 **NOTE:** On the first primer tubes holder make sure the holes are aligned with the holes of the carriage.


6. Remove 7 screws (1 is the tensioner).

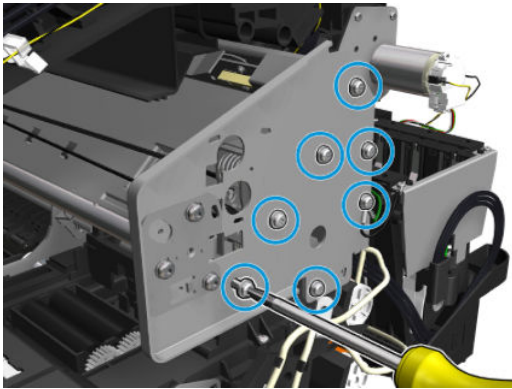



7. Remove the bracket.

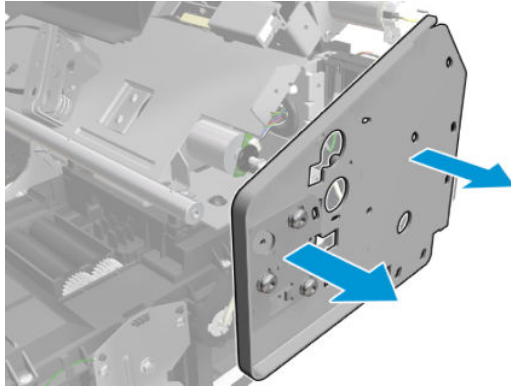



8. Disconnect the cable.

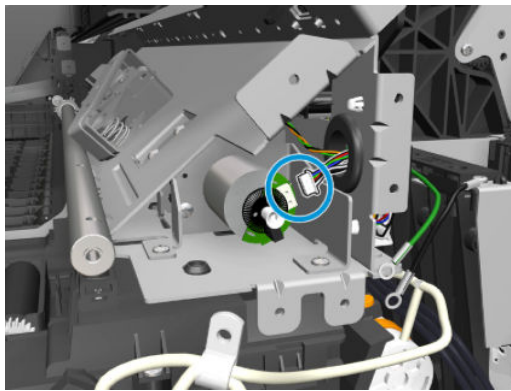


9. Remove 4 screws.

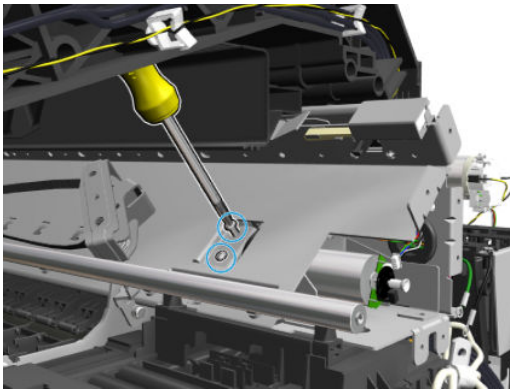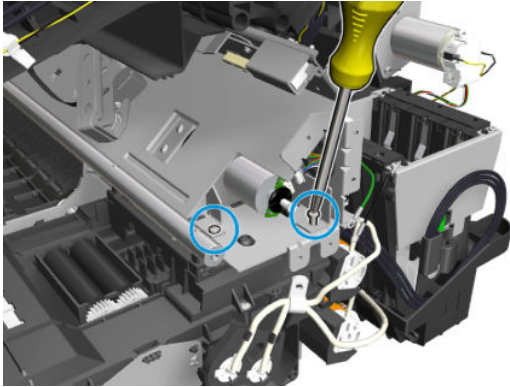


10. Slide out the auto pinch lifter, and disconnect the sensor.

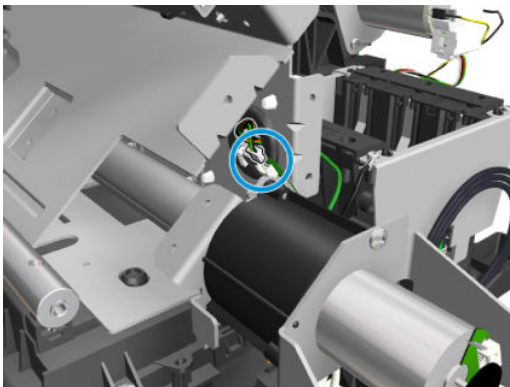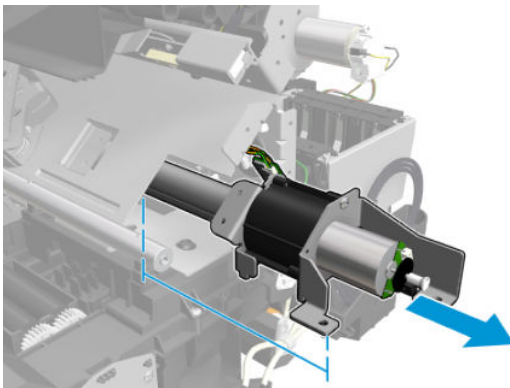


11. Rotate, unlock, and remove the auto pinch lifter.

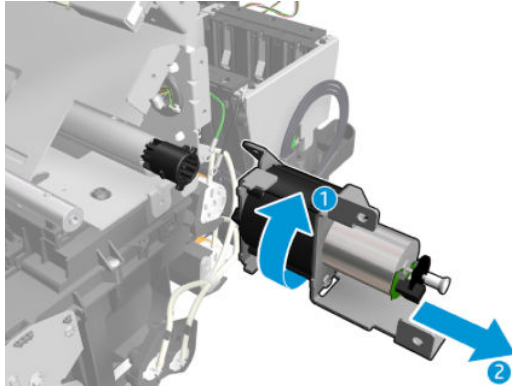

 **NOTE:** The cam does not need to be removed.

Installation



- ▲ Slide into place and follow the removal procedure in reverse.

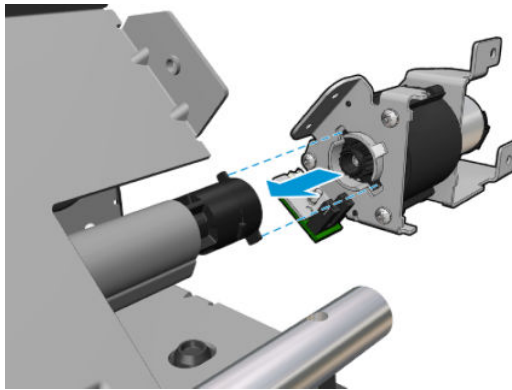



Pinch Wheel Assembly

Removal


1. Remove the converger. See [Converger Assembly on page 287](#).
2. Remove the cleanout. See [Cleanout on page 288](#).
3. Remove the bottom roll cover. See [Customer Self Repair Flyers on page 473](#).
4. Remove 3 T-10 screws.

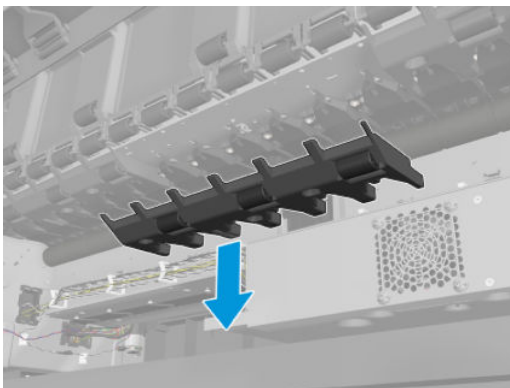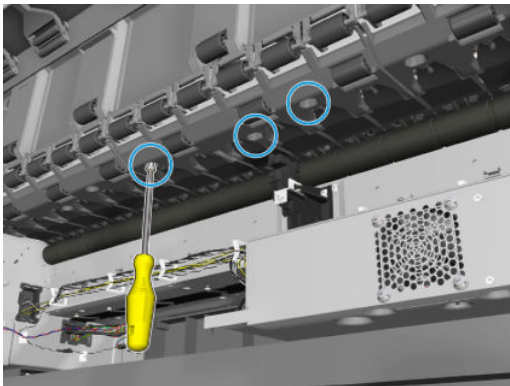


5. Remove the spring using the tool.

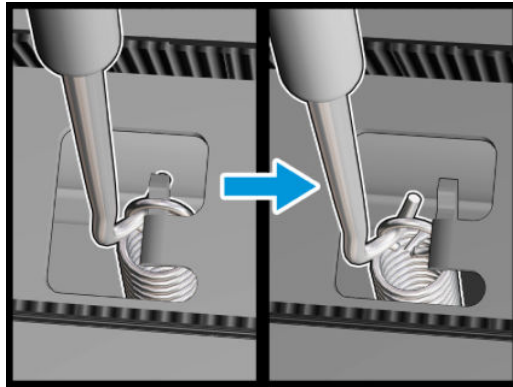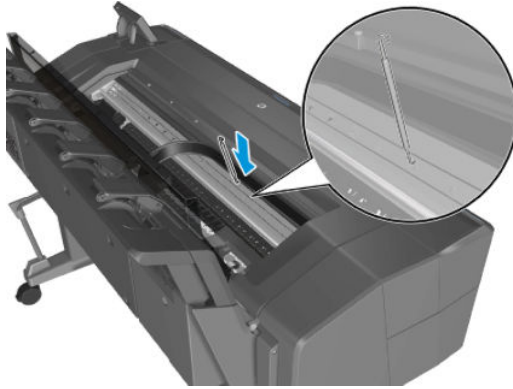

6. Remove 2 T-10 screws.

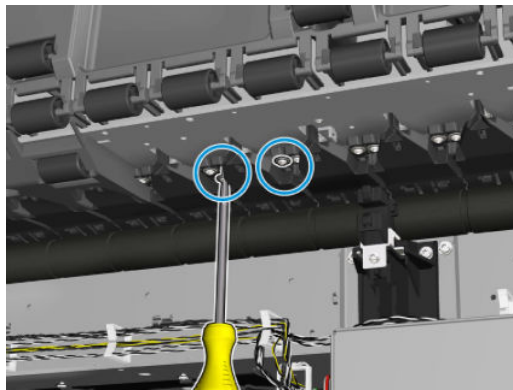




7. Remove the pinch wheel.

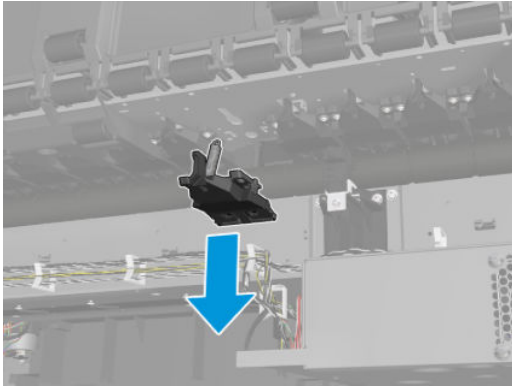



Motor Media Advance Transmission with Encoder

Removal


1. Remove the front panel side main cover. See [Main cover \(front panel side\) on page 281](#).
2. Remove 3 screws and the starwheel lifter cover.

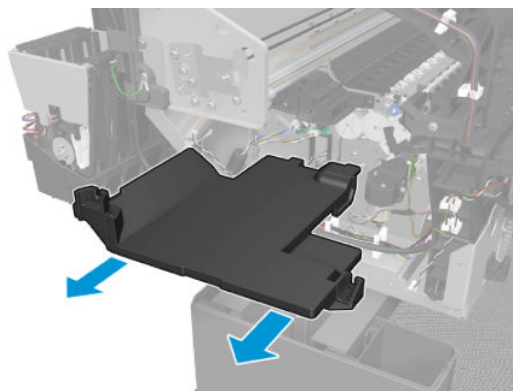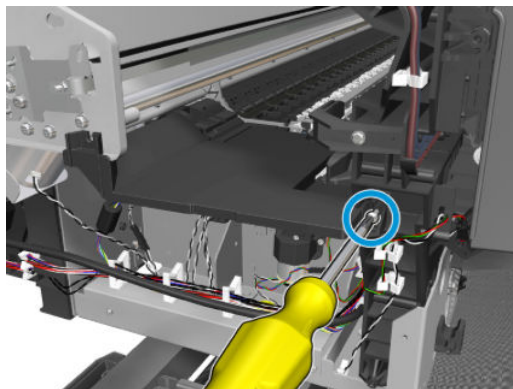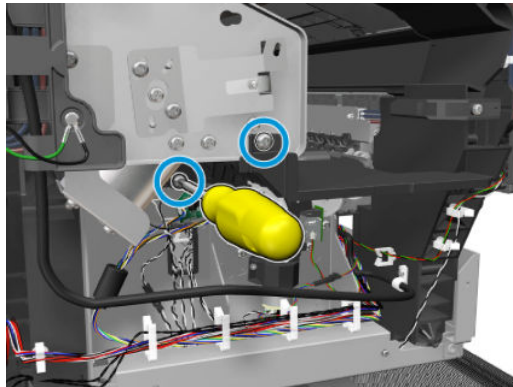



3. Remove the 2 T-7 screws, and then the encoder PCA.

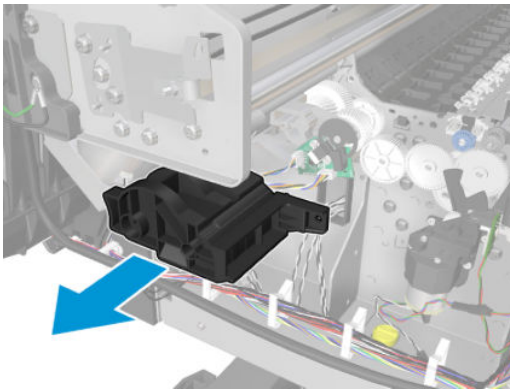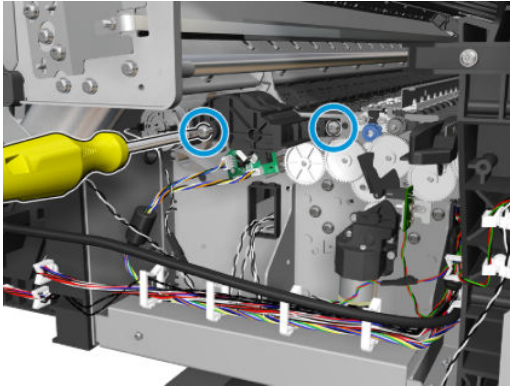



4. Disconnect the cable.

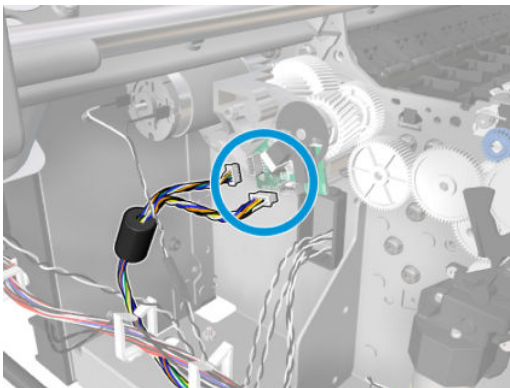


5. Remove the 2 screws and remove the connectors.

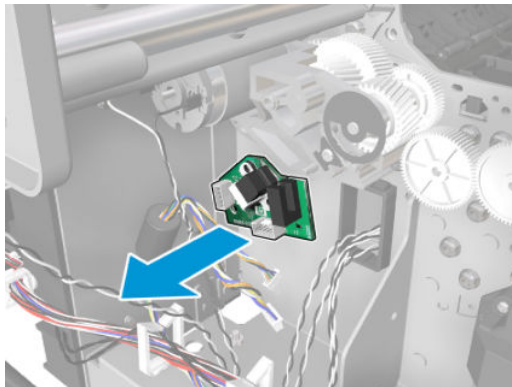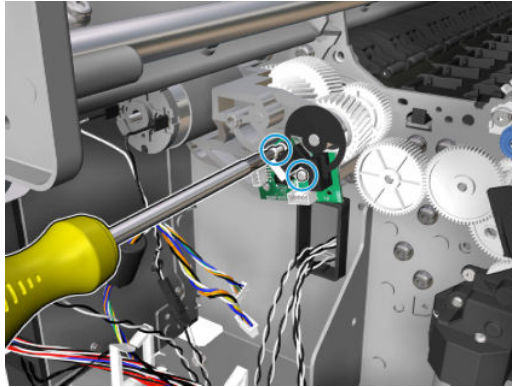


6. Disconnect the cable, and remove the 3 screws.

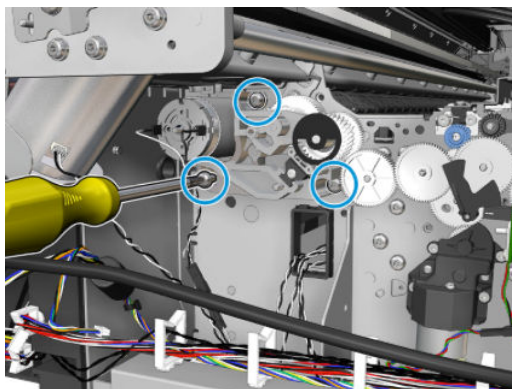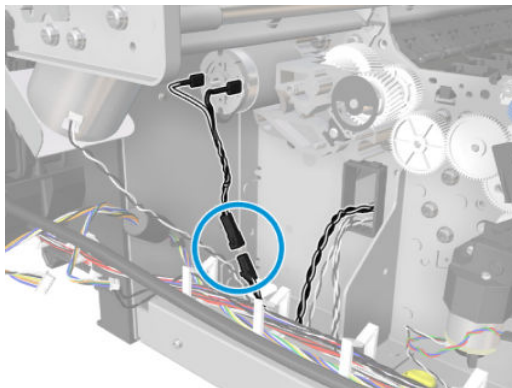

7. Remove the paper axis motor.

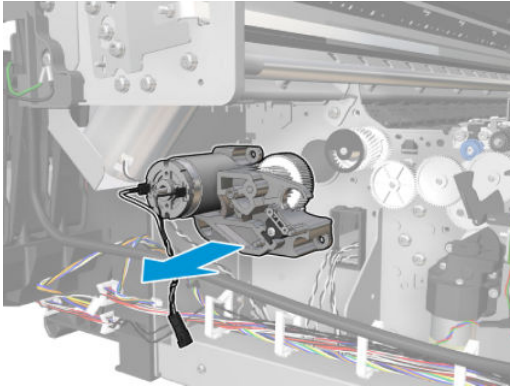


 **NOTE:** Never install a used Encoder PCA. This can cause serious problems, and may make the product unusable.

 **WARNING!** Be careful not to damage the Encoder PCA.


Installation with encoder sensor adjustment

Use the following procedure to install and adjust a new Media Advance Drive. This is the normal procedure that should be followed in most cases. You will need Media Advance Drive Adjustment Tool from the Tool Kit.


1. Carefully position the Media Advance Drive in the product.
2. Be careful not to touch the encoder sensor adjustment screw; not even when replacing the encoder disc and sensor.

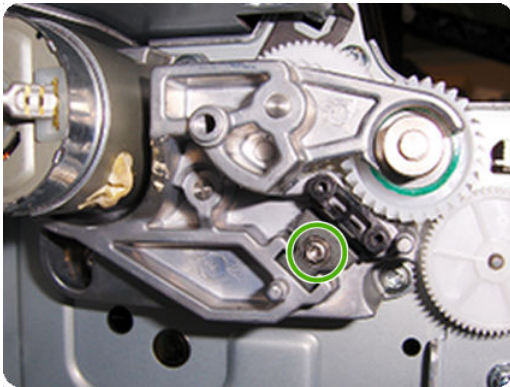


3. Insert the three T-15 attachment screws, but do not fully tighten them.

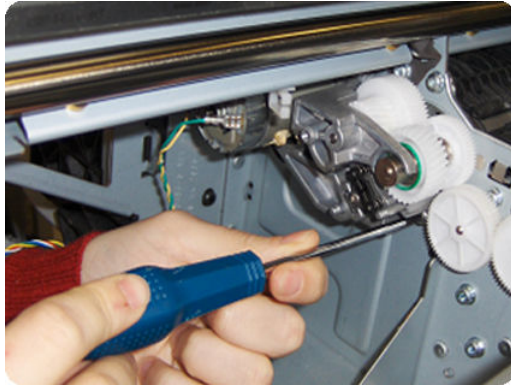

4. Position the Media Advance Drive Adjustment Tool on the end Media Advance Roller shaft, push it firmly onto the shaft and maintain a constant pressure to ensure it is flush to the Media Advance Drive.

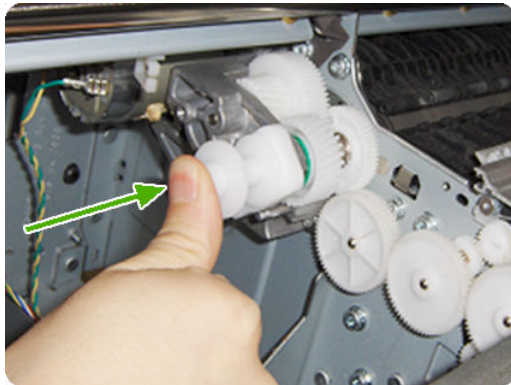

5. While maintaining pressure on the Media Advance Drive Adjustment Tool, fully tighten the three T-15 attachment screws in the order shown.

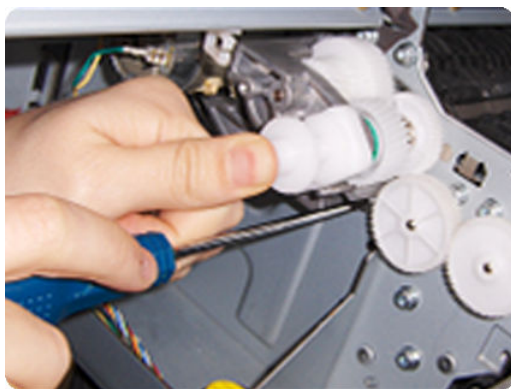


6. Remove the Media Advance Drive Adjustment Tool.

Installation with encoder sensor adjustment


Use the following procedure to install and adjust a new Media Advance Drive, and to adjust the encoder sensor. This procedure is recommended only when the motor mount has to be replaced or the encoder sensor has to be readjusted. You will need Media Advance Drive Adjustment Tool from the Tool Kit.

1. Carefully position the Media Advance Drive in the product.


2. Insert the three T-15 attachment screws, but do **not** fully tighten them.

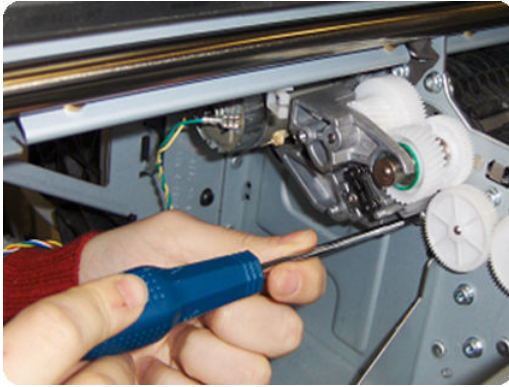


3. Loosen the encoder sensor adjustment screw.

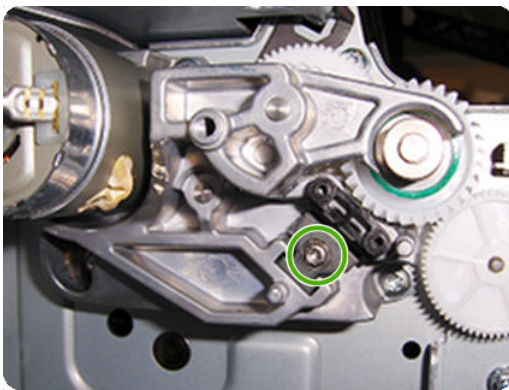


4. Add the Encoder Sensor Tool to the Media Drive Adjustment Tool.

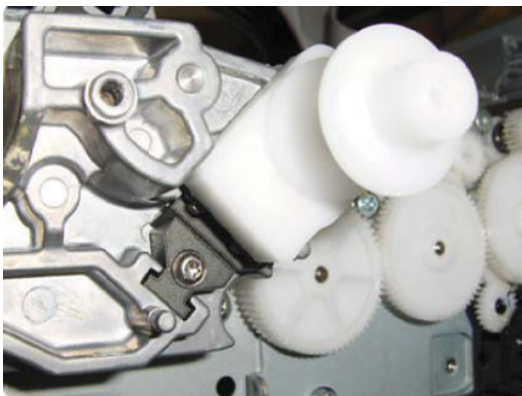


5. Position the Media Advance Drive Adjustment Tool on the end Media Advance Roller shaft, push it firmly onto the shaft and maintain a constant pressure to ensure it is flush to the Media Advance Drive.

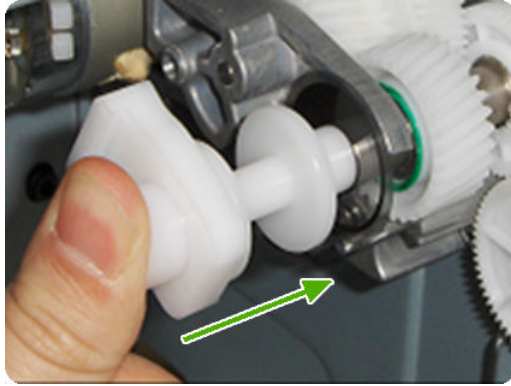

6. While maintaining pressure on the Media Advance Drive Adjustment Tool, fully tighten the three T-15 attachment screws in the order shown.

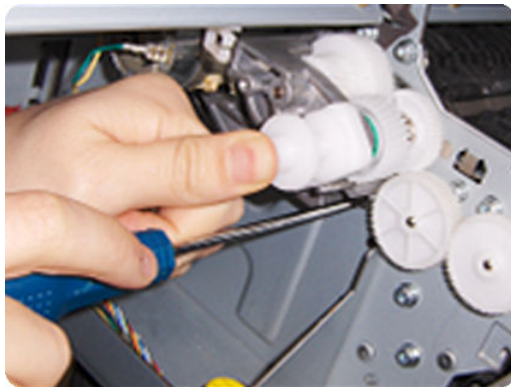


7. While maintaining pressure on the Media Advance Drive Adjustment Tool, fully tighten the encoder sensor adjustment screw.

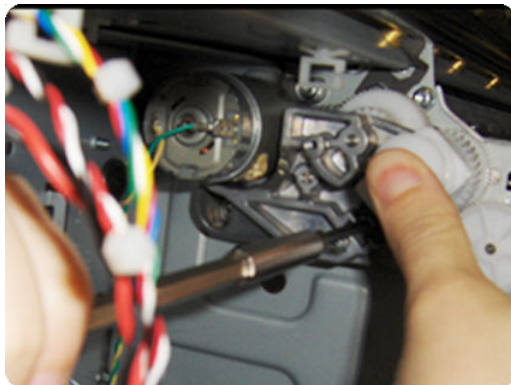

8. Remove the Media Advance Drive Adjustment Tool.

Encoder disk assembly


1. Remove the paper that protects the glue of a new encoder.

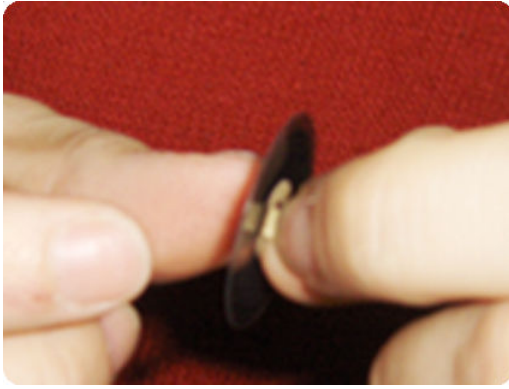


2. Pre-assemble the encoder on the roller without using pressure.



3. Press the encoder using the Media Advance Drive Adjustment Tool (reversed) so that it sticks to the roller.



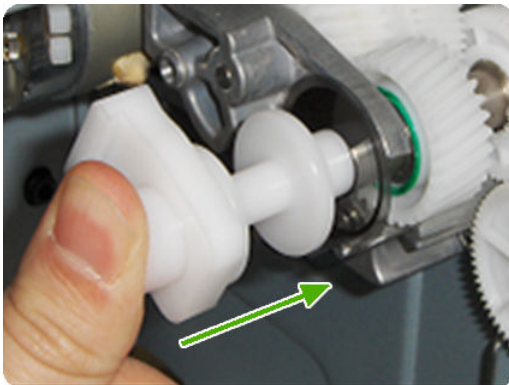


 **NOTE:** When you finish installing or replacing these components, you must perform the necessary Service Calibrations. To find which calibrations you must perform, see [Service Calibration Guide to Removal and Installation on page 278](#).




Starwheel Motor

Removal




1. Remove the Front Panel side main cover. See [Main cover \(front panel side\) on page 281](#).
2. Remove 3 screws and the starwheel lifter cover.

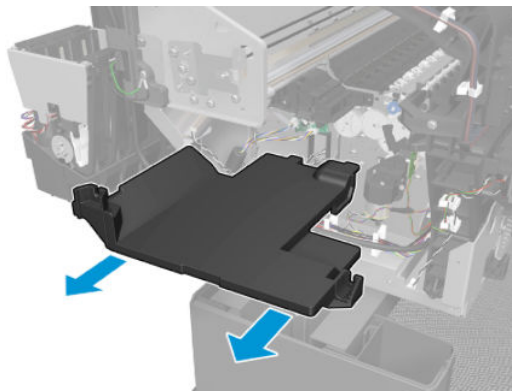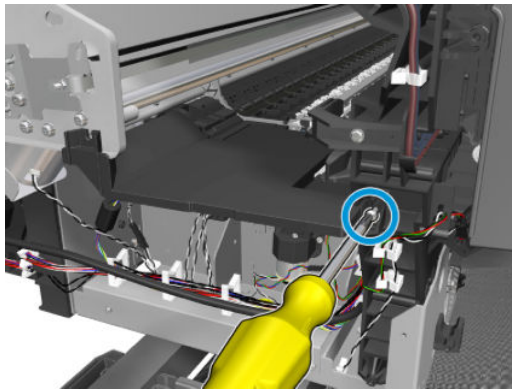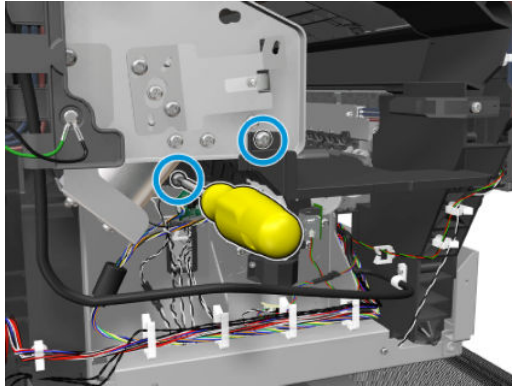


3. Disconnect the cable, remove 4 T-10 screws, and the Starwheel Motor.

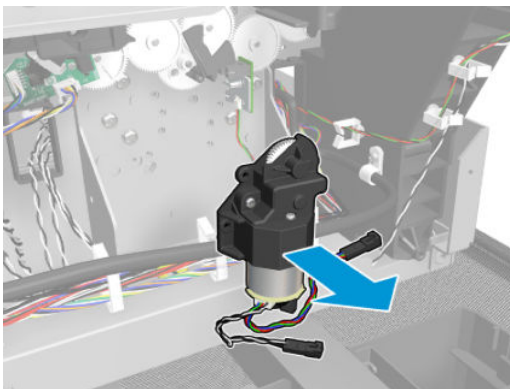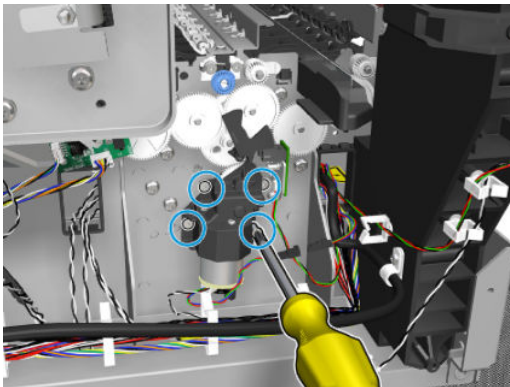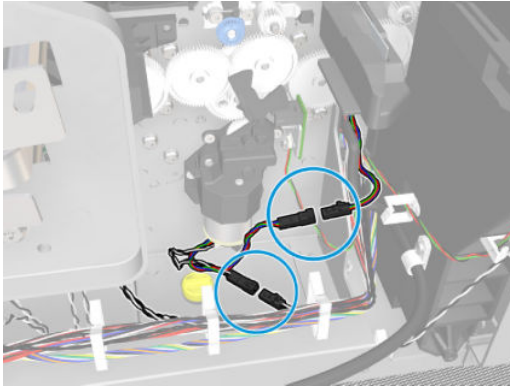


4. Disconnect the cable, remove the screw and the OPTO PCA.

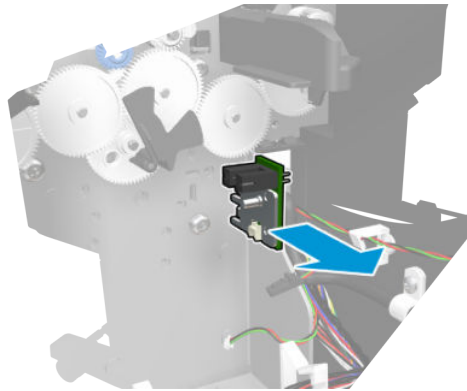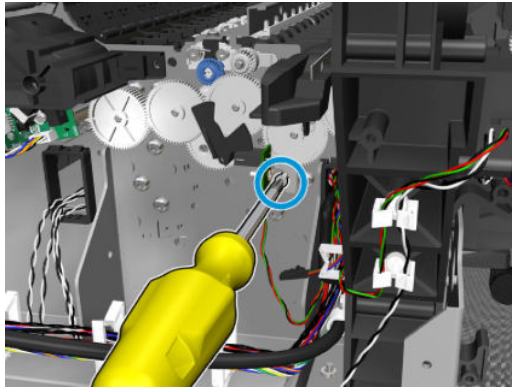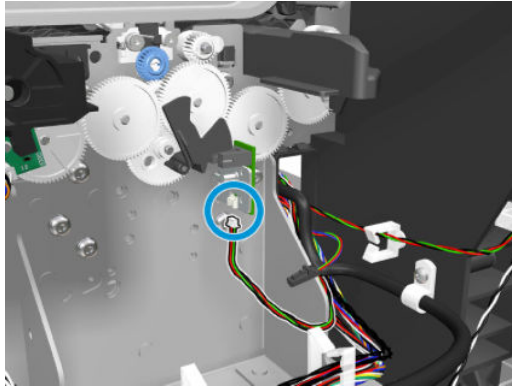

5. Remove the 3 gears.

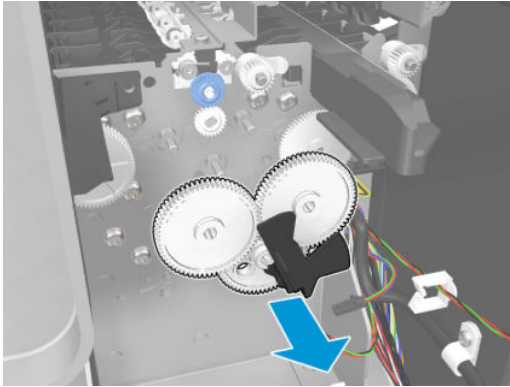


⚠ WARNING! Do not remove the following gear.

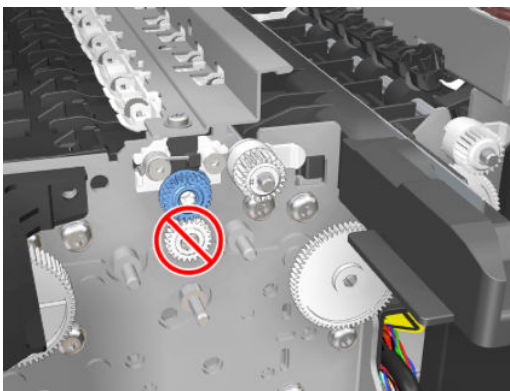


Installation

1. To install the gears, they have to fit into the hole.

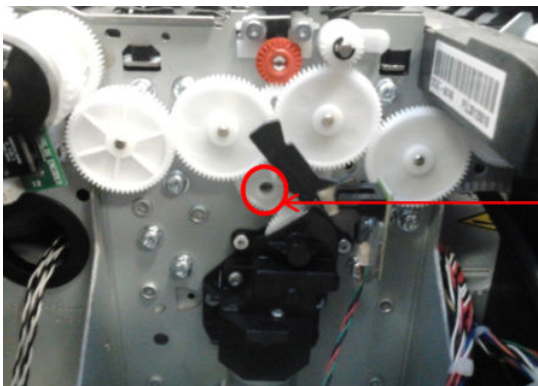




2. Install the new gears that came with the kit reversing the removal process.

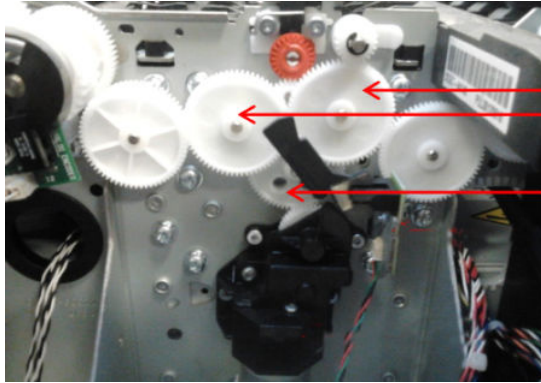


Starwheel Support

Removal


1. Remove the main front covers See [Main cover \(front panel side\) on page 281](#) and [Main cover \(service station side\) on page 283](#).
2. Remove the service station. See [Service Station with Drop Detector on page 339](#).
3. Remove the metal starwheel assembly. See [Customer Self Repair Flyers on page 473](#).
4. Remove the 3T-10 screws, and the starwheel lifter cover.

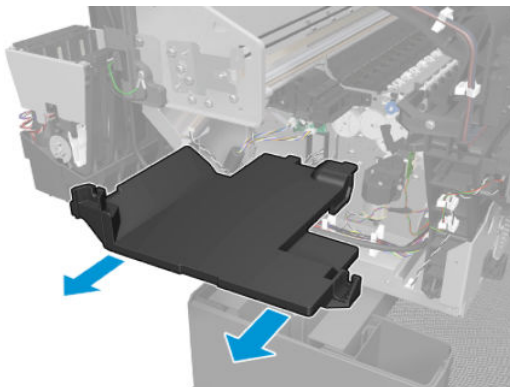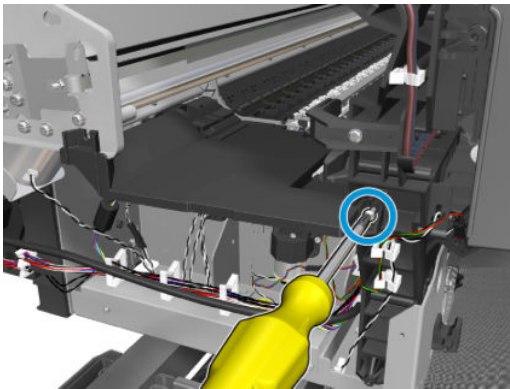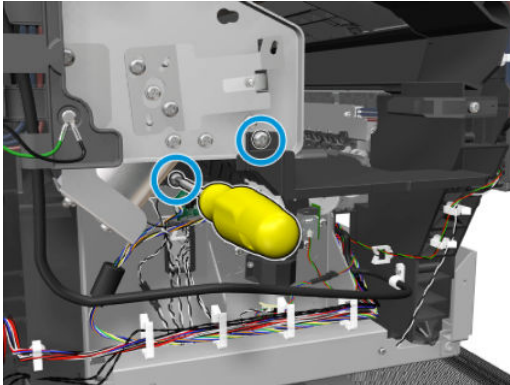

5. Remove 2 screws

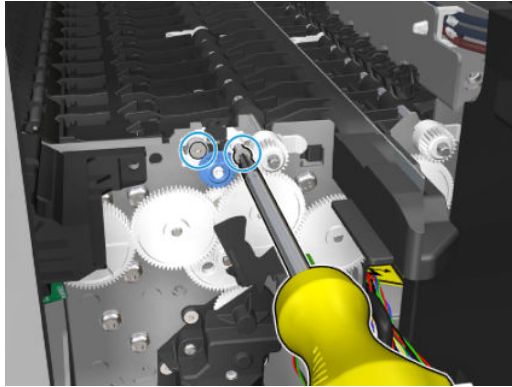

6. Remove the plunger.

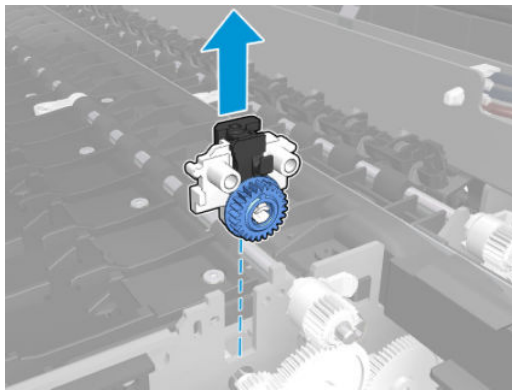


 **NOTE:** This assembly is on both sides.


Second Starwheel Rail

Removal



1. Open the window.
2. Move the carriage to the front panel side.

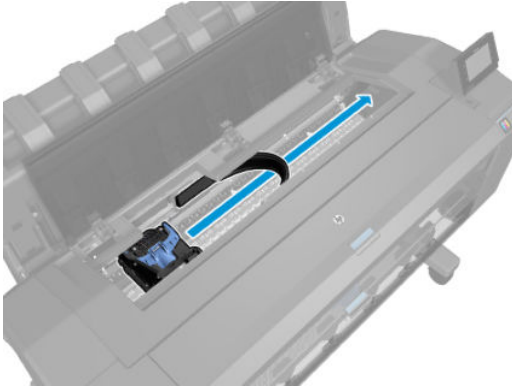

3. Detach and unrout the ink tubes.

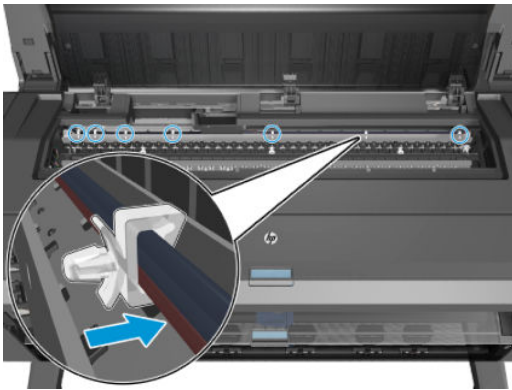




4. Remove 2 T-20 screws, and the second starwheel rail.

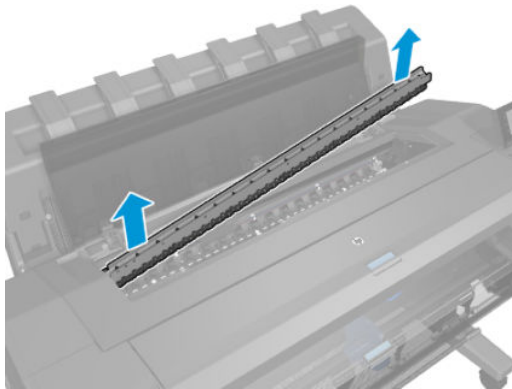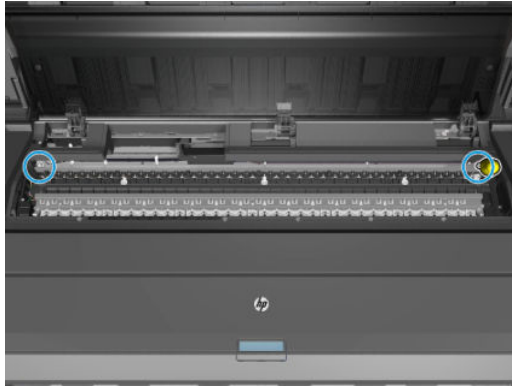

Overdrive



Removal

1. Remove the Front Panel side main cover. See [Main cover \(front panel side\) on page 281](#).
2. Remove 3T-10 screws, and the starwheel lifter cover.

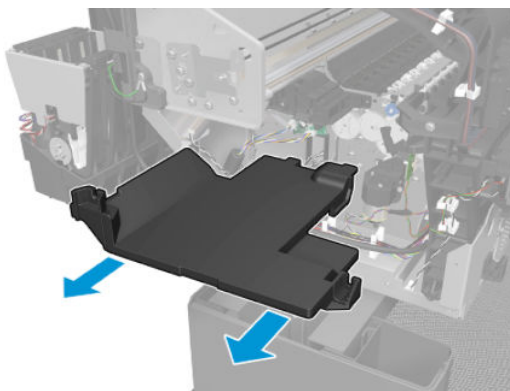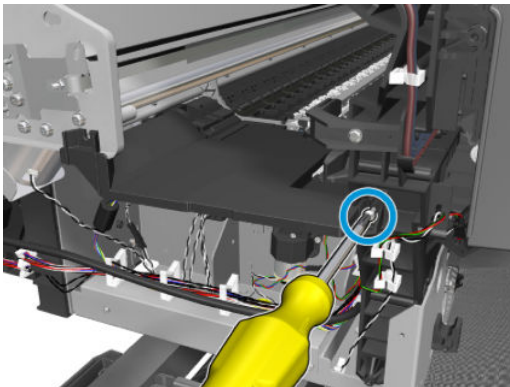
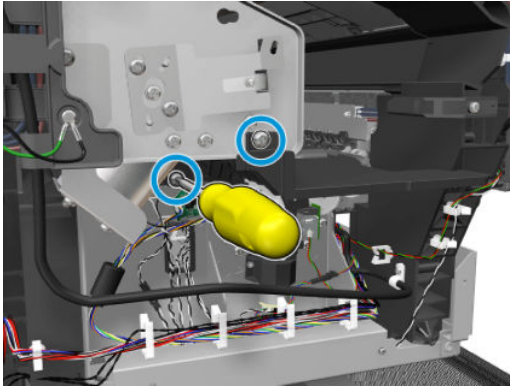


3. Remove the first starwheel rail. See [Customer Self Repair Flyers on page 473](#).

4. Remove the holders.

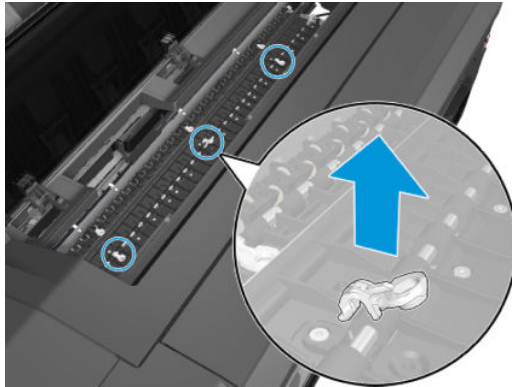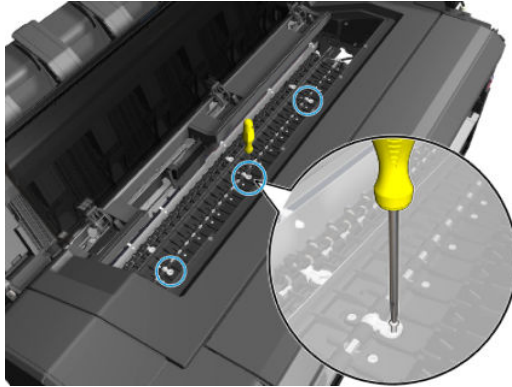



5. Lift up the flap at both sides and remove the overdrive.

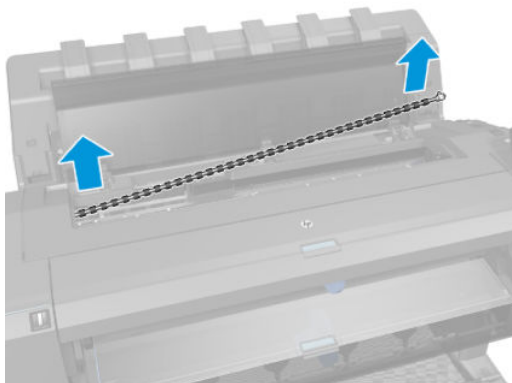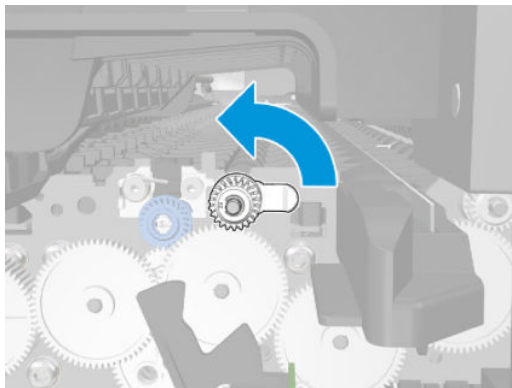


Cutter Platen

Removal


1. Remove the starwheel rail. See [Customer Self Repair Flyers on page 473](#).
2. Remove the overdrive. See [Overdrive on page 396](#).
3. Remove the output platen. See [Output platen on page 290](#).
4. Remove the stacker. See [Stacker on page 405](#).
5. Remove the 2nd starwheel rail. See [Second Starwheel Rail on page 394](#).
6. Remove the 3 holders from the 2nd overdrive.

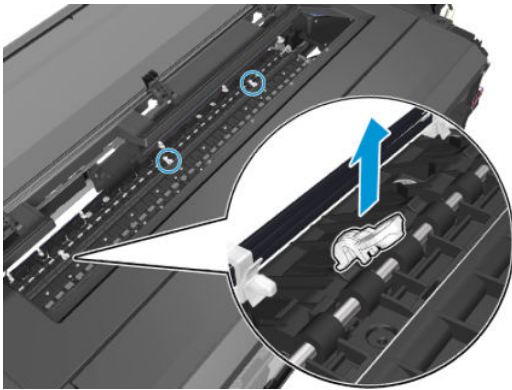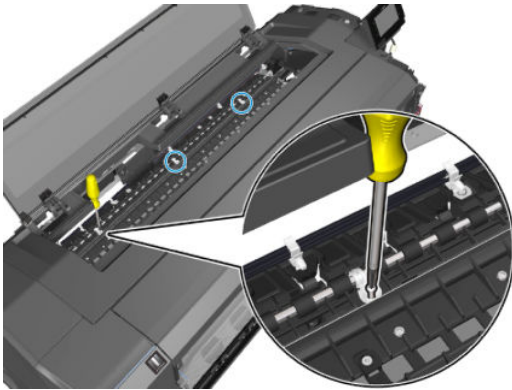


7. Move the flaps from the 2nd overdrive.

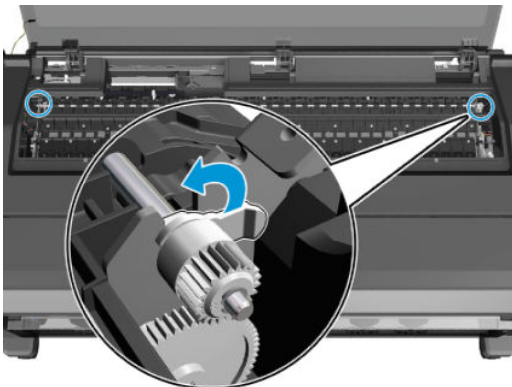


8. Remove the 2nd overdrive.

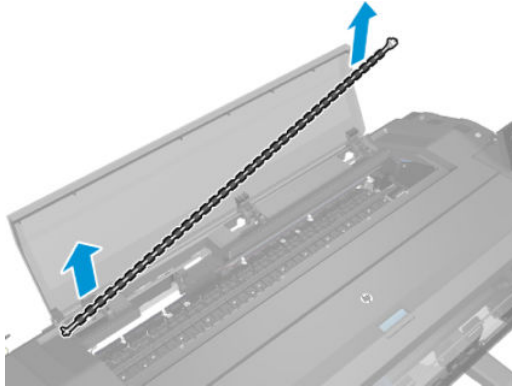


9. Remove 13 T-10 screws.

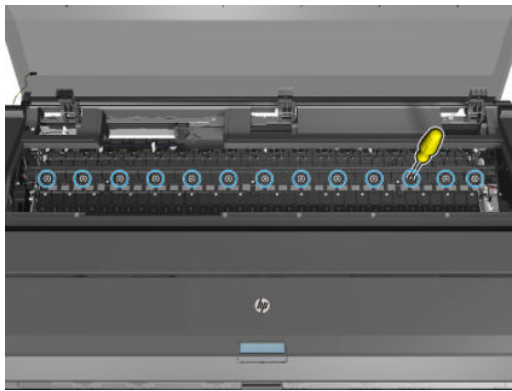

10. Remove 4 T-10 screws.

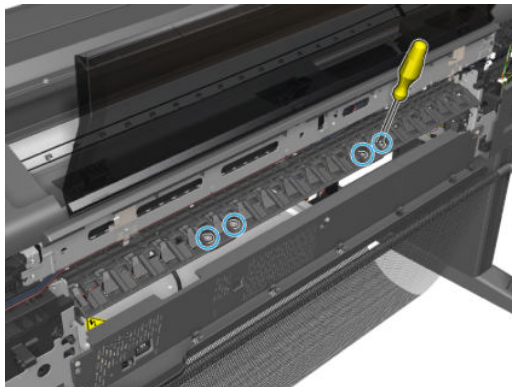



11. Remove the platten.

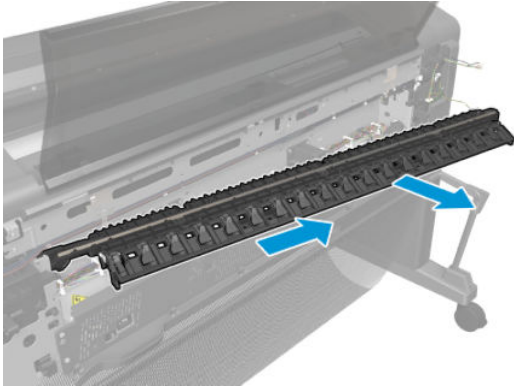



Sensor Valves

Removal


1. Remove the output platen. See [Output platen on page 290](#).
2. Remove the rear cover. See [Rear cover on page 295](#).
3. If the valves are down; put them into the up position by turning motor encoder.

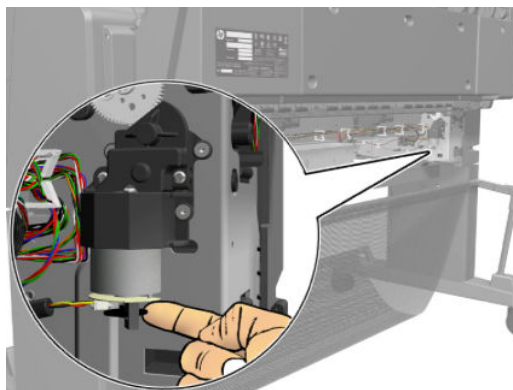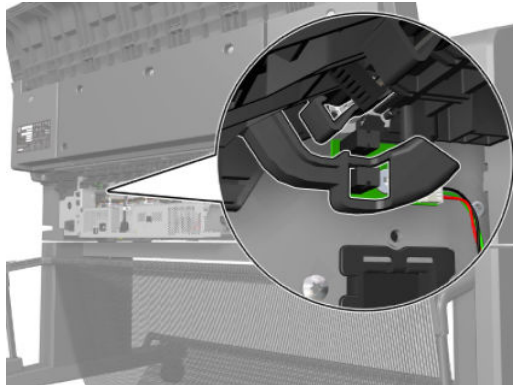

4. Disconnect the cable, and remove the T-10 screw.

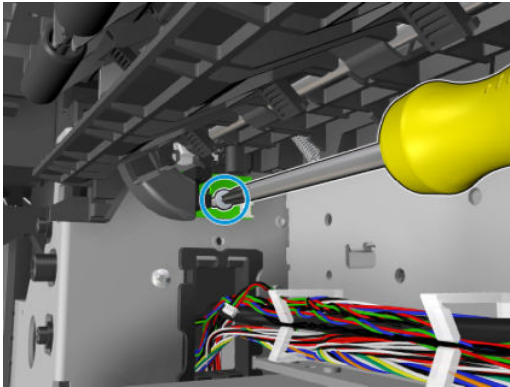
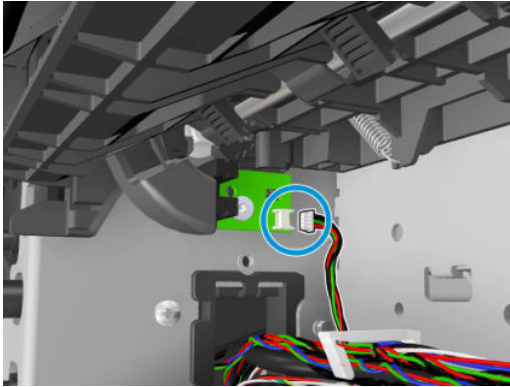


5. Remove the sensor valves.

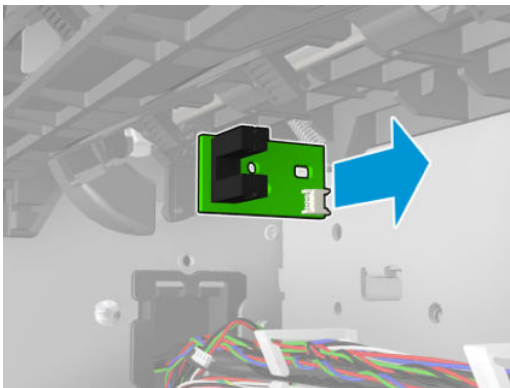

Installation


- ▲ When reinstalling the sensor valves, move the valves into the down position with the motor encoder in order to check sensor positioning.

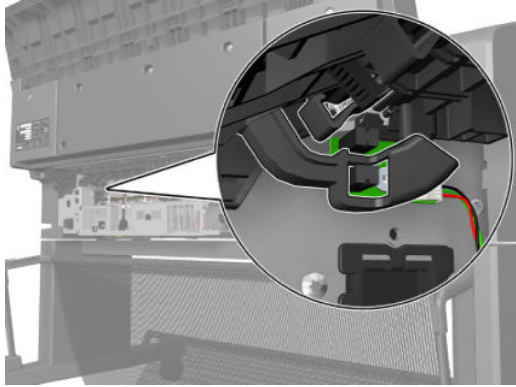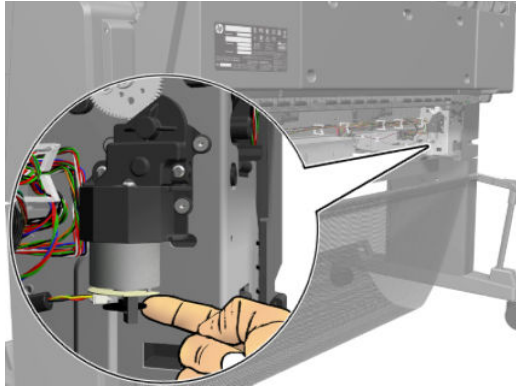


Valves Motor

Removal


1. Remove the rear cover and output platen. See [Rear cover on page 295](#) and [Output platen on page 290](#).
2. Disconnect the cable.

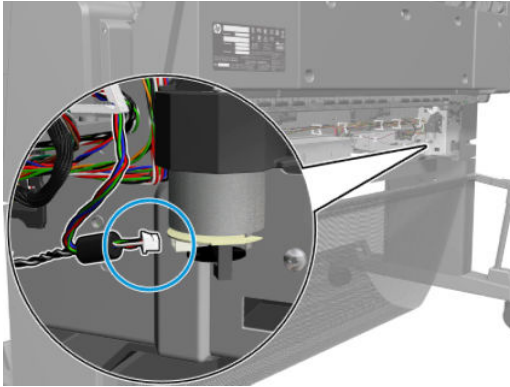

3. Remove 4 screws.

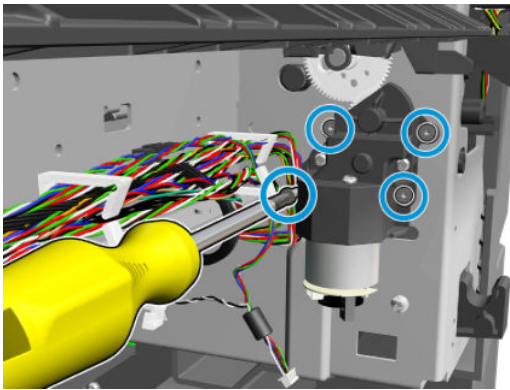

4. Remove the valves motor.



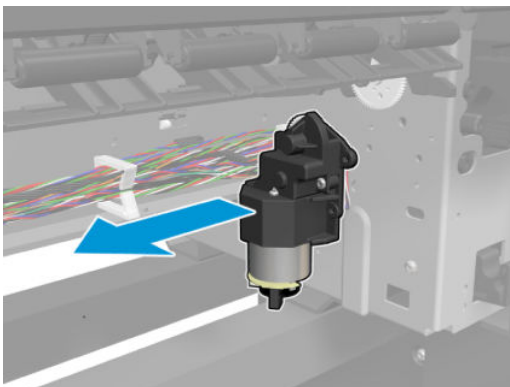


Stacker



T2500 only: adaption kit CR359-67006 must be installed before installing the stacker. This kit is sometimes referred to as the Stacker MFP SV, or the Stacker adaptor for MFP. See [Stacker adaptor for MFP on page 407](#).

Removal


1. Remove the stacker arms. See [Customer Self Repair Flyers on page 473](#).
2. Remove fixed tray cover from the front panel side and from the service station side. See [Fixed tray cover \(Front Panel side\) on page 291](#) and [Fixed tray cover \(service station side\) on page 292](#).
3. Disconnect the cables.

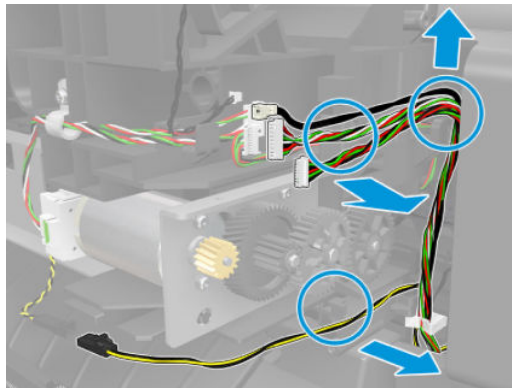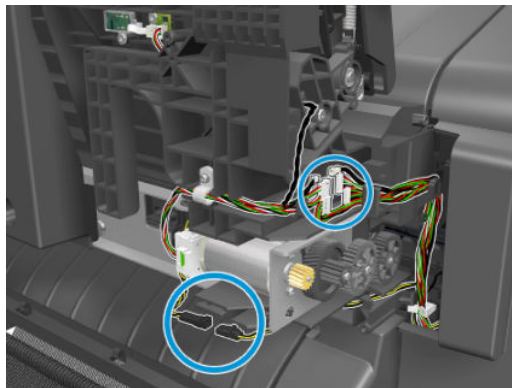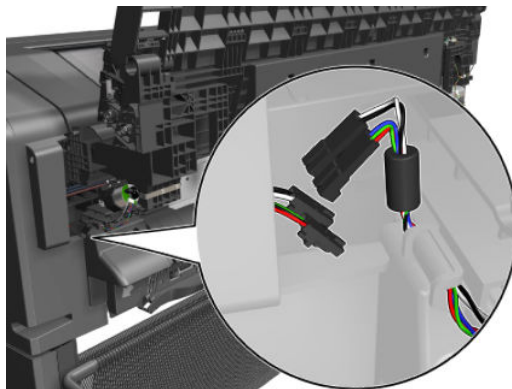


4. Remove 4 T-15 screws from both sides.

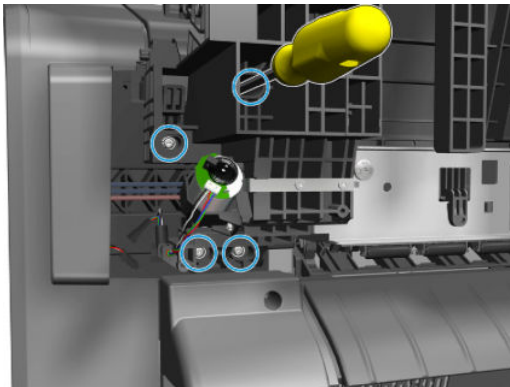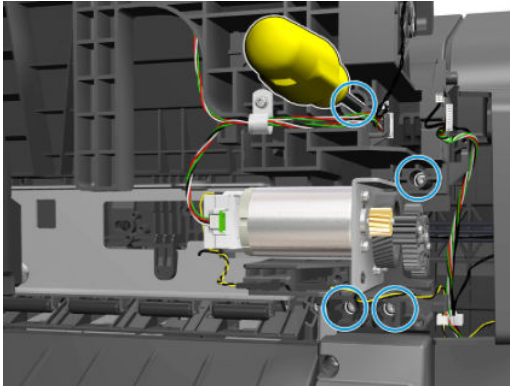

5. Remove the stacker, pulling the handles on the back.

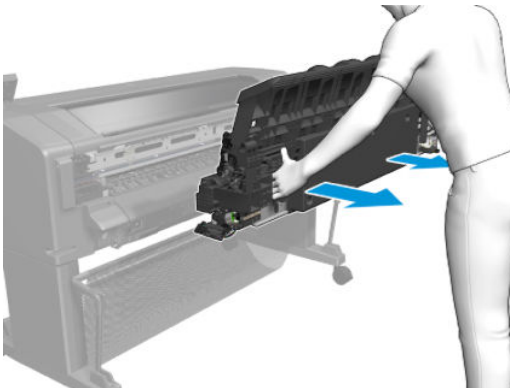


 **NOTE:** For installation make sure that the valves are down and the ramps are hidden, otherwise it can cause improper assembly, and show SE90:03 or SE89:03.

Stacker adaptor for MFP


T2500 only: installing adaption kit CR359-67006.

Removal of the old stacker wheel lifters


1. Pull the stacker wheel lifter towards you.

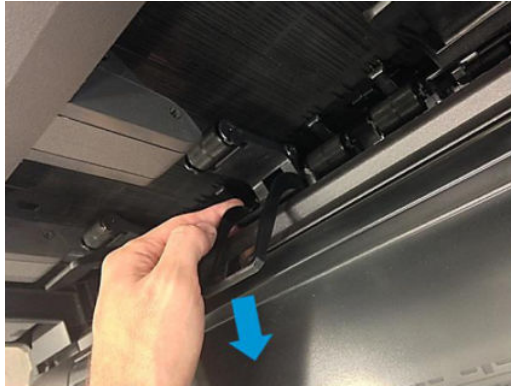


2. Push the stacker wheel lifter's left leg to unclip it. Be sure not to unclip the second wheel holder.

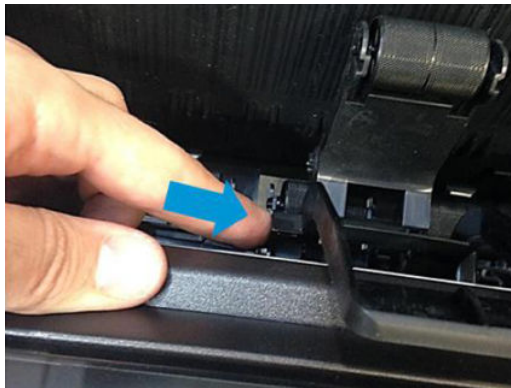


3. Slide the leg towards the foldable tray.

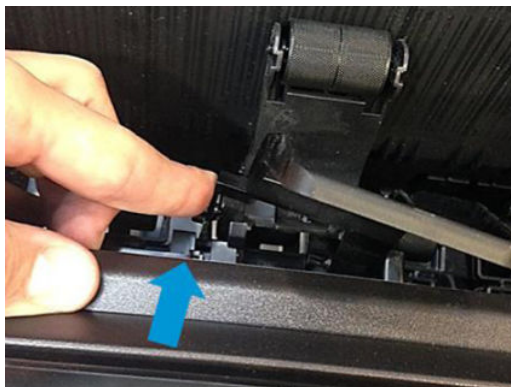


4. When the left leg is unclipped, the right leg will come out too. Remove each stacker wheel lifter.

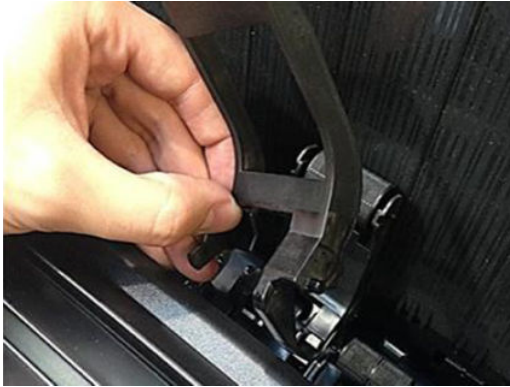


Before assembling the MFP stacker wheel lifters, check the following reference images for guidance:
The hook of the stacker wheel lifter for MFP should be inserted into the hole shown by the blue arrow.

 **NOTE:** This is easier to do when the stacker ramps are down.

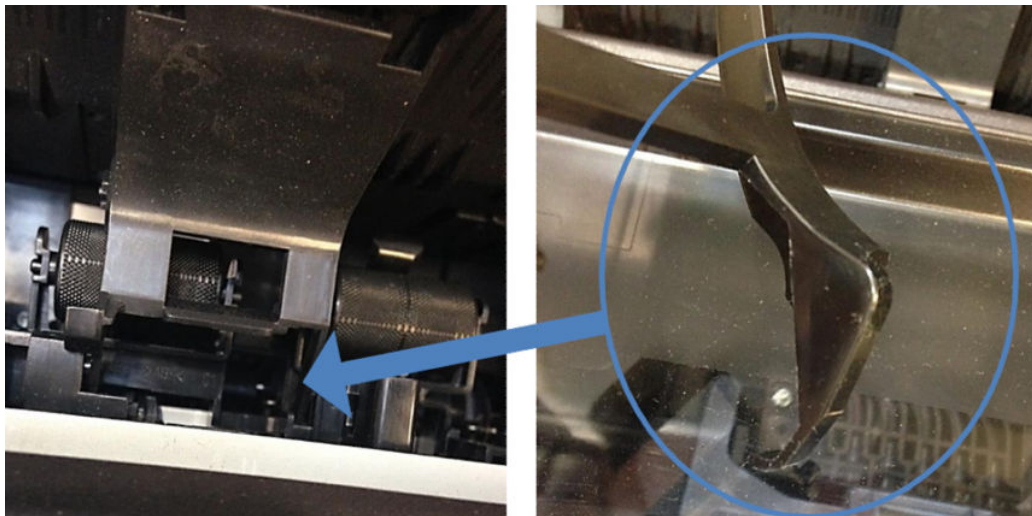

The right pin of the stacker wheel lifter for MFP must slide into the groove shown by the blue arrow.

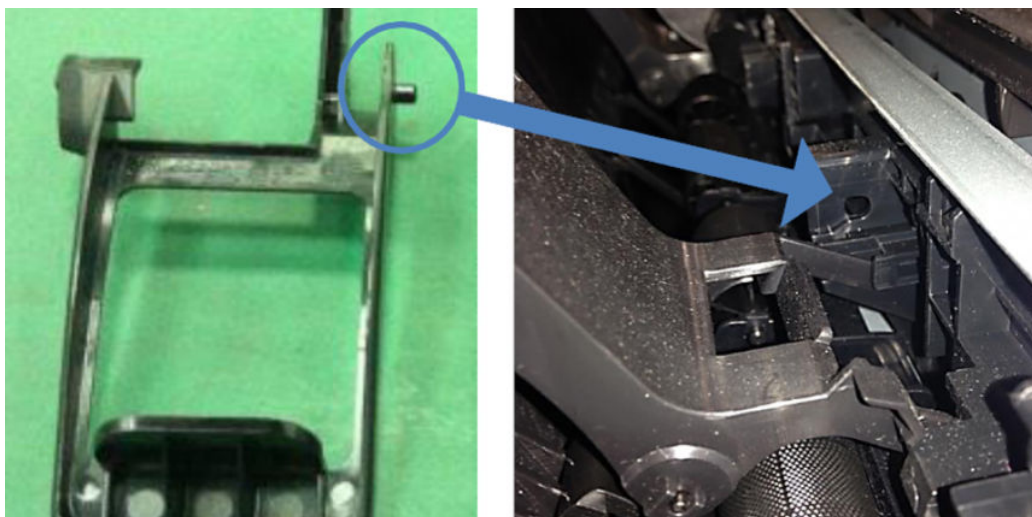


Assembling the MFP stacker wheel lifters


1. Insert the right leg in the hole and align the right pin as explained previously.



2. Push the stacker wheel lifter's left leg to align the left pin with the left groove.

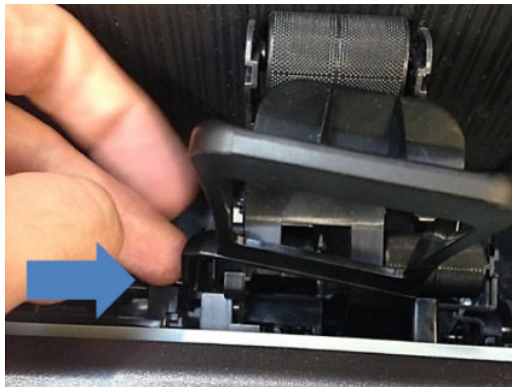


3. While pushing, slide the leg towards you. It clicks into place.

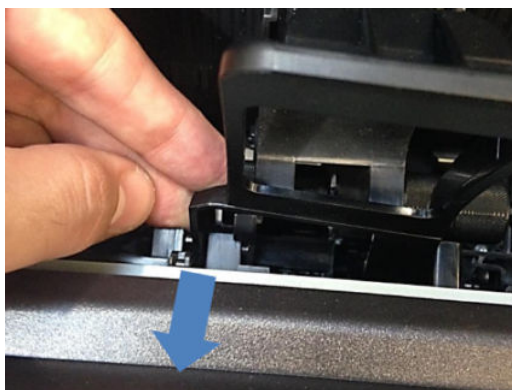

4. Check that the stacker wheel lifter can rotate freely.



5. Attach the hinge stoppers on both sides. Each hinge stopper is attached to the stacker with one screw.


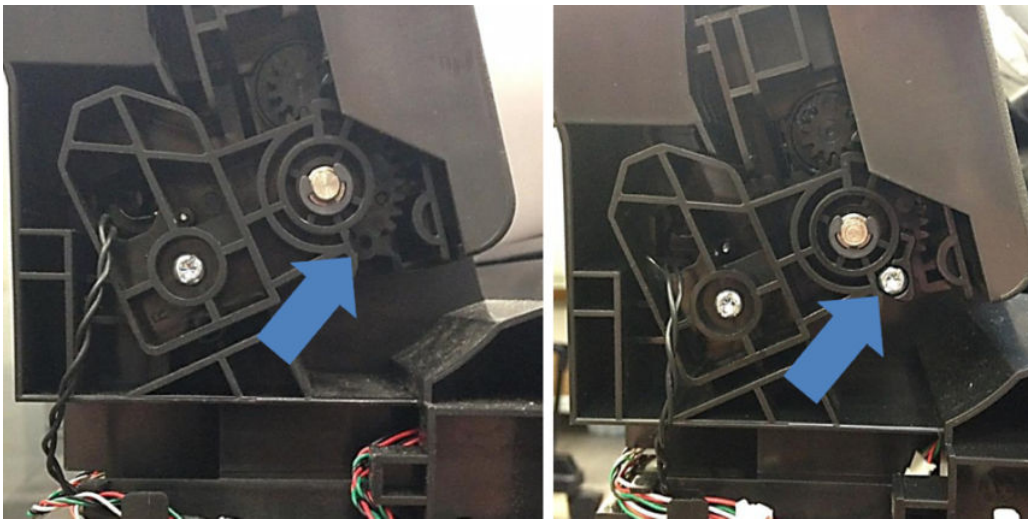



You can now proceed to install the stacker. See [Stacker on page 405](#).


Stacker Pinches

Removal

1. Remove the stacker. See [Stacker on page 405](#).
2. Remove the 3 T-10 screws, and then the pinches.

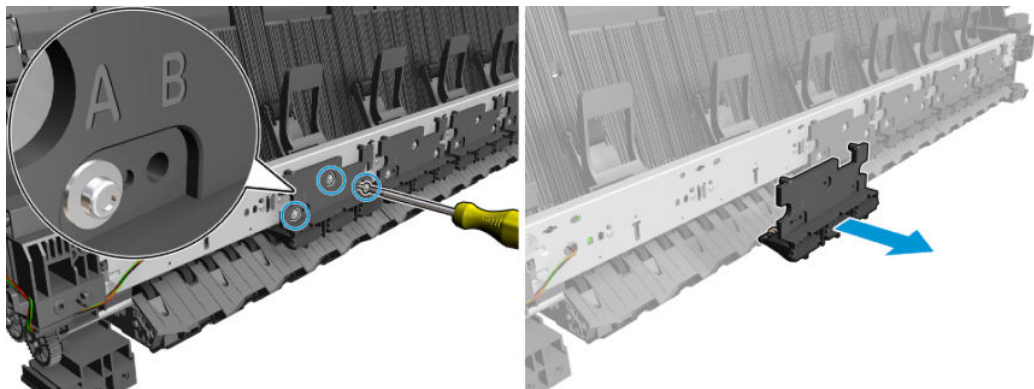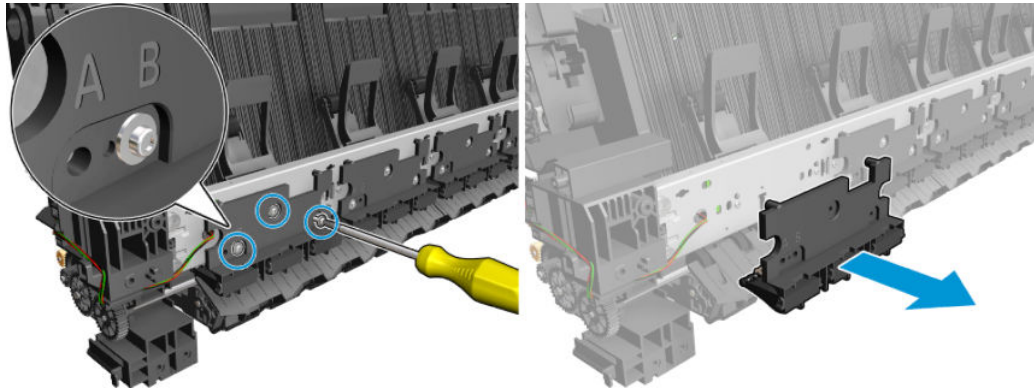

 **NOTE:** For installation make sure that you install the 1st pinch using hole B.

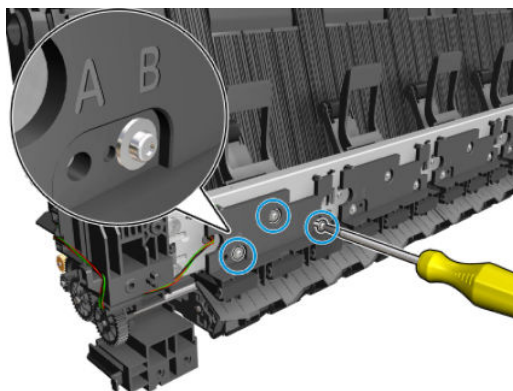


Stacker Hand Off


T2500 only: In order to change the stacker hand of, you need first install service kit. See [Stacker Hand Off Assy Service Kit \(CR357-67041\)](#) on page 413.

Removal


1. Remove the stacker. See [Stacker on page 405](#).
2. Remove 3 T10 screws and the 1st pinch (B).

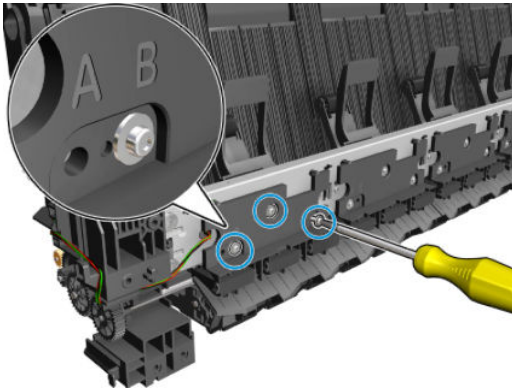


3. Unroute the cable.

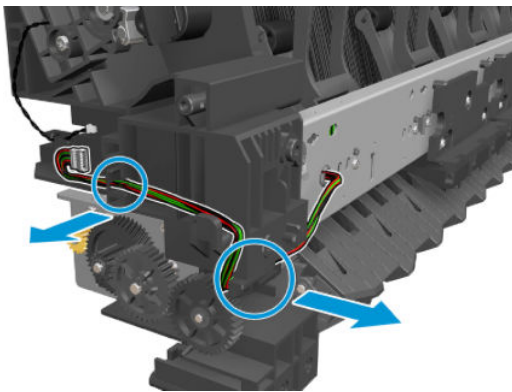

4. Remove 2 T10 screws.

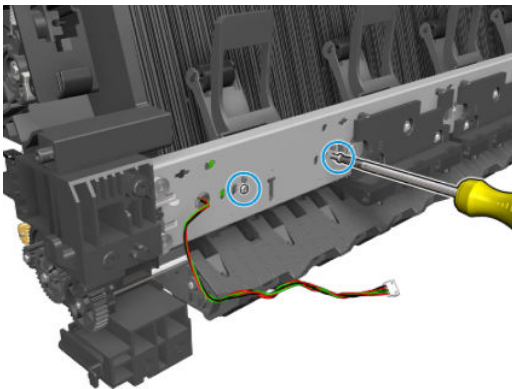


5. Remove the stacker hand off.

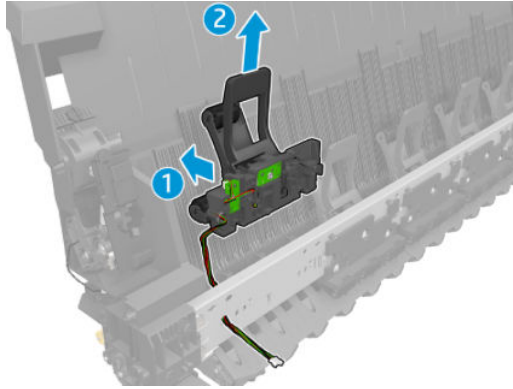

Stacker Hand Off Assy Service Kit (CR357-67041)

T2500 only: the Stacker Hand Off Assy (CR375-67041) includes parts needed to repair the MFP and single function printer. Follow the steps below to assemble the part depending on the product.

Each service kit CR357-67041 (both for Single Function and MFP) includes:

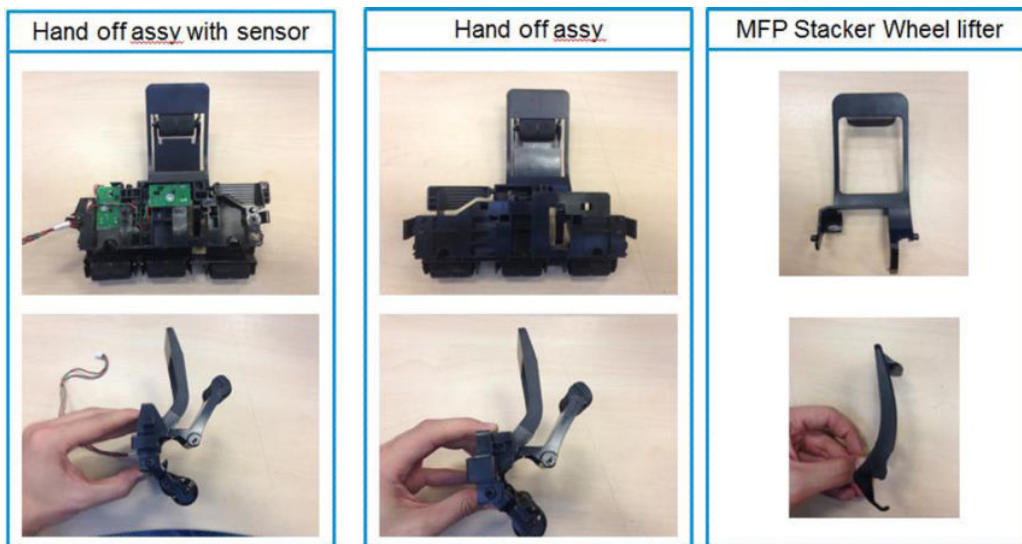

Hand off assemblies come with single function stacker wheel lifters.

To install them in an MFP, first you need to replace the 6 stacker wheel lifters with the MFP stacker wheel lifters included in the same package.

Then, install the hand off assemblies following the service manual procedure.

Remove single function stacker wheel lifters


1. Rotate the stacker wheel lifter as shown by the arrow below to remove it.



2. Press the right leg of the stacker wheel lifter to unclip it.



While pressing, slide the leg in the direction shown by the arrow.

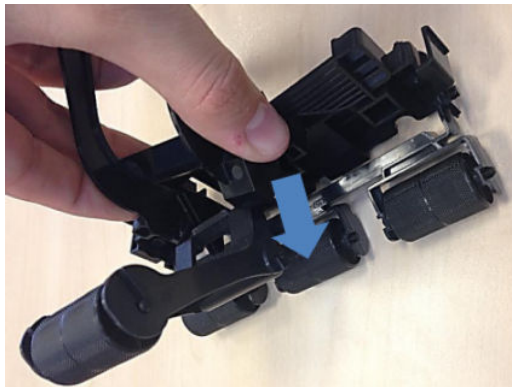


The stacker wheel lifter is now removed from the Hand-off assembly.




Assemble multi-function printer stacker wheel lifters

1. Insert the hook through the hole shown below.

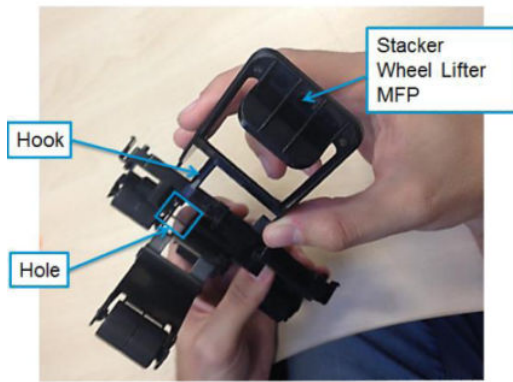

2. Rotate the second wheel holder in order to insert the right and left pin.
3. Clip the hook side pin into place, then press in the other leg to clip in the other pin.

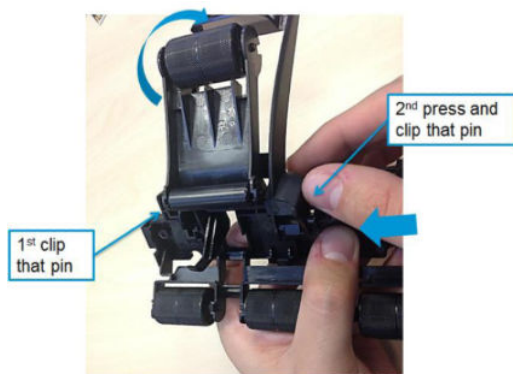

4. Repeat all steps for each hand-off assembly, and for the hand-off assembly with sensor.




You can now proceed to change the stacker hand off. See [Stacker Hand Off on page 412](#).


OPTO Sensor

Removal


1. Remove the stacker. See [Stacker on page 405](#).
2. Remove the hand off. See [Stacker Hand Off on page 412](#).
3. Disconnect the cable.

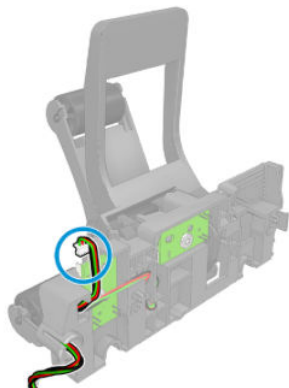


4. Remove the screw.

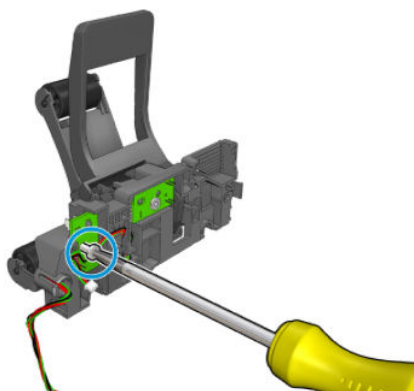



5. Remove the sensor.

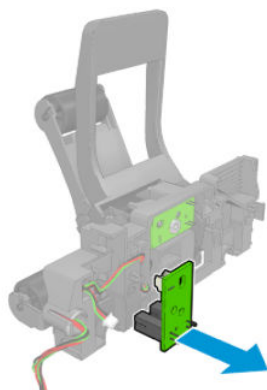

6. Remove the screw.

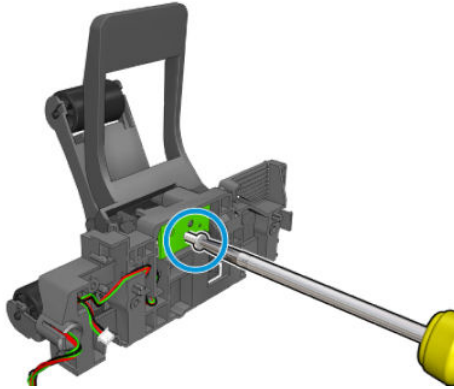



7. Remove the PCA and disconnect.

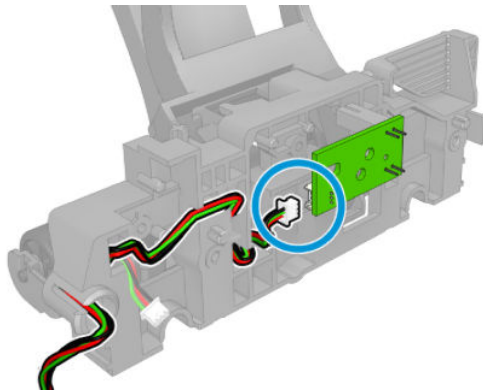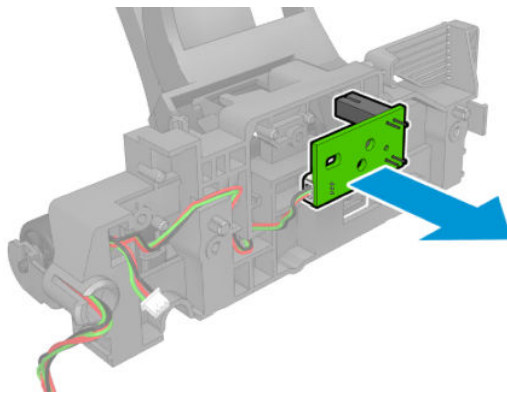


REDI sensor

Removal

1. Remove the cover of the fixed tray on the service station side. See [Fixed tray cover \(service station side\) on page 292](#).
2. Disconnect the cable and remove the 2 screws.

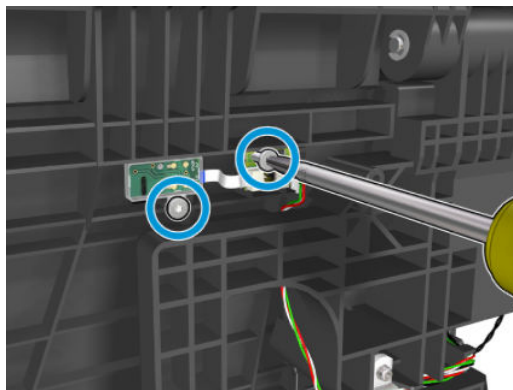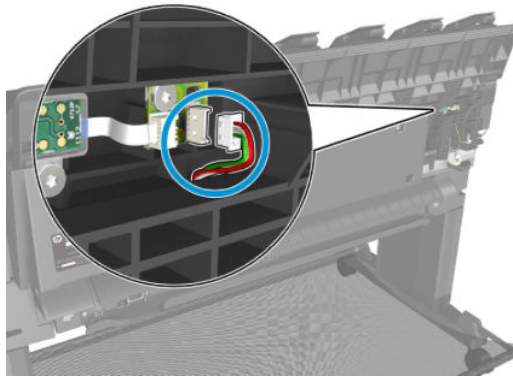



3. Remove the REDI sensor.

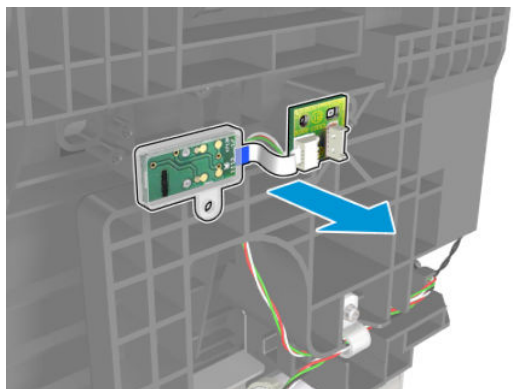


OVD Transmission with Motor

Removal


1. Remove the fixed tray cover from the service station side. See [Fixed tray cover \(service station side\)](#) on page 292.
2. Disconnect the cables.

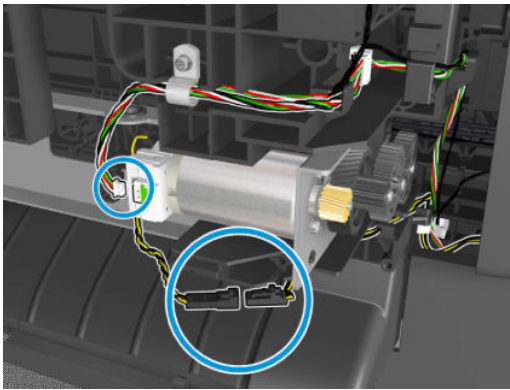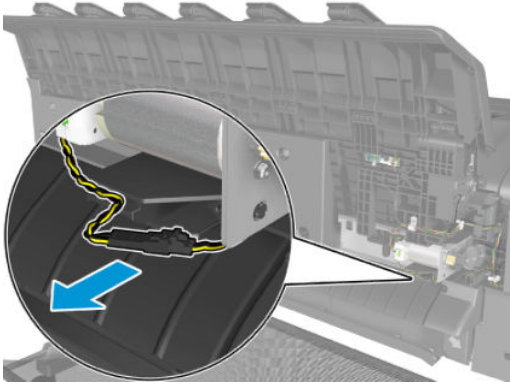

3. Remove 3 screws.

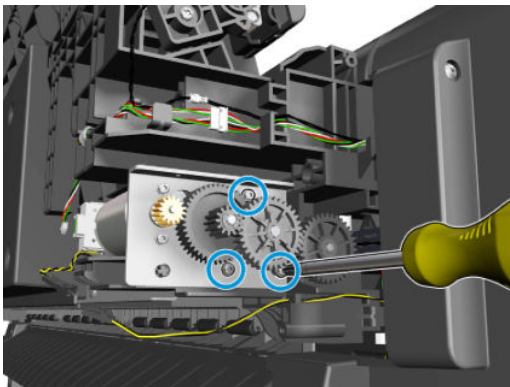



4. Remove the overdrive.

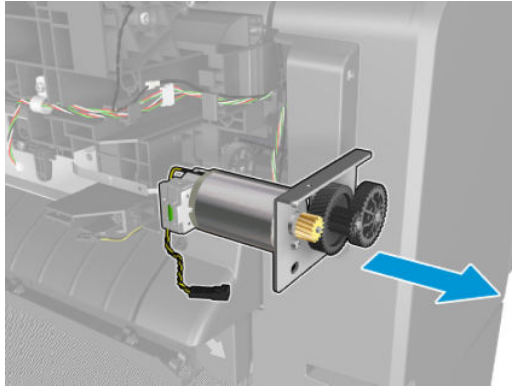


Ramps Motor

Removal


1. Remove Main Cover Front Panel Side. See [Main cover \(front panel side\) on page 281](#).
2. Disconnect and unroute the cables.

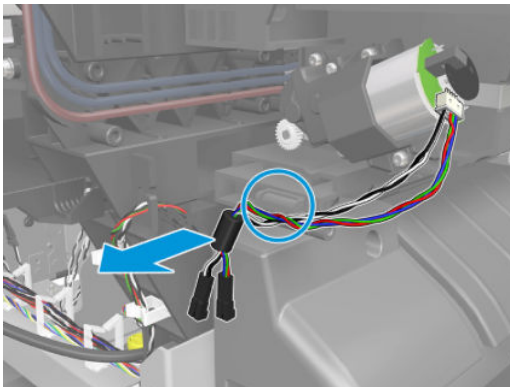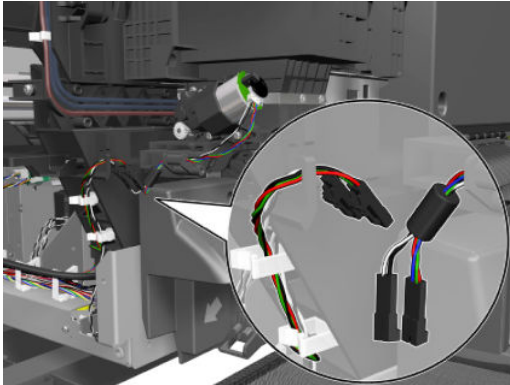

3. Remove 4 screws.

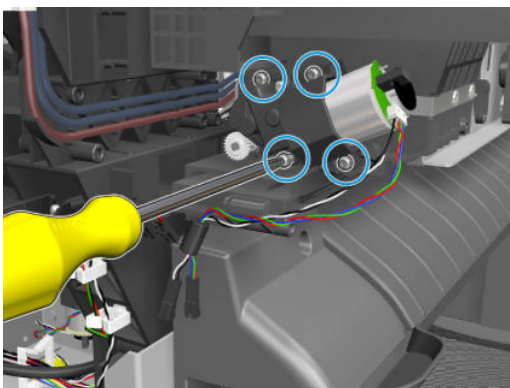



4. Remove the ramps motor.

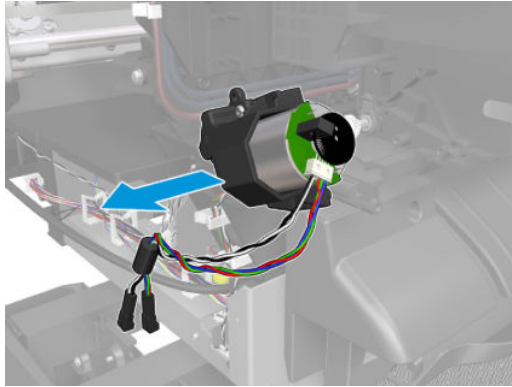


Stacker Arm Sensor

Removal


1. Remove the stacker arm. See [Customer Self Repair Flyers on page 473](#).
2. Remove SVS fixed tray cover. See [Fixed tray cover \(service station side\) on page 292](#).
3. Disconnect and unroute the cable.

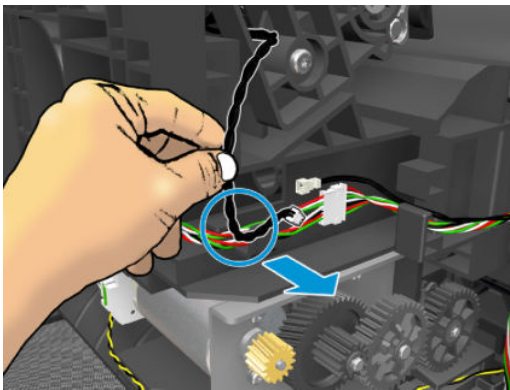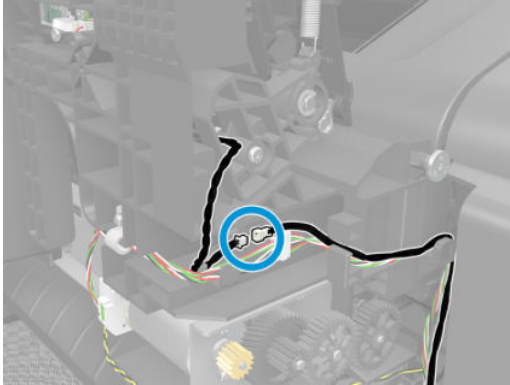


4. Remove the screw.

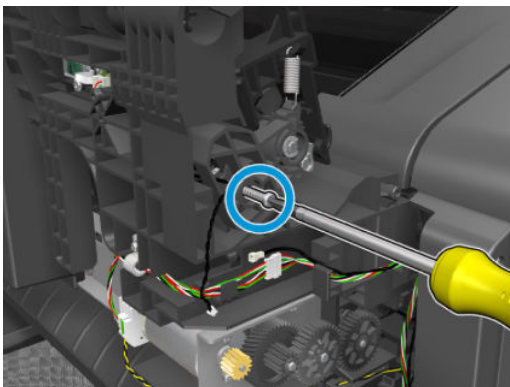

5. Remove the module.

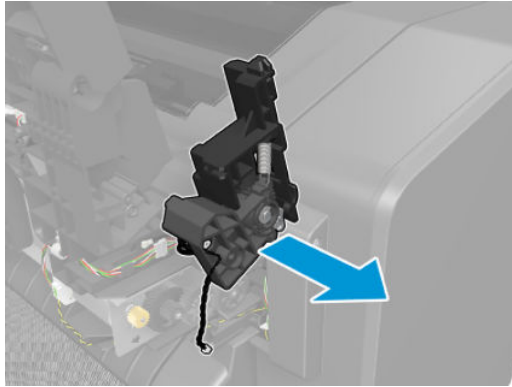


6. Remove the screw and microswitch (sensor).

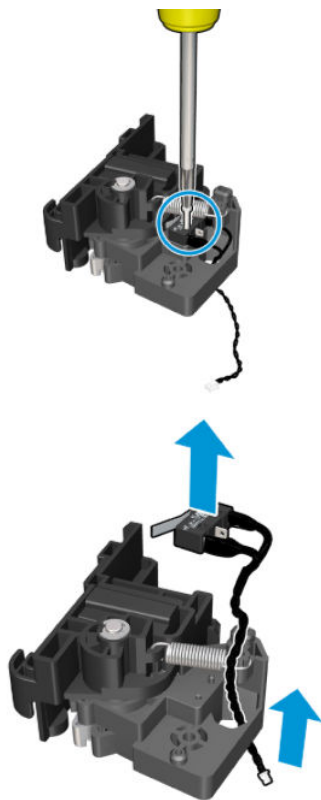


Bump Cutter Actuator

Removal

1. Remove Main Cover Front Panel Side. See [Main cover \(front panel side\) on page 281](#).
2. Remove the T-15 screw.

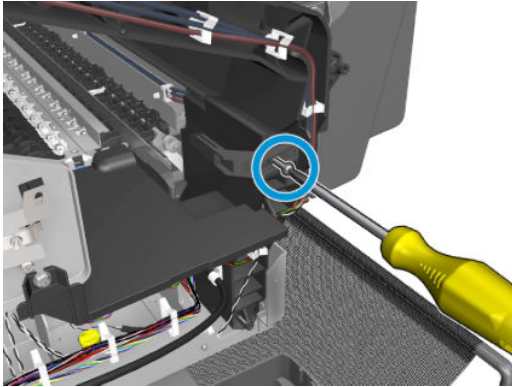


3. Remove the bump cutter actuator.

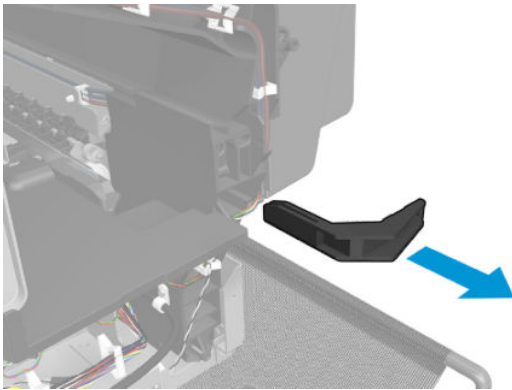

How to release Service Station Caps

Removal


1. Remove the SVS main cover. See [Main cover \(service station side\) on page 283](#).
2. Release the caps with the spring wheel.

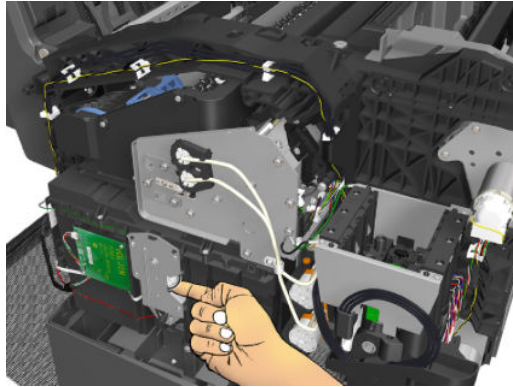

How to manually move Valves

Removal


1. Remove the rear cover. See [Rear cover on page 295](#).
2. Turn the motor valves encoder.

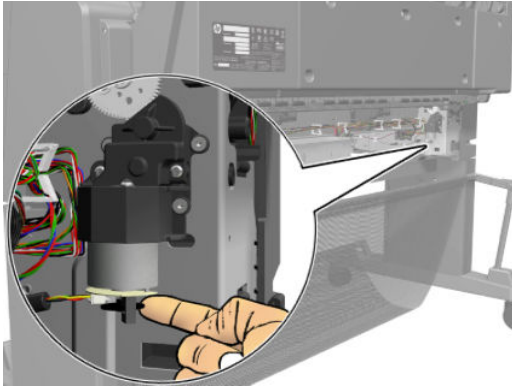

How to manually move Stacker Ramps

Removal


1. Remove the front panel fixed tray cover. See [Fixed tray cover \(Front Panel side\) on page 291](#).
2. Turn the ramps motor encoder.

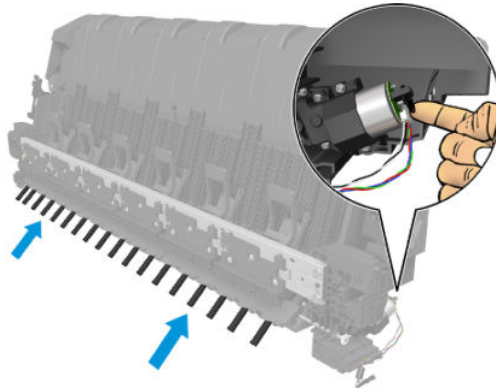


Scanner Controller Unit (SUP)

Removal


1. Turn the scanner off, disconnect the power cord, and tilt open the CIS bridge.
2. Remove the screws marked S1 (Torx 10), and open the CIS unit.

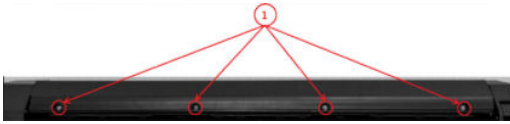

3. Disconnect the cables, release the ribbon cables lock (A), and pull out cable.

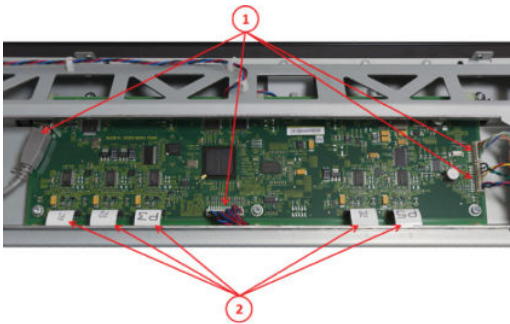

4. Remove the Screws (Torx 10), and remove the Scanner Controller Board.

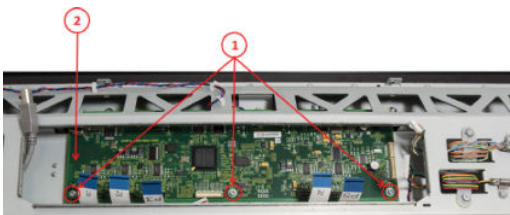

Replacement

- ▲ To replace reverse the removal steps.

 **NOTE:** The new Scanner Controller Board needs to be calibrated.


CIS Tiles

Removal

1. Remove the screws (Torx 10), and remove the idle roller cover sheet.



2. Remove the CIS tiles, and mark them for repositioning if necessary.

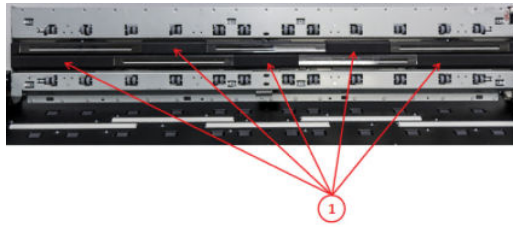


Replacement


1. If only the CIS tiles are being replaced; reverse the removal steps.
2. Re-calibrate the scanner.

CIS Modules


Removal

1. Remove the CIS Tiles. See [CIS Tiles on page 431](#).
2. Remove the screws marked S1 (Torx 10), and open the CIS unit.

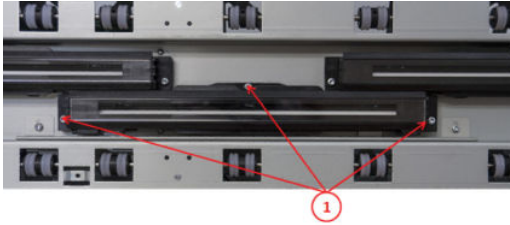


 **NOTE:** In order to remove the lower CIS modules the upper must be removed (there is no need to disconnect).

3. Carefully disconnect by pulling.

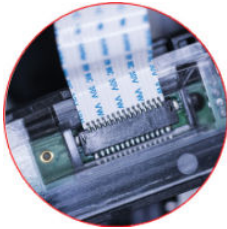

Replacement

1. Replace the CIS module and tighten the screws in order 1 to 3.

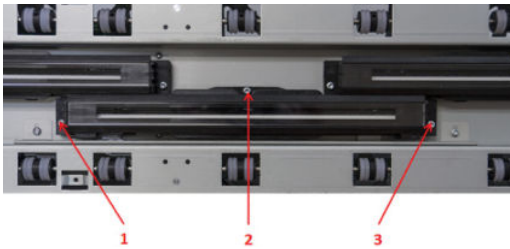


2. Re-calibrate the scanner.


CIS FFC Cables


Removal

1. Remove the affected CIS Tiles. See [CIS Tiles on page 431](#).
2. Remove the affected CIS Modules. See [CIS Modules on page 432](#).
3. Replace the CIS module and tighten in order 1 to 3.

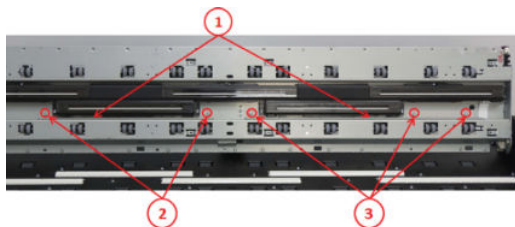


4. Unplug only the FFC cables that need to be replaced.

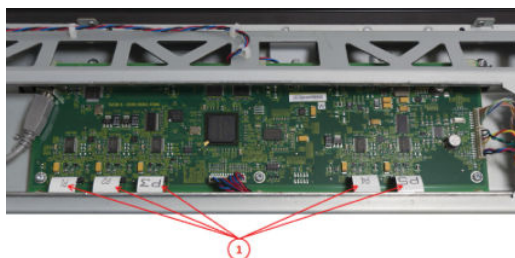

 **NOTE:** For some of the cables it may be helpful to remove the Scanner Controller board. See [Scanner Controller Unit \(SUP\) on page 430](#).

CIS Glass


Removal

 **IMPORTANT:** Only replace glass when in a “clean” environment, and be careful not to touch the underside of glass.

- ▲ Remove the CIS Tiles. See [CIS Tiles on page 431](#).

Replacement

1. Replace by carefully inserting the new glass, pushing the old one out.

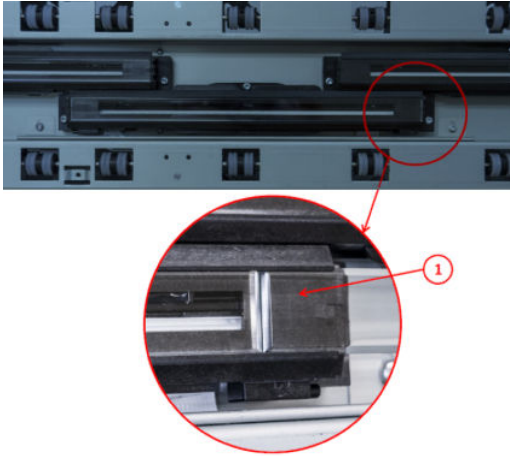


2. Re-calibrate the scanner.


Stepper Motor Assembly (taco sensor, and belt)

Removal


1. Turn the scanner off, disconnect the power cord, and tilt open the CIS bridge.
2. Remove the screws (1) and then the scanner RHS cover (2).

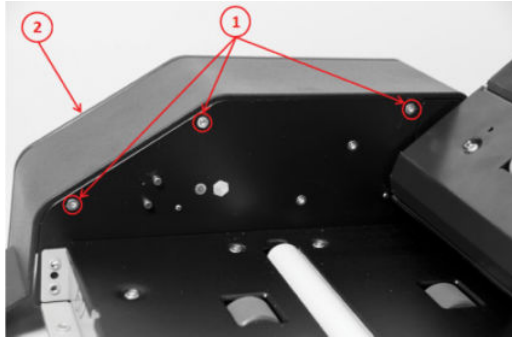


3. Remove the screws (1), and then the motor cover (2).

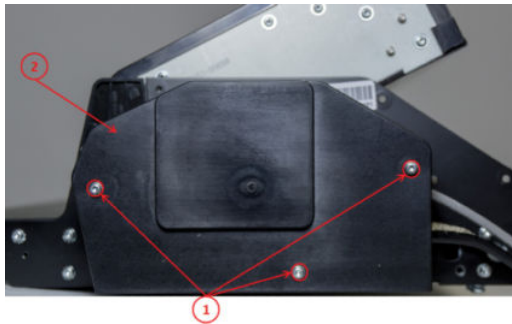


4. Disconnect the Sensor Motor cables.

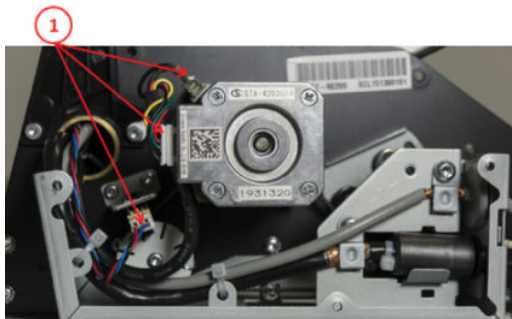


5. Loosen the screw (don't remove it), and remove the Taco Wheel.

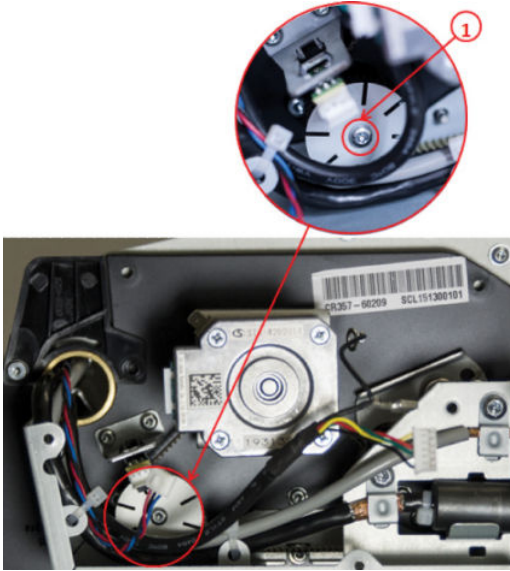

6. Release belt tension by loosening the screw (don't remove it), and push the tension wheel upwards and tighten the screw.

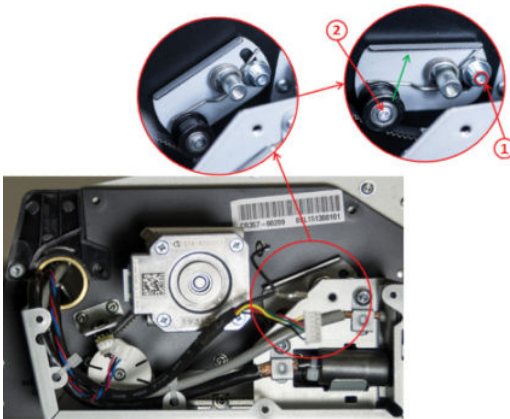

7. Remove the motor screws.

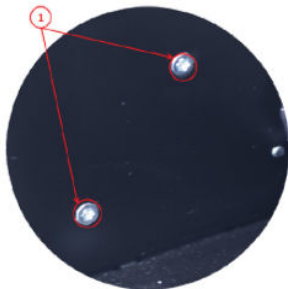


Replacement

- ▲ Replace by reversing the removal steps. If the Cable is being replaced see [Stepper Motor Assembly \(cable\) on page 437](#).


Stepper Motor Assembly (cable)

Removal

1. Open the CIS unit. See [Scanner Controller Unit \(SUP\) on page 430](#).
2. Remove the screws, and unclip the cable.

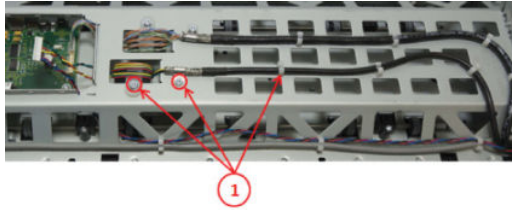

3. Cut the cable tie, and push the cable into the CIS unit.

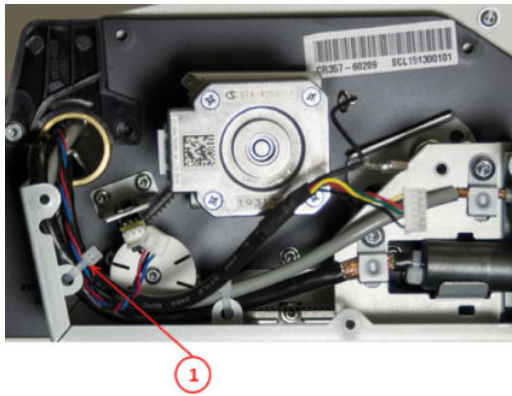


Replacement

- ▲ Replace the cable by reversing the removal steps.


Paper and Lid Sensors

Removal


1. Turn the scanner off, disconnect the power cord, and tilt open the CIS bridge.
2. If replacing the Exit Sensor or the Lid Sensor, you will need to open the CIS unit. See [Scanner Controller Unit \(SUP\) on page 430](#).
3. If the sensor cable needs replacing, the Paper & Lid Sensor is affected. See [Paper and Lid Sensor Cable on page 440](#).
4. Remove the screws, and the roller cover.

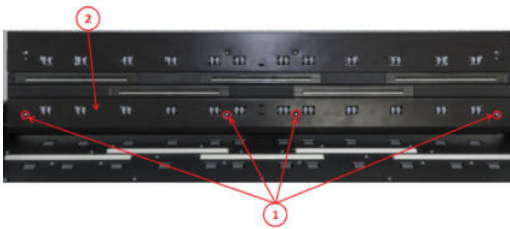


5. Remove the screw (1), and the sensor bracket (2).

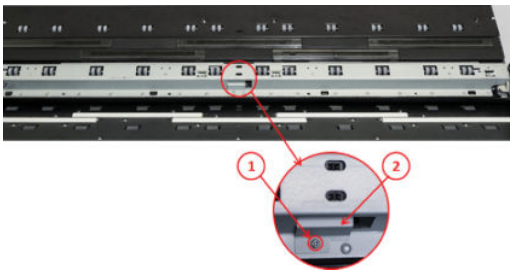


6. Open the CIS unit. See [Scanner Controller Unit \(SUP\) on page 430](#).
7. Remove the screws and the CIS unit cover (1). Remove the screws (2), the sensor bracket (3), and disconnect the Lid Sensor (4).

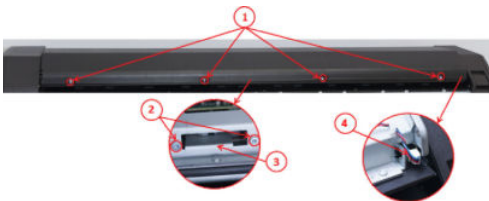

8. Disconnect the cable (1), remove the screw and Exit Sensor (2).

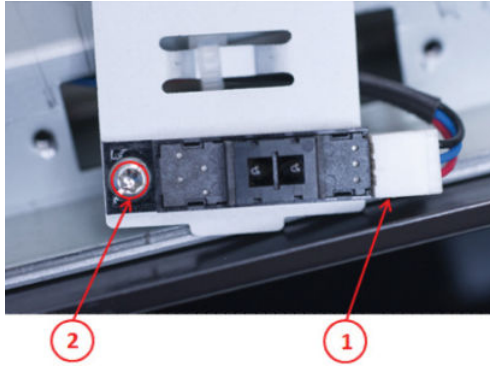

9. Squeeze lock pins, and remove the Lid Sensor.

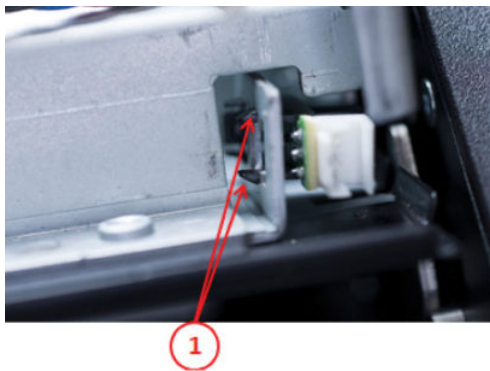


Replacement

- ▲ Replace by reversing the removal steps.

Paper and Lid Sensor Cable

Removal


1. All Sensors need to be removed in order to replace the cable. See [Paper and Lid Sensors on page 438](#).
2. Disconnect the Sensor Cable.

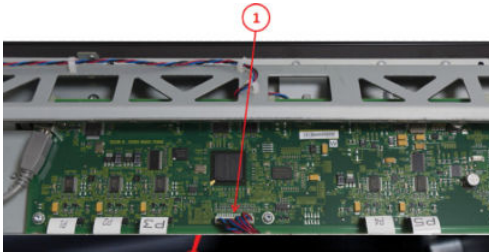


USB & Awake / Power Cable

Removal


1. Turn the scanner off, disconnect the power cord, and tilt open the CIS bridge.
2. Remove the RHS and Motor Cover. See [Stepper Motor Assembly \(taco sensor, and belt\) on page 435](#).
3. Disconnect the USB & Awake / power cable (1). Unclip the cable throughout the CIS unit.

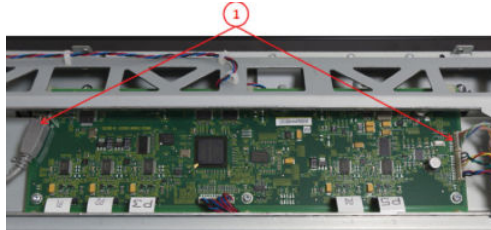


4. Unclip the USB Cable and pull it gently out of the CIS bridge (1). Remove the screws and unclip the cable (2).

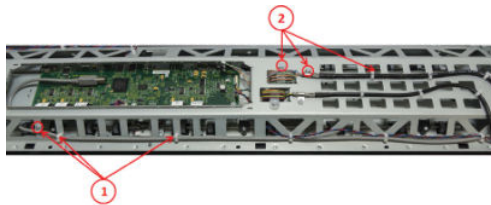


5. Remove the screws.

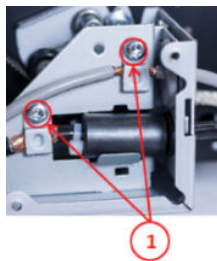

6. Remove the screws.

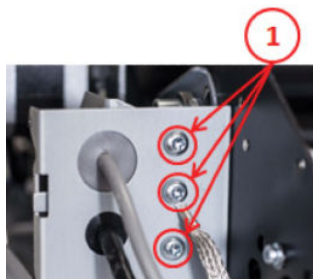

7. Carefully pull Cables into motor compartment (1 & 2).

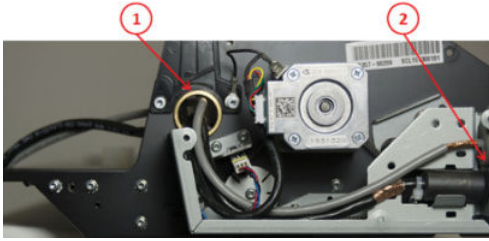


Replacement

- ▲ Replace by reversing the removal steps.


CIS Bridge Damper

Removal


1. Turn the scanner off, disconnect the power cord. Open the CIS Unit. See [Scanner Controller Unit \(SUP\) on page 430](#).
2. Remove the screws and LHS cover.

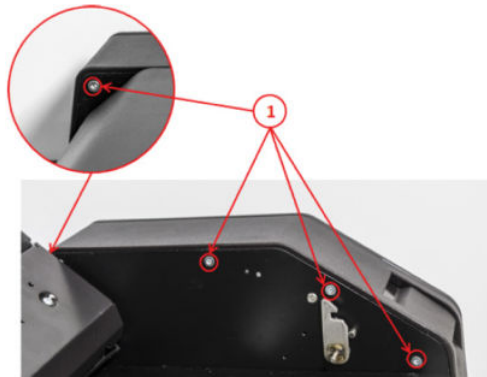


3. Tilt open the CIS bridge to decrease the spring tension (1), and unhook the spring (2).

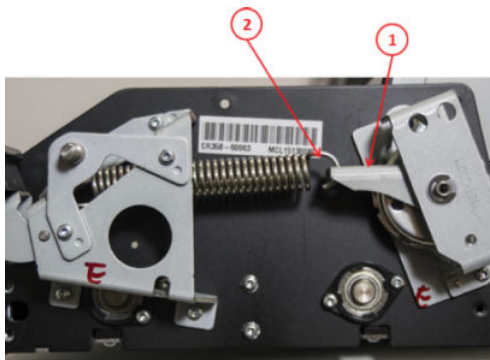

4. Remove the screw and carefully free the CIS bridge.

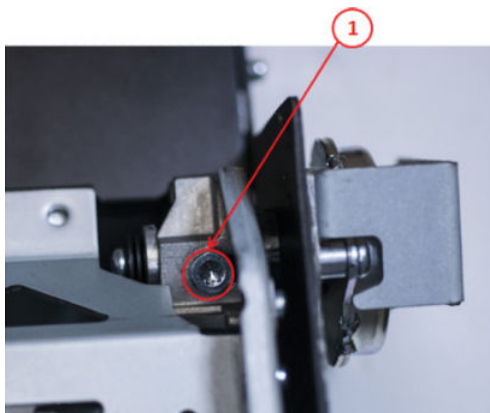


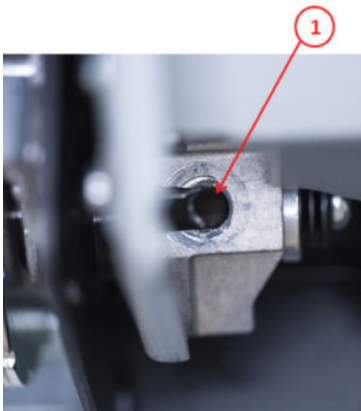
5. Tilt open the CIS bridge to decrease the spring tension (1), and remove CIS damper (2).

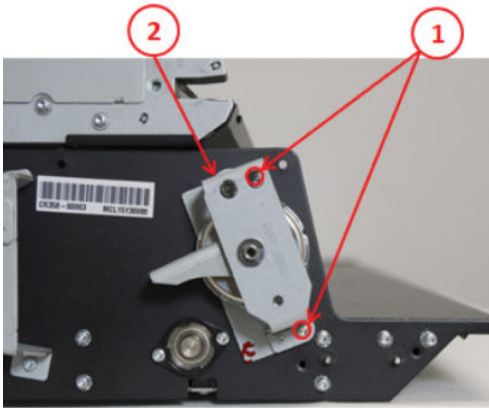

Replacement

- ▲ Replace by reversing the removal steps.


 **NOTE:** When replacing, be sure to align the holes and hold, when securing the screws (1).



CIS Scanner Latch

Removal

1. Turn the scanner off, disconnect the power cord, and remove the LHS cover. See [CIS Bridge Damper on page 443](#).
2. Remove the spring (1). See [CIS Bridge Damper on page 443](#). Remove the screws (2), and bracket (3).

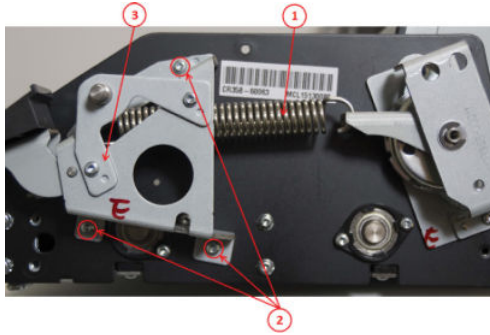


Replacement

- ▲ Replace the damper by reversing the removal steps.


Pressure Rollers

Removal

1. Turn the scanner off, disconnect the power cord, and tilt open the CIS Bridge.
2. Remove the screws (Torx 10), and pull the Roller Cover sheet out through the back.

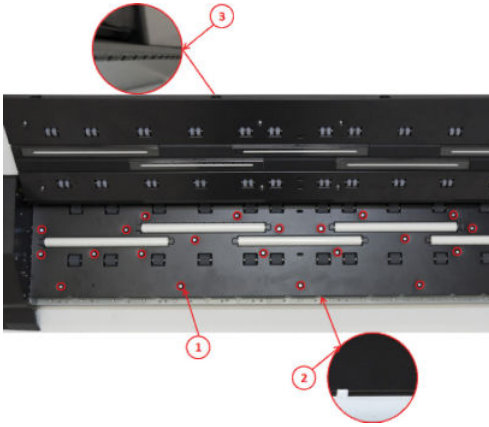


3. Gently pull the Pressure Roller out, and replace (repeat for all 5).

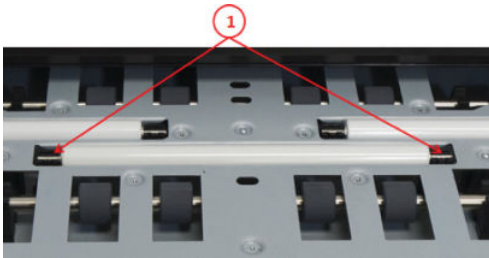

Replacement

1. After replacing the rollers, reverse the removal steps. Don't forget to calibrate the scanner.
2. Insert all screws without tightening. Align the 2 holes (A). When all screws are inserted, tighten in order 1 to 25.

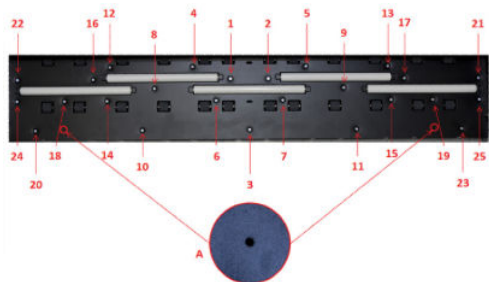

 **NOTE:** If the white rollers were replaced due to stitching and/or alignment errors, the scanner needs to be re-calibrated.

Front panel side scanner cover

Removal

1. Open the scanner cover.
2. Remove the 3 screws (Torx 10).



3. Close the scanner cover.
4. Open the scanner.
5. Remove 1 screw (Torx 10).



6. Remove the cover.

Service station side scanner cover

Removal

1. Open the scanner cover.
2. Remove the 3 screws (Torx 10).



3. Close the scanner cover.
4. Remove 1 screw (Torx 10).




5. Open the scanner.
6. Remove 1 screw (Torx 15).



7. Remove the cover.


Rear scanner cover



 **NOTE:** An angle screwdriver is needed, if not, you will have to remove scanner covers (FP and SVS side).


Removal

1. Open the scanner.
2. Remove 2 screws, 1 on each side (Torx 15).

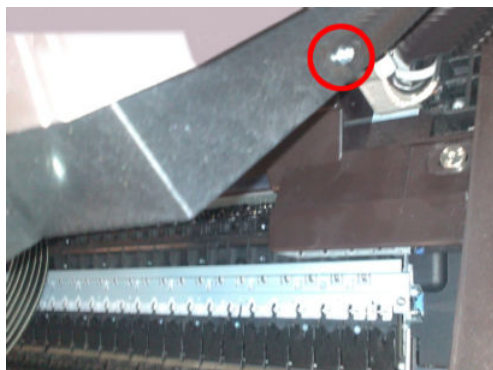


3. Remove the rear cover.

Bumper bracket

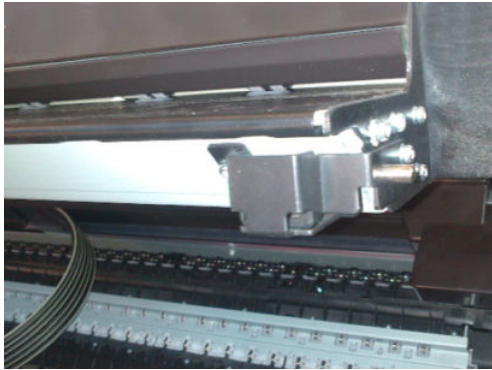

Removal

1. Open the scanner.
2. Remove 3 screws (Torx 10).

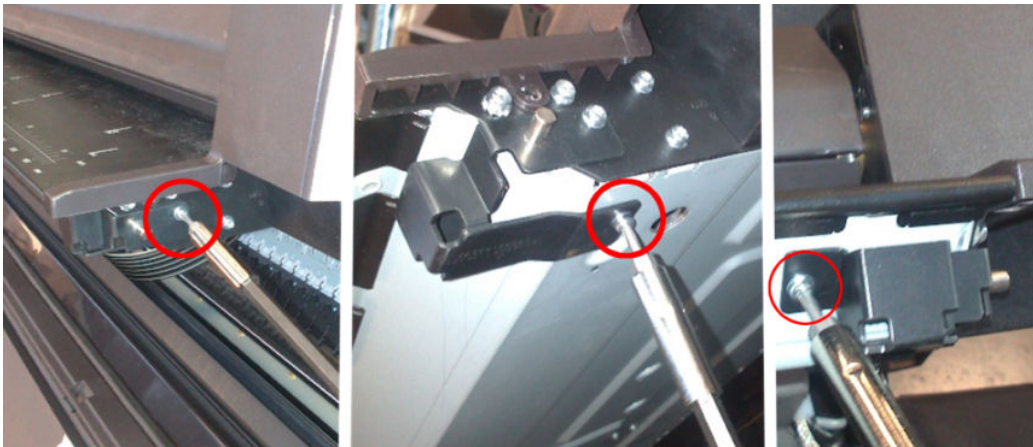

Deflector hinge

Removal

1. Remove the deflectors.
2. Remove the stacker arm cover.
3. Using a short screwdriver, remove 1 screw (Torx 20) from the hinge.



4. Remove the hinge.




NOTE: Deflector hinges are not symmetrical, make sure you install the proper one.

Lift assembly


Removal

1. Remove service station side scanner cover. See [Service station side scanner cover on page 448](#).
2. Open the scanner.
3. Remove 1 screw (Torx15).

 **WARNING!** Hold the scanner to avoid it falling. It is heavy.

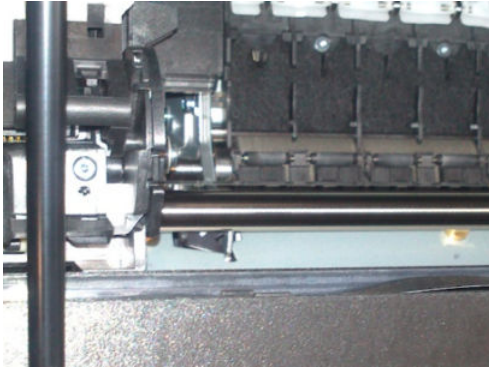


4. Remove the circlip.

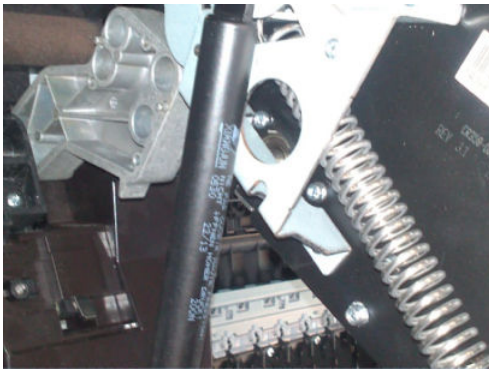


5. Remove the lift assembly. See [Lift assembly on page 452](#).

Scanner front beam bumper assembly

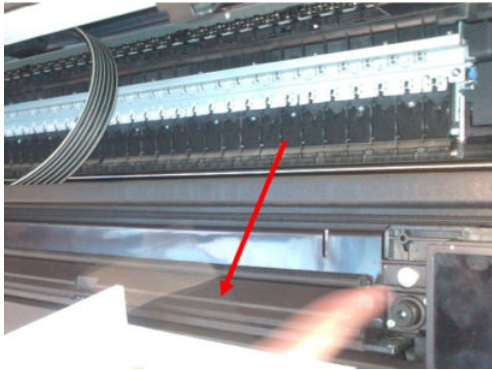


Removal

1. Open the scanner.
2. Remove 2 screws (Torx 15).

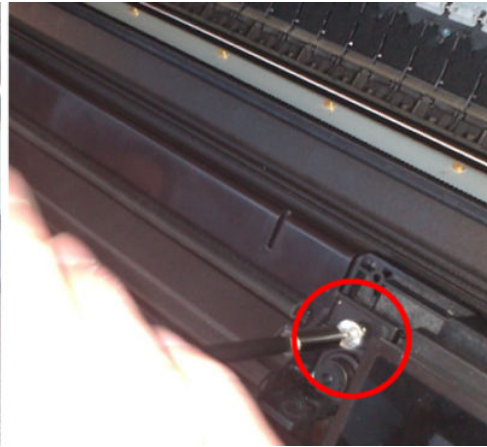

3. Open the upper roll cover.
4. Remove 3 screws (Torx 15).

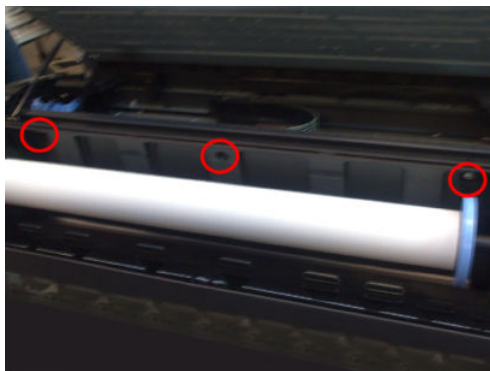


5. Unhook the 2 hooks, and remove the bumper.


Scanner latch hook assembly

Removal

1. Remove 1 screw (Torx 15) on the downer piece.

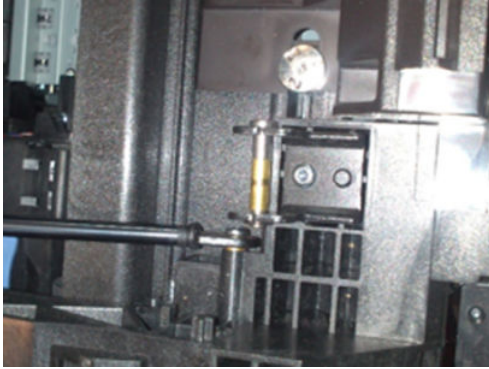

2. Remove the service station side scanner cover. See [Service station side scanner cover on page 448](#).
3. Remove 3 screws (Torx 15) on the upper piece.

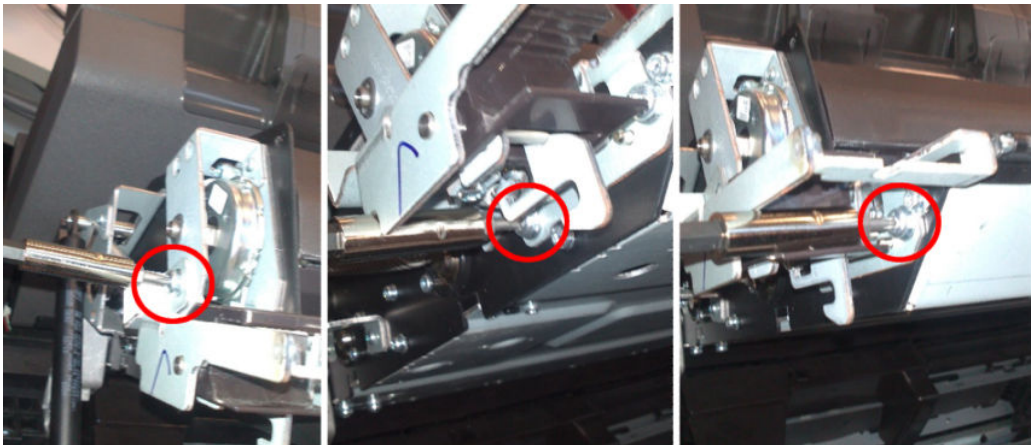

Top scanner cover

Removal

1. Open the scanner.
2. Remove 4 screws (Torx 15).



3. Close the scanner.
4. Remove the piece.


Batch scanning piece

Removal

1. Open the scanner cover.
2. Remove the 4 screws (Torx 15).



3. Open the scanner cover lid.

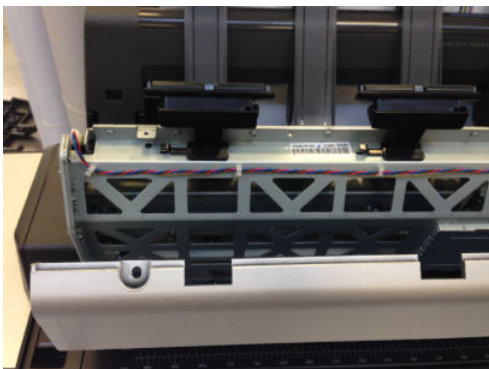

4. Replace the broken batch scanning piece.


Card Reader Accessory

API Technologies Corp provides Netgard Card Reader devices compatible with the HP Designjet T2500 ePrinter series.

Setup and configuration

Setup requirements:

- MRY_02_00_03.4 firmware or later installed in the printer.
- The printer is connected to a router/switch that interfaces with.
- The Card Reader is connected to the router/switch.
- A WebApp developed by API is installed in the MFP.

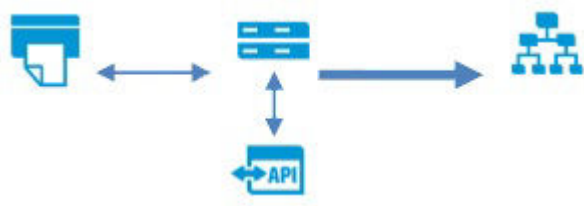

What is provided?

- Outgoing printer information is blocked, stopping the ability to submit scans to the net unless the user identifies himself with an ID Card in the Card Reader.
- The Scan and Copy Icons are removed from the Front Panel.
- The scanned jobs are removed from the queue.

Support

HP is not supporting the Card Reader. This is supported by the Card Vendor.

In case of network problems, try these troubleshooting steps:

- Unplug the printer from the secured network and try directly connecting it to a PC or an open unsecured network, then try to reproduce the issue.
- Uninstall the WebApp and try to reproduce the issue.

7 Maintenance

- [Preventive Maintenance](#)
- [Preventive Maintenance Kits](#)


Preventive Maintenance

Cleaning the Product

To maintain the product in good operating condition, keep it free of accumulated dust, ink, and other contamination. Cleaning intervals are determined by the product environment and by the types of product supplies used.


General Cleaning

Proper general cleaning should include the following:

 **NOTE:** To prevent electric shock, make sure that the product is switched OFF and unplugged before any cleaning is performed. Do **not** let any water get inside the product.

1. Blow away dust accumulation with compressed air if available.
2. Clean the outer surface of the product with a damp sponge or cloth. Use a mild soap and water solution if necessary. Do not use abrasive cleaners.
3. Wipe the product dry with a soft lint-free cloth.

Cleaning the Drive Roller


 **NOTE:** If ink is spilled on the Overdrive, remove the ink. Due to the ink's reflectance, ink on the Overdrive can disrupt the product's edge-sensing function. To remove any ink from the Overdrive, perform the following procedure: Prevent water or other liquids from running onto electrical components or circuits, or through openings in the Electronics Module.

1. Perform the Turn Drive Roller Utility. See Turn Drive Roller.
2. Open the Window.
3. Apply any common household cleaning solution (water based only) to a soft, lint-free rag and apply it to the Drive Roller and Overdrive surface while it is rotating. Make sure that you thoroughly clean the Drive Roller and Overdrive surface.
4. Press **Enter** when you have completed the cleaning procedure.
5. Allow the Drive Roller to dry before loading paper in to the product.


Cleaning the Encoder Strip

1. Make sure that the product is not printing and that the Carriage Assembly is located at the front panel side of the product. Turn off the printer.

- Using tap water and a small cloth that will not leave fibers in the product, dampen the cloth and remove any excess water so that the cloth is damp but not wet.

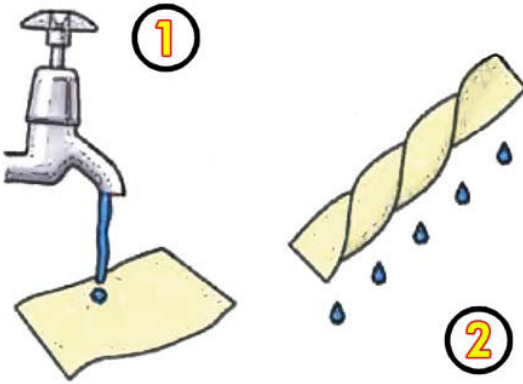

- Open the Window.
- Hold the cloth in an inverted “U” shape around the Encoder Strip and carefully wipe until no ink residue appears on the cloth. Be very careful not to scratch the Encoder Strip with your fingernail or any other object. Make sure that you are holding the cloth correctly.


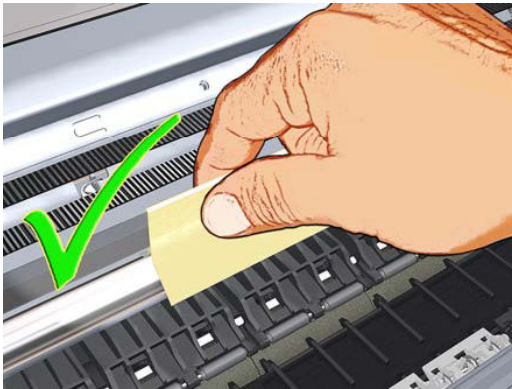


- Open the window and move the Carriage Assembly further to the left, allowing you to access the front panel side.
- Turn the product back on.

Clean the scanner's glass plate

You are recommended to clean the scanner's glass plate periodically, depending on how often you use the scanner.


1. Turn off the printer using the **Power** key at the front, then also turn off the power switch at the rear and disconnect the power cable.
2. There is a small lever at the rear left of the scanner. Slide the lever up and open the scanner cover.

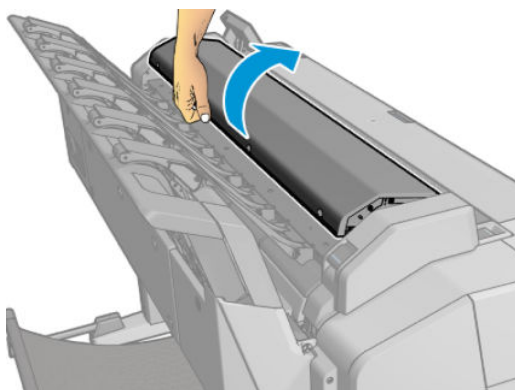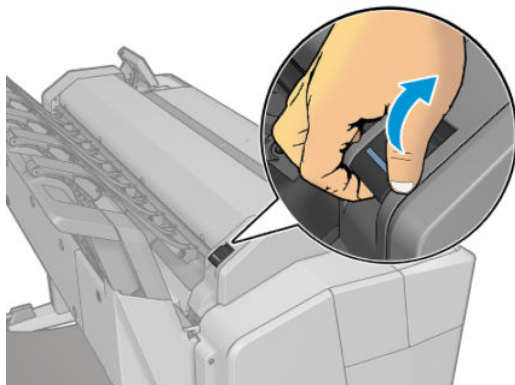

⚠ WARNING! Do not lift the scanner while the scanner cover is open. Your fingers or hand may be trapped or crushed.

3. Gently wipe the glass plate and the surrounding area with a lint-free cloth dampened with water and then wrung dry. A suitable cloth is provided with the printer.




⚠ CAUTION: Do not use abrasives, acetone, benzene or fluids that contain these chemicals. Do not spray liquids directly onto the scanner glass plate or anywhere else in the scanner.

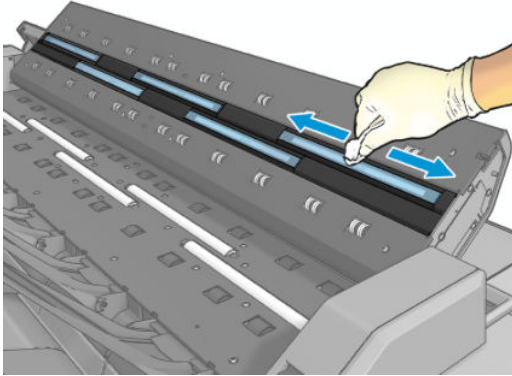



Do not worry about tiny droplets of water left on the glass: they will evaporate.

4. Optionally, for more thorough cleaning:
 - Remove the glass plate and clean it on both sides.

- Clean the pressure rollers and the feed rollers.

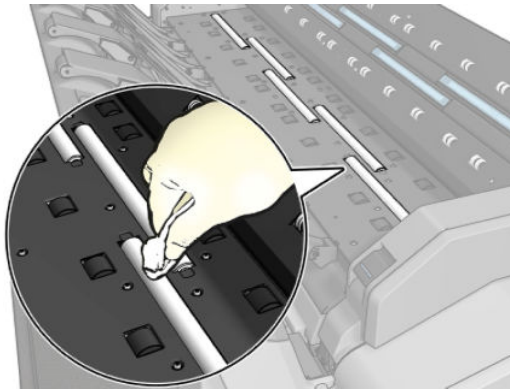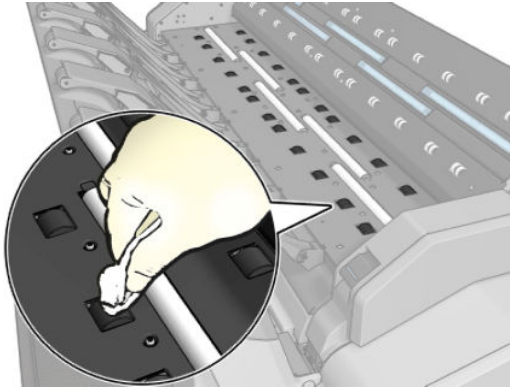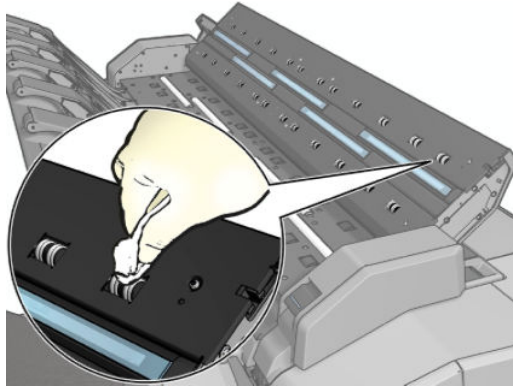

5. Close the scanner cover and gently push it down to lock it into place.

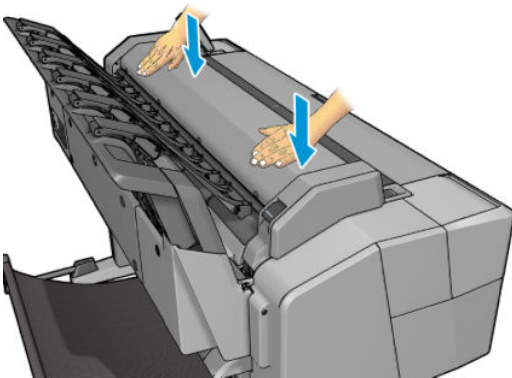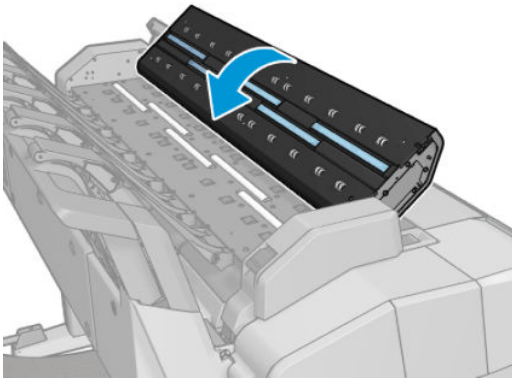

6. Clean the area immediately in front of the scanner, where the scanned sheet rests before scanning.
7. Reconnect the printer's power cable, turn on the power switch at the rear, and turn on the printer using the [Power](#) key.

Carriage Assembly Lubrication

To ensure correct operation of the product you must lubricate the Carriage Assembly whenever any of the following are encountered if:

- The Front Panel displays "Maintenance #1 required".
- There is excessive noise when moving the Carriage Assembly.
- A shut down of the carriage PWM error message appears.
- There are IQ (vertical banding problems). You should also lubricate the Carriage Assembly whenever you change any of the following service parts:
 - The Carriage Rear Bushing.
 - The Carriage Assembly.
 - The Carriage Rail Oiler.

To lubricate the Carriage Assembly you will require the Lubrication Kit (Q5669-60692). Use the following procedure to lubricate the Carriage Assembly:

1. Use the IPA alcohol (Q6675-60070) and the cleaning cloth to clean the Carriage Rail and the Carriage Slider Rod. Do not use IPA alcohol in California or other areas that restrict the volatile organic compound (VOC) content of cleaning solvents. A regulatory compliant alternate should be used.
2. Use an Oil Dispenser (Q6675-60062) to lubricate the Carriage Rail and the Carriage Slider Rod.
3. Replace the Carriage Rail Oiler with the new one contained in the kit and add 2 or 3 drops of oil to the foam of the Carriage Rail Oiler.
4. Use an Oil Dispenser (Q6675-60062) to lubricate the Carriage Rear Bushing.

Moisture on the Product

Users should use the product in an environment between 20% and 80% relative humidity. To recover from moisture condensation, turn the product Off, and, using the main roller as a reference, wait until the product is completely dry before using it again.

Noisy Carriage Bushing

To prevent noisy movement of the carriage, remove aluminum or dust particles from the bushing at the back of the carriage, and from the slider path along which the bushing moves. Lubricate the slider path using the Lubrication Kit (Q5669-60692).

Noisy Service Station

To prevent or to remove squeaking noise coming from Service Station side of the printer, please follow next steps:



NOTE: This noise does not affect to the functionality of the printer.


Troubleshooting:

- The squeaking noise is related with friction in the gears of transmission plate of the Service Station
- Make sure that the printer has the latest firmware installed, available from: www.hp.com/go/T1500/software
- Get a new lubrication kit: **CR357-67090** Mercury Grease Kit 3cc Syringe

Each Mercury Grease Kit 3cc Syringe (CR357-67090) contains:


- Nitrile Gloves x 1 pair
- Lubricant 6040-1451 in 3cc syringe set
- 2" x 2" Lint Free Cotton

- MSDS

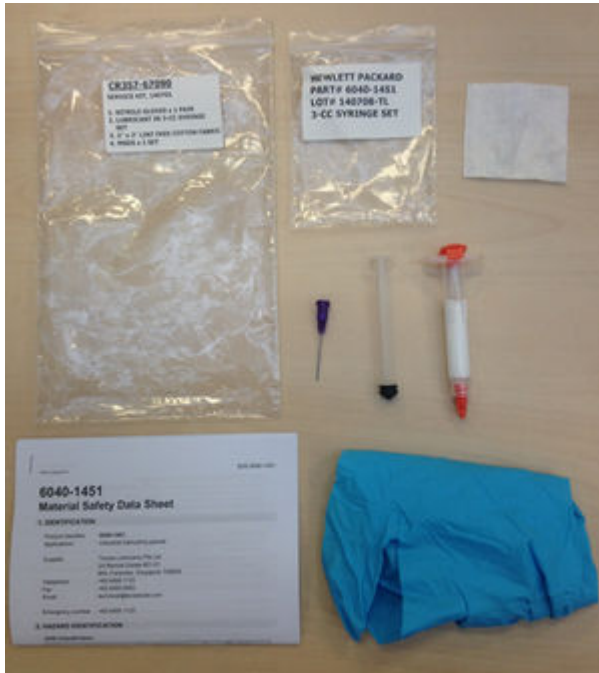


Application instructions

1. Power off the printer.
2. Record printer Serial Number (CNxxxxxxx).
3. Remove Main Cover (service station side). See [Main cover \(service station side\) on page 283](#).
4. Record Service Station Serial Number. See image below.

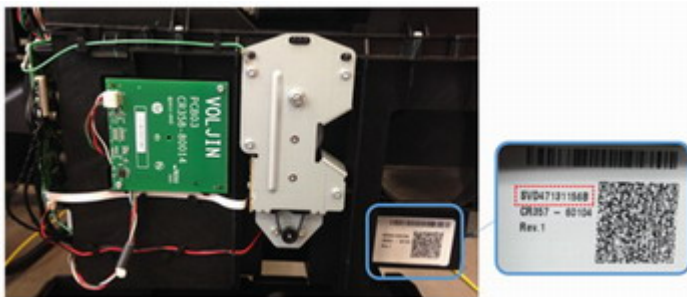


5. Disconnect and take out from route location the encoder cable and motor cable.

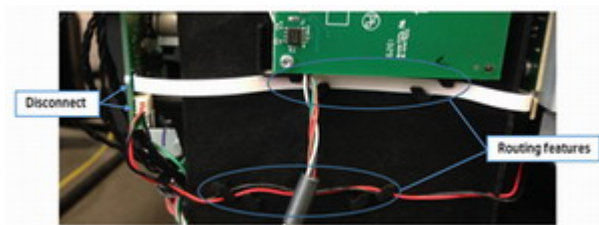


6. Loosen the 4 screws and the grounding cable.



7. Place the transmission plate on a table.

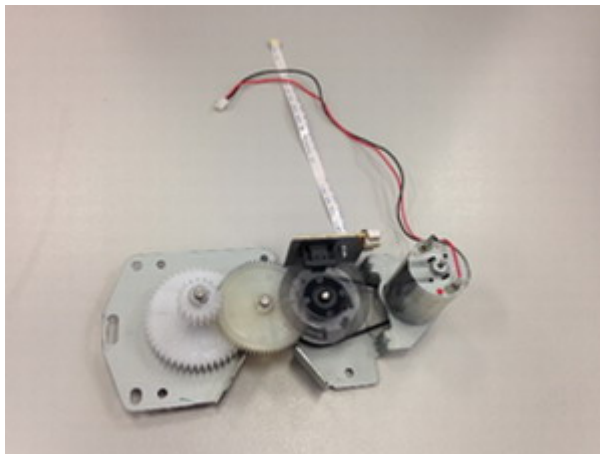

8. Open the bag 6040-1451. Mount the syringe.

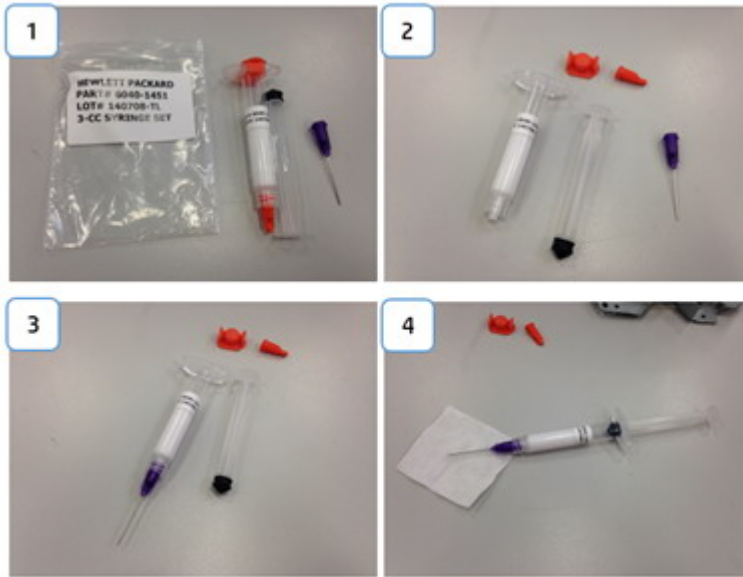


9. Grease must be applied in both slots that are in the Gear 2.




10. Place the tip of the needle in the slot and inject grease until it covers the slot. Repeat this step in both slots.


⚠ CAUTION: Be careful to not stain with grease the encoder.

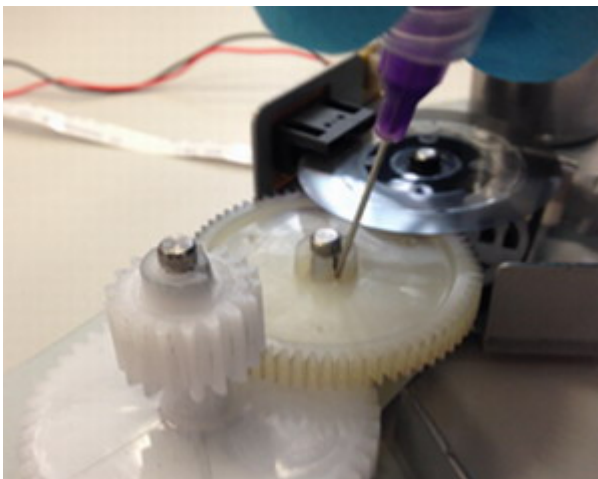


11. Clean the remaining grease with the lint free cotton. After cleaning it should look like in the image below.

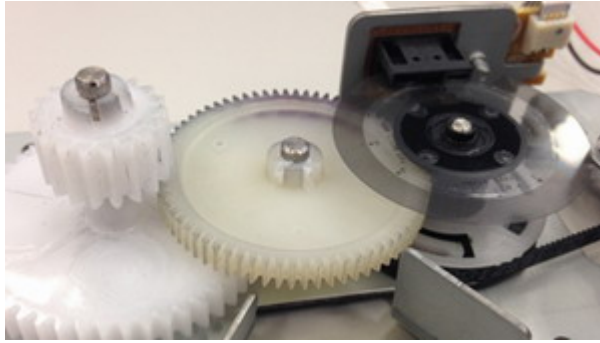


12. Reassemble the Transmission Plate in the Service Station. First screw the Grounding Cable.

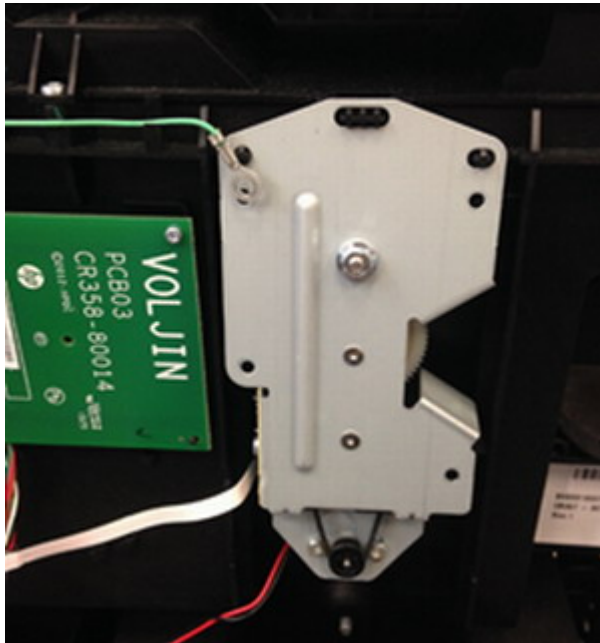


13. Route the cables carefully and reconnect them again.

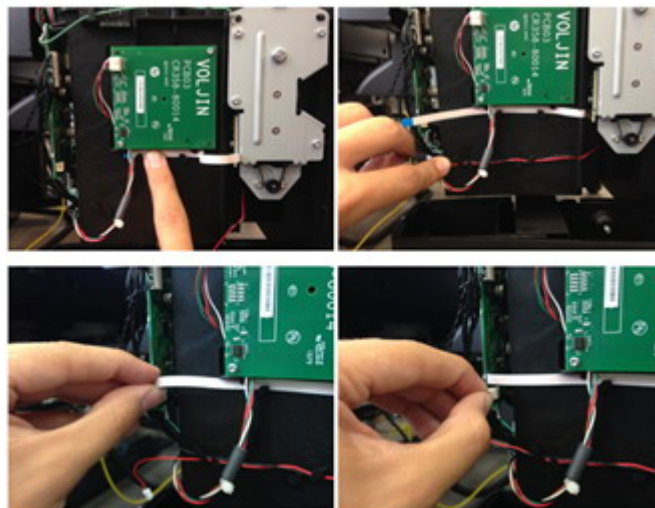

14. Mark with a dot at the left bottom of the Service Station label to have a visual check of the reworked units.

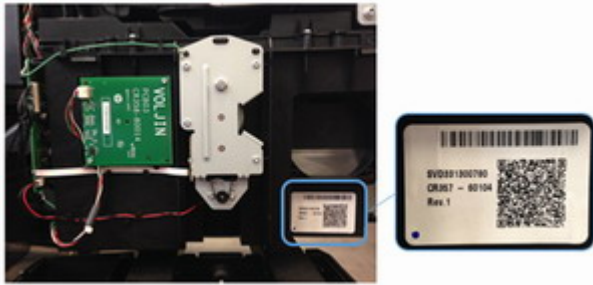

15. Disassemble the syringe and save it for the next time.

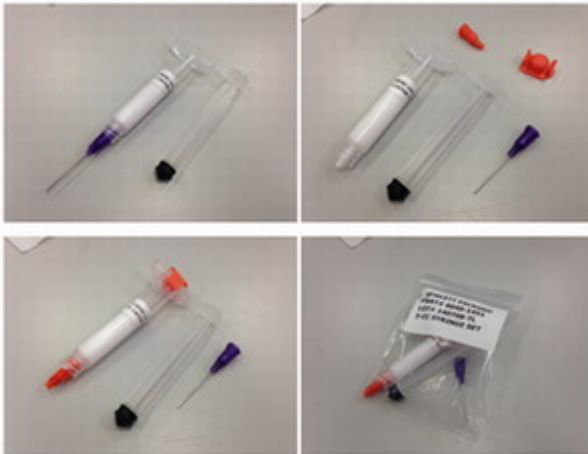

Belt Swelling

To prevent new belts from swelling incorrectly, keep them in their bags with desiccant until you need to install them.

Level of Product Usage

Normal product use means 3,000,000 Carriage Cycles (which corresponds to approximately 32,000 A0 prints on average). Under normal usage conditions, it will be approximately 5 years before the product needs maintenance. If the product is used more than the normal usage conditions, then it will need maintenance service much more frequently.

One of the EEROM counters is assigned to counting the number of carriage cycles.

Service Part	LIFE_VALUE	Maintenance Advice
Belt Cycles	3,000,000	PMKIT1
Bushings Life	3,000,000	PMKIT1
Trailing Cable Cycles	3,000,000	PMKIT1
Scan Axis Cycles	3,000,000	PMKIT1
Scan Axis Distance Covered	4,500,000	PMKIT1

Service Part	LIFE_VALUE	Maintenance Advice
Tubes Cycles	3,000,000	PMKIT1
Service Station Volume	750,000,000	PMKIT2

When these components of the product exceed this amount, the Front Panel displays the following message:

"Maintenance #1 required"

"Maintenance #2 required"

Once one of the maintenance advised messages is displayed, the relevant preventive maintenance kit must be used to replace the most worn parts of the product. See Removal and Installation when replacing the necessary parts.

Preventive Maintenance Kits

There is no preventive maintenance kit for the cutter, which is expected to last for the life of the product.

Preventive Maintenance Kit #1 (CR357-67072)

- Scan Axis Motor
- Belt
- Carriage
- Cutter
- Carriage PCA
- Encoder Strip
- Ink Tubes and Trailing Cable



NOTE: The Lubrication Kit is not included in the Preventive Maintenance Kit.




Preventive Maintenance Kit #2 (CR357-67073)

- Service station
- Line Sensor




8 Customer Self Repair Flyers









- [Starwheel](#)
- [Cutter](#)
- [Stacker arm](#)
- [Ink covers](#)
- [Leg, front-panel side](#)
- [Leg, service-station side](#)
- [Bottom roll cover](#)
- [Top roll cover](#)
- [Carriage latch](#)
- [Basket](#)
- [Pinch arm top roll](#)
- [Pinch arm bottom roll](#)
- [Scanner's glass plate](#)

Designjet T9x0 and T15x0 ePrinter Series Starwheel

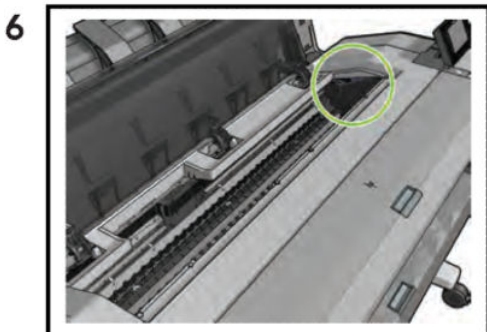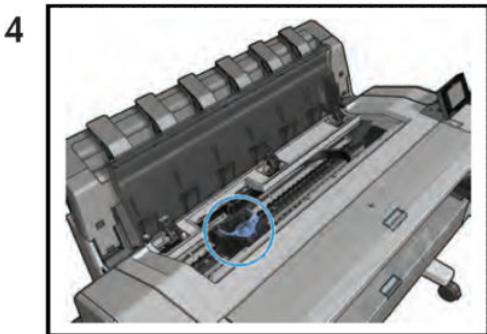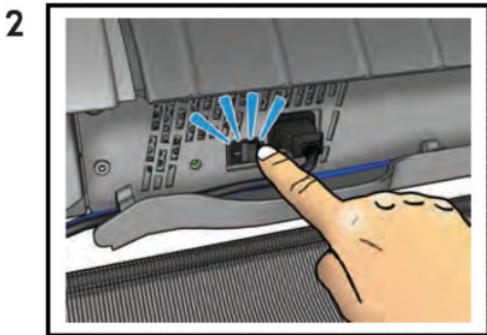




- EN: > > Replace printhead
- FR: > > Remplacer la tête d'impression
- IT: > > Sostituisci testina
- DE: > > Druckkopf ersetzen
- ES: > > Sustituya el cabezal de impresión
- PT: > > Substituir cabeçote de impressão
- CA: > > Canvieu el capçal d'impressió
- ZH: > > 更换打印头
- TW: > > 更換印字頭
- JA: > > プリントヘッドを交換してください
- KO: > > 프린트 헤드 교체
- RU: > > Заменить печатающую головку
- PL: > > Wymień głowicę drukarki

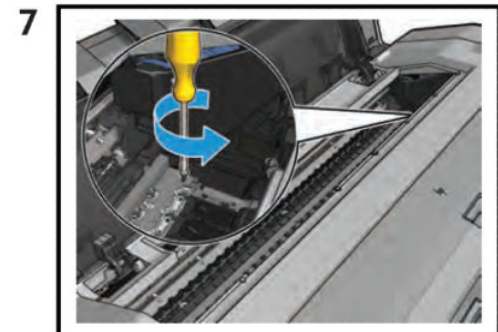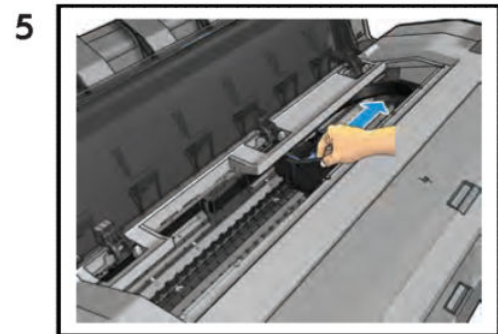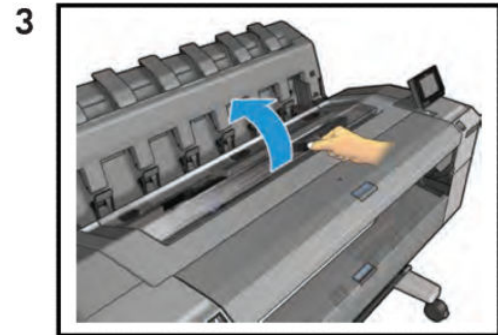

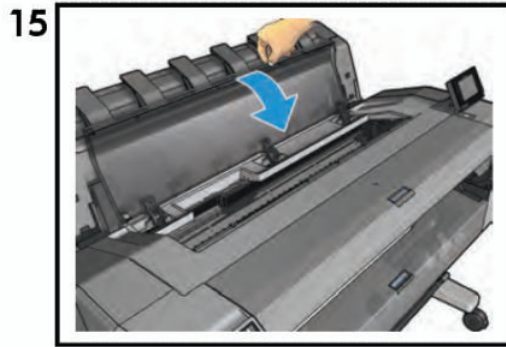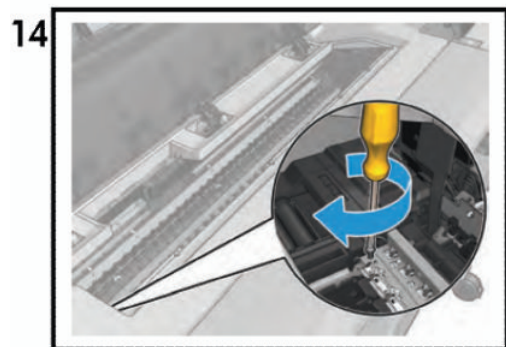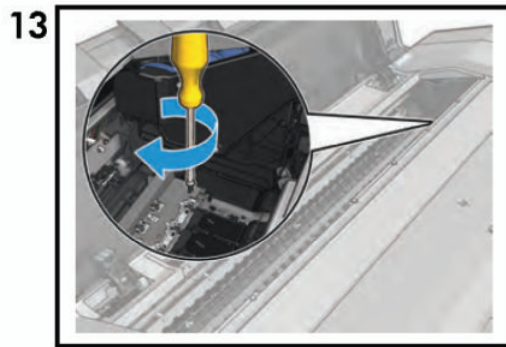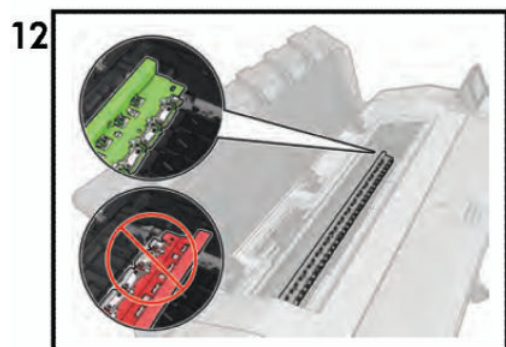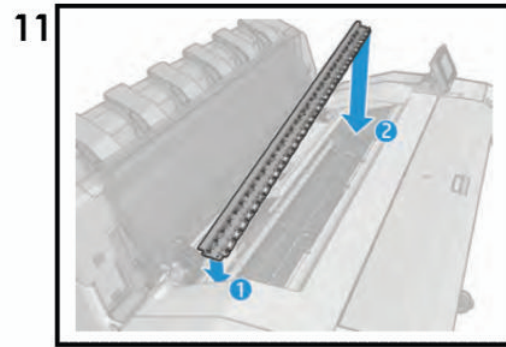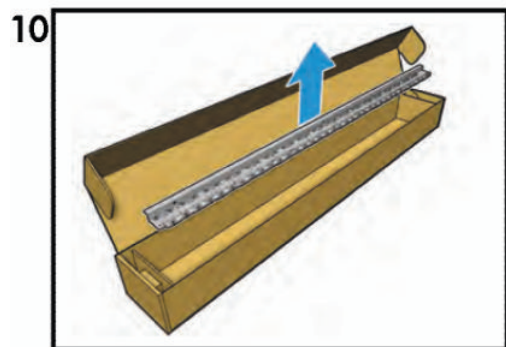
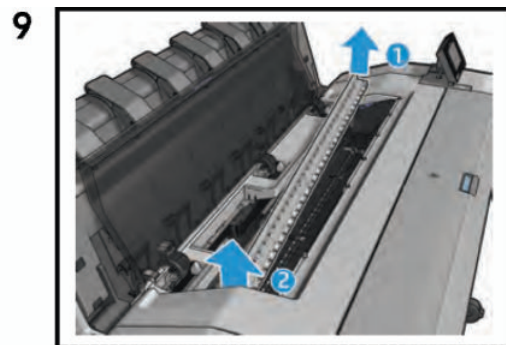
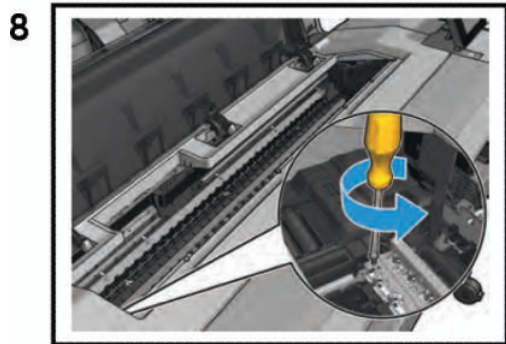






Cutter

Designjet T9x0 and T15x0 ePrinter Series Cutter

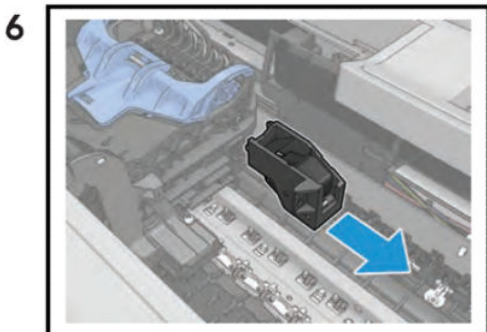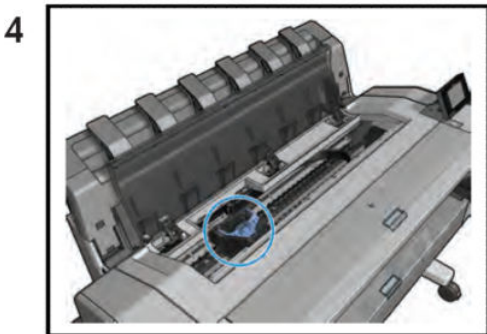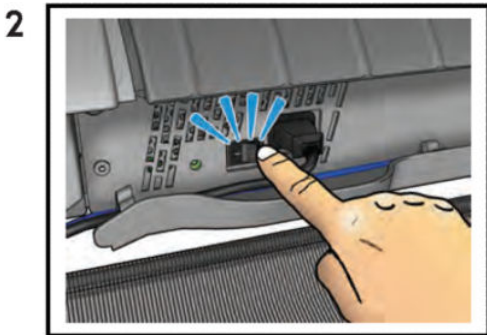








- EN: > Replace printhead
- FR: > Remplacer la tête d'impression
- IT: > Sostituisci testina
- DE: > Druckkopf ersetzen
- ES: > Sustituya el cabezal de impresión
- PT: > Substituir cabeçote de impressão
- CA: > Canvieu el capçal d'impressió
- ZH: > 更換打印頭
- TW: > 更換印字頭
- JA: > プリントヘッドを交換してください
- KO: > 프린트 헤드 교체
- RU: > Заменить печатающую головку
- PL: > Wymień głowicę drukarki

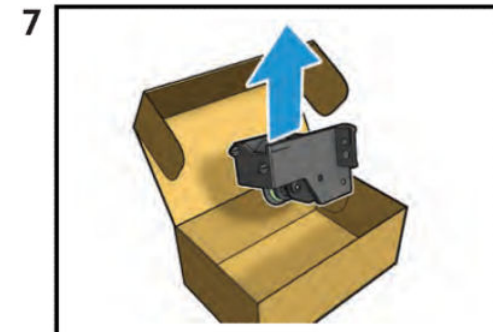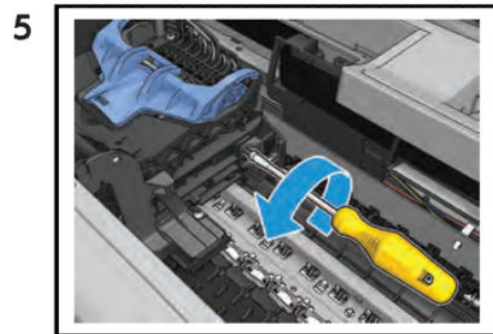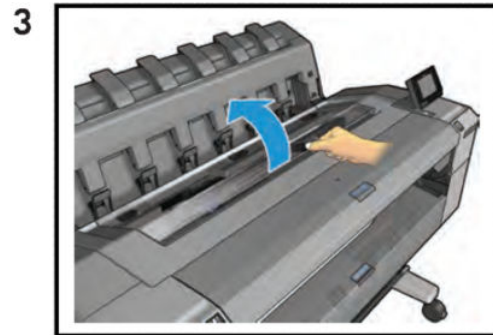

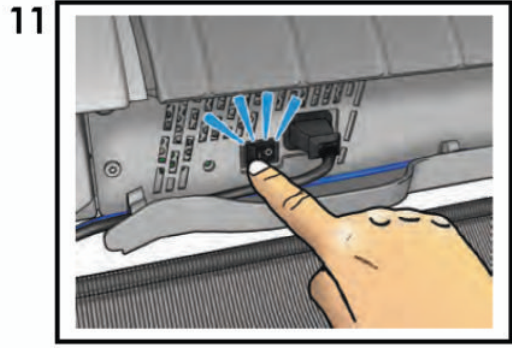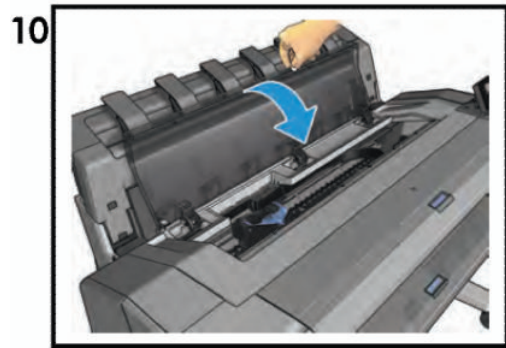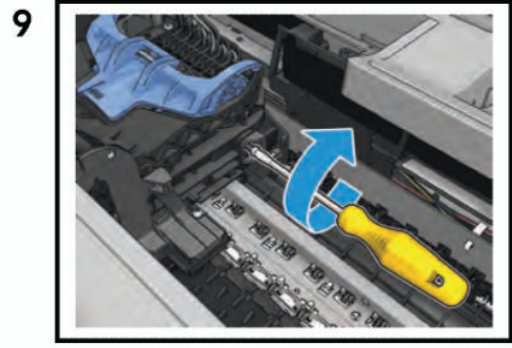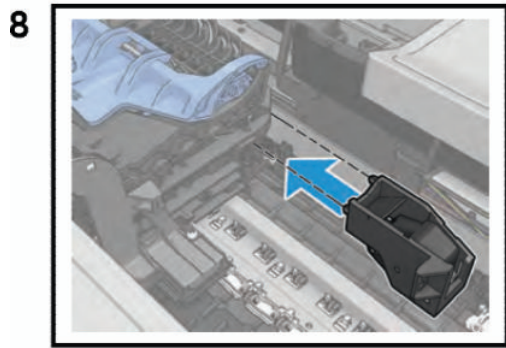



Stacker arm

Designjet T9x0 and T15x0 ePrinter Series Stacker arm

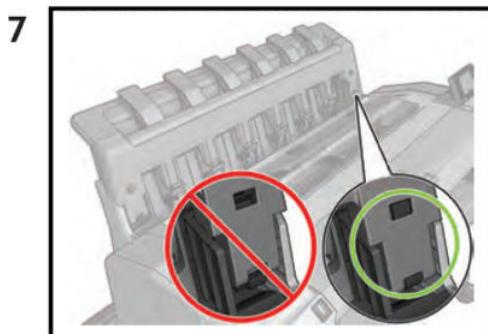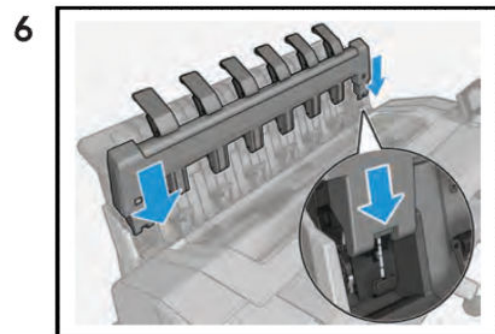
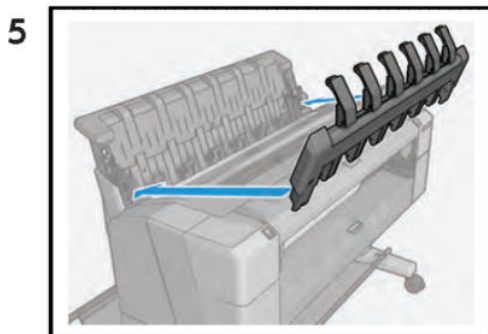
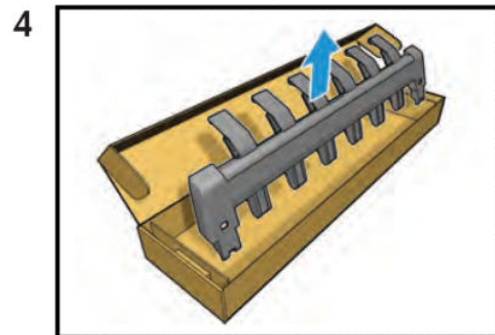
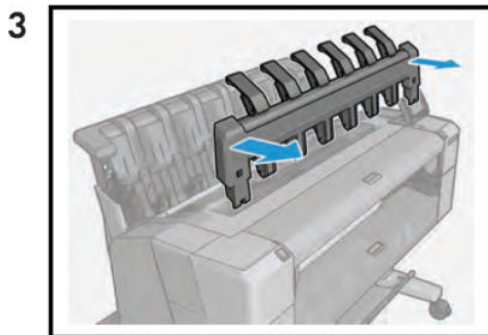
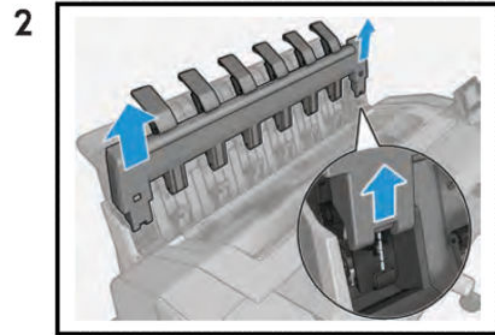
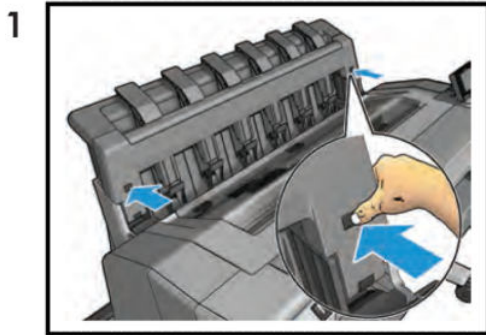


Ink covers







Designjet T9x0 and Tx5x0 ePrinter Series Ink covers

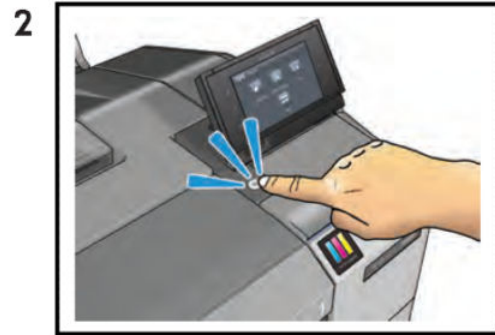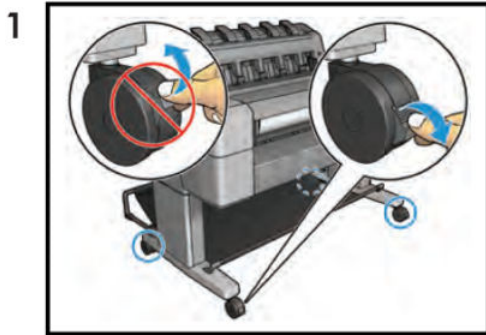

Service-station side

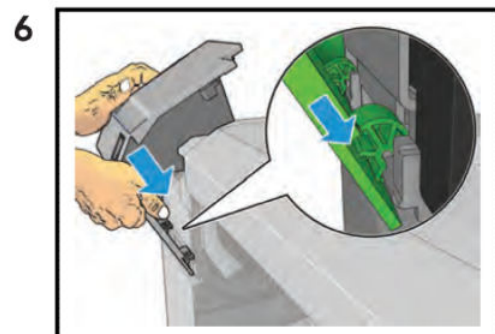
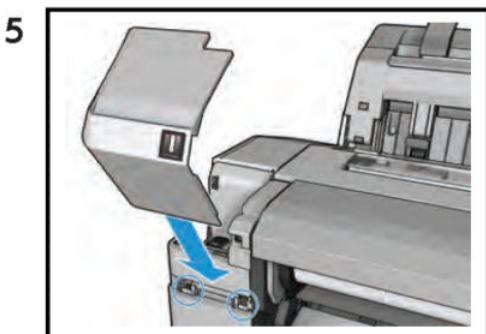
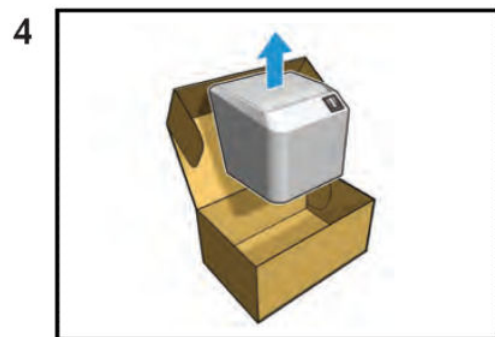
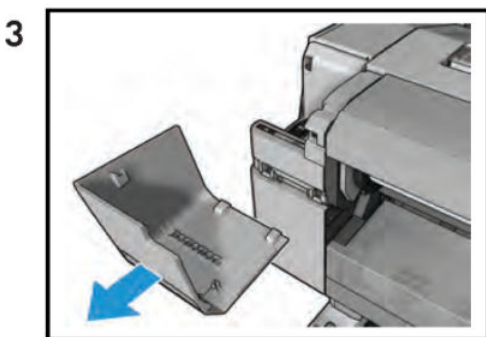
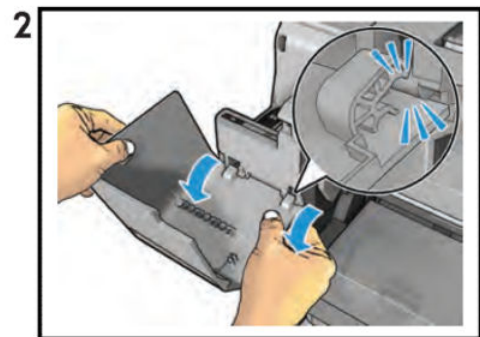
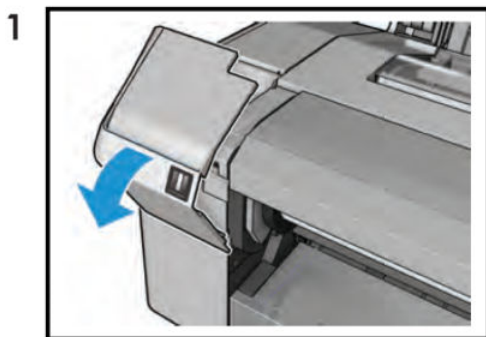










Front-panel side

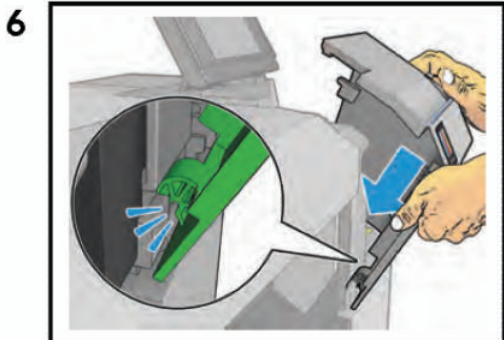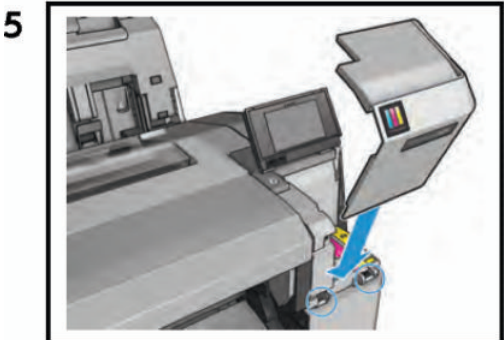
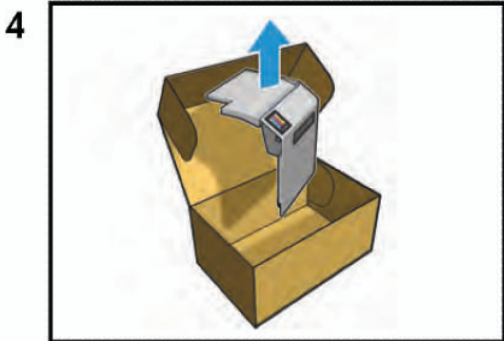
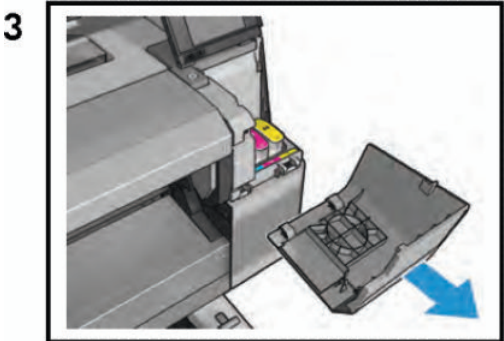
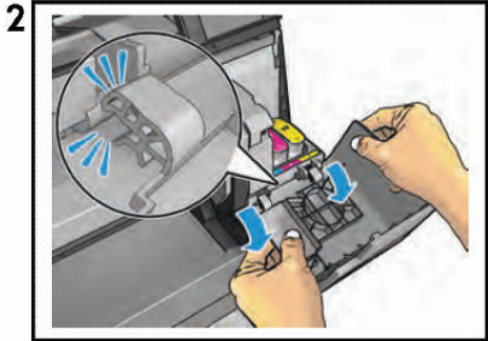
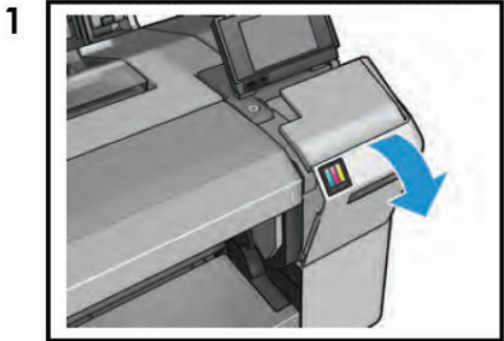


Leg, front-panel side

Designjet T9x0 and T15x0 ePrinter Series Leg, front-panel side

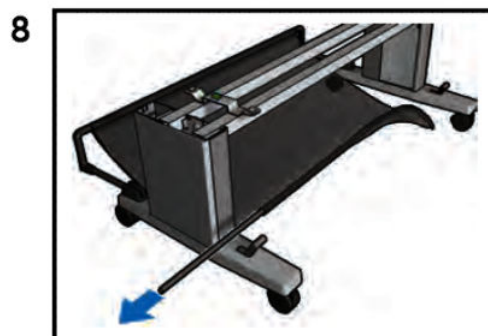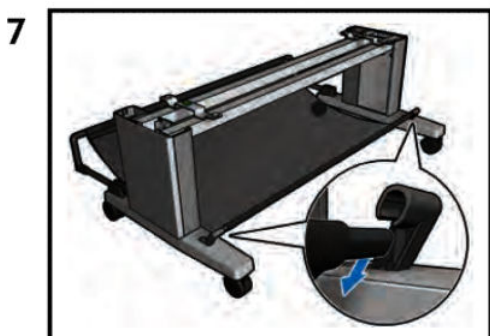
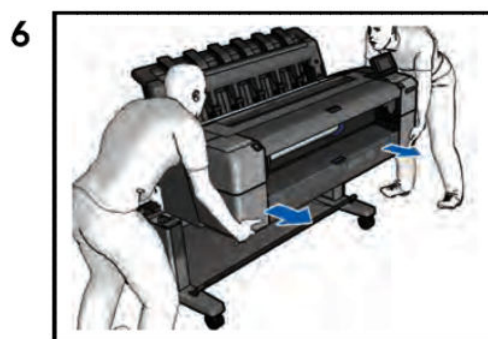
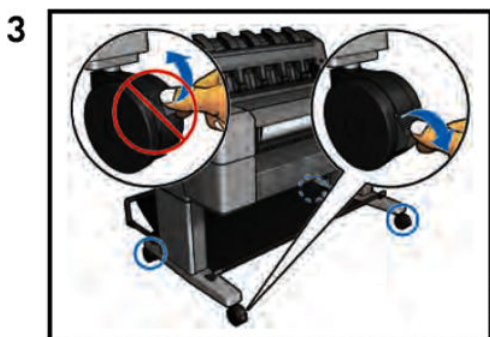
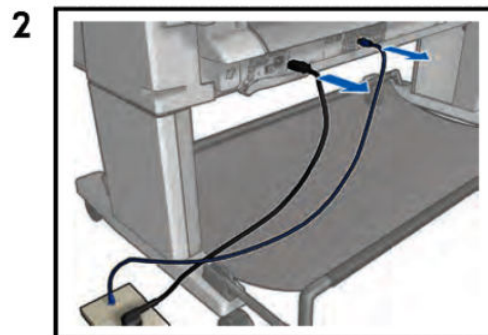
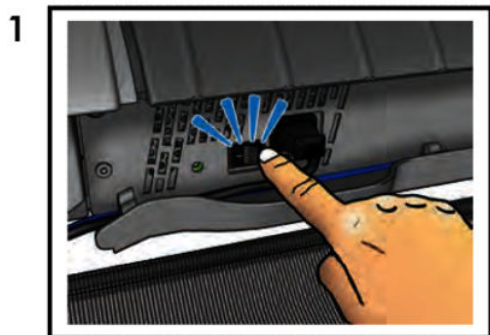


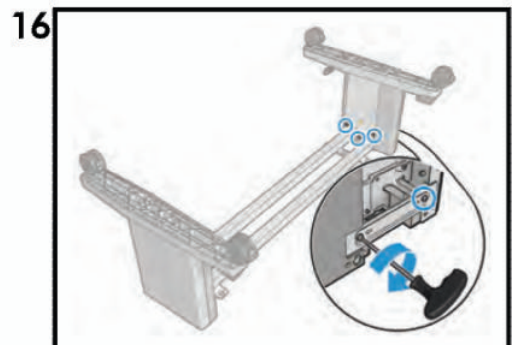
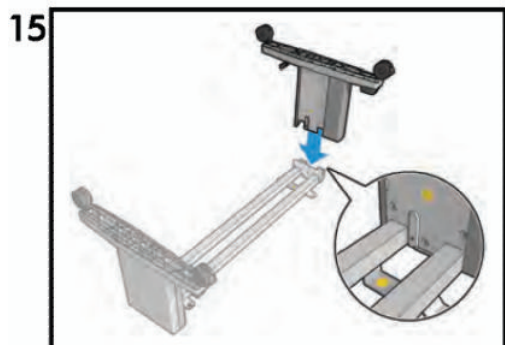
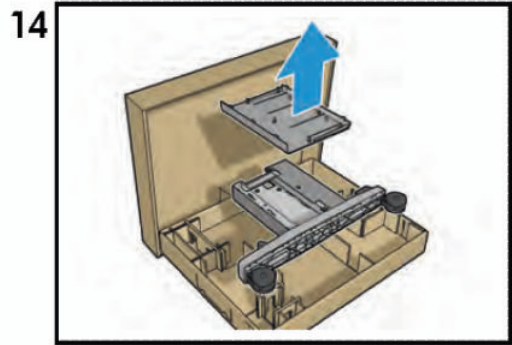
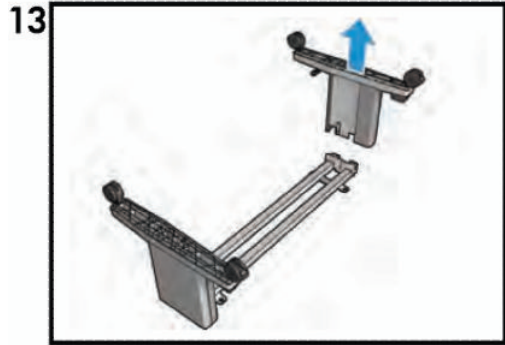
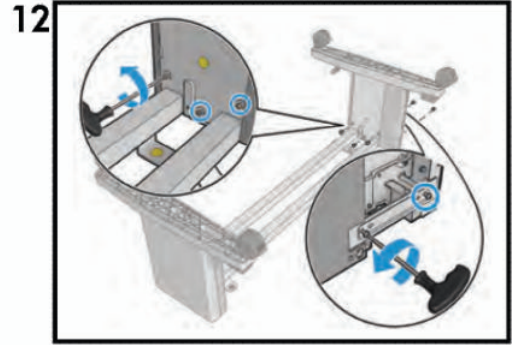
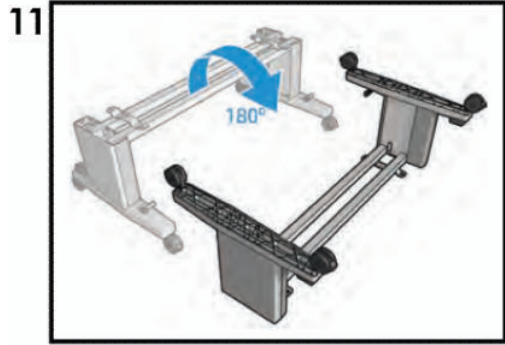
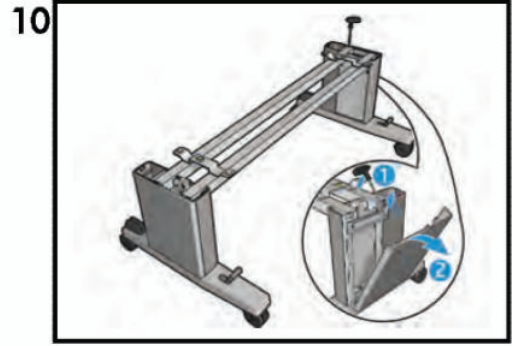
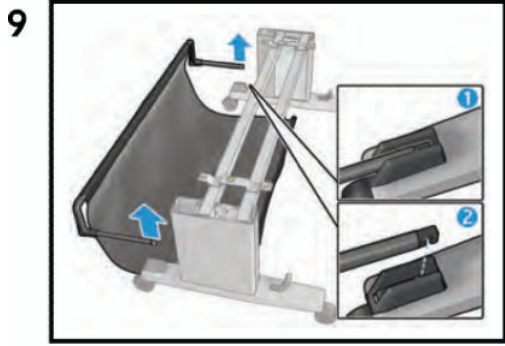


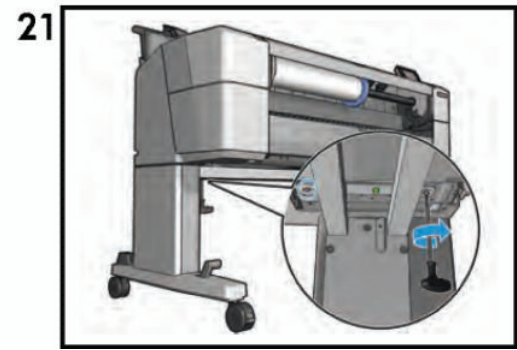
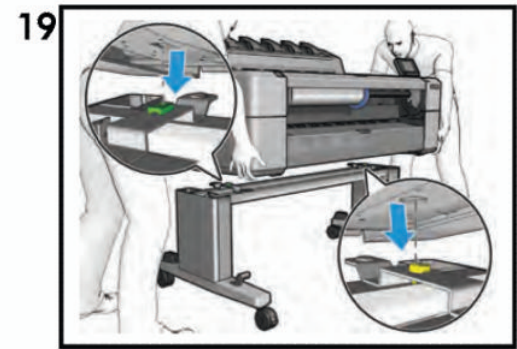
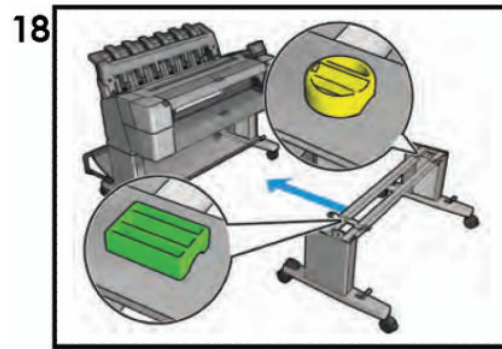
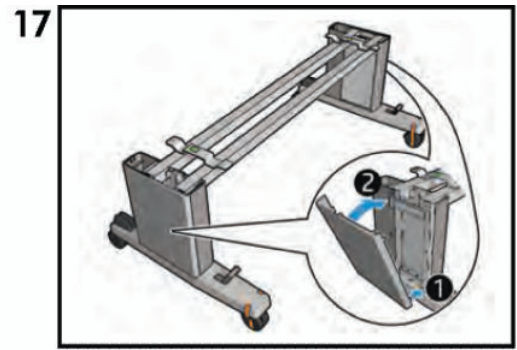
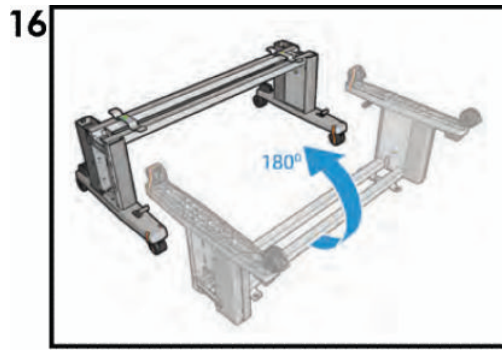


Leg, service-station side

Designjet T9x0 and T15x0 ePrinter Series Leg, service-station side




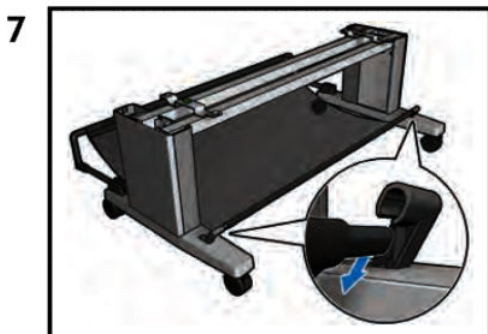
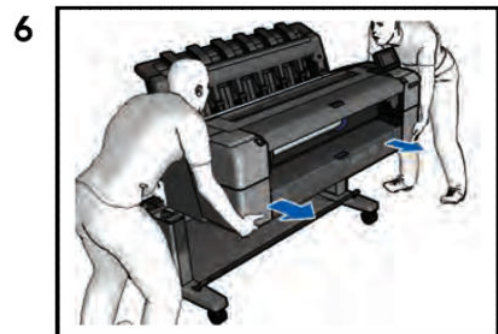
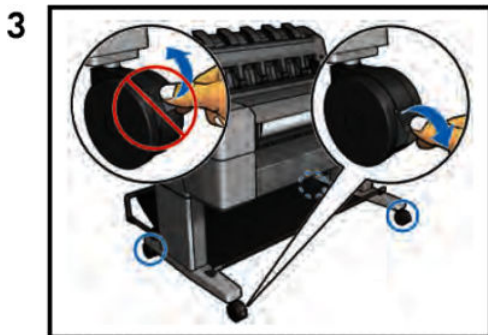
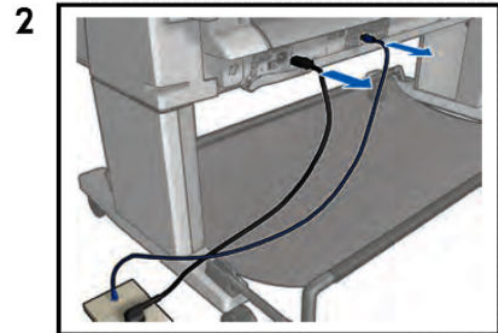
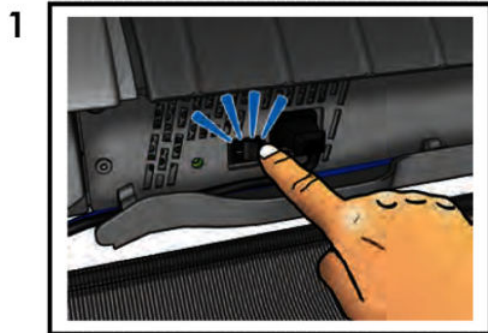


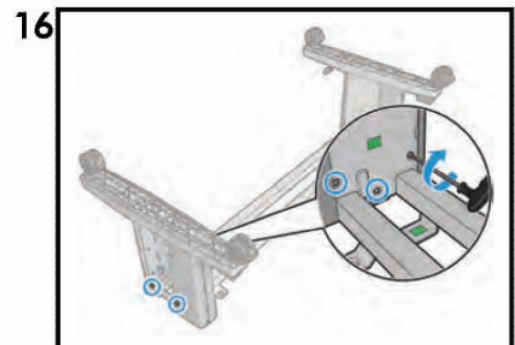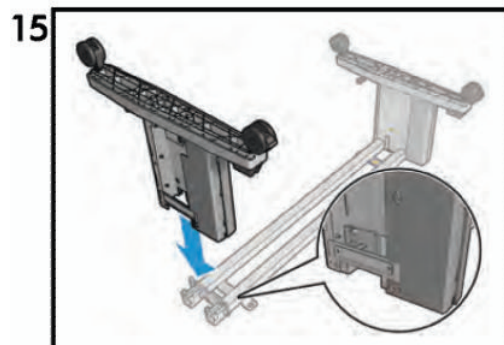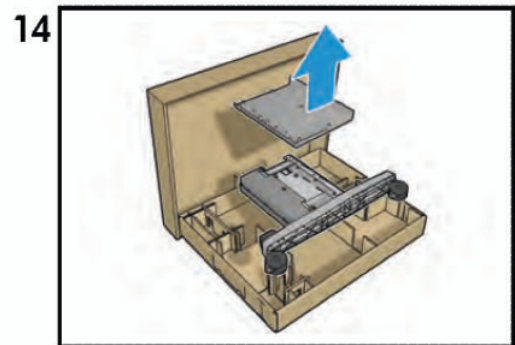
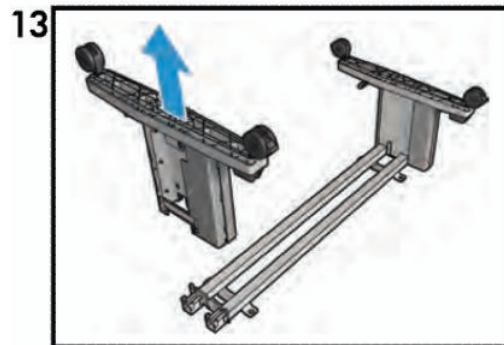
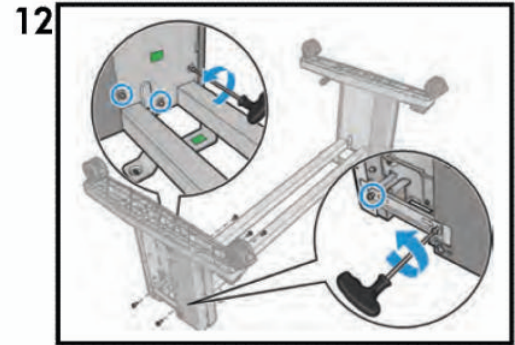
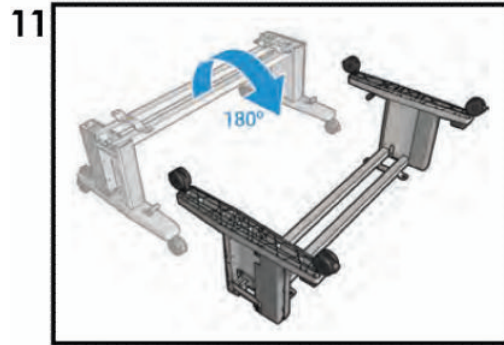
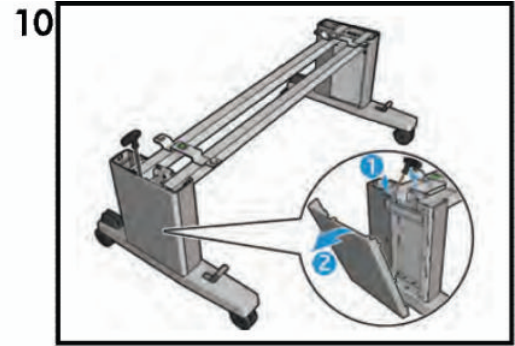
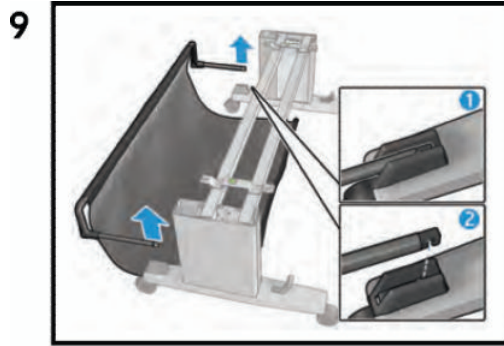


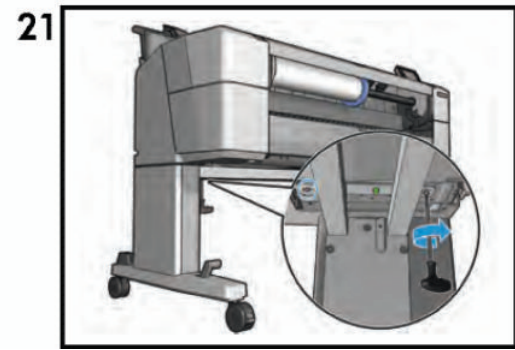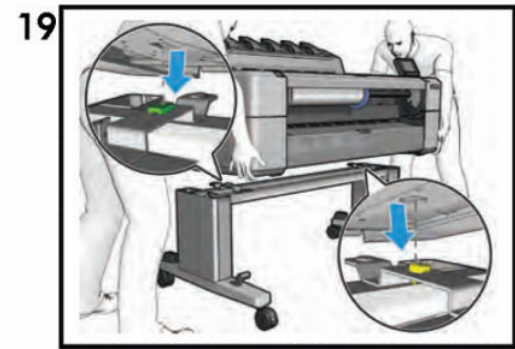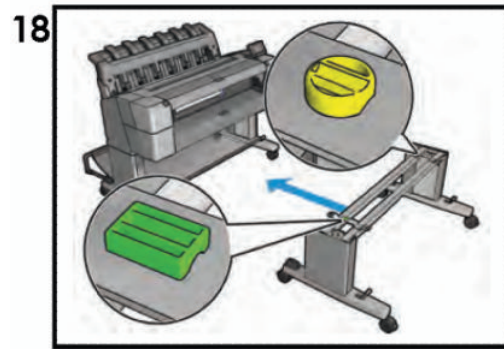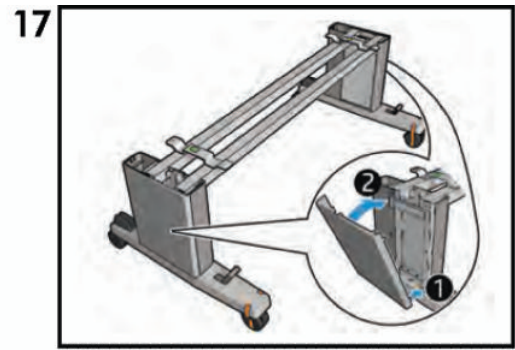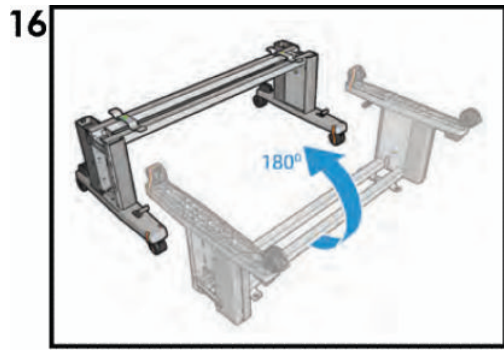

Bottom roll cover









Designjet T9x0 and Tx5x0 ePrinter Series Bottom roll cover

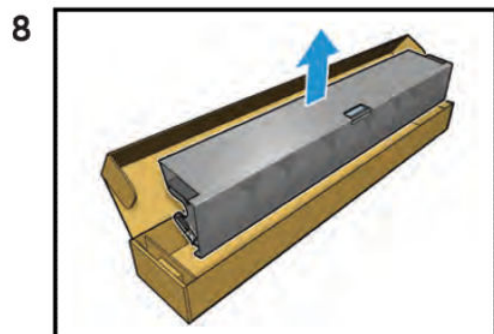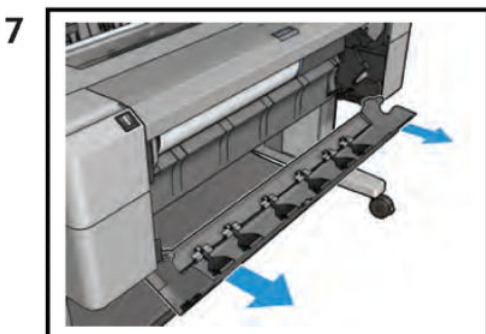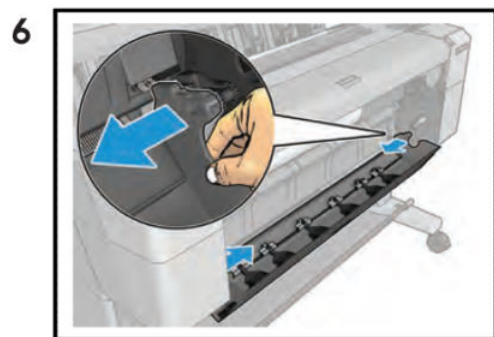
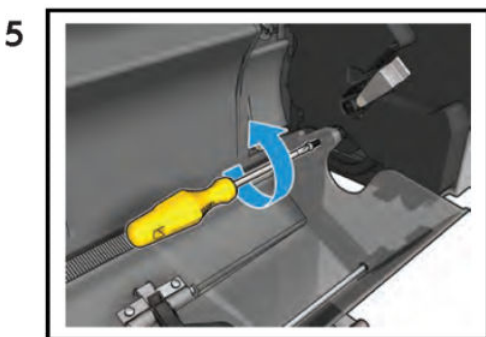
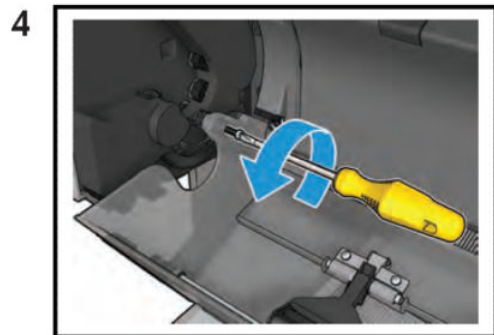
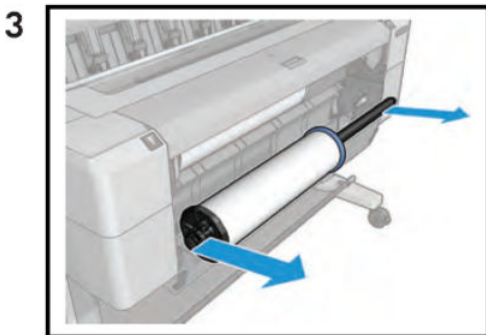
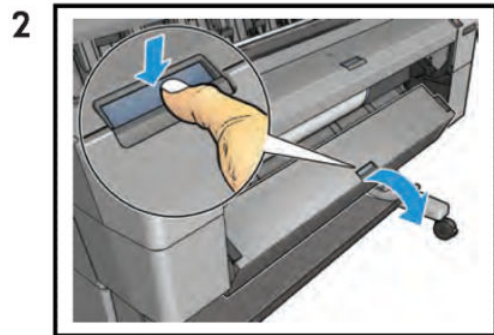
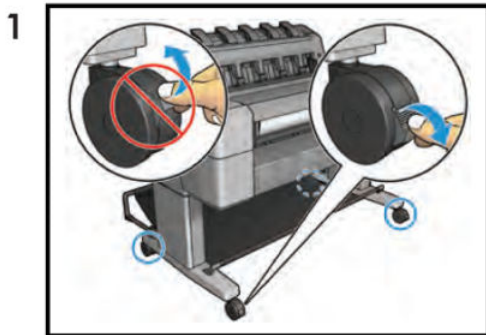


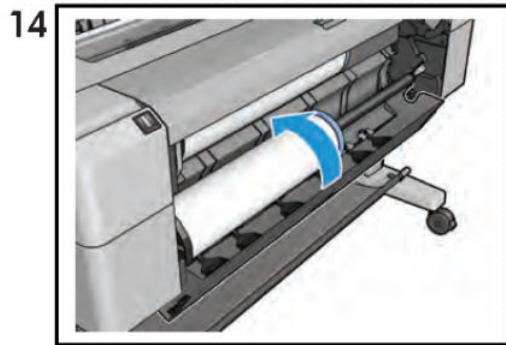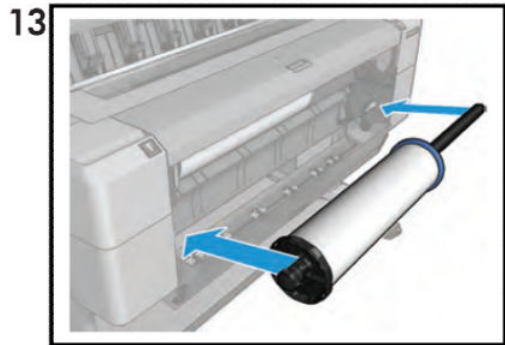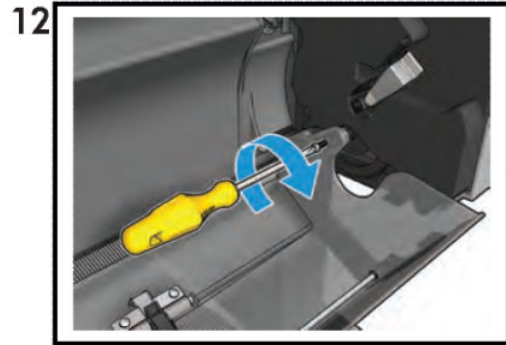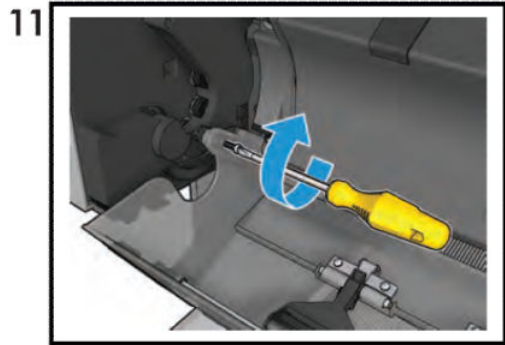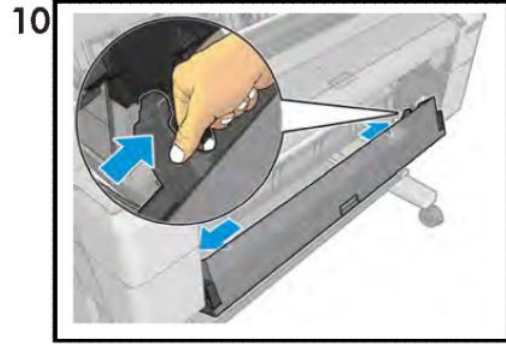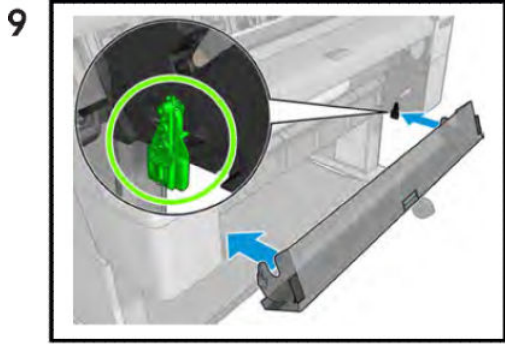

Top roll cover




Designjet T9x0 and Tx5x0 ePrinter Series Top roll cover

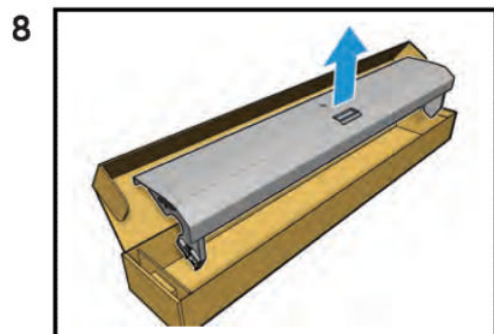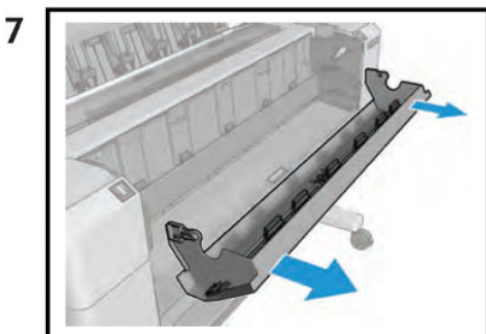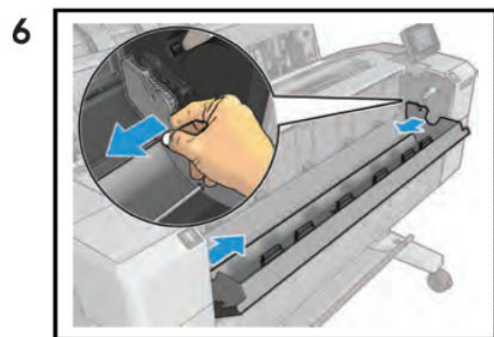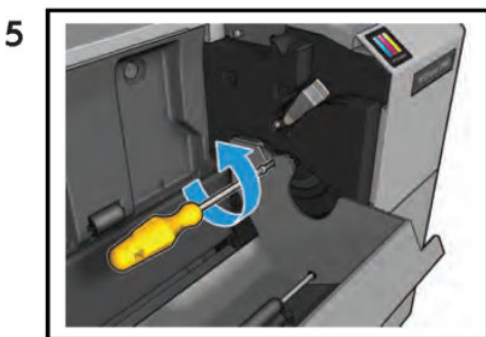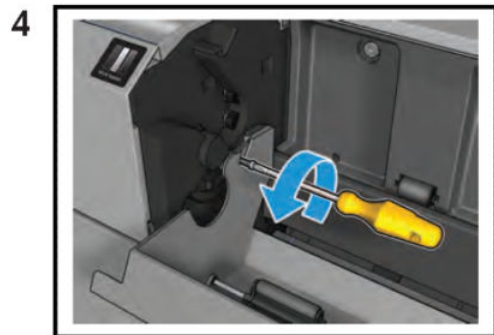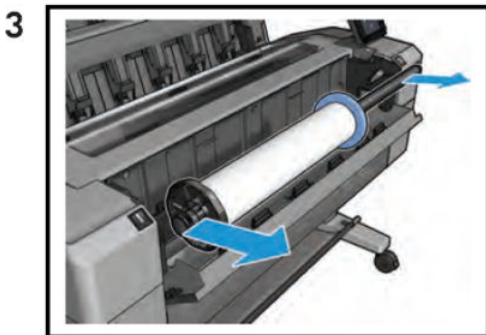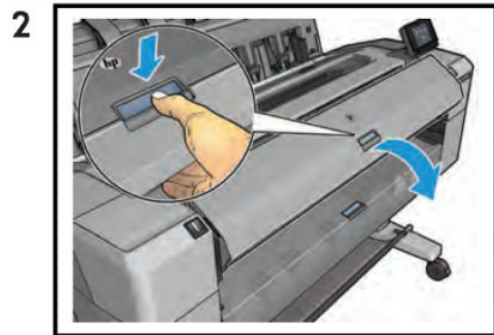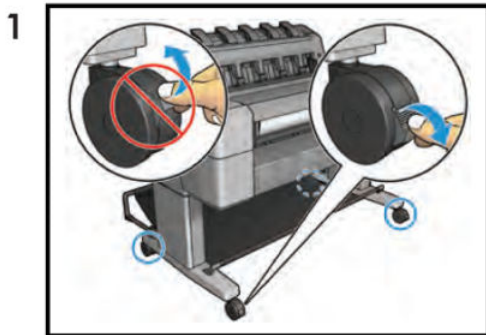

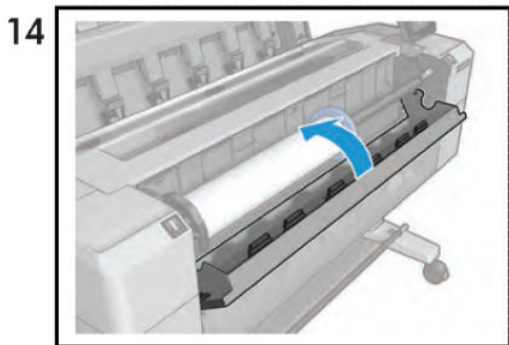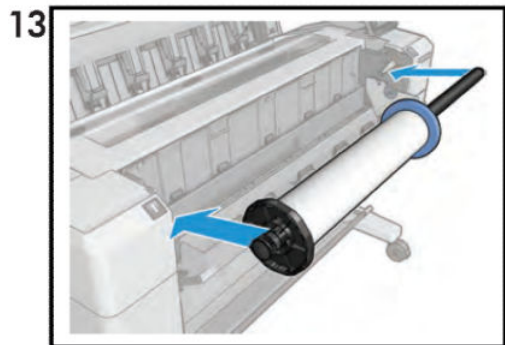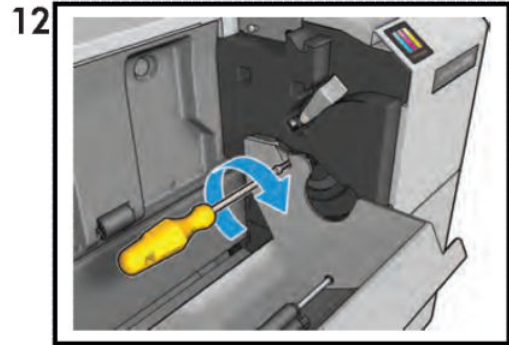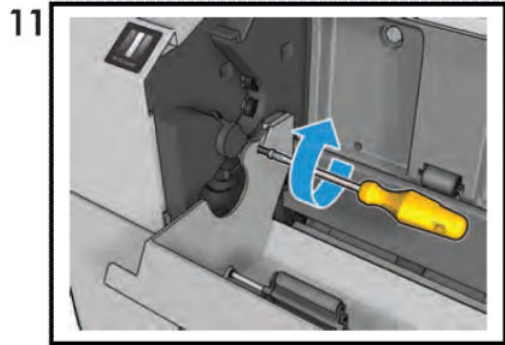
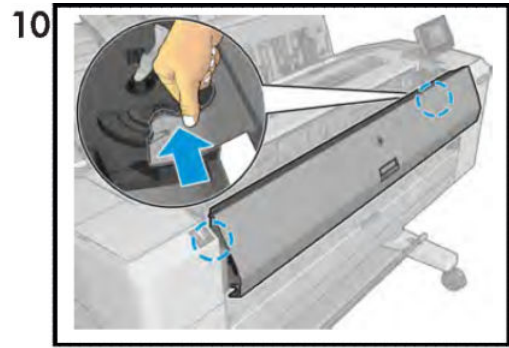
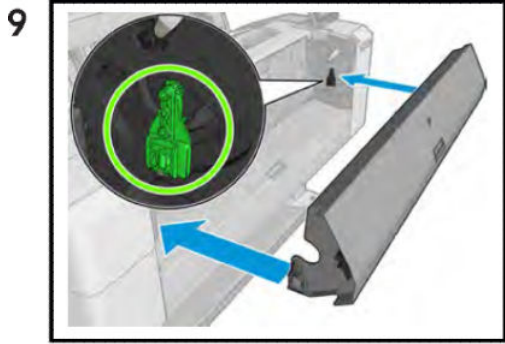










Carriage latch






Designjet T9x0 and T15x0 ePrinter Series Carriage latch

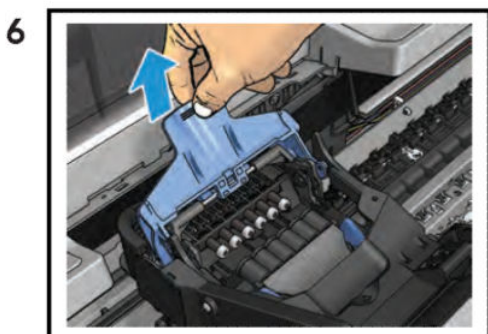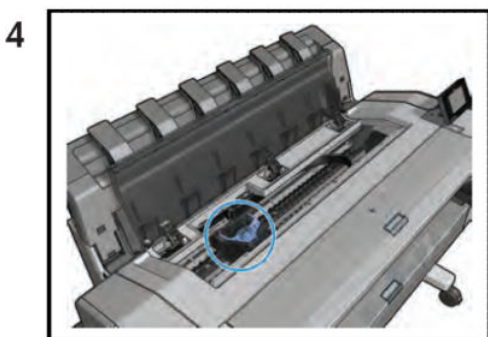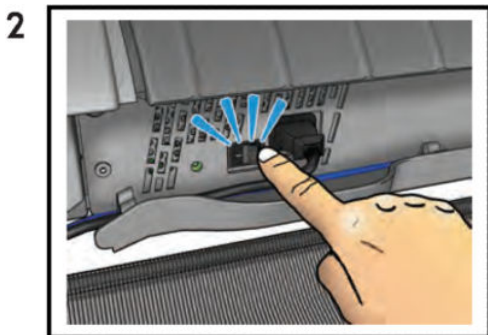

- EN:  >  > Replace printhead
- FR:  >  > Remplacer la tête d'impression
- IT:  >  > Sostituisci testina
- DE:  >  > Druckkopf ersetzen
- ES:  >  > Sustituya el cabezal de impresión
- PT:  >  > Substituir cabeçote de impressão
- CA:  >  > Canvieu el capçal d'impressió
- ZH:  >  > 更換打印頭
- TW:  >  > 更換印字頭
- JA:  >  > プリントヘッドを交換してください
- KO:  >  > 프린트 헤드 교체
- RU:  >  > Заменить печатающую головку
- PL:  >  > Wymień głowicę drukarki





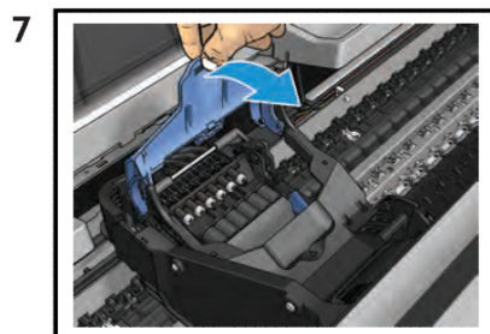
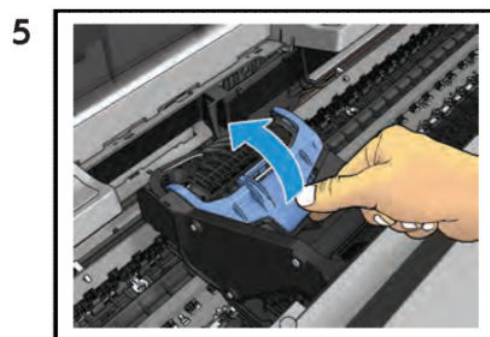
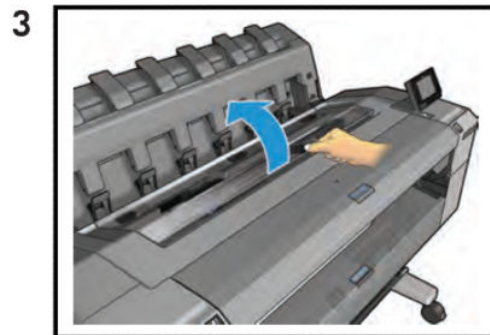


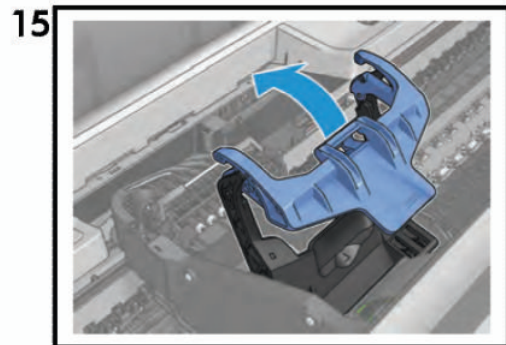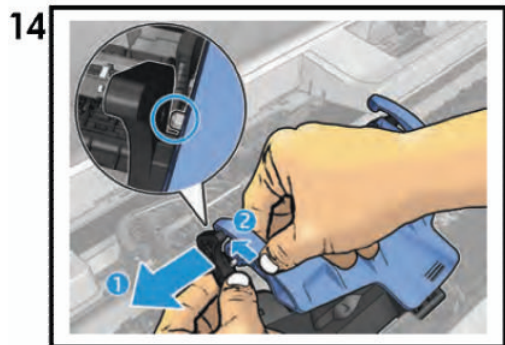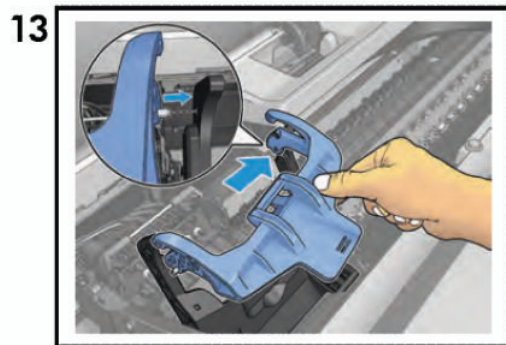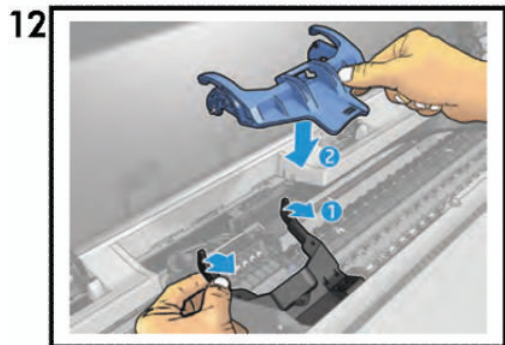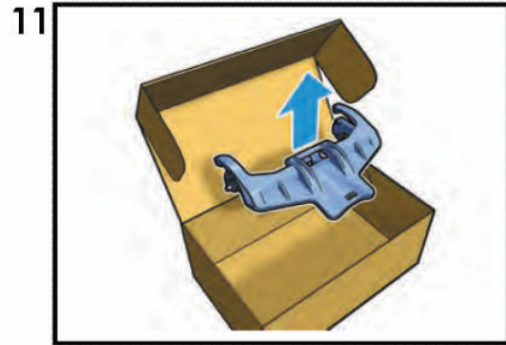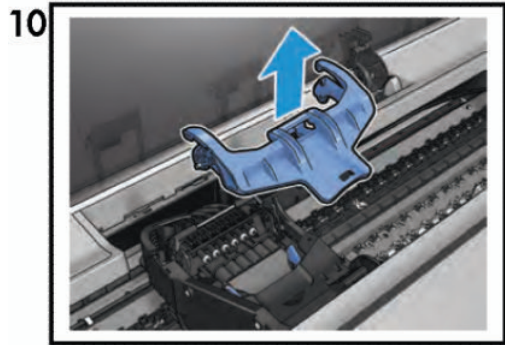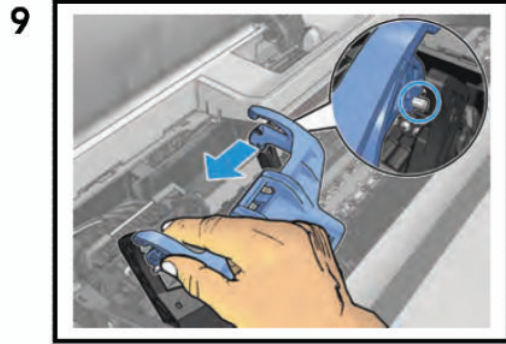
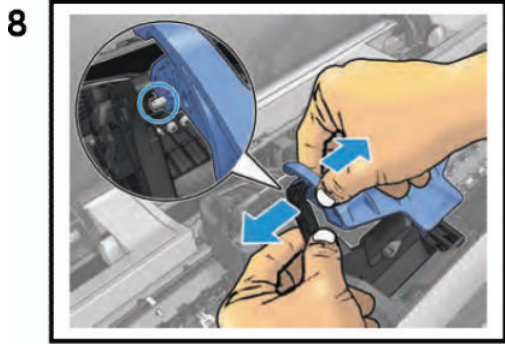


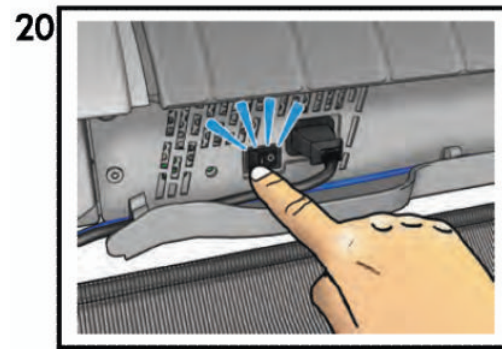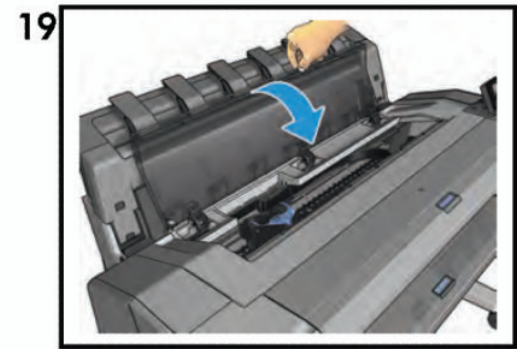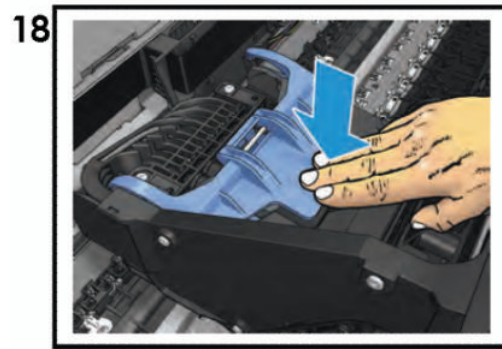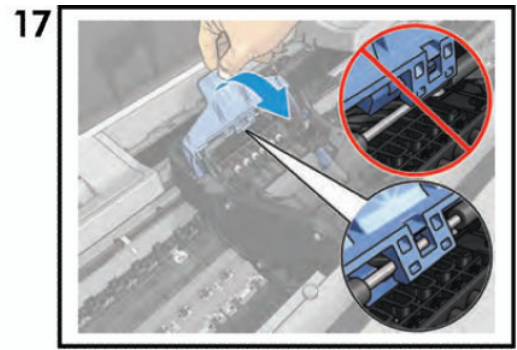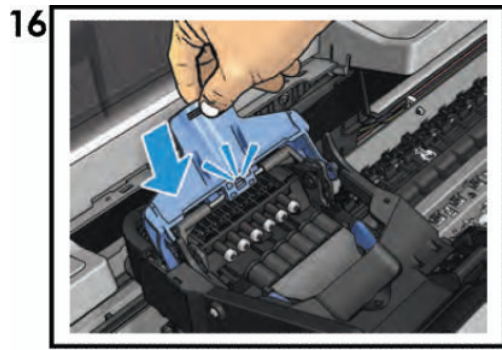

Basket









Designjet T9x0 and T15x0 ePrinter Series Basket

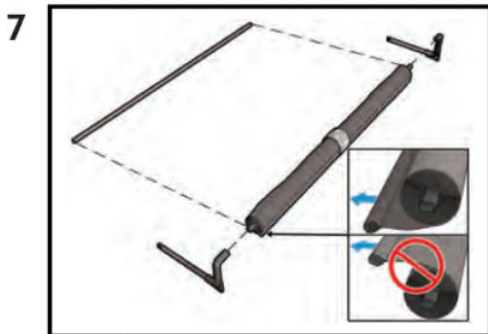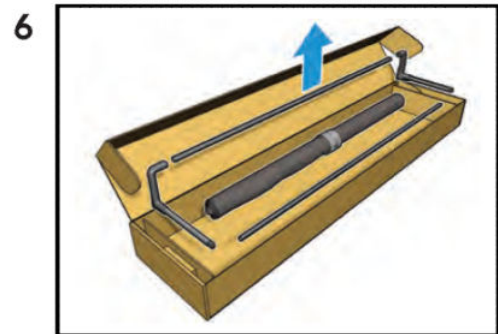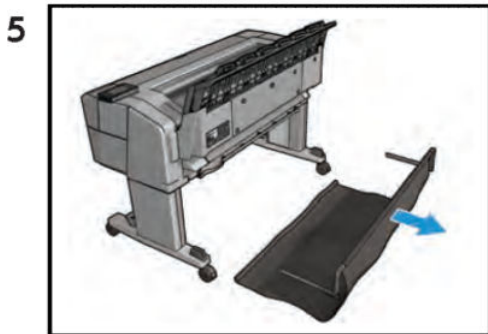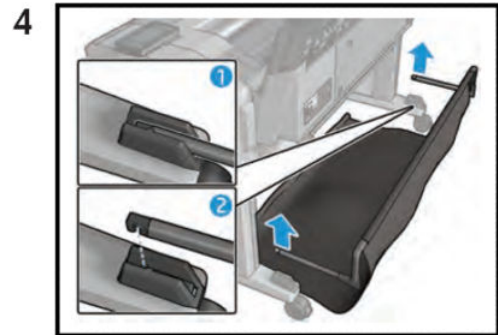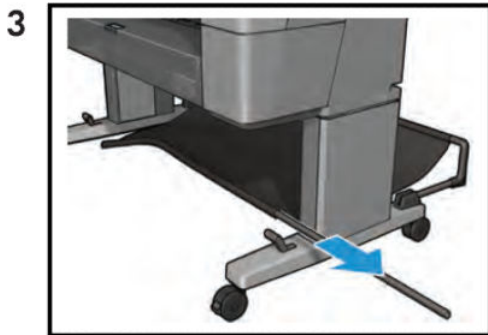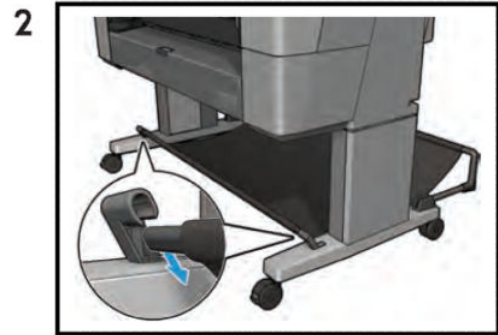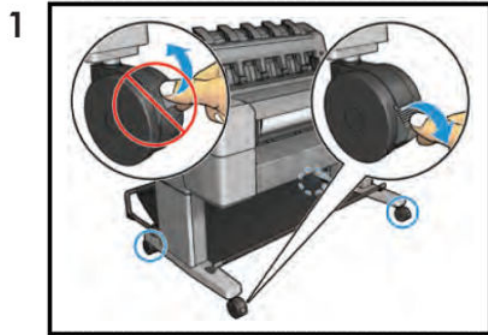

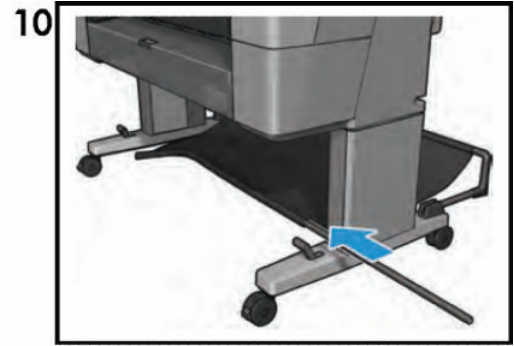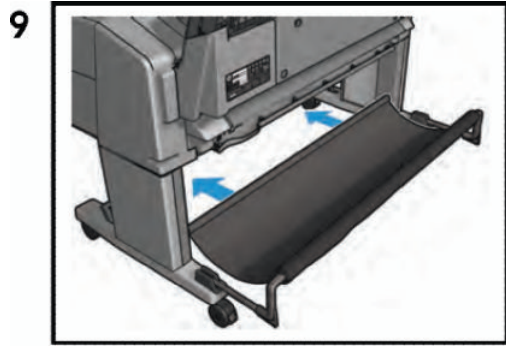








Pinch arm top roll

Designjet T9x0 and Tx5x0 ePrinter Series Pinch arm top roll

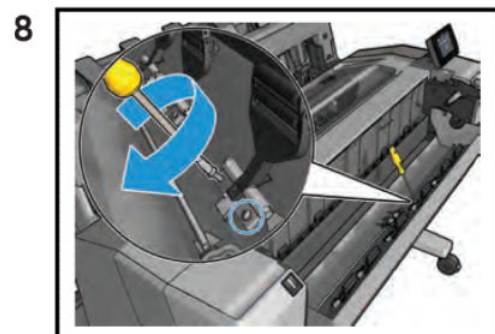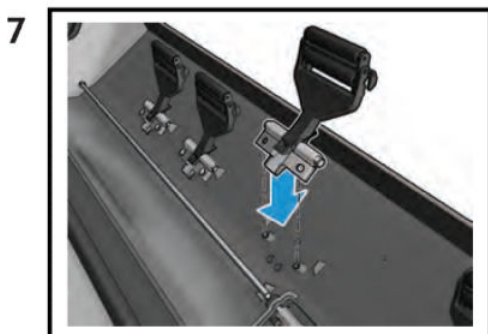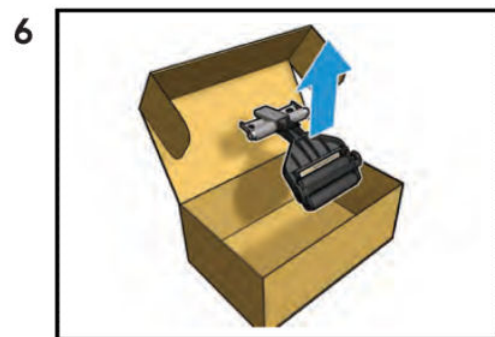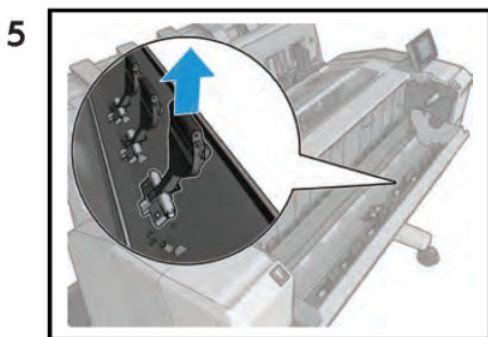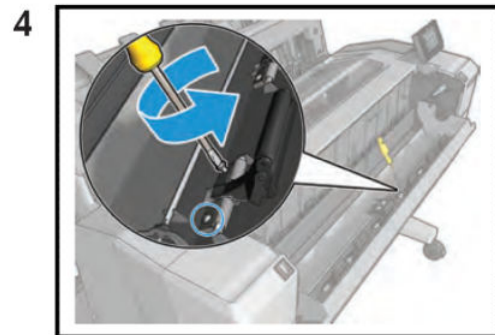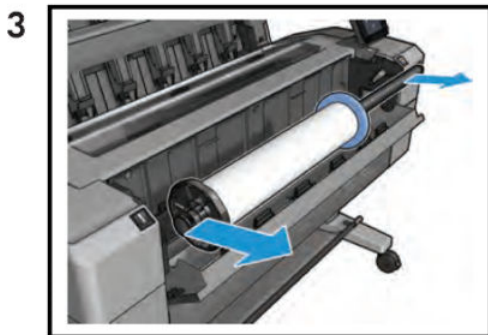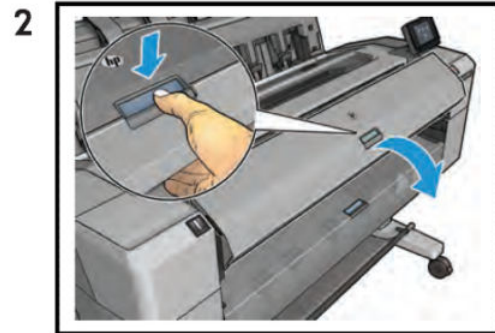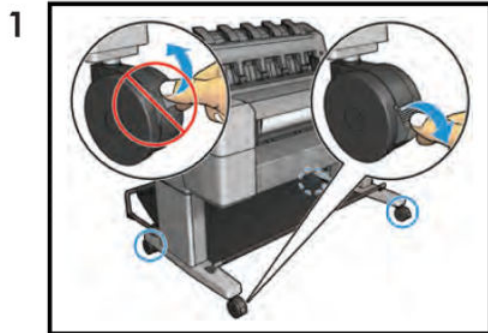

Pinch arm bottom roll

Pinch arm bottom roll

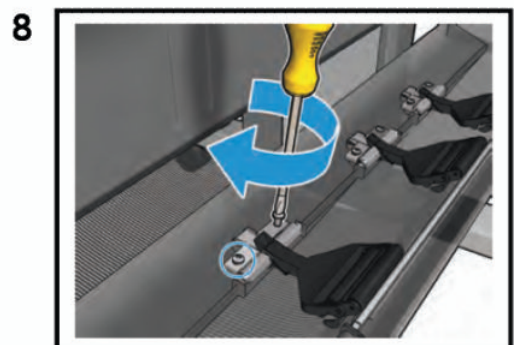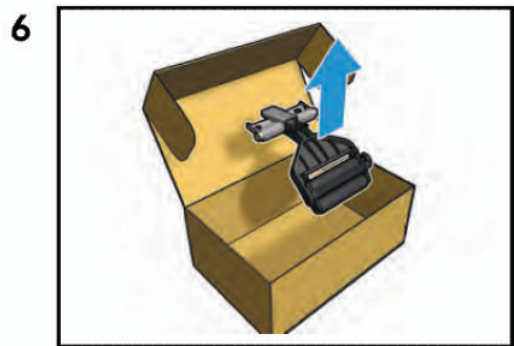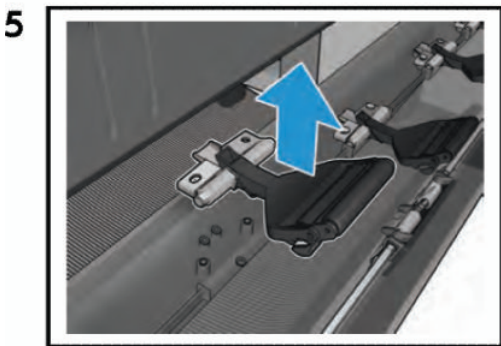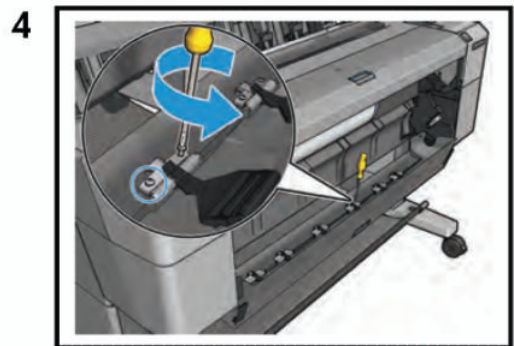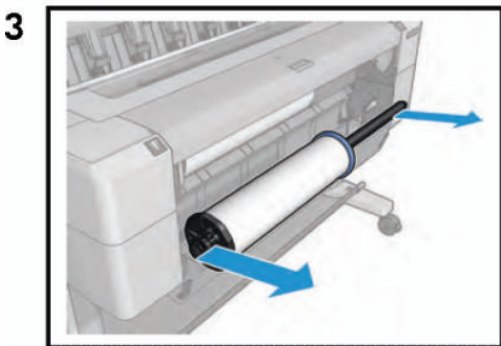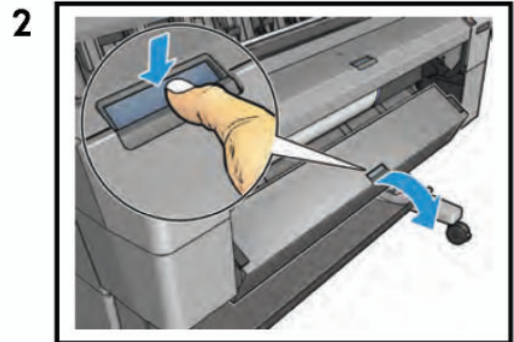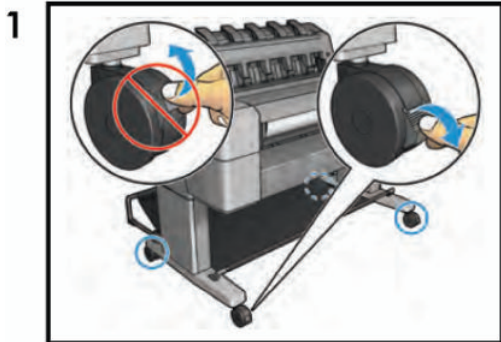

Scanner's glass plate

Designjet T25x0 eMultifunction Series Scanner's glass plate

