


UCOS Feeder Belt Recovery Procedure

Caution: Please remove power prior to servicing.

Cleaning the belt.

1. Clean (wipe) the paper feed belt with alcohol.
2. If the paper feeding does not improve through the cleaning with Isopropyl alcohol, scrape the feed belts gently with sandpaper. (Use No. 240 grit sandpaper cut into 70 – 80 mm. square pieces) **NOTE: ALL 6 Belts need to be cleaned**
 - a. Widen the side guides in order to clean the paper feed belts easily.

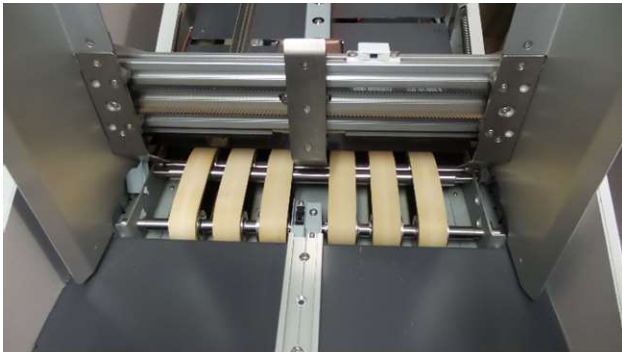

- b. Scrape the belts back and forth vigorously. It is easiest when pulled in the direction of the user.



- c. Rotate the belt by hand as you scrape each side with sandpaper as not to generate shavings.
- d. Confirm the friction of the belt compared to an area that has not been treated.
- e. Reclean the belt with Isopropyl alcohol.